1960 Mercedes 300sl Repair List

1.	Grommet where steering column goes through dashboard is coming loose.
2.	Why does thermostat have threaded rod coming out at top? <
Į∕3.	Adjust clutch V
4.	Drain engine oil and replace with Kendall 20/50 ✓
5.	Change oil filter V
6.	Drain cooling system V
7.	Flush brakes - make sure brake fluid is not silicon V
√*8.	Lubricate chassis V
19.	Change transmission and differential oil
¥ 10.	Check all hoses (brake, water, heater, etc.) \vee
¥ 11.	Check fuel lines
12.	Clunking noise under middle to front of car when backing out of Brain's driveway.
13.	Clunk in rear end.
№ 14.	Fuel injection-any adjustment necessary?
15.	Air filter-replace?
16.	Clunk when turning engine off.
17.	The rubber shifter boot is falling apart-needs to be replaced.
18.	Screw missing on cover behind seats on passenger side.
19.	The auxiliary fuel pump electric solenoid is not working. Leave for now.
	Fuel smell: After putting 10 gallons in the tank (tank was reading ¼ tank prior) began getting slight fuel smell. Please check for fuel smell in trunk.

Brian Crall Company, Inc.

FERRARI SERVICE

10 Beta Ct., San Ramon, CA 94583 Tel. (925) 552-9700 Cell: (925) 457-7005

going down your list the items that require comments:

- 1. The rubber trim piece is broken and needs to be replaced. I will order one for you and install it at a later date.
- 2. No answer for you except that is evidently a generic replacement that has a provision for something your car does not have.
- 7. Car did not have silicon fluid. Now has Motul RBF 600.
- √10 and 11. All hoses and fuel lines look great except as noted in 20.
- √12. With the chassis lube and working on the idler arm this seems to be gone for now. Lets keep our fingers crossed.
 - 13. The clunk in the rear end seems to have been a worn set of splines on the wheel in conjunction with a worn set on the hub. I swapped the wheels side for side and the fit was much better. I believe that as long as we look after the wheels it will be OK.
- 16. The clunk when shutting off the motor is normal on the 300 Roadster. It is an anti Dieseling solenoid located at the throttle.
 - 17. Will order boot.
- 20. I inspected the entire fuel system and the only thing I found amiss is a cracked fuel filler hose. I will order one and we can install it when we do the other items.

The brake dragging issue is partially resolved. As I discussed with you I found a run out problem with the drums and axles in the rear. I matched them as well as possible but after the test drive found a contributing problem. The hydraulic system maintains a small amount of pressure to the rear brakes after stopping. This subsides rather quickly and is in my experience caused by a valve starting to stick in the brake booster. The booster is of the "Hydrovac" variety and as such has hydraulic as well as vacuum boost functions. With the brake fluid flush as well as with regular use may correct itself. We should monitor it and make a decision later.

As far as your alignment concerns go, drive it now and see what you think. The alignment process is rather involved on that car and we can certainly do it but with the idler arm taken of you may find it satisfactory as is.

7-12 3005L

Brian Crall Company, Inc.

FERRARI SERVICE

BAR# AD233408

10 Beta Ct., San Ramon, CA 94583 Tel. (925) 552-9700

Cell: (925) 457-7005

Customer Invoice # 43 Name Date Addres Make Phone Phone Orig. Estimate \$2000.00 Year Phone Rev. Estimate \$ Vin Rev. Est. Time + Date

Labor Operations

Adj clutch, change all fluids, complete lube service, insp brake, coolant and fuel hoses. Ck for clunk in front and rear ends. Ck clunk when turning off motor. Ck operation of fuel inj. Reattach batt cover. Ck for fuel smell. Ck for dragging brakes.

See attached sheet for remedies performed and work suggested. Special order rubber trim piece at steering column, fuel filler hose, and shift boot

10-20-04 Mercedes Model 300SL 1960 2624 License None Mileage 423

> 11 hrs. @ \$125.00 \$1,375.00

> **Labor Amount**

Part #		Description	(Qty.	Amount
KENDALL 20/50		MOTOR OIL	\$6.95 Qt	14	\$97.30
REDLINE 75/90 NS		GEAR OIL	\$5.95 Pt	9	\$53.55
IPN		ANTIFREEZE	\$8.00 Gal	2	\$16.00
MOTUL RBF 600		BRAKE FLUID	\$14.50 1/2 Liter	2	\$29.00
Wix	51762	Oil filter		1	\$9.00

Sublet Labor

Amount

Parts Total	\$204.85
Tax	\$16.90
Labor	\$1375.00
Hazardous	
Waste Fee	\$8.00
Sublet Labor	•2
Total	\$1604.75
	Labor Hazardous Waste Fee Sublet Labor

1960 Mercedes 300sl Repair List



Check all hoses (brake, water, heater, etc.) All hoses and fuel lines look great except for the cracked fuel filler hose. Been ordered.

Air filter-replace? Brian, was this done?

The rubber shifter boot is falling apart-needs to be replaced. Been ordered.

- 5. Go over where belly pans go. Should I order from GWG?
- 6. THOREX NYLON HAMMER-do you know where I can get one?
- Seat belts-webbing fraying. Repair or replace? Period correct? Look newer.
- 8. The auxiliary fuel pump electric solenoid is not working. Leave for now.
- 9. Jacking pad-Jim Gallucci making
- 10. New rubber for the wiper blades?
- 11. Heater valves controls on dash don't seem to be working,
- 2. Screws behind seat should be cad (not black)
 - 13. ID tag on firewall loose
 - Relay bracket on passenger side near firewall: Detailer said loose or broken, haven't checked.
- 15. Left sun visor (passenger side) is loose and will not stay up.
- M16. Paul Russell Company is restoring my jack. It should be done on or about December 1, 2004. Cost will be a couple hundred dollars.

RIDF AFTGAT

I+N Ned four for hammen

Brian Crall Company, Inc.

FERRARI SERVICE

BAR# AD233408

10 Beta Ct., San Ramon, CA 94583 **Tel. (925) 552-9700**

Cell: (925) 457-7005

Customer

Name Addres

Phone

Phone

Phone

Labor Operations

Adj suspension ride height, x

Replace air filter x Replace shift boot x

Find seat belts x ID plate loose x

Batt cover screws x

Wiper blade inserts x

Get Thorex K/O hammer

Part #

REDLINE 10/40 REDLINE 75/90

MPN

MOTUL RBF 600

Invoice # 48

Date 11-29-04

Make Mercedes Benz

300 SL Model

Year 1960 Vin 2624

License None

Mileage 807

Labor Amount

\$1600.00

Repl. fuel filler hose x

Rev. Estimate \$

Rev. Est. Time + Date

Orig. Estimate \$2500.00

Ck/repair heater valves/controls x

Ck/adj L visor x

Relay bracket R side firewall loose x

Replate tail pipe tip

Rubber on steering column x

Adi. drivers door x

Amount

Qtv.

Description MOTOR OIL \$7.95 Qt GEAR OIL \$5.95 Pt ANTIFREEZE \$8.00 Gal

BRAKE FLUID \$14.50 1/2 Liter Shift boot Filler hose

Ball cover screws K+N air filter conversion kit Steering column rubber ring

Wiper blade refills Heater cable

Metal stock for spring shims Hose clamp

\$30.00 1 \$22.50 1 2 \$3.50 \$120.00 \$19.50 \$24.00 1 \$6.60

Sublet Labor Shipping

Ups

Amount \$51.10

\$3.50

\$1.00

I heraby authorize the above repair work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acnowledged on this vehicle to secure the amount repairs thereto. You will not be held responsible for loss or damage to the vehicle or items left in vehicle in case of fire theft or any other cause beyond your control.

Signed X

\$230.60 Parts \$19.02 Tax Labor \$1600.00 Hazardous Waste Fee Sublet Labor \$51.10

Total

1940 72

\$1900.72



Mercedes Benz 300SL

Labor Description

Disassemble jack & inspect Replace worn roller Put pieces in rust bath hot tank Rinse pieces Package for plating

 Oty
 Item
 Description

 1.10
 ser
 Service Labor

 1.00
 nip
 Pin & roller

Invoice Date Nov 19, 2004
Customer ID
Mileage
Chassis No.
Engine No.
Invoice No. 12897

Unit

104.50
35.00

Extended

Mechanical Labor	1.10 Hrs. \$	104.50
Body Labor	Hrs.	
Metal Labor	Hrs.	
Upholstery Labor	Hrs.	
Outside Services		
Parts	\$	35.00
Fluids		
Sales Tax		
Total	S	139.50



Invoice Date Nov 26, 2004

Customer ID

Mileage

Chassis No.

Engine No.

Invoice No.

12898

Mercedes Benz 300SL

Labor Description

MECHANICAL

ART:

Bead blast jack pieces.

Sort, hang parts in booth for 1/4 gloss polane and epoxy primer.

Oty	Item	Description	Unit	Extended
1.40	ser	Service Labor	95.00	133.00
1.00	nipbod	Polane	10.00	10.00
1.00	nipbod	Glasso epoxy	13.00	13.00

Mechanical Labor	1.40 Hrs. \$	133.00
Body Labor	Hrs.	
Metal Labor	Hrs.	
Upholstery Labor	Hrs.	
Outside Services		
Parts	\$	23.00
Fluids		
Sales Tax		
Total	\$	156.00



Invoice Date Dec 03, 2004

Customer ID

Mileage

Chassis No.

Engine No.

Invoice No.

12918

Mercedes Benz 300SL

Labor Description

Unwrap freshly plated pieces and inspect. Chuck main shaft in lathe, spin up and sand with emery cloth, 220 and then 400 Assemble jack and test - Good.

Qty	Item	Description	<u>Unit</u>	Extended
1.00	ser	Service Labor	95.00	95.00
1.00	sub hp	Nickel plating	63.79	63.79

Mechanical Labor	1.00 Hrs.	S	95.00
Body Labor	Hrs.		
Metal Labor	Hrs.		
Upholstery Labor	Hrs		
Outside Services		\$	63.79
Parts			
Fluids			
Sales Tax		65	
Total		\$	158.79

Brian Crall Company, Inc.

10 Beta Ct., San Ramon, CA 94583

Tel_(925) 552-9700 Cell: (925) 457-7005

FERRARI SERVICE

Invoice #93 Date 6-1-05 BAR# AD233408

Page one

Estimate Revised

\$6,000.00 \$9,200.00

CA# 2579

Name Addres

Phone Phone

Resale# 100468322

Make Mercedes Benz License

None

VIN

2624

Model 300 SL

Mileage

1229

Assv

Labor Operations

1960

Rebuild wheel cylinders, rebuild master, rebuild booster. Replace brake hoses.

Repair loose left fender strakes. Repair (Heli Coil) loose rear bumperettes. Repair spare tire hold down. Find location for and install battery switch. Fabricate thumb screws for battery cover. Have seat belts made and install. Replace clutch. Rebush shifter.

Part #		Description		Qty.		Amount
KENDAL 20/50		MOTOR OIL	\$4.95 Qt	14		\$69.30
_KENDAL 80/90		GEAR OIL	\$3.95 Pt	8		\$31.60
IPN		ANTIFREEZE	\$10.00 Gal	2		\$20.00
CASTROL DOT4		BRAKE FLUID	\$14.50 1/2 Liter	3		\$43.50
	27F	Battery (for 330)		1		\$120.00
	NPN	Fiamm batt sticker	(for 330)	1		\$22.00
	NPN	Seat belts	•	2		\$175.00
	NPN	Battery switch		1		\$7.95
	51045	Oil filter		1		\$8.95
	4280835	Brake hose (Front)		2	\$52.50	\$105.00
	4284835	Brake hose (Rear)	2	2	\$52.50	\$105.00
	5862799	Booster kit		1		\$325.00
	1982500404	Rebuilt pressure pla	ate	1		\$1,800.00
	1982500303	Clutch disc		1		\$437.50
	1862501115	T.O. Bearing		1		\$502.50
	49975646	Trans seal		1		\$17.59
	1159800015	Pilot bearing		1		\$22.50
	1862610060	Trans seal		1		\$15.63
	9975347	Pinon seal		1		\$71.25
	1989970140	O Rina		1		\$18.75
		12 17 17 17 17 17 17 17 17 17 17 17 17 17	05.5			

Sublet Labor UPS

Pankeys Radiator

Shipping

Repair oil cooler

Tax

Labor

Hazardous

Parts Total

Waste Fee

Sublet Labor

Total

See page 2

Amount

\$105.98

\$225.00

I heraby authorize the above repair work to be done along with the necessary material and hereby grant you and or your employees permission to operate the vehicle herein described for the purpose of testing and or inspection. An express mechanics lien is hereby acnowledged on this vehicle to secure the amount If repairs thereto. You will not be held responsible for loss or damage to the vehicle or items left in vehicle in case of fire theft or any other cause beyond your control.

Signed X

R+R and reseal trans. Repair leaks in differential. R+R radiator and oil cooler assy to have oil cooler leakage fixed. Have new lower oil cooler hose fabricated. Repair leak at injection pump drive gear cover. Ck operation of brake lights and make sure they work in every condition.

Brian Crall Company, Inc.

FERRARI SERVICE

10 Beta Ct., San Ramon, CA 94583 Tel. (925) 552-9700

Cell: (925) 457-7005

Invoice #93

BAR# AD233408

Date

Page two

Estimate

Revised

Name

Address

Phone

Phone Other

Make

License

VIN

Model

Part#

Mileage

Assy

Labor Operations

Year

	Description	Qty.		Amount
1862610179	Trans Gasket	1		\$6.25
3092610880	Trans gasket	1		\$12.38
	Seat belts	2		\$175.00
BC11418	1 1/4 inch flex hone	1		\$25.52
WK152	Front wheel cyl kit	4	\$9.75	\$39.00
WK101	Front wheel cyl kit	4	\$10.42	\$41.68
WK418	Rear wheel cyl kit	2	\$8.79	\$17.58
1982680069	Shifter bushing kit	1		\$59.00
NPN	Brake parts cleaner	4	\$5.95	\$23.80

Sublet Labor			Amount
Hoses unlimited	Repair oil cooler hose		\$75.43
I heraby authorize the above repair v	work to be done along with the necessary material and hereby grant	Parts Total	\$4,319.23
you and or your employees permissi	on to operate the vehicle herein described for the purpose of testing	Tax	R/S
and or inspection. An express mech	anics lien is hereby acnowledged on this vehicle to secure the amount	Labor	\$4,500.00
of repairs thereto. You will not be he	ld responsible for loss or damage to the vehicle or items left in vehicle	Hazardous	
in case of fire theft or any other caus	e beyond your control.	Waste Fee	\$12.50
		Sublet Labor	\$406.41
Signed X		Total	\$9,238,14

300SL Mercedes

LABOR

Date	Hours	Activity
2-Dec	2	Receive car, survey seat belt fastening prospects, switch & index heater valve cores Left & Right
3-Dec	3	Remove aluminum rocker panel extensions, straighten. Design/Fit seat belt anchors
10-Dec	2	Fabricate seat, belt anchors
11-Dec	3	Remove Pass training arm, fit new rubber bushings, fit & weld out 2 seat anchors
16-Dec	7	Complete trailing arm bushings, complete seat belt anchors. Clean underside, reinstall alum panels.

Subtotal 17 \$50 \$ 850.00

MATERIALS & SUBCONTRACT

Trailing arm bushings - 2 pieces	\$82.00
Seat belt anchor hardware	\$36.00

 Subtotal
 \$ 118.00

 Total Parts + Labor
 \$ 968.00

Bob West 112 Deodara Way Martinez, CA 94553

NOTES:

Breaking is solid, true & straight, Disconscerting "check valve release sound" after prolonged breaking is OK - attributable to rebuilt ATE Brake Booster

Watch for leaky water pump - evidence of prior coolant leak from the water pump seal. Added 3 quarts of coolant after repair of driver's side heater valve.

Checked Injection pump oil level OK now; Continue to check periodically per Tech Tip.

Driveshaft rear U-joint is loose; Rear end/differential backlash is somewhat loose.

Keys4Classics.com

AP Workshop, 5 Ryrie St, PO Box 182, Campbell ACT 2612, Australia Our USA Fax and Voicemail is 309-218-5246

Fax: Australia (011) +612-6100-6114

Tel: Australia (011) +612-6248-7956 (Note: Time zone is US-PT + 18 hours)

www.Keys4Classics.com sales@keys4classics.com

30006

Feb 17, 2006

2 of HU9 cut to code SX12

2 of DM2R cut to code CQ314

2 of BH4 cut to code E05

for Mercedes 300SL

Total US\$59.80

Paid by PayPal -- thanks, Stuart

Thank you, we appreciate your business.

CUT KEYS WARRANTY

(1) Keys cut from a code provided by you: We guarantee our keys to be cut correctly to the code provided.
(2) Keys cut from a code with a photo to check, or decoded from a photo:
We fully guarantee that our keys will work in your locks.
We use the latest technology computer controlled cutting systems for optimal accuracy.

IMPORTANT NOTE FOR US & INTERNATIONAL CUSTOMERS PAYING BY CREDIT CARD

PRICES ARE IN US\$ BUT CREDIT CARD BILLING IS IN AUSTRALIAN DOLLARS (AUD)
AT RATE AUD 1.00 = US\$
THE TOTAL BILLED IS AUD

Credit card sales are billed in Australian Dollars (AUD) at the day's exchange rate.

For US customers the total on your card statement may vary by a small amount from the US\$ total shown here because of currency fluctuations and credit card provider charges beyond our control. Note- VISA and MASTERCARD billing is by our parent company AP WORKSHOP, CAMPBELL, AU.

LABOR

21	2	4	10	6
-1		,	1	

Date	Hours	Activity
29-Jan	2	Vacuum check for brake booster, Remove rear drums & driveshaft
2-Feb	1	Beadblast rear drums
3-Feb	6	Install Driverside trailing arm bushings, prime & paint drums, remove booster,
4-Feb	2	Mount drums, troubleshoot wipers
18-Feb	2	Mount driveshaft, procure keys
19-Feb	3	Install Brake booster, bleed brakes, reinstall rocker panel & trim.

Subtotal 16 \$50 \$ 800.00

MATERIALS & SUBCONTRACT

Trailing arm bushings - 2 pieces	\$82.00
Driveline Service	\$109.46
Power Brake Exchange	\$225.00
Keys for Classics	\$39.58
Shipping, paint & supplies	\$44.96
Subtotal	\$ 501.00
Total Parts + Labor	\$ 1,301.00

NOTES:

Vacuum check shows steady 12 inches at hot idle, measured out the back of the intake manifold. Good for a well running roadster engine.

Power Break Supply reported a bad poppet valve in the booster. No one has been in the booster for years. They rebuilt and bench tested it, now it actuates better.

Used Castrol LMA dot 4 brake fluid

Driveshaft U-joint replaced & ballanced.

Wiper blades seem OK (Especially for summer), adjusted linkage, wiper gearboxes are stiff - major pain to access.

Adjusted last tailpipe hanger to keep from rubbing, looks like exhaust tip has been scraped on the bottom - Would cause this

Specialists in Drive Shaft Assemblies, Parts and Repair

DRIVELINE SERVICE OF PORTLAND, INC.

9041 N.E. Vancouver Way ortland, Oregon 97211



Telephone 503-289-2264 Toll Free 800-227-8608 FAX 503-289-5838 www.driveshafts.com

Drive Lines are not a sideline - They are our ONLY business

BILL TO:

CASH BUSINESS

SHIP TO:

PAGE 1 OF 1

INV# 47264 **CUST 1385**

DATE 02/15/06

Doc# 15060

CASH SALE Wed Feb 15 15:46:40 2006

2 NEA-1-0013 U-JDINT 0.00 27.89 19.52 39.04 N 999-3 CK STRAIGHTN/BAL 0.00 62.00 62.00 N 999-G UPS*GROUND****** 0.00 0.00 8.42 8.42*N 999-VM PD W/ CREDIT CARD 0.00 0.00 0.00 0.00 0.00 N	QTY	MFR - PART NUMBER	DESCRIPTION	CORE	LIST	NET	EXTENSION CODES
	2 1 1	999-3 999-6	CK STRAIGHTN/BAL UPS*GROUND*****	0.00	27.89 62.00 0.00	19.52 62.00 8.42	39.04 N 62.00 N 8.42*N
	(MANUAL TO THE PROPERTY OF THE	ELYPA Lepter of Electronic of Electronic of RA Security	10,000 150 10,001 2,50 10,000 1,00 10,000 1,00 11,000 1,00 11,00
					1000 1000 1000 1000 1000 1000		

THANKS WE APPRECIATE YOUR BUSINESS

THE TERMS AND CONDITIONS OF THIS SALE ARE STATED ON THE OTHER SIDE OF THIS INVOICE. THE CUSTOMER'S SIGNATURE AND/OR RECEIPT OF MERCHANDISE CONSTITUTES ACCEPTANCE OF THOSE TERMS AND CONDITIONS.

TAXABLE TAX % NON-TAXABLE CORE TOTAL 109.46 0.00 0.00 3.000 0.00 109.46

CODES: B = BUYOUT

* = INTERNAL

C = CREDIT

1 = CORE RETURN

N = NON-TAXABLE

T = TAXABLE

2 = INVENTORY RETURN 3 = WARRANTY RETURN

PLEASE PAY THIS AMOUNT

RECEIVED BY:

* OPEN WEEKDAYS UNTIL 5:00 SATURDAYS UNTIL 1:00 #

> POWER BRISKE EXCHANGE 260 PHELAN AVENUE SAN JOSE, CA 95112 PHONE: (408)292-1305

PACKING SLIP NO: 79919-01 DATE: 02/16/06 鬼 的证 1

889998-R

SOLD TO: CASH ACCOUNT -- SHIP TO:

RESALE MAMBER REGIJIRED

P/8 H

DATE: 02-16-06 * SHIP VIA: U P S

* FOB: DEST/PREPAID : TAX % @

QUANTITIES

ITM ORDERED SHIPPED BYORD PART NO DESCRIPTION

PRYCE CORE

R & R OR EXCHANGE

1092

69-56 MERCEDES BENT

TOTAL PARTS TOTAL CORES 225.00

SUB TOTAL

225.88

TAX

.00

TOTAL THIS ORDER.

225.00

CARD 5811892

		/	1		1	7	ζ
HBB	AMOUNT.	1.	·	D		-	,


PACKING SLIP NO: 79819-01 DELIVERY DATE: 82/16/06



RECEIVED BY...... DATE:...... DATE:.....

A 15% RESTOCKING CHARGE MAY BE CHARGED ON RETURNED PARTS.

300SL Mercedes

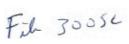

LABOR

Date	Hours	Activity
26-May	2	Remove leaking water pump
9-Jun	4	Install new water pump, replace surrounding hoses, refill coolant 50-50

Subtotal 6 \$50 \$ 300.00

MATERIALS & SUBCONTRACT

Star Classic Monument 1	s 10002997 Water Pump 199996	\$564.74 \$72.09
Subtotal		\$ 636.83
	Total Parts + Labor	\$ 936.83

NOTES:

Noticed one external mounting clip and internal level indicator (both soldered joints) have come loose from the coolant fill tank. No immediate concern, but something to be aware off.

One threaded screw hole in the aluminun water pump housing required a helicoil repair.



TRIMON INC. D.B.A.

MONUMENT CAR PARTS

5166 PACHECO BLVD. PACHECO, CA 94553 PHONE (925) 798-6330



TERMS

Unless otherwise specified, payment of this invoice is due on the 10th of the month following date of purchase. Purchaser agrees to pay 1½% per month on all past due balances, which is an annual percentage rate of 18%, and all reasonable costs and attorney fees incurred in collection of this account, if necessary.

No refunds on installed parts, special orders, electrical parts, or carburetor assemblies. Returns subject to 15% handling charge. All claims and returned goods must be accompanied by this invoice. No returns accepted after 30 days from date of invoice. All warranties are as specified by the manufacturer. No labor claims.

VISA # 8429

**** CASH INVOICE **** MONUMENT PACHECO RECEIVED BY PATEIS/2006 \$166 PACHECO BLVD INVOICE NO .: SALESMAN 1 PAGE COLOF PACHECO P.O. NO. SHIP VIA St CUST NO JIME 2 PACHECOS · CA 94553 MESSAGE AMOUNT TAX NET LIST VENDOR - PART NUMBER DESCRIPTION CORE SHIP PRA AF2000 PRESTONE ANTIFR 13,99 10.99 10.99 1.98 1,49 0.99 HOS 12 1/2 HEATER HOSE, 0.99 0.99 3/4 HEATER HOSE, 1,49 HOS 34 15.98. 15.98 117.68 600 58024 HOSE - 4 FEET \$15.98 ONE FROM OF #58024 G00 5 120 1 F06 1, 1/4 HOSE - 4 FEET 111.88 15.48 15.48 \$15. 48 PMC 1221-308 1 PERMA-COIL 29.99 19.99 19.99 TRU 12-135 NIPPLE 1.39 1.19 1.19 72.09 TAXABLE TAX AMOUNT DUE CORE TOTAL NON-TAXABLE FREIGHT LABOR



Account No.	Date	Transaction No.
103176	05/25/2006	10002997

Bill To Ship To

F.O.B. Flagstaff, AZ

P.O. Number	Location	Sales Person	Terms	Due Date	Ship Via	Tender Type
	101	01	Net 10 Days	06/04/2006	UPS-GR	Visa

SKU	Description	Quantity UM	Back Order	Unit Price	Extended Price
189-200-07-20	WATER PUMP	1	4	525.00	525.00
188-352-00-65	RUBBER MOUNT, TH ARM MB \$45.15	-1	******	38.85	38.85
186-201-01-80	GASKET	1		15.00	15.00
900260 053200	RUBBER SEAL	1		7.80	7.80
110-352-10-65	MOUNT, CONTROL ARM MB \$17.85	-2		13.65	27.30

YOUR STAR CLUB DISCOUNT HAS BEEN APPLIED TO THIS INVOICE

ALL SALES ARE FINAL AFTER 30 DAYS. PLEASE NOTE: NO RETURNS OR ADJUSTMENTS WILL BE ACCEPTED OR GIVEN AFTER 30 DAYS FROM THE DATE OF THIS RECEIPT. All RETURNS must be returned with a COPY of the ORIGINAL INVOICE for processing a refund or credit including core parts. NO REFUNDS or returns are accepted on any electrical parts or special orders.

WE APPRECIATE YOUR BUSINESS AND VALUE OUR CUSTOMERS. if you should have any questions please call us at (928) 774-5600. STAR CLASSICS INC IS CELEBRATING 16 YEARS OF SERVICE TO CLASSIC MERCEDES OF THE 50'S & 60"S AND THEIR OWNERS. PLEASE CALL 1-800-644-7827 FOR FUTURE ORDERS.

SUBTOTAL	613.95
State Sales Tax	0.00
FREIGHT	16.94
TOTAL DUE	 630.89
BALANCE DUE	0.00

300SL

564.74

Questions? 928-774-5600 Star Classics Inc.

1

Coker Tire Company

Branch: 02

Coker Tire Chattanooga- Corp. Branch

1317 Chestnut St

Chattanooga, TN 37402-4418

UNITED STATES OF AMERICA

(423) 265-6368

Bill To:



INVOIC	E
995427	8
Invoice Date	Page
8/7/2006 17:12:49	1 of 2
ORDER NUM	MBER
1081987	7

Ship To:

Customer ID: 95234

PO N	Number	Terms Description	Net Due Date	Disc Due Da	e Discoun	t Amount
		Due upon receipt	08/08/06	08/08/06	0.	.00
Order Date	Pick Ticket No	Primary Sal	esrep Name		Taker	
8/7/2006 09:56:43	1049659	Coker House Account			GERALD	Н
Qu Ordered Shipped	antities d Remaining UOM	Item ID Item Description		Pricing UOM	Unit Price	Extended Price

Order Note: reged 5 tubes in mich for a 2157015 mich tire to

be shipped overnight

Carrier: FedEx Standard Overnight

Tracking #:

0 TIRE

15F13 185/195R15 MICH. TUBE TR-13

TIRE

17.00

85.00

Card: Visa / MC

Tran Type: Prior Auth

Name:

Account Number: 2367

Authorization Number: 318099

Reference Number: 48645

Batch Number:

Merchant ID: 275260109887

Authorization Amount: 133.28

Retrieval Number:

I agree to pay above total amount according to card issuer agreement

INVOICE

Coker Tire Company

Branch: 02

Coker Tire Chattanooga- Corp. Branch

1317 Chestnut St

Chattanooga, TN 37402-4418

UNITED STATES OF AMERICA



INVOIC	CE
995427	8
Invoice Date	Page
8/7/2006 17:12:49	2 of 2
ORDER NUM	MBER
1081987	7

(423) 265-6368

85.00	SUB-TOTAL:		Total Lines: I
32.75	SHIPPING AND HANDLING:	S & H Out: 32.75	S & H In: 0.00
5.10	California State:		
1.59	Fresno County:		
0.09	Fresno Local:		
8.75	California Tire Fee:		
133.28	PREVIOUSLY PAID:		
-0.00	AMOUNT DUE:		

& S TIRE INC

3935 ALHAMBRA AVE MARTINEZ. CA 94553-3819 (925)228-8900, BAR REG# AK60281R. I.D. FEDERAL TAX ID# 942437197

CAD053044053

GOOD YEA

INABIGE

PAGE: 01

BILL TO:

02/01/08 02/01/08 08:27 AM 09:24 AM TERR: 7799 NONSIG: 186140

PHONE 1 PHONE 2 DATE REQUESTED 02/01/08 TIME REQUESTED RETURN PARTS.. YES

SALESMAN..... 009 / 009

VEH YEAR/MAKE. 58 MERCEDES VEHICLE MODEL. 300 SL VEHICLE COLOR. LICENSE/STATE. 65511 / CA ODOMETR IN/OUT 4717 / 4717 PRIOR INVOICE. 098026

ACCOUNT # COB TC CUST# TYPE/STATE AUTHORIZATION CREDIT CARD NO. 01 01901 0 CA 00154C HDC 9270

SLSM TECH

PRODUCT CODE

DTY DESCRIPTION PARTS LBR/EXCISE LINE TOTAL

009 062 078-161

USTOMER AUTRORIZATION FOR TOTAL

R VEHICLE ALIGNMENT CHECK 39.95 39.95

ALL OF US HERE AT W & S TIRE WANT TO THANK YOU FOR YOUR BUSINESS.

PLEASE COME BACK AND SEE US.

I UNDERSTAND THAT ALL CUSTOM WHEEL LUG NUTS MUST BE RE-TORQUED AFTER 25 MILES AND CHECKED PERIODICALLY.

(signature)

PARTS TOTAL..... LABOR TOTAL..... SALES TAX...... CHARGED AMOUNT TAXABLE AMOUNT 39.95 .00 INVOICE TOTAL

E REVERSE SIDE FOR IMPORTANT SAFET

W & S Tire Inc. Goodyear 3935 Alambra Ave. Martinez, Calif. 94553 (925) 228-8900

Work Order ID

R098752

Customer Number

3348

Name

AA

License

62211

Year:

58

Technician

62

Mileage

4717

Time Printed

2/1/08 10:13 AM

Mercedes-Benz : 107 (SL Class 1972-89) : 8/85 - : 107.041

Front : Left

Front	Right
LLOHE	Lugue

Actual	Before	Specifi	ed Range
0.2°*	0.2°*	-0.5°	0.0°
3.5°*	3.5°*	9.8°	10.8°
0.09°	-0.01°*	0.08°	0.25°
		-1.50°	-0.17°

Camber
Caster
Toe
SAI
Included Angle
Turning Angle Diff.

Actual	Before	Specifie	ed Range
0.8°*	0.7°*	-0.5°	0.0°
4.0° ±	4.0°*	9.8°	10.8°
0.07°*	-0.01°*	0.08°	0.25°
		-1.50°	-0.17°

Front

Cross Camber Cross Caster Cross SAI Total Toe Cross Turn Diff.

Actual	Before	Specifie	ed Range
-0.6°±	-0.5°*	-0.3°	0.3°
-0.5°	-0.5°	-0.5°	0.5°
0.16°*	-0.01°*	0.17°	0.50°
22.222			

Rear : Left

Camber Toe

Rear : Right

Actual	Before	Specified	Range
0.4° -0.01°	0.4° -0.04°*	-0.01°	0.58°

Actual Before Specified Range 0.7° 0.7° -0.06°* -0.05°* -0.01° 0.58°

Rear

Cross Camber Total Toe Thrust Angle

Actual	Before	Specifie	d Range
0.3°	0.3°	-1.0°	1.0°
-0.06°*	-0.09°*	0.17°	0.67°
-0.03°	-0.01°	-0.30°	0.30°

^{*} This value is not within specification. Tire wear, handling and safety problems may result.

4,757. KM

1960 Mercedes 300sl Repair List-2/13/08 Bob West notes

12 quanto of oil 16 02 (bottle) of Fos

Formatted: Highlight

Deleted: 7

-Change certain fluids: This service: Engine Delo 400. Add EOS Done. Transmission Kendall EP 80/90. Differential Kendall EP 80/90. This service: Flush brakes Done and eluteh Castrol Dot 4. Flush radiator 50/50 mix. Do transmission and differential at major service only, do radiator flush next time June 2009. Flush radiator every 3 years.

-Corrosion Inhibitor: Always use? Brand and quantity? Needed or is it already in the Anti Freeze? Bob doesn't add anything besides the anti-freeze.

-Clunking sound: when getting on and off the gas. Replaced the u joints but still getting some clunking noise. Brake shoes? Half shafts? Gear lash I did not hear much if anything. There is some gear lash in the differential, but nothing requiring attention now,

-Windshield rubber seal: replace or caulk Best done with a windshield replacement, the German rubbers weren't good in the 80's

 Coolant Tank: Bob noticed one external mounting clip and internal level indicator (both soldered joints) have come loose from the coolant tank. No immediate concern, but need to repair sometime.

-Radiator Overflow Tank - Fluid measuring tab on the inside of the tank has come off. It may still be in the tank. Check the clips for holding the tank. They need to be repaired.

-Vibration/rubbing - Car has a funny feeling. 1997 (or 1987) hard old V rated Michelins Check the wheel bearings and anything else that could cause this. Bearings all seem good Might have been fixed at last service.

-Rear Bumper - There is a rattle on the left side. I can't tell where it is hitting. Might have been fixed at last service. Every time the exhaust tip gets scraped the last exhaust hanger will bend and hit the bumper bracket. I bent it back.

-Mud Flap - Driver side front mud flap is coming off. Repaired both sides

-Floor mats - Rubber floor mats are loose. The holding screws do not seem to firmly hold them in place. Normal? Yes

-Hard top seal – Dry, replace?

-Antenna: How controlled? Usually automatic when the radio is turned on, but I did not troubleshoot

-Noise: There's a clicking noise coming from left rear quarter panel. Could it be a gas tank float hitting the side of the gas tank? I did not hear this

-Throw out bearing: check for free play per spec Adjusted per manual

 Oil Cooler: Make removable aluminum cover per tech tips. Done Would like to get engine hot enough so that heater puts out hot air.

 Oil Pressure: Ok? List pressures cold and warm. Warm at idle was 2bar which is very good. Bob said 1/2bar (7psi) at idle is the lower wear limit good. If the gauge is reading,

-Seat Belts: how strong are the cut carabineers that Bob put on. Way to calculate or ask the company. Steel Hooks and preexisting flatbars are much stronger than any fabric belt

-Valve Adjustment: Necessary? Valve clearances checked OK

-Brake Drum Lock Tabs: Are these ok? Yes

Formatted: Strikethrough

Deleted: 2/11/2008

-Alignment: Check alignment, car wanders_Alignment laser-checked and found to be in spec. Old Michelins are the likely culprit, but those are cool tires.

-Brakes: Check for pulling 1 did not experience any pulling...be kind to the brakes.
Rudge Drums are a few grand \$\$ each

-Fuel Injection: Check for gas in oil issue Changed the FI Pump oil - -smelled a little normal "fuelish", but the quantity of oil was good - -which is a good sign

-Tech Tips: Any other items need to be addressed? If you don't already have it - -I would suggest getting the history of the car from Paul Russell. They were proud enough to rivet their ID number on the firewall in 1982, they should have some records. I noticed that the head had a casting date of 1968. All in all - ---a great driving, solid roadster. PS – why is the fuel pump wire disconnected from the oil pressure switch? I left it, but the starter will crank longer without the supplemental fuel pump going. If hooked up, it will override the manual lighted switch on dash. Not sure why disconnected. Did not test, may have been disconnected for a reason.

Parts Needed:

- 1. Need wrench to remove spare from trunk-19mm combo wrench
- 2. Original tool kit

Deleted: 2/11/2008

Formatted: Font: Bold

300SL Mercedes

LABOR

2/13/08 attack natu

Date	Hours	Activity	4,757 km
26-Jan	2	Fab & install oil cooler cover, chassis diagnosis	, , , ,
27-Jan	3	Change engine oil w/ new Wix Filter, adjust clutch linkage	
1-Feb	3	Check front end alignment, Flush brake fluid, change Fl pump of	oil
9-Feb	3	Repair mudflaps, repair exhaust clunk, Check valve clearances	

12 quate of oil, 16 oz of Evz (16the

Subtotal 11 \$50 \$ 550.00

MATERIALS & SUBCONTRACT

Goodyear		\$49.00
Oil filter, fluids		\$15.00
Subtotal		\$ 64.00
	Total parts + Labor	\$ 614.00

NOTES:

Refer to worklist

MUNUMENT CAR PARTS #7 1965 SAN FYMON VALLEY BLV SAN RAMON, CA 94583 925-838-9883

SERVIC OU CAN TRUST THANK YOU FO YOUR BUSINESS

FAMILY OWNED SINCE 1965

Merchant ID: 160014053847

Ref #: 0024

Sale

1000000000000005216

MISTERCARD

Approd: Online

lotal:

Exp: 85/11 Entry Method: Swiped

120.12

Batch#: 000581

87/19/09 14:47:12 Inv #: 000024 Appr Code: 78992P

Cuntoner Copy

THANK YOU FOR SHOPPING MONUMENT CAR PARTS! THE BAY AREA'S LEADING ACTO PARTS SUPPLIERS SINCE 1965.

LIVERMORE CONCORD 1055 Detroit Ave.

925-676-1000

1814 First Street 925-373-1086 **PACHECO**

5166 Pacheco Blvd. 925-798-6330 PLEASANTON SAN RAMON 925-846-5555

1809-A Santa Rita Rd. 1965 San Ramon Valley Blvd. 925-838-9003

TRACY

208 E. 11th Street 209-835-3514

this invoice is due on the 10th of the month following date of purchase. Purchaser agrees to pay 11/2% per month on all past due balances, which is an annual and attorney fees incurred in the collection of this account, if necessary. RETURNS: All returns must be accompanied by this invoice. No returns accepted ect to 15% handling charge. No returns on installed parts and special orders. All warranties are as specified by the manufacturer, No labor claims.

749 RECEIVED BY: 45

MESSAGE

SALESMAN: H-7 SHIP VIA:

P.O. NO .:

INVOICE NO .:

SAM REMON

AMOUNT

BER	DESCRIPTION	CORE	LIST	NEI	AMOUNT	ICA
	BATTERY - 7YR (AC		162.95	109.95	109.95	
	SEE MESSAGE		0.00	0.00	0.00	T
	Fru replacement	of Jails	Enother 36	months		
		1	09.95 10	0.17	120.12	

CORE TOTAL

NON-TAXABLE


TAXABLE

AMOUNT DUE

INVOICE





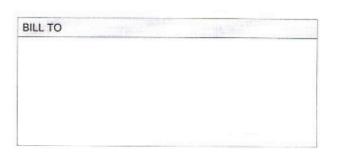

TRANSACTION NO.	10001566
INVOICE DATE	07/23/2009
ACCOUNT NO.	130542
P.O. NUMBER	
LOCATION	, 101
SALES REP	AFT
INVOICE TERMS	Due On Receipt
DUE DATE	07/24/2009
SHIP VIA	USPS-PRI
TENDER TYPE	
FOB	

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
198-887-03-93	1	HOOD TO RADIATOR FOAM SEAL , GRAY, M-B \$206.	23.50	23.50

THANK YOU FOR YOUR BUSINESS, YOUR SATISFACTION IS OUR NUMBER ONE CONCERN; PLEASE LET US KNOW IF YOU HAVE ANY QUESTIONS ON YOUR ORDER AT 602-397-5300.

PLEASE NOTE "ALL RETURNS MUST BE PROCESSED WITH A (RMA #) Return Mechanize Authorization Number AND ARE ONLY VALID 30 DAYS FROM THE DATE OF THIS RECEIPT. THERE IS A 15% RESTOCKING FOR ALL RETURNED ITEMS. PLEASE NOTE: NO REFUNDS WILL BE GIVEN FOR PARTS THAT ARE SPECIAL ORDERED. ELECTRICAL PARTS ARE NE=OT RETURNABLE.

SUBTOTAL	23.50
Sales Tax	0.00
FREIGHT	14.80
TOTAL AMOUNT	38.30
BALANCE DUE	38.30

fust post a check if you prefer

Page

Mahl with chick 211/10

Gull Wing Group Club Store

P/N	Description	Qty	Cost	Total
	BOSCH PARTS	V.		
500	Battery Shut Off Switch		\$60.00	
510	Distributor Cap - Gullwing Single Coil/Single Points		\$25.00	
511	Distributor Cap - Gullwing Single Coil/Dual Points		\$350.00	
512	Distributor Cap Roadster		\$680.00	
520	Fine Fuel Filter (Basket), Comes with One Square O-Ring		\$20.00	
521	Additional Fuel Filter Square O-Ring		\$3.00	
525	Coarse Screw-On Fuel Filter		\$10.00	
526	Coarse Push-On Fuel Screen with O-Ring		\$20.00	
530	Ignition Coil - Smaller Diameter - Gullwing and Roadster		\$80.00	
540	Ignition Condensor - Gullwing - Single Coil/Single Points		\$14.00	
541	Ignition Condensor - Gullwing - Single Coil/Dual Points		\$25.00	
542	Ignition Condensor - Roadster		\$50.00	
550	Ignition Points - Gullwing - Single Coil/Single Points		\$13.00	
551	Ignition Points - Gullwing - Single Coil/Dual Points		\$80.00	
552	Ignition Points - Roadster		\$130.00	
560	Ignition Rotor - Gullwing - Single Coil/Single Points		\$17.00	
561	Ignition Rotor - Gullwing - Single Coil/Dual Points		\$20.00	
562	Ignition Rotor - Roadster		\$540.00	75-50
570	Ignition Wire End - Spark Plug Connector (Beru) Each		\$8.00	
571	Ignition Wire Rubber Boots - Each		\$1.00	
580	Injection Pump Diaphram		\$115.00	
57	REPLACEMENT PARTS			. Y. = X
620	Fuel Hose - Steel Braid, Part #198 476 02 26		\$55.00	
630	Injection Pump Lower Cover with Drain - Fits R-2 Pump		\$80.00	
631	Injection Pump Lower Cover with Drain - Fits R-3 (R-8 Pumps)		\$80.00	1
640			\$75.00	
650			\$45.00	
670	Front Koni Shocks for the Gullwing & Roadster - Set of Two		\$475.00	
671	Rear Koni Shocks for the Gullwing & Roadster - Set of Two		\$475.00	
	Note: O/S in the 'Quantity' column means item is temporarily out of stock.		al Page 2:	80
Pric	es may change month to month. Please order from the current StarLetter.	Sub-101	al Page 1:	-
	hipping and Handling \$200.00 and over\$25.00 may pay by check or McVISA. Next Day Air, if requested, is MC/VISA.		Shipping:	12.5
\$1.00 \$25.0 \$50.0 \$75.0	an additional cost. All foreign shipments are sent by the United States Postal Service at the actual shipping cost. Allow four to six weeks. No COD orders. 15% handling charge for returns. You an additional cost. All foreign shipments are sent by the United States Postal Service at the actual shipping cost. Allow four to six weeks. No COD orders. 15% handling charge for returns. You Make check payable to GWG Intl. and send to club store address: 4720 Hatchery Road, Waterford, MI 48329. You may also fax orders to: (248) 674-3091.	GRAN	ID TOTAL:	92.5

		-		
 -	m	_	_	

Ship To:

Address

City: __ GWG Me MC/VISA ...

Authorization Signature:

LOOSE WHEEL

Ace Auto Repair & Tire Center

Page 1

Order Date 11/21/12 05:05 pm Completed: 11/23/12 01:14 pm

BAR #: ARD238987 EPA #: CAL259552 Invoice No.

www.AceAutoRepair.com

114822

2560 San Ramon Valley Blvd.

San Ramon, CA 94583

Phone: 925-743-1552 FAX: 925-743-2557

No Vehicle

Quotes
1 11/21/12 05:07pm 120.00
in person.

LOOSE WHEELS

MOUNT / BALANCE CUSTOMERS

Labor: \$120.00

Payments to Ace Auto Repair & Tire Center	Cost Summar	У
Status: Completed Work Order	Labor	120.00
	Parts	0.00
Payments:	Subtotal	120.00
	Total	\$120.00
	Payments	0.00
	Bal Due	120.00

Thank you for choosing Ace Auto Repair & Tire Center

Mounted Michelin from Costes - Used my Michelintabe

UNLESS OTHERWISE NOTED, ALL REPAIRS ARE WARRANTED FOR 90 DAYS OR 4,000 MILES

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees
permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing
and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of
repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire,
accident or any other cause beyond your control.



MEMBER PURCHASE INVOICE

Time In: 15:39:14

Membership #: 111665292190

MEMBER INFORMATION	VEHICLE INFORMATION				
	1960 MBZ 30	OOSL			
	Color:	WHITE	License:	5555555	
	Odometer:	20000			
	Wheel Torque:	100			
	Air Pressure:	Front: 35	Rear:	35	

ITEM#	DESCRIPTION	Qty	SLIP PRINT
152257	MICHELIN X-RADIAL DT MICH PASSENGER S/T P205/75R15 97S BW MSPN 14729	4	***SPECIAL ORDER***
	80,000 Mile Warranty		30036
	W _a		* MEMBER #111665292190 *TIRESHOP ORDER # 0000210178035 *PRICE DVRD 4 @ 103.99
			* 152257 P205/75R15DT 415.96 * 4 @ 1.75
			* CA STATE TIR 7.00 * A 8.25% TAX 34.32
			* TOTAL 457-28 *VF EFT/DEBIT 517.28
			1 / 100
			* CHANGE *TOTAL NUMBER OF ITEMS SOLD =
			CASHIER: BILL W. REG 95 *11/09/2012 15:40 0021 95 0038 105
			/
			Ouch

NOTES:				
*Inflation and Torque specifica	tions are recommended by Manufacturer.			

__ Best to Spare

Static ___ Dynamic Blackwall __ Whitewall

BMW

Sales Person





CRW ENTERPRISES LLC
DBA Art's Star Classics Restoration Mgt
13100 GA HWY 144 EAST
Suite #289
Richmond Hill, GA 31324

Bill To			
	ALTERNATION OF	Address	

TRANSACTION NO. 10019044 INVOICE DATE 11/13/2014 ACCOUNT NO. 137315 P.O. NUMBER 300SL RO LOCATION 101 SALES REP AFT INVOICE TERMS Due On Receipt DUE DATE 11/14/2014 SHIP VIA **UPS-GR** FOB

Tracking No. 1ZA6348W-03-4144-2147

SKU	QTY	DESCRIPTION		UNIT PRICE	EXTENDED PRICE
186-016-00-80	1 EA	Valve Cover Gasket, M-B \$174.	DICHTRING	88.00	88.00
007603-018100	1 EA	Aluminum Seal Ring 18 X 24MM		1.00	1.00
007603-010101	2 EA	Aluminum Seal Ring10 X 14MM		0.50	1.00

THANK YOU FOR YOUR BUSINESS, YOUR SATISFACTION IS OUR NUMBER ONE CONCERN; PLEASE LET US KNOW IF YOU HAVE ANY QUESTIONS ON YOUR ORDER AT 912-459-0380.

PLEASE NOTE: ALL RETURNS MUST BE PROCESSED WITH A RMA # (Return Mechanize Authorization Number). TO OBTAIN A RMA# PLEASE CONTACT THE OFFICE AT 912-459-0380 AND EXPLAIN THE REASON FOR THE RETURN.

NOTE: ALL RETURNS ARE ONLY VALID 30 DAYS FROM THE DATE OF THIS RECEIPT. THERE IS A PROCESSING FEE OF \$10.00 AND ALSO A 20% RESTOCKING FOR ALL RETURNED ITEMS. NO REFUNDS WILL BE GIVEN FOR PARTS ELECTRICAL PARTS OR PARTS THAT ARE SPECIAL ORDERED FOR THE CUSTOMER OR RETURNED DAMAGED.

ELECTRICAL PARTS ARE NOT RETURNABLE.

SUBTOTAL	90.00
Sales Tax	0.00
FREIGHT	16.78
TOTAL AMOUNT	106.78
Visa **7455	(106.78)
BALANCE DUE	0.00

Contra Costa Radiator, Inc.

Page 1 Order Date: 12/03/14 04:56 pm

BAR #: ARD 060051 EPA #CAL00033335

Work Order No. 000040679

300SL

160 C River Road

Rio Vista, CA 94571

Phone: 707 374-2299 FAX: 707 374-2356

No Vehicle

Quotes 1 12/03/14 05:03pm 209.38 in person.

C&R OIL COOLER

Labor: \$197.50

Payments to Contra Costa Radiator, Inc.	Cost Summan	СУ
Status: New Work Order	Labor	197.50
	Parts	0.00
Payments:	Env. Fee	11.88
	FREIGHT	17.76
	Subtotal	227.14
	Total	\$227.14
	Payments	0.00
	Bal Due	227.14

Thank you for choosing Contra Costa Radiator, Inc.

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature)					


DEALERSHIP HOURS

SALES

8:00AM - 8:00PM Mon - Fri 9:30AM - 6:00PM Saturday 11:00AM - 5:00PM Sunday PARTS & SERVICE

7:30AM - 5:30PM Mon - Fri 8:30AM - 4:00PM Saturday CLOSED Sunday

1119/15

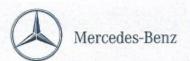

MERCEDES-BENZ OF PLEASANTON 5885 OWENS DRIVE • PLEASANTON, CA 94588 925.463.2525

www.mbofpleasanton.com

MERCEDES-BENZ OF PLEASANTON WILL ACCEPT MOST PARTS, WITH THE EXCEPTION OF ELECTRICAL, FUEL RELATED, SOFT TRIM, GLASS AND SPECIAL ORDER ITEMS, WITHIN 15 DAYS OF PURCHASE AND ONLY WHEN ACCOMPANIED BY THIS INVOICE. ALL PARTS TO BE RETURNED MUST MEET THE STRICT MANUFACTURER'S PACKAGE GUIDELINES AND ARE SUBJECT TO A 20% RESTOCKING CHARGE. PURCHASES MADE BY CHECK WILL REQUIRE A 15 DAY CLEARING PERIOD PRIOR TO ISSUANCE OF A REFUND CHECK. SPECIAL ORDER ITEMS NOT PICKED UP WITHIN 60 DAYS WILL BE RETURNED TO THE FACTORY WAREHOUSE.

30052

DATE ENTERED 08 JAN 15	YOUR ORDER NO.	DATE SHIPPED 08 JAN 15	08 JAN 15	INVOICE NUMBER	765131
S 0 L D		**PREPAID** .83098			PAGE 1 OF 1
T O			T _O		

VIA			SLSM.	B/L NO.	11	TERMS	1 1000		F.O.B. F	OINT	
			722	13:56	:09	CASI	HR	9	PL	EASANTON CA	X
b.	SHP	8.0.	PART NO			ESCRIPTION		LIST	NET	AMOUNT	
1	1	1				FILTER I		9.00	9.00	9.00	
1	1	1	000-47	7-35-80		GASKET,	FUE	1.50	1.50	1.50	
1	1	1	000-47	7-36-15		FILTER PREPAID	ELE	10.00	10.00	10.00	
										PA	AID - 8 2015
											- 8 2015
										JAN	
										Time:	
cc	edes	Ber	nz of P	leasanto	on		ARTS	The second secon		20.50	
							REIGH			0.00	
							ALES		J. H. A.A.	1.85	
								TOTAL		\$22.35	
						C	7	R'S SIGNATURE			

NVOICE COPY

Return Address:

Delivery Address:

Cost Code:

Class/Service: Priority Mail ®

Special Services: USPS Tracking

Print Date:

May 25, 2015 - 10:09:06 PM May 26, 2015

Mail Date: User: Twintime11

Weight: 2 lbs 2 oz E-refund

9405511899562311519950

Refund Type: Insurance ID: Printed Msg:

\$13.52

\$8.50

300SL Hoseshipping

\$22.02

* Insurance fees will be processed during your next billing cycle.

Insurance: Stamps.com Insurance (\$600.00)*

Tracking: 9405511899562311519950

Location	Date	Local Time	Description
RICHMOND HILL, GA, 31324, US	May 28, 2015	12:12:00	DELIVERED IN/AT MAILBOX
RICHMOND HILL, GA, 31324, US	May 28, 2015	07:03:00	OUT FOR DELIVERY
RICHMOND HILL, GA,	May 28,	06-53-00	SORTING/PROCESSING COMPLETE



CRW ENTERPRISES LLC

DBA Art's Star Classics Restoration Mgt 13100 GA HWY 144 EAST Suite #289 Richmond Hill, GA 31324 300 SL

INVOICE

TRANSACTION NO.	10021138
INVOICE DATE	06/17/2015
ACCOUNT NO.	137315
P.O. NUMBER	300SL RO
LOCATION	101
SALES REP	AFT
INVOICE TERMS	Due On Receipt
DUE DATE	06/18/2015
SHIP VIA	ÚPS-GR
FOB	



Tracking No. 1ZA6348W-03-4221-9020

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
198-476-00-26E	1 EA	Fuel Hose, Shoirt Exchange -SELL W/01 26	198.00	198.00
198-476-01-26E	1 EA	Fuel Hose, Long, Exchange -SELL W/00 26	198.00	198.00
198-476-02-26E	2 EA	Fuel Hose, Short Exchange	182.00	364.00
007603-008109	3 EA	Copper Seal Ring 8X12MM	1.75	5.25
007603-012104	4 EA	Ring Seal, Aluminum 12X18MM	2.00	8.00
007603-014104	4 EA	Aluminum Seal Ring 14 X 18 MM	3.00	12.00

THANK YOU FOR YOUR BUSINESS, YOUR SATISFACTION IS OUR NUMBER ONE CONCERN; PLEASE LET US KNOW IF YOU HAVE ANY QUESTIONS ON YOUR ORDER AT 912-459-0380.

PLEASE NOTE: ALL RETURNS MUST BE PROCESSED WITH A RMA # (Return Mechanize Authorization Number). TO OBTAIN A RMA# PLEASE CONTACT THE OFFICE AT 912-459-0380 AND EXPLAIN THE REASON FOR THE RETURN.

NOTE: ALL RETURNS ARE ONLY VALID 30 DAYS FROM THE DATE OF THIS RECEIPT. THERE IS A PROCESSING FEE OF \$10.00 AND ALSO A 20% RESTOCKING FOR ALL RETURNED ITEMS. NO REFUNDS WILL BE GIVEN FOR PARTS ELECTRICAL PARTS OR PARTS THAT ARE SPECIAL ORDERED FOR THE CUSTOMER OR RETURNED DAMAGED.

ELECTRICAL PARTS ARE NOT RETURNABLE.

SUBTOTAL	785.25
Sales Tax	0.00
FREIGHT	26.34
TOTAL AMOUNT	811.59
DISCOUNT	(38.00)
MasterCard **3932	(773.59)
BALANCE DUE	0.00
U.S. Dollars	



DBA Art's Star Classics Restoration Mgt 13100 GA HWY 144 EAST Suite #289 Richmond Hill, GA 31324

300 SL

ill To		

Tracking No. 9405-8036-9930-0291-0850-76

TRANSACTION NO.	10024520
INVOICE DATE	09 AUG 2016
ACCOUNT NO.	137315
P.O. NUMBER	300SL RO
LOCATION	101
SALES REP	AFT
INVOICE TERMS	Due On Receipt
DUE DATE	10 AUG 2016
SHIP VIA	USPS-PRI
FOB	

INVOICE

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
900260-053200	1 EA	Seal, Rubber, Water Pump to Side Cover, M-B \$23.50	17.00	17.00
915035-000025	1 EA	Copper Seal Ring 26 X 32MM	2.00	2.00

THANK YOU FOR YOUR BUSINESS, YOUR SATISFACTION IS OUR NUMBER ONE CONCERN; PLEASE LET US KNOW IF YOU HAVE ANY QUESTIONS ON YOUR ORDER AT 912-459-0380.

PLEASE NOTE: ALL RETURNS MUST BE PROCESSED WITH A RMA # (Return Mechanize Authorization Number). TO OBTAIN A RMA# PLEASE CONTACT THE OFFICE AT 912-459-0380 AND EXPLAIN THE REASON FOR THE RETURN.

NOTE: ALL RETURNS ARE ONLY VALID 30 DAYS FROM THE DATE OF THIS RECEIPT. THERE IS A PROCESSING FEE OF \$10.00 AND ALSO A 20% RESTOCKING FOR ALL RETURNED ITEMS. NO REFUNDS WILL BE GIVEN FOR PARTS ELECTRICAL PARTS OR PARTS THAT ARE SPECIAL ORDERED FOR THE CUSTOMER OR RETURNED DAMAGED.

ELECTRICAL PARTS ARE NOT RETURNABLE.

SUBTOTAL	\$19.00
Sales Tax	\$0.00
FREIGHT	\$14.45
TOTAL AMOUNT	\$33.45
Visa **9252	\$-33.45
BALANCE DUE	\$0.00



DBA Art's Star Classics Restoration Mgt 13100 GA HWY 144 EAST Suite #289 Richmond Hill, GA 31324

300 SL

IAI	1/	0	10	
IIN	v	U	IC	

TRANSACTION NO.	10026682
INVOICE DATE	16 MAR 2017
ACCOUNT NO.	137315
P.O. NUMBER	62 300SL
LOCATION	101
SALES REP	AFT
INVOICE TERMS	Due On Receipt
DUE DATE	17 MAR 2017
SHIP VIA	UPS-GR
FOB	

Bill To			
	/bickey		

Tracking No. 5405-8036-9930-0418-6471-87

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
186-201-01-80	1 EA	Gasket	17.25	17.25

THANK YOU FOR YOUR BUSINESS, YOUR SATISFACTION IS OUR NUMBER ONE CONCERN; PLEASE LET US KNOW IF YOU HAVE ANY QUESTIONS ON YOUR ORDER AT 912-459-0380.

PLEASE NOTE: ALL RETURNS MUST BE PROCESSED WITH A RMA # (Return Mechanize Authorization Number). TO OBTAIN A RMA# PLEASE CONTACT THE OFFICE AT 912-459-0380 AND EXPLAIN THE REASON FOR THE RETURN.

NOTE: ALL RETURNS ARE ONLY VALID 30 DAYS FROM THE DATE OF THIS RECEIPT. THERE IS A PROCESSING FEE OF \$10.00 AND ALSO A 20% RESTOCKING FOR ALL RETURNED ITEMS. NO REFUNDS WILL BE GIVEN FOR PARTS ELECTRICAL PARTS OR PARTS THAT ARE SPECIAL ORDERED FOR THE CUSTOMER OR RETURNED DAMAGED.

PARTS THAT ARE SPECIAL ORDERED FOR THE CUSTOMER OR RETURNED DAMAGED.

ELECTRICAL PARTS ARE NOT RETURNABLE.

SUBTOTAL	\$17.25
Sales Tax	\$0.00
FREIGHT	\$7.65
TOTAL AMOUNT	\$24.90
Visa **0390	\$-24.90
BALANCE DUE	\$0.00

Questions? 1-800-644-STAR CRW ENTERPRISES LLC

Page 1 6:52PM



DBA Art's Star Classics Restoration Mgt 13100 GA HWY 144 EAST Suite #289 Richmond Hill, GA 31324

300 SL

Bill To		

Tracking No. 1ZA6348W-03-4128-4265

ı	B. I	1/	0	10	
ı	N	v	U	IC	

TRANSACTION NO.	10027424
INVOICE DATE	19 JUN 2017
ACCOUNT NO.	130542
P.O. NUMBER	300SL RO
LOCATION	101
SALES REP	AFT
INVOICE TERMS	Due On Receipt
DUE DATE	20 JUN 2017
SHIP VIA	UPS-GR
FOB	

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
198-094-00-91	1 EA	RUBBER ELBO OR BOOT	77.00	77.00
198-268-01-96	1 EA	Shift Boot, M-B \$ 32.50	24.00	24.00
186-427-00-96R	2 EA	Hand Brake Boot, M-B \$35.	24.00	48.00
636-184-13-80	1 EA	Oil Filter Gasket	3.50	3.50
007603-018100	1 EA	Aluminum Seal Ring 18 X 24MM	2.50	2.50
915035-000025	1 EA	Copper Seal Ring 26 X 32MM	2.00	2.00
000-071-19-34U	1 EA	SOLEX Carb Jet #210	12.50	12.50
000-071-05-34U	1 EA	SOLEX Carb Jet #220	12.50	12.50
000-071-20-34U	1 EA	SOLEX Carb Jet #230	12.50	12.50
000-071-21-34U	1 EA	SOLEX Carb Jet #240	12.50	12.50

THANK YOU FOR YOUR BUSINESS, YOUR SATISFACTION IS OUR NUMBER ONE CONCERN; PLEASE LET US KNOW IF YOU HAVE ANY QUESTIONS ON YOUR ORDER AT 912-459-0380.

PLEASE NOTE: ALL RETURNS MUST BE PROCESSED WITH A RMA # (Return Mechanize Authorization Number). TO OBTAIN A RMA# PLEASE CONTACT THE OFFICE AT 912-459-0380 AND EXPLAIN THE REASON FOR THE RETURN.

NOTE: ALL RETURNS ARE ONLY VALID 30 DAYS FROM THE DATE OF THIS RECEIPT. THERE IS A PROCESSING FEE OF \$10.00 AND ALSO A 20% RESTOCKING FOR ALL RETURNED ITEMS. NO REFUNDS WILL BE GIVEN FOR PARTS ELECTRICAL PARTS OR PARTS THAT ARE SPECIAL ORDERED FOR THE CUSTOMER OR RETURNED DAMAGED.

ELECTRICAL PARTS ARE NOT RETURNABLE.

SUBTOTAL	\$207.00
Sales Tax	\$0.00
FREIGHT	\$31.53
TOTAL AMOUNT	\$238.53
Visa **0408	\$-238.53
BALANCE DUE	\$0.00



DBA Art's Star Classics Restoration Mgt Www.Artsstarclassics.Com Richmond Hill, GA 31324

30036

Bill To				
	NAME AND S			100

ACCOUNT NO. P.O. NUMBER LOCATION SALES REP

FOB

INVOICE DATE 26 OCT 2017 ACCOUNT NO. 130542 P.O. NUMBER 60 300SL RO LOCATION 101 SALES REP AFT INVOICE TERMS Due On Receipt DUE DATE 27 OCT 2017 SHIP VIA UPS-1D

TRANSACTION NO.

INVOICE

10028498

Tracking No. 1ZA6348W-13-4166-7056

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
198-268-00-69K	1	Stick Shift Bushing Kit, inc/spring ring	135.00	135.00
121-150-02-32	1 EA	Ground Cable	12.00	12.00
198-293-00-60	2 EA	Pedal Linkage Seal, M-B \$27.	6.00	12.00

Returns and Refunds Policy

Thank you for shopping at Art's Star Classics. If you are not entirely satisfied with your purchase, we're here to help.

All parts/items must be returned within 30 days of the original purchase of the product and have NOT been a special order item or a electrical part.

To be eligible for a return, please make sure that:

- 1. The product was purchased in the last 30 days
- 2. The product is in its original packaging
- 3. The product isn't used or damaged
- 4. You have the receipt or proof of purchase
- 5.Note: There is a 20% restocking fee for all items returned with RMA
- 6. You obtained a Return Merchandise Number (RMN) from us
- Products that do not meet these criteria will not be considered for return.

To obtain a Return Merchandise Number (RMN), contact us: By phone number: 912-459-0380 or by email to: info@artsstarclassics.com

Only after you have been give a RMA# please send the product with its original packing and the receipt or proof of purchase and the RMN number noted, to: PARTS RETURNS, Art's Star Classics 407 Victors Court, Richmond Hill, GA 31324

SUBTOTAL	\$159.00
Sales Tax	\$0.00
FREIGHT	\$36.36
TOTAL AMOUNT	\$195.36
Visa **6510	\$-195.36
BALANCE DUE	\$0.00



Morgan Racing Engines

walnut creek, calif.

300 SL

TIM MORGAN 939-7346 1285 PARKSIDE DR. WALNUT CREEK CALIF. 94596



PERFORMANCE PARTS CENTER

NAME ____ MODEL: MAKE: _____ LIST NET SPECIAL QUANTITY SUB TOTAL No Cash Refunds - 20% Restocking Charge - No Returns After 15 Days No Returns On Any Electrical Items - No Returns On Special Order Items TAX Not Legal For Sale Or Use In California On Pollution Controlled Motor Vehicle TOTAL



DBA Art's Star Classics Restoration Mgt Www.Artsstarclassics.Com Richmond Hill, GA 31324

Bill To		

Tracking No. 1ZA6348W-03-4231-2928

INVOICE

TRANSACTION NO.	10028614
INVOICE DATE	10 NOV 2017
ACCOUNT NO.	130542
P.O. NUMBER	60 300SL
LOCATION	101
SALES REP	AFT
INVOICE TERMS	Due On Receipt
DUE DATE	11 NOV 2017
SHIP VIA	UPS-GR
FOB	

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
000-501-00-15	1 EA	Radiator Cap, M-B \$70.	59.00	59.00
000-158-10-90	1 EA	Points, M-B NLA - 300SL RO	388.00	388.00
000-156-84-01	2 EA	Condenser, M-B \$112. each	68.00	136.00
198-268-00-69K	1	Stick Shift Bushing Kit, inc/spring ring	109.00	109.00
198-993-07-10	4 EA	SPRING	24.00	96.00
900263-005000	25 M	Hose Strap, 5MM, By Meter, 25 Meter Min	5.00	125.00
900263-009000	5 M	Hose Strap, 9MM, Sold By Meter	6.50	32.50

Returns and Refunds Policy

Thank you for shopping at Art's Star Classics. If you are not entirely satisfied with your purchase, we're here to help.

All parts/items must be returned within 30 days of the original purchase of the product and have NOT been a special order item or a electircal part .

To be eligible for a return, please make sure that:

- 1. The product was purchased in the last 30 days
- 2. The product is in its original packaging
- 3. The product isn't used or damaged
- 4. You have the receipt or proof of purchase
- 5.Note: There is a 20% restocking fee for all items returned with RMA
- 6. You obtained a Return Merchandise Number (RMN) from us
- Products that do not meet these criteria will not be considered for return.

To obtain a Return Merchandise Number (RMN), contact us:

By phone number: 912-459-0380 or by email to: info@artsstarclassics.com

Only after you have been give a RMA# please send the product with its original packing and the receipt or proof of purchase and the RMN number noted, to:
PARTS RETURNS, Art's Star Classics 407 Victors Court, Richmond Hill, GA 31324

SUBTOTAL	\$945.50
Sales Tax	\$0.00
FREIGHT	\$25.82
TOTAL AMOUNT	\$971.32
Visa **6510	\$-971.32
BALANCE DUE	\$0.00



Morgan Racing Engines

walnut creek, calif.

300 56



TIM MORGAN 939-7346 1285 PARKSIDE DR. WALNUT CREEK CALIF. 94596



PERFORMANCE PARTS CENTER

	NAME			
MAKE:	MODEL:			
VITTUAL		LIST	NET	SPECIAL
1 +	# 10 pushlock Hose.			6.99
)	MPOTE			150 9
	Core			0
	(Down			
No Ca	ash Refunds - 20% Restocking Charge - No Returns After 15 Days SUB TOTAL			15794
No R	eturns On Any Electrical Items - No Returns On Special Order Items			13/03
Not L	egal For Sale Or Use In California On Pollution Controlled Motor Vehicle			170 97



1767 Placentia Ave

Costa Mesa, CA 92627 www.racebrakes.com

Voice: (949) 548-4470

Bill To:

Fax: (949) 548-7783

PIA	10	-	-	-
LA A	V	ı	U	C

Invoice Number: 134336

Invoice Date:

Nov 22, 2017

Page: Duplicate

Ship to:

			ent Terms
			repaid
Sales Rep ID	Shipping Method	Ship Date	repaid Due Date

	Shipped	B/O QTY	Item	Description	Unit Price	Amount
	1.00		Reline Customer Shoe	RD-4 Compound	179.00	179.00
1						
						27

Check/Credit Memo No: 60791637320

Subtotal	179.00
Sales Tax	14.77
Freight	18.65
Total Invoice Amount	212.42
Payment/Credit Applied	212.42
TOTAL DUE	0.00

NOTE: All merchandise returned is subject to a 20% handling or restocking fee. All returns must be authorized and accompanied by a Returned Goods Authorizatic Number, freight prepaid. The customer is responsible for freight on all merchandise returned because of refused or missed delivery. Shortage, damage, or miss bo: MUST be filed within five (5) business days of receipt of merchandise. Returned checks are subject to three (3) times the amount of the check or \$100 whichever is plus the amount of the check and court costs. There is no warranty stated or implied due to the unusual stress placed on racing parts and because we have no cont how they are used. Prices subject to change without notice.



DBA Art's Star Classics Restoration Mgt Www.Artsstarclassics.Com Richmond Hill, GA 31324

Tracking No. 1ZA6348W-12-4099-3171

INVOICE

TRANSACTION NO.	10028796
INVOICE DATE	01 DEC 2017
ACCOUNT NO.	130542
P.O. NUMBER	60 300SL
LOCATION	101
SALES REP	AFT
INVOICE TERMS	Due On Receipt
DUE DATE	02 DEC 2017
SHIP VIA	UPS-3D
FOB	

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
000-824-01-27	2 EA	Wiper Blade Insert, Cut To Fit, M-B \$20	15.00	30.00
072601-012100	2 EA	Bulb, 12VOLT- 45/40WATT	10.00	20.00
000-997-23-46	2 EA	Front Wheel Hub Seal, M-B \$117.	64.00	128.00
000-323-03-85	4 EA	Rubber spacer	20.00	80.00 - Retur
000-323-01-85	2 EA	Shock Bushing, Front Lower Or Rear Up., M-B \$22.50	16.00	32.00

Returns and Refunds Policy

Thank you for shopping at Art's Star Classics. If you are not entirely satisfied with your purchase, we're here to help.

All parts/items must be returned within 30 days of the original purchase of the product and have NOT been a special order item or a electircal part .

To be eligible for a return, please make sure that:

- 1. The product was purchased in the last 30 days
- 2. The product is in its original packaging
- 3. The product isn't used or damaged
- 4. You have the receipt or proof of purchase
- 5.Note: There is a 20% restocking fee for all items returned with RMA
- 6. You obtained a Return Merchandise Number (RMN) from us
- Products that do not meet these criteria will not be considered for return.

To obtain a Return Merchandise Number (RMN), contact us:

By phone number: 912-459-0380 or by email to: info@artsstarclassics.com

Only after you have been give a RMA# please send the product with its original packing and the receipt or proof of purchase and the RMN number noted, to: PARTS RETURNS, Art's Star Classics 407 Victors Court, Richmond Hill, GA 31324

SUBTOTAL	\$290.00
Sales Tax	\$0.00
FREIGHT	\$33.72
TOTAL AMOUNT	\$323.72
Visa **6510	\$-323.72
BALANCE DUE	\$0.00

- Returned : Fear to but : 243.72 Partsklassik 6500 W Snowbowl View Circle Flagstaff, AZ 86001 Phone 928 255 2824

PartsKlassiK Receipt

*** PLEASE RETAIN FOR FUTURE REFERENCE ***

Order Number 105512

Customer ID 14054069

Order Date 12/1/2017 11:42:30 AM

Ship To:

Bill To:

SKU:	Product	Quantity	Price	Ext. Price
616.100.900.05	Main Jet Air Corrector, Solex 170	2	\$9.99	\$19.98
616.100.900.175	Main Jet Air Corrector, Solex 175	2	\$9.99	\$19.98
616.100.900.02	Main Jet Air Corrector, Solex 180	2	\$9.99	\$19,98
616.100.900.00	Main Jet Air Corrector, Solex 200	2	\$9.99	\$19.98
Order Notes:		SubTotal:		\$79.92
None		Shipping:	FedEx	\$12.13
			Ground	
			Service	
		Tax:		\$0.00
		Total:		\$92.05

Thank you for your order! Partsklassik Phone 928 255 2824

No returns without RMA by phone 20% restocking fee on all returns



DBA Art's Star Classics Restoration Mgt Www.Artsstarclassics.Com Richmond Hill, GA 31324

300SL

ı	M	1/	0	10	
ı	IN	v	U	IC	

TRANSACTION NO.	10028896
INVOICE DATE	12 DEC 2017
ACCOUNT NO.	130542
P.O. NUMBER	61 300SL
LOCATION	101
SALES REP	AFT
INVOICE TERMS	Due On Receipt
DUE DATE	13 DEC 2017
SHIP VIA	UPS-1D
FOB	

Tracking No. 1ZA6348W-13-4251-2649

SKU	QTY	DESCRIPTION	UNIT PRICE	EXTENDED PRICE
000-428-48-35	2 EA	Brake Hose Front, M-B, \$104.	90.00	180.00
000-428-08-35	0 EA	Brake Hose, Rear, M-B \$89.	49.60	0.00
		GROUND		

Returns and Refunds Policy

Bill To

Thank you for shopping at Art's Star Classics. If you are not entirely satisfied with your purchase, we're here to help.

All parts/items must be returned within 30 days of the original purchase of the product and have NOT been a special order item or a electircal part.

To be eligible for a return, please make sure that:

- 1. The product was purchased in the last 30 days
- 2. The product is in its original packaging
- 3. The product isn't used or damaged
- 4. You have the receipt or proof of purchase
- 5.Note: There is a 20% restocking fee for all items returned with RMA
- 6. You obtained a Return Merchandise Number (RMN) from us
- Products that do not meet these criteria will not be considered for return.

To obtain a Return Merchandise Number (RMN), contact us: By phone number: 912-459-0380 or by email to: info@artsstarclassics.com

Only after you have been give a RMA# please send the product with its original packing and the receipt or proof of purchase and the RMN number noted, to: PARTS RETURNS, Art's Star Classics 407 Victors Court, Richmond Hill, GA 31324

	-
SUBTOTAL	\$180.00
Sales Tax	\$0.00
FREIGHT	\$51.66
TOTAL AMOUNT	\$231.66
MasterCard **0179	\$-231.66
BALANCE DUE	\$0.00



12/20/17

Invoice

PETERSON MOTORSPORTS, LLC 22255 ARNOLD DR SONOMA, CA 95476 PH 707-996-7764

Bill To			Date	12/15	/2017	
			Invoice #	202097		
			Project			
			1959 Mercedes	edes		
Item Code	Quantity	Description		Rate	Amount	
Labor	3	Machine brake drums and fit brake shoes. Labor Subtotal		105.00	315.00 315.00	
Due Upo	n Receip	t	Subtotal		\$315.00	
			Sales Tax (8.1		\$0.00	
			Total		\$315.00	
			Payments/Credits		\$0.00	
			Balance Due	3/5/-	\$315.00	

Mercedes-Benz USA LLC

9 Whatney - Irvine, CA 92618-2808

(949) 598-4850

Toll-free: 1-866-MB-CLASSIC (622-5277)

Fax: (949) 598-4860

Email: classicparts@mbusa.com

Web: www.mbusa.com/classic

300 SL

ATE ENTERED Y 8 DEC 17	OUR ORDER NO. DATE SHIPPED 18 DEC 17		IVOICE UMBER	1	60117	
S O L D T				P.	AGE 1 OF 1	
			3355	F.O.B. 1	POINT	
HIP VIA			-		VINE, CA	Testino de Californio
DAY	PART NO. DESCRIPTIO	N LIST	NET	-	AMOUNT	We are not responsible for erro on parts orders when the pa
1 1 0	183-492-02-82 6 SHIPPING & HANDLING Mercedes Bea	00HANGER 85.		3.00	68.00	number is furnished to us by the purchaser. We will not be responsible for an damage to any vehicle caused it parts used on a model they we not specifically intended for, in is there any warranty on surports. All perts shortage and damage part claims must be mainimedistrally upon receipt of order all shipments must be signed tupon delivery, unless we a instructed otherwise. We bear responsibility for, a lost shipmer (eleased without proof-of-delivery signature. Parts returns must have prouted and must accompanied the original salinyole within 30 days of toriginal purchase. All return parts must be their original purchase. All return parts that have been open and/or unsealed. No returns "Special Order" parts. No return installed, painted, modification of the parts that have been "in installed, painted, modification of the parts that have been "in installed, painted, modification of the parts returned are subject to 20% re-stocking fee. We are
Core returns must be ship	pped within 30 days of the exchange part purchase. Co	ores must be				responsible for shipping char- on parts returns. We will
seturned in the same nack	age the exchange part was supplied in. The core must buildable and complete condition to satisfy our core d	be a genuine			68.00	return freight charges only if made an error on the parts ord
abligation. The original or	we denosit invoice must be sent with the return, We	Will not pay SUBLET				
shipping charges on core r	eturns. Failure to return a core will result in forfeiture of t	SHIPPING &	HANDLIN	IG	8.00	
core deposit.		SALES TAX			6.46	
11	CUSTOMER'S SIGNATURE					
	×	Т	OTAL		\$82.46	

BRANCH # 216 (925) 828-7780 6805 SIERRA COURT, SUITE E DUBLIN CA 94568



30056

Page Number 1 of 2 Print Time 12/19/17 09:40:00

> Route #: Stop #:

To: 102101

102101 (999) 999-9999 216 CASH SALES - PROFESSIONAL 6805 SIERRA CT STE E DUBLIN CA 94568 Ship To: 102101 (999) 999-9999 216 CASH SALES - PROFESSIONAL 6805 SIERRA CT STE E DUBLIN CA 94568

_	65176 12/19/17	Salesma 980	n Counter Coo 32079	THE RESERVE OF THE PERSON NAMED IN		D.O.D.		Order # 59800		Ship Vi	a PO#		
	Item Number		Description			Tax	Orde	Ship	B/O	UOM		Unit Price	Total
	XNAS-FUL-8Z		NAS-FUL MISC I 80	MIX ROOM S	SALES	Υ	1	1		OZ		17.50	17.50
	483-56-8Z		ACTIVATOR 3.5	VOC 8Z		Υ	1	1		8Z		40.84	40.84
	EZM78000		DABBER APPLIC	CATOR		Υ	1	1		TU		11.22	11.22
	PRM9437		MICROBRUSH ((25)		Υ	1	1		EA		6.95	6.95
	EZM70002		TOUCH-UP BOT	TILES		Υ	1	1		EA		1.47	1.47
	Taxal	ole Amo	unt:	77.98	3							Subtotal: Tax:	77.98 7.22
	Taxab	ole Amo	unt:	77.98	3					To	otal invoice	Tax:	7.22
	Taxab ank you for your b Chemical Emerge	business	s Si	gnature_						To	otal invoice	Tax:	7.22 85.20
(ank you for your b	business ency Con	Si tact - 1-800-	gnature_					[To	utal invoice	Tax:	7.22 85.20 77821
(ank you for your b	business ency Con al Inform	Si tact - 1-800- nation	gnature_					#			Tax: e Amount: INFOTRAC Weigh	7.22 85.20 77821
(ank you for your b Chemical Emerge Hazardous Materi	ousiness ency Con al Inform II LTD C	s Si tact - 1-800- nation	gnature_					#	Pks	Units	Tax: e Amount: INFOTRAC Weigh	7.22 85.20 77821 t
(ank you for your b Chemical Emerge Hazardous Materi UN1263,Paint,3,	ousiness ency Con al Inform II LTD C	s Si tact - 1-800- nation	gnature_					#	Pks 1	Units 8Z	Tax: e Amouni:	RAC

In observance of the holidays, FinishMaster is closed 12/23 through 12/25 and 12/30 through 1/01. Email orders to orders@finishmaster.com.

They will be processed on 12/26 or 1/02. Have a happy holiday!

___/___ PULLED PACKED DRIVER

Mercedes-Benz USA LLC

9 Whatney - Irvine, CA 92618-2808

(949) 598-4850

Toll-free: 1-866-MB-CLASSIC (622-5277)

Fax: (949) 598-4860

Email: classicparts@mbusa.com Web: www.mbusa.com/classic

300 SL

DATE ENTERED	YOUR ORDER NO.	DATE SHIPPED	INVOICE	DATE	INVOIC	_			
11 JAN 19		11 JAN 19	11 3	AN 19	NUMBE			L71341	
S O L D							I	PAGE 1 OF 1	
T O									
SHIP VIA								POINT	
DAY	PART NO.	DESCRIPTION	N.I.	LIST		NET	TI	RVINE, CA	
2 2 0	000625-03630 SHIPPING & H	8 B	ALL B		3.00	59	.00	118.00 JAN 1 2019	We are not responsible for errors on parts orders when the part number is furnished to us by the durchaser. We will not be responsible for any damage to any vehicle caused by bard used on a model they were not specifically intered for, nor is there env warranty on such parts. All parts shortage and damaged part claims must be made perhediately upon receipt of order. All shipments must be signed for upon delivery, unless we are instructed otherwise. We bear no responsibility for a lost shipment released without a proof-of-delivery signature. Parts returns must have prior authorization and must be accompanied the original sales invoice within 3D days of the original purchase. All returned parts must be their original packaging with our picking label affixed and in saleable condition. No returns on "Special Order" parts. No returns on parts that have been "test" installed, painted, modified, altered or disassembled in any way. All parts returned are subject to a 20% re-stocking fee. We are not
returned in the same pac Mercedes-Benz part in r obligation. The original shipping charges on core	hipped within 30 days of the ex ckage the exchange part was su rebuildable and complete conditi core deposit invoice must be so returns. Failure to return a core	oplied in. The core must be on to satisfy our core dep ent with the return. We w	e a genuine posit refund will not pay	PARTS SUBLET SHIPPING	9. LIANI	DUNG		118.00	responsible for shipping charges on parts returns. We will pay return freight charges only if w made an error on the parts order.
core deposit.				SALES TA		DLING		10.64	
	CUSTOMER'S S	IGNATURE		SALES IA	^	-		10.64	
	X	E SIDE FOR IMPORT		AND DESCRIPTION OF THE PERSON NAMED IN COLUMN 1	TOTAL			\$139.64	

Mercedes-Benz USA LLC

9 Whatney - Irvine, CA 92618-2808

(949) 598-4850

Toll-free: 1-866-MB-CLASSIC (622-5277)

Fax: (949) 598-4860

Email: classicparts@mbusa.com Web: www.mbusa.com/classic

DATE ENTER	2010	YOUR ORD	JER NO.	DATE SHIP		INVOIC			INVO						
1 MAR	19			04 MAR	19	04	MAR	19	NUM	BER		1727	48		
S O L D T O O HIP VIA DDAY GRANT 1 1 1		00650	NO. 178-00-79 14-008100 PING & HA	DESC 9	RIPTIOI G: BI		L	JIST 355 555	.000	NET 28 44	F.O.E I I B.000	PAGE 8. POINT RVINI AM	1 0) E, CZ MOUNT 28	A	We are not responsible for em on parts orders when the p number is furnished to us by surchaser. We will not be responsible for a damage to any vehicle caused parts used on a model they w not specifically intended for, is there any warranty on parts. All parts shortage and dama part claims must be minimediately upon receipt of ord All shipments must be signed upon delivery, unless we
turned in the : ercedes-Benz oligation. The	same pack: part in reb original co	oped within 3 age the exchi unidable and tre deposit in	O days of the exclange part was supported conditions of the return a core with the return a	hange part pur olied in. The co to satisfy ou	thase. Core re must be re core depo-	s must be a genuine oil net pay		ET PING &					20.		instructed otherwise. We bear responsibility for a lost shipm released without proof-of-delivery signature. Parts returns must have a subnorlead and must accompanied the original sinvolce within 30 days of original purchase. All return parts must be their original packaging with our picking astifixed and in saleable condition of the package has been ope and/or unsealed. No returns "Special Order" parts. No returns on electrical part the package has been ope and/or unsealed. No returns "Special Order" parts. No returns on parts that have been "te installed, painted, modifiated or disassembled in way. All parts returned are subject to 20% re-stocking fee. We are responsible for shipping charon parts returns. We will return freight charges only if made an error on the parts ord
			CUCTOMEN'S CO	N W D. E			SALE	STAX					7	. 59	
			CUSTOMER'S SIG	SNATURE					DTAI				\$99.		

Mercedes-Benz USA LLC

9 Whatney - Irvine, CA 92618-2808

(949) 598-4850

Toll-free: 1-866-MB-CLASSIC (622-5277)

Fax: (949) 598-4860

Email: classicparts@mbusa.com Web: www.mbusa.com/classic

300SL

2 JUL 19		12 JUL 19	12 JUL	19 NUN		1	76751		
S O L			22 002				PAGE 1	OF 1	
day	PART NO.	DESCRIPTION		CT			POINT RVINE,	-	
ORD. SHIP R	0 309-470-00-05	DESCRIPTION	S CAP	ST 32.50	NET	.00	AMOL	26.00	We are not responsible for error on parts orders when the pa
	Part number SHIPPING & HA		309-470-	00-05	rep	lace	es 19	8-471	purchaser. We will not be responsible for an damage to any vehicle caused to parts used on a model they we not specifically intended for, in is there any warranty on supports. All parts shortage and damage part claims must be madimediately upon receipt of order All shipments must be signed from the delivery, unless we an instructed otherwise. We bear responsibility for a lost shipmen responsibility for a lost
sturned in the same na	hipped within 30 days of the exc ickage the exchange part was sup	olled in The care must be	a accuracy	A TOTAL ST					responsible for shipping charg-
lercedes-Benz part in i	rebuildable and complete conditio	n to satisfy our core depo-	sit refund PART	S				26.00	
ligation, the original	core deposit invoice must be ser	nt with the return. We will	not pay CLIB!	ET			- SALESHIP III		made an error on the parts orde
re deposit.	e returns. Failure to return a core w	in result in forfeiture of the i	SHIPP	ING & HA	NDLING			10.00	2 75 1
				STAX	TOLING			2.97	
1	CUSTOMER'S SI	GNATURE	SALE	IAA				4.91	
	X			TOTA	1		Ċ	38.97	

Mercedes-Benz USA LLC

9 Whatney - Irvine, CA 92618-2808

(949) 598-4850

Toll-free: 1-866-MB-CLASSIC (622-5277)

Fax: (949) 598-4860

Email: classicparts@mbusa.com Web: www.mbusa.com/classic 30056

DATE ENTER		YOUR ORDE	ER NO.	DATE SHIPP	ED	INVOIC	E DATE		NVOIC	E						
5 SEP	19			25 SEP	19	25	SEP	19	NUMBE	R		178	922			
S O L D T O O O O O O O O O O O O O O O O O O											F.O.B	POIN	E 1			
OHD SHIP		PART	NO.	DESCR	RIPTIO	V	L	IST		NET			MOL			We are not responsible for and
1 1	2 0 1 0 1 0	Part 121-7 121-7	25-00-66 number 25-11-66 25-12-66 ING & HA		SI	EAL 121- EAL EAL 12.00		16. 00-66 51. 51.	00	13 rep: 41 41 41	lac		000	41.	87	purchaser.
ore returns mu	st be shi	pped within 30	days of the excha	ange part purch	ase. Core	s must be										20% re-stocking fee. We are responsible for shipping charge
			nge part was suppl complete condition					S					10	08.	00	on parts returns. We will preturn freight charges only if
			oice must be sent to return a core will				SOUL		Ma.	4						made an error on the parts orde
re deposit.	On Core 1	eco-no, randre	to recuir a core will	resurt in rolleit	u-a or the	respective	SHIPF	ING & F	HAND	DLING				12.		
1								STAX						9.	90	
			CUSTOMER'S SIG	NATURE										ontropic		and the same of th
			X				11 11 11	TO	TAL	- STORY			\$12	20	90	

Mercedes-Benz USA LLC

9 Whatney · Irvine, CA 92618-2808


(949) 598-4850

Toll-free: 1-866-MB-CLASSIC (622-5277)

Fax: (949) 598-4860

Email: classicparts@mbusa.com Web: www.mbusa.com/classic

DATE ENTER	TO YOUR	YOUR ORDER NO.	DATE SHIPPED				VOICE					
7 SEP	19		27 SEP 1	9 27	SEP 1	9 N	UMBE	R	1790	001	-	
S O L D									PAGI	3 1 OF	1	
T O												
									B. POIN			
DAY	ITY	J DART NO	DECORIO	TION				Contract Contract Contract	-	NE, CA		
ORO SHI	8.0	PART NO.	DESCRIP		LI	-	-	NET		MOUNT	0.0	We are not responsible for error on parts orders when the p
4	7 0			SEAL		16.		13.00		26.	00	number is furnished to us by
	7	Part number			725-0		100	replac		000-9		purchaser. We will not be responsible for
4	1 0			SEAL		51.	10000	41.00	1 100	41.	10000	damage to any vehicle caused parts used on a model they w
4	1 0			SEAL		51.	100000	41.00	\$ 70000 LOOK	41.	800000	not specifically intended for,
4	2 0	000-987-38-53 SHIPPING & HA		FRAMES	EAL	75.	00	60.00		120.	00	is there any warranty on sparts.
		pped within 30 days of the exc							TA SE	P 28 25	en	part claims must be m immediately upon receipt of or All shipments must be signed upon delivery, unless we instructed otherwise. We bear responsibility for a lost shipmelessed without proof-of-delivery signature. Parts returns must have a cathorization and must accompanied the original sinvoice within 30 days of original purchase. All return parts must be their original purchase. All return parts must be their original purchase and in saleable, condit No returns on electrical part the package has been ope and/or unsealed. No returns "Special Order" parts. No ret on parts that have been "installed, painted, modil altered or disassembled in way. All parts returned are subject 20% re-stocking fee. We are
turned in the	same pack	age the exchange part was sup buildable and complete condition	plied in. The core m	oust be a genuine						228.	0.0	responsible for shipping char on parts returns. We will return freight charges only if
ligation. The	original co	ore deposit invoice must be se	nt with the return.	We will not pay						220.	-	made an error on the parts ord
pping charge re deposit.	s on core r	eturns. Failure to return a core w	ill result in forfeiture	of the respective	THE RESERVE OF THE PARTY OF THE	NG & F	IANE	IING		12.	0.0	
					SALES		INTIAL	ZENYO .		19.		
Passani		CUSTOMER'S SI	GNATURE		SALES	. ~ ~				10.	30	
		X				TO	TAL			\$259.	80	
7107720		SEE REVERS							_	4000.	00	

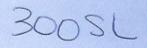



DATE ENTERED

SEP 19

YOUR ORDER NO.

4-5 DAYS

MERCEDES BENZ OF WALNUT CREEK

1301 PARKSIDE DRIVE WALNUT CREEK, CA 94596 (925) 937-1655

Pd 9/25/19

10:01

RETURN/REFUND POLICY: ALL RETURNS MUST BE ACCOMPANIED BY THIS INVOICE AND ARE SUBJECT TO A 15% HANDLING CHARGE. RETURNED ITEMS MUST BE IN THE ORIGINAL UNOPENED BOX OR CONTAINER, PLEASE NOTE THAT THE DEALERSHIP WILL NOT ACCEPT RETURNS OR MAKE REFUNDS AFTER 30 DAYS. NO REFUNDS OR RETURNS ON SPECIAL ORDER PARTS OR ELECTRICAL PARTS.

DISCLAIMER OF WARRANTY: ALL PARTS AND ACCESSORIES ARE SOLD BY OUR DEALERSHIP AS IS. OUR DEALERSHIP DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE, IN CONNECTION WITH THE SALE OF PARTS AND ACCESSORIES. THE ENTIRE RISK AS TO THE QUALITY AND PERFORMANCES OF THE VEHICLE AND PARTS AND ACCESSORIES IS WITH THE CUSTOMER AND, IF APPLICABLE, THE MANUFACTURER. IF THE VEHICLE OR ANY INSTALLED PARTS OR ACCESSORIES SHOULD PROVE DEFECTIVE FOLLOWING THEIR PURCHASE, THE CUSTOMER AND POSSIBLY THE MANUFACTURER AND NOT THE DEALERSHIP ASSUME THE ENTIRE COST OF ANY NECESSARY SERVICING OR REPAIR. CUSTOMER SHALL NOT BE ENTITLED TO RECOVER FROM THE DEALERSHIP ANY CONSEQUENTIAL DAMAGES, DAMAGES TO PROPERTY, DAMAGES FOR LOSS OF LOSS OF LIMIT, LOSS OF PROFITS OR INCOME, OR ANY OTHER INCIDENTAL DAMAGES. THE DEALERSHIP'S LIMITED WARRANTY ON THE REVERSE SIDE OF THIS INVOICE APPLIES ONLY TO PARTS INSTALLED AND/OR REPAIRS PERFORMED BY OUR DEALERSHIP. THE DEALERSHIP NEITHER ASSUMES NOR AUTHORIZES ANY OTHER PERSON TO ASSUME FOR IT ANY LIABILITY IN CONNECTION WITH THE SALE OF SAID PARTS OR PRODUCTS. THIS DISCLAIMER IN NO WAY AFFECTS THE PROVISIONS OF ANY MANUFACTURER OR SUPPLIER WARRANTIES.

INVOICE

NUMBER

1056525

INVOICE DATE

DATE SHIPPED

25 SEP 19

PAGE 1 OF 1 0 Ď 0 AIVA F.O.B. POINT 55 WALNUT CREEK. CA PART NO. NET AMOUNT 0 198-671-00-10 WINDSHI 880.00 800.00 800.00 0 198-671-01-20 FRAME, W 528.00 480.00 480.00 CHARGE AC# SEP 2 5 2019 MERCEDES BENZ OF WALNUT CREEK SPECIAL ORDER PARTS UNDER \$10.00 AND KEY ORDERS ARE NOT RETURNABLE * PARTS 1,280.00 THANK YOU FOR USING WALNUT CREEK** SUBLET *FOR YOUR MERCEDES-BENZ PARTS NEEDS * FREIGHT 0.00 RS: MON THRU FRI 7:30AM TO 5:30PM SALES TAX 105.60 CUSTOMER'S SIGNATURE TOTAL \$1,385.60 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.

Mercedes-Benz USA LLC

9 Whatney · Irvine, CA 92618-2808

(949) 598-4850

Toll-free: 1-866-MB-CLASSIC (622-5277)

Fax: (949) 598-4860

Email: classicparts@mbusa.com Web: www.mbusa.com/classic

OATE ENTERED 19 OCT 19	YOUR ORDE		TE SHIPPED OCT 19	10 O	THE PERSON NAMED IN	INVOICE NUMBER		1793	345		
S O L D								PAGE	8 1 OF	1	
T 0											
PVIA							8.30	B. POIN			
KIORIT_	PARTA	10	DESCRIPTION	NI I	LIST		NET	THE RESERVE OF THE PERSON	MOUNT	1	
ORO SHIP B		10. 24-03-99-3	DESCRIPTIO	AP		.00	56.0		112.0	O on pan	not responsible for errors s orders when the par-
		number ING & HAND	DLING	136-8 13.00	24-03-9	9-3 1	repla	ces (V Mp)	136-82	4 purchas We will damage parts us not spe is them parts. All per part is immedia. All ship upon resource response proof-o Parts authorit accompliance original parts packag affixed No ret the parts and/or "Special on parts parts authorit accompliance or parts package affixed way. All parts parts package affixed way.	not be responsible for any to any vehicle caused by seed on a model they were calically intended for, nor a say warranty on such a say warranty of order ments must be signed for delivery, unless we are of otherwise. We bear no distingtry, unless we are of otherwise. We bear no distingtry or lost shipmen of without a foliowery signature, returns must have prior
Core returns must be a returned in the same pa	ckage the excha	nge part was supplied	in. The core must b	be a genuine	DARTO	1 100			112.	00.00	sible for shipping chargers returns. We will perform the charge of the c
Mercedes-Benz part in obligation. The original					SUBLET				114.		freight charges only if v an error on the parts order
hipping charges on cor		to return a core will res		he respective	SHIPPING (чанг	LING		13.	00	
re deposit.					SALES TA		21140		10.		
figure e	ю 9	CUSTOMER'S SIGNA	TURE								
		X		- H		TOTAL			\$135.	0.1	

Advanced Auto Glass

3937 Kern Court ARD# 221323

Pleasanton, CA 94588

Phone: 650-533-0602 Fax: 888-262-2421

Federal Tax ID: 36-4615445

E-Mail: adv.autoglass@yahoo.com - please check yelp reviews



30056

Date: 10/9/2019

WorkOrder 8683

Customer:

WorkOrder Date: 10/9/2019

CSR:

Installer:

Location: In-Shop

Home: Work:

Fax:

Mobile:

Insurance Information

Loss Information:

10/9/2019

Date:

Deductible:

\$0.00

Policy #:

Bill To:

Claim #:

Agent:

Contact:

Type: Region/Dist:

AGRSS Information

Safe drive-away time:

Temperature: 0.00

Humidity: 0.00

Vehicle: 1960 MBENZ 300SL 2DCNV

Qty Part/Service

1.0 FW00065NANN

Odometer: 0

License Number:

Description ListPrice NetPrice Labor Total Not Available 0.00 -30.000.00 395.00 395.00 Total Material: \$0.00 Total Labor: \$395.00

Santa Clara @ 9.000%:

\$395.00 Total: \$0.00

Deductible Due:

Balance Due:

Subtotal:

\$395.00

\$395.00

\$0.00

Special Instructions:

Leave your windows open about an inch for about 2-3 hours to allow for proper ventilation while the adhesive cures Don't extensively (stop & go) drive for about an hour (you can re-park your car) Remove the tape in the first thing in the morning & don't wash your car until tomorrow afternoon

Check #	C/C		EXP
A decomposit Assets	Class manufication the automatic	and the state of t	

Advanced Auto Glass warranties the automotive glass installed by Advanced Auto Glass in your vehicle against defects in materials and workmanship for as long as you own your vehicle. Evidence of prior rust or defects in materials not supplied by Advanced Auto

Glass will not be covered under warranty. Reason: Customer Initials

Customer Signature Date BAR #: 238987 EPA#: CAL259552

www.AceAutoRepair.com

Invoice No.

2560 San Ramon Valley Blvd.

177572

San Ramon, CA 94583

Phone: 925-743-1552 FAX: 925-743-2557

No Vehicle

Order Date 11/07/19 03:20 pm Completed: 11/08/19 09:53 am

Ref: JC-LOOSE TIRE

Quotes 1 11/07/19 03:22pm 28.50 in person.

TIRE IS LEAKING AIR SOME WHERE

TIRE REPAIR		Labor:	\$27.50
FOUND STEM CRACKING, REPLACED TUBE			
TUBE, 15" TUBE, 15"-N	1.0 @	13.00 =\$	13.00
Payments to Ace Auto Repair &	Tire Center	Cost Summary	
Status: Completed Work Order		Labor	27.50
		Parts	13.00
Payments:		Diag/Info Acces s	1.00
		Subtotal	41.50
		Tax	1.07
		Total	\$42.57
		Payments	0.00
		Bal Due	42.57

Thank you for choosing Ace Auto Repair & Tire Center

UNLESS OTHERWISE NOTED, ALL REPAIRS ARE WARRANTED FOR 90 DAYS OR 4,000 MILES I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature)



• 20

. 22



PowerSportsPlace.com 1200 Southeast Avenue • Tallmadge, OH 44278 • 330-630-0250

• 960 Fast Glendale Avenue • Snarks NV 89431 • 775-352-8787

Calling Customer Service? Please have your invoice number ready.

4881966	01/08/20

INVOICE NUMBER

CUSTOMER NUMBER	PAGE
4 50 500 40	1 2

EXCHANGE/RETURN FORM

4881966-1 01/08/20

Part Number

INVOICE NUMBER

DATE

TNK-VVR

** DECLARED VALUE

Qty.

NOTE: Please read the How to Return. instructions on the back of this form. Please indicate how you wish us to handle your return by checking either the exchange or refund column beside the part number on the list below. Include the reason code for the return. Please provide your daytime phone number in case we need additional information. Please be certain that you complete the additional exchange information

,	n	Q	Π	e	:	(_	_	_	
-	-	-	-	•	-	-	-	•	-	-

Reason Codes

N. No longer need the part

form on the back of this sheet.

- D. The part is defective, or missing a piece
- Q. I am not happy with the quality of this product

Explanation

- W. Part was not what I ordered
- 1. I ordered the wrong part
- S. Other; please explain

Exchange Refund - City.

Qty.	Part Number	Part Description		Status*	Unit Price	Extended Amt.
1	TNK-VVR	ROLLOVER VENT	VALVE REM		18.99	18.99 T
MARNING	. Dyonogition	SE Compliance Char	6			
other r	o the State of eproductive ha	65 Compliance Stating Water & Toxic ed from our catal California to carm. Purchaser may eturn of unopened	use cancer, receive ful	ll refu	defects, o	als r ing
0.74.5		ART VALUE THIS SH ICE CA SALES TAX	IPMENT **	18.9	9 U.S.D.	2.39

NOTE: If you wish to return an item, see instructions on the back of this form and complete the attached Exchange/Return Form.

Thank

You!

*Explanation of status column codes: B/O = backorder C/S = cancel ship S/S = shipped separate

Delivery & Handling

9.99 T

Credit Card Charge

31.38

Some parts are not legal for sale or use in California on any pollution controlled motor vehicles.

YOU CAN TRACK YOUR ORDERS FROM OUR WAREHOUSE TO YOUR DOOR: GO TO WWW.SUMMITRACING.COM AND CLICK THE ORDER STATUS LINK.

S16550108

CCU

U0001239

W 22	14			
***	- 1	8 -8		
	56 B			
1 = -	- 6			

Y MAIL RETURNS® SERVICE

Summit Racing Equipment Attn: Returns Dept. 1103 East Glendale Ave. Sparks, Nv. 89431-9809

NO POSTAGE NECESSARY IF MAILED IN THE UNITED STATES

USPS TRACKING NUMBER



9201 9902 3186 7236 9953 93

Mercedes-Benz USA LLC

9 Whatney · Irvine, CA 92618-2808

(949) 598-4850

Toll-free: 1-866-MB-CLASSIC (622-5277)

Fax: (949) 598-4860

Email: classicparts@mbusa.com Web: www.mbusa.com/classic

CLASSIC PARTS SALES

INVOICE NUMBER

INVOICE DATE

08 JAN 20

30056

181658

S O L D				PAGE 1 OF 1		
T O						
HIP VIA			F.O.	B. POINT		
O.V				IRVINE, CA		
OURNITY BO	PART NO. DESCRIPTION	LIST	NET	AMOUNT	We are not responsible for errors	
2 2 0 198		-HOSE 107.00	86.00	172.00	on parts orders when the promoter is furnished to us by to purchaser. We will not be responsible for a damage to any vehicle caused parts used on a model they we not specifically intended for, it is there any warranty on superts. All parts shortage and damage part claims must be mainmediately upon receipt of ord All shipments must be signed upon delivery, unless we instructed otherwise. We bear responsibility for a lost shipment released without proof-of-delivery signature. Parts returns must have prautherization and must accompanied the original salivedce within 30 days of a original purchase. All return parts must be their original parts must be their original salivedce within 40 days of a original purchase. All return parts must be their original salivedce within 40 days of a original purchase. All return parts must be their original parts must be their original salivedce within 40 days of a original purchase. All return parts must be their original parts and the original parts the package has been open and/or unseeledd. No returns "Special Order" parts. No return on parts that have been "te installed, painted, modificatived or diseasembled in a way. All parts returned are subject to 20% re-stocking fee. We are to the parts of the subject to 20% re-stocking fee.	
	within 30 days of the exchange part purchase. Cores in the exchange part was supplied in. The core must be a	acquipe -		170 00	responsible for shipping charge on parts returns. We will pr	
ercedes-Benz part in rebuild:	able and complete condition to satisfy our core deposit leposit invoice must be sent with the return. We will it	refund PARTS		172.00	return freight charges only if w made an error on the parts order	
nipping charges on core return	s. Failure to return a core will result in forfeiture of the re:	enantive OODEL!	DUNG	10.00		
ore deposit.		SHIPPING & HAN	DLING	12.00		
	QUICTOMENIC CICHATURE	SALES TAX		15.18		
	CUSTOMER'S SIGNATURE			4100 10	1 2 2 7 77	
	X SEE REVERSE SIDE FOR IMPORTAL	TOTAL		\$199.18		

DATE ENTERED

08 JAN 20

YOUR ORDER NO.

DATE SHIPPED

08 JAN 20

PHONE (510) 581-6804

BAR NO. AA075176 PANKEY'S RADIATOR SHOP, INC. 21805 FOOTHILL BLVD. • HAYWARD, CA 94541

PankeysRadiator@yahoo.com

HEAVY INDUSTRIAL & TRUCK

PLASTIC RADIATORS

SPECIALI	ST	4	D • REPAIRED	• RECORE
ISTOMER IDER NO		DATE / -	8-	20
LD TO				
DRESS				
ESMAN		TERMS		
SH SALE CHARGE	SALE MILEAGE	LICENSE NO.	90 DAY	RANTY 1 YEA
TY. PART NUMBER	DE	ESCRIPTION	PRICE	AMOUNT
18"	Merce	tes Oil	Coole	1
	1/2	0	5/	
	lem	Repair		
	19,1	colen	in The Th	1750
	0,000	41	al Paris	
	100			
	0/1	the P		
-	gard 1	5190		
	1-9	- 20		
			,	
	NO	Paint		
		7		
A	II claims and returned go		ied by this bill.	a year year.
247087	AUTHORIZED B	BY	TOTAL	
241001		Products · 510.78	5	6995



900002303 HEALDSBURG 1423 E. GROVE ST. HEALDSBURG, CA 95448 (707) 433-6927

Time: 10:08

Date: 12/07/2023

1/1

Invoice Number 121735 eInvoice#

RETAIL CUSTOMER WITH AAA CA 00000

Delivery:

Attention:

Tax Exemption:

PO#: .

Terms: 10TH PROX ns

Y

OCR

9000023031217357

Y

AAA SHOW YOUR CARD & SAVE - INPUT MEMBER # IN PO

Part Number	Line	Description	Quantity	Price	Net	Total	
7527F 520 7527F 7527F	ENV BAT	2YR WTY BAT (BR) CA Battery Environmental Fee () Core Deposit (BR) Core Deposit (BR)	1.00 1.00 1.00 -1.00	232.16 2.00 18.00 18.00	189.9900 2:0000 18.0000 18.00	189.99 2.00 18.00 18.00	T DE TD C D

Employee: 504 , Nicole Sales Rep: 0 , Salesman

Accounting Day: 6

Subtotal CITY Healdsburg 9.0000% 191.99

18.72

Visa

30056

7409 04583C ABRAMSON/JEFF

210.71

210.71

Customer Signature ALL GOODS RETURNED MUST BE ACCOMPANIED BY THIS INVOICE I agree to pay total amount according to card issuer agreement.

NAPA AUTO PARTS - 303 REMIT TO: 2440 S Main St Lakeport, CA 95453

CUSTOMER COPY

Total

Packing Slip

123Ignitionusa, LLC 23448 Royalton Rd Columbia Station, OH 44028



Ship To:

Order # 6608

Date 1/30/2024

User

Ship Date 1/31/2024

Item	Description	Price	Qty	Ext. Price
Merc 6-R-V-Old	Switched Mercedes 6 cyl engines 62 and older Mercedes Pinch Clamp; \$39.50 Mercedes Pinch Clamp, Flame Thrower Epoxy Colls: Epoxy Coll 1.5 ohm (adds \$85) epoxy coll for 8 and 6 cyl or 4 cyl race applications	\$609.50	1	\$609.50
Merc Clamp	Mercedes Pinch Clamp	\$0.00	1	\$0.00
123111	Epoxy Coil 1.5 ohm for 6 and 8 cyl	\$0.00	1	\$0.00
			Sub Total:	\$609.50

Shipping: \$23.50 Total: \$633.00

