



1218 7TH STREET, BERKELEY, CA 94710
(510) 524-6000

TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 100443

1991 BMW M5

VIN: BK05515

Engine:

Trans: 5SPD MAN

License # CR MOVIE

Odom: 124917

Color: Glanzschwarz

Mfg. Date: 09/90

Unit #

Inv Date: 9/16/2021 @ 12:27pm

Service Writer: Marta Horevajova

Status: Complete

Driver:

PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|------------------|----------------------|--------------------|-----|-----|-------|-----|
|------------------|----------------------|--------------------|-----|-----|-------|-----|

| | | | | | | |
|--|--|--|------|--|--|------|
| Fluid leaking from RR, load level warning few months ago | | | | | | |
| Labor Service - Inspect rear of the cra for leakage: R accumulator line at accumulator leaking. Tighten plug & check fluid level. KR | | | 0.20 | | | 0.00 |

| | | | | | | |
|---|--|--|------|--|--------|--------|
| Rattle sound over rough roads Inspect exhaust check Suspension is clunky - Check suspension | | | | | | |
| Labor Service - Inspect front & rear suspension: ok Check exhaust: front exhaust heat shielding loose & rusty, rattles slightly Test drive: exhaust rattles at idle, rear brake pads rattling over bumps Inspect brake condition: front & rear good (pads at 12 mm) KR | | | 1.00 | | 180.00 | 180.00 |

| | | | | | | |
|---|--|--|------|------|--------|--------|
| Odometer illumination out, replace illum bulbs for gauges too. | | | | | | |
| Labor Service - Remove & install instrument cluster, replace bulbs for odometer & gauges illumination. NS | | | 0.75 | | 180.00 | 135.00 |
| New 62-11-1-391-260 Bulb 1.5w tan | | | | 6.00 | 6.75 | 40.50 |
| New 07-11-9-905-358 Bulb 3w 2821 | | | | 3.00 | 4.48 | 13.44 |

| | | | | | | |
|---|--|--|--|--|--|------|
| Check tire pressures. Adjust to recommended pressures. | | | | | | |
| Labor Service - Check & adjust tire pressures. Front 38psi Rear 41psi | | | | | | 0.00 |
| Note next service due and remaining mileage or SI light status: 4 greens KR | | | | | | |

| Revisions of Original Estimate - Original Estimate of Services and Parts | | | | | \$81.00 | | | |
|--|-------------------|---------------|--------|-----------|----------|-----------|--------|--|
| Rev# | Date and Time | Who Contacted | Method | Contact # | Cont. By | Revise By | Total | |
| 1 | 9/21/2021 12:02PM | | | | MH | 269.00 | 350.00 | |
| cluster illum | | | | | | | | |

X _____
Customer accepts revision to the invoice and agrees to pay revised amount.

| | | | |
|--|--|--|--------|
| Recommended Repairs and Services: | | | 414.05 |
| • Steering wheel noisy - slip ring \$370 or steering column bearing? | | | |
| • Radio head unit needs repair (no LF audio output) | | | |



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 100443

Chris Robyn

1991 BMW M5

License # CR MOVIE

Inv Date: 9/16/2021 @ 12:27pm

Continued from previous page

| | | | |
|--|--|----------------------|------------------------|
| <p>X _____ Customer acknowledges receipt of merchandise and services.</p> | | | Invoice Summary |
| | | | Parts 53.94 |
| | | | Labor 315.00 |
| | | | Labor Discount -31.50 |
| | | | Total 342.97 |
| | | Sub Total 337.44 | |
| | | Sales Tax (DEF) 5.53 | |
| | | Total 342.97 | |



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____
 Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.
 X _____ Date: _____
 I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 99390

1991 BMW M5

VIN: BK05515
 Engine:
 Trans: 5SPD MAN

License # CR MOVIE
 Odom: 123105
 Color: Glanzschwarz
 Mfg. Date: 09/90
 Unit #

Inv Date: 6/08/2021 @ 3:02pm
 Service Writer: Eric Ingraham
 Status: Complete
 Driver: Robyn, Phil
 PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|--|----------------------|-------------------------|------|-------|--------|--------|
| A/C system not cooling, needs R134a conversion | | | | | | |
| Labor Service - Recover R12 refrigerant. Drain & replace oil. Convert service ports. | | | 2.50 | | 170.00 | 425.00 |
| Evacuate system & recharge w/R134a refrigerant. Perform leak check: Schrader valves leaking, replaced w/ conversion. Monitor! A/C output temp 40 degrees F. AW | | | | | | |
| New | 55-9807-901 | R134a retrofit kit | | 1.00 | 19.38 | 19.38 |
| New | R134A | R134a refrigerant, lbs. | | 2.65 | 30.00 | 79.50 |
| New | OIL A/C | A/C PAG oil w/ dye (mL) | | 20.00 | 0.23 | 4.60 |
| Change wheel centers to turbine style | | | | | | |
| Labor Service - Swap wheel centers, install w/ Loctite. Note: some bolts stripped, use best bolts (different lengths but engage fully). LL | | | 1.00 | | 170.00 | 170.00 |
| Oil & filter change | | | | | | |
| Labor Service - Drain & replace engine oil, remove & replace oil filter. LL | | | 0.25 | | 170.00 | 42.50 |
| New | 20W50 VALVOLINE | Oil Valvoline, liters | | 6.00 | 6.95 | 41.70 |
| New | 11-42-9-063-138 | Oil filter kit M30 | | 1.00 | 17.47 | 17.47 |
| Labor Service - Check & adjust tire pressures. | | | | | | 0.00 |
| Front 33psi | | | | | | |
| Rear 38psi LL | | | | | | |
| Trunk/tailgate shocks weak | | | | | | |
| Labor Service - Remove & replace trunk shocks. AW | | | 0.25 | | 170.00 | 42.50 |
| New | 51-24-8-110-327 | Trunk shock E34 | | 2.00 | 47.89 | 95.78 |
| Trunk roundel needs replacement | | | | | | |
| Labor Service - Remove & replace trunk roundel. LK | | | | 1.00 | 46.77 | 0.00 |
| New | 51-14-8-132-375 | Roundel | | | | 46.77 |

Revisions of Original Estimate - Original Estimate of Services and Parts \$610.86

| Rev# | Date and Time | Who Contacted | Method | Contact # | Cont. By | Revise By | Total |
|------|------------------|---------------|--------|-----------|----------|-----------|--------|
| 1 | 6/09/2021 3:12PM | | | | EI | 336.37 | 947.23 |

X _____
 Customer accepts revision to the invoice and agrees to pay revised amount.

Recommended Repairs and Services:

- Odometer illumination out and owner likes it that way
- Radio head unit needs repair (no LF audio output)
- Steering wheel noisy - slip ring \$370 or steering column bearing? 344.03

Add On Charges Breakdown

Haz. Materials 1.50
 FET 0.30



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 99390

Phil Robyn

1991 BMW M5

License # CR MOVIE

Inv Date: 6/08/2021 @ 3:02pm

Continued from previous page

| | | |
|--|---------------------|---|
| <p>X _____ Customer acknowledges receipt of merchandise and services.</p> | | <p>Invoice Summary</p> <p>Parts 305.20</p> <p>Labor 680.00</p> <p>Labor Discount -68.00</p> <p>Add On Charges 1.80</p> <p>Sub Total 919.00</p> <p>Sales Tax (DEF) 28.23</p> |
| | Discard old parts | Original Estimate: 610.86 |
| | Total 947.23 | |
| | | |
| | | |



Invoice No.
15449

Order Date 03/11/21 10:03 am
Paid: 03/12/21 03:10 pm

BAR #: ARD00257306
WWW.BMWREPAIRBERKELEY.COM
2396 SAN PABLO AVENUE
BERKELEY, CA 94702
Phone: 510-525-6000 FAX: 510-525-4590

| | |
|--|--|
| | 91 BMW M5 BLACK Mileage in:122650 out:122650 Lic: CR MOVIE/CA I6Cyl 3.5 Eng Vin: WBSHD9310MBK05515 09/90 Eq: Last in 1/11/2021 |
|--|--|

Quotes
1 03/11/21 10:06am 330.00
CHRIS in person.

| | |
|-------------------------------------|------------------------|
| VEHICLE ELECTRICAL DIAGNOSIS | Labor: \$330.00 |
|-------------------------------------|------------------------|

C/S CIG LIGHTER KEEPS BLOWING.
ALSO RECENTLY INSTALLED DEALER BATTERY IS NOT HOLDING CHARGE.
PLEASE INSPECT AND REPORT.

Could not duplicate battery draw concern. Hooked up amp clamp over negative cable. And hooked up DMM in line with battery and positive cable. By placing one probe on batter terminal and the other on battery post. Let vehicle sit with door latches closed and a piece of cardboard was used to push in contact switches to turn off dome lights. After 45 minutes checked on draw. Vehicle does not have an excessive draw. It's only pulling 39mA, max draw is 50mA. Both DMM and amp clamp showing same reading but on different scales.

Pulled up wiring diagram for cigar lighter circuit. Circuit is dedicated strictly to cigar lighter in front and in rear. Hooked up fuse saver tool into fuse socket for cigar lighter. Breaker on tool tripped right away. Checked front cigar lighter fo any debris that might be bridging contacts, none found. Checked rear cigar lighter, found what seems to be a piece of a charging cable inside cigar lighter, object is metal and was making contact with the negative and positive terminals inside and was reason for circuit being shorter. Removed object, reset breaker on fuse saver, breaker did not trip. Removed tool and installed 30 amp fuse. Checked front and rear cigar lighter ports for operation, both working now.

Status: Completed Tech: BEN

Job Subtotal: \$330.00

| | |
|------------------------------------|----------------------|
| BRAKE AND TIRE MEASUREMENTS | Labor: \$0.00 |
|------------------------------------|----------------------|

BRAKES: FRONT- 12 mm / REAR- 8 mm
PRESSURE: FRONT- 33 PSI / REAR- 38 PSI
TIRE TREAD: F/L- 6.8 mm, F/R- 6.4 mm, R/L- 5.7 mm, R/R- 5.7 mm

Status: Completed Tech: BEN

Job Subtotal: \$0.00

----->----->----->-----Continued on the next page----->----->----->----->



Invoice No.
15449

Page 2

Order Date 03/11/21 10:03 am
Paid: 03/12/21 03:10 pm

BAR #: ARD00257306
WWW.BMWREPAIRBERKELEY.COM
2396 SAN PABLO AVENUE
BERKELEY, CA 94702
Phone: 510-525-6000 FAX: 510-525-4590

| Payments to GERMAN AUTO SPORT | Cost Summary | |
|-------------------------------|--------------|----------|
| Status: Paid Work Order | Labor | 330.00 |
| | Parts | 0.00 |
| | Total | \$330.00 |
| Payments: \$330.00 | Payments | 330.00 |
| 1 03/12/21 330.00 Visa | Bal Due | 0.00 |

Thank you for choosing GERMAN AUTO SPORT

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or items left in vehicle in case of fire, accident or any other cause beyond your control.

SIGNATURE: _____



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 96810

1991 BMW M5

VIN: BK05515

Engine:

Trans: 5SPD MAN

License # CR MOVIE

Odom: 0

Color: Glanzschwarz

Mfg. Date: 09/90

Unit #

Inv Date: 9/15/2020 @ 2:48pm

Service Writer: Nino Guerra Gilmour

Status: Complete

Driver: Robyn, Phil

PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|--------------------------------|----------------------|--------------------|-----|------|--------|--------|
| Parts Only | | | | | | |
| Labor Service - Parts only: NG | | | | | | 0.00 |
| New | 61-21-2-353-810 | Battery BMW 90ah | | 1.00 | 195.00 | 195.00 |
| Core | 61-21-2-353-810 | Core Received | | 1.00 | 0.00 | 0.00 |

Recommended Repairs and Services:

- Odometer illumination out and owner likes it that way
- Radio head unit needs repair (no LF audio output)
- Steering wheel noisy - slip ring \$370 or steering column bearing?

344.03

Add On Charges Breakdown

Haz. Materials

1.00

| | | |
|--|------------------------|---------------|
| <p>X _____ Customer acknowledges receipt of merchandise and services.</p> | Invoice Summary | |
| | Parts | 195.00 |
| | Add On Charges | 1.00 |
| | Sub Total | 196.00 |
| | Sales Tax (DEF) | 18.04 |
| | Total | 214.04 |



1218 7TH STREET, BERKELEY, CA 94710
(510) 524-6000
TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____
Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____
I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 95383

1991 BMW M5

VIN: BK05515

Engine:

Trans: 5SPD MAN

License # CR MOVIE

Odom: 122295

Color: Glanzschwarz

Mfg. Date: 09/90

Unit #

Inv Date: 3/18/2020 @ 9:48am

Service Writer: Eric Ingraham

Status: Complete

Driver: Robyn, Phil

PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|--|----------------------|-----------------------------|------|------|--------|--------|
| Inspection II Service | | | | | | |
| Labor Service - Inspection II Service, includes all factory-recommended maintenance and additional items. NAI, SS | | | 4.50 | | 170.00 | 765.00 |
| New | 20W50 VALVOLINE | Oil Valvoline, liters | | 6.00 | 6.95 | 41.70 |
| New | MTL | Red Line MTL 75W80, quart | | 2.00 | 29.64 | 59.28 |
| New | LE1605 | Gear oil purple, pints | | 3.60 | 8.79 | 31.64 |
| New | 07-11-9-963-384 | Seal ring 24x29mm M gearbox | | 1.00 | 2.26 | 2.26 |
| New | 07-11-9-963-355 | Seal ring 22x27mm | | 2.00 | 0.79 | 1.58 |
| New | 11-42-9-063-138 | OX41D oil filter kit M30 | | 1.00 | 17.47 | 17.47 |
| New | 13-72-1-726-916 | LX408 air filter | | 1.00 | 29.76 | 29.76 |
| New | 13-32-1-270-038 | KL9 fuel filter | | 1.00 | 64.31 | 64.31 |
| New | 11-12-1-312-172 | Gasket VC S38 | | 1.00 | 63.79 | 63.79 |
| New | 11-12-1-312-173 | Gasket VC S14/S38 small | | 3.00 | 14.44 | 43.32 |
| New | 12-12-9-061-867 | Spark plug BMW S38B36 | | 6.00 | 19.69 | 118.14 |
| Labor Service - Check & adjust tire pressures. Front 38psi Rear 41psi NAI | | | | | | 0.00 |
| Brake fluid flush due 11/18, coolant flush 04/18 | | | | | | |
| Labor Service - Brake fluid flush. NAI | | | 0.60 | | 170.00 | 102.00 |
| New | 81-22-0-142-155 | Brake fluid, liters | | 1.00 | 16.40 | 16.40 |
| Labor Service - Drain, refill, bleed & pressure-test cooling system. NAI | | | 0.75 | | 170.00 | 127.50 |
| New | 82-14-1-467-704 | Antifreeze BMW, gallons | | 1.50 | 24.75 | 37.13 |
| New | H2O | Distilled water, gallon | | 1.50 | 2.00 | 3.00 |
| New | 07-11-9-963-200 | Seal ring 14mm al | | 1.00 | 0.54 | 0.54 |
| Oil leak from timing chain tensioner dampener, oil residue from VC seals | | | | | | |
| Labor Service - Remove & replace leaking timing chain dampener. Degrease including leak at right rear of motor. LK | | | 1.50 | | 170.00 | 255.00 |
| New | 11-31-1-308-309 | Diaphragm chain tensioner | | 1.00 | 156.99 | 156.99 |
| New | 07-11-9-963-355 | Seal ring 22x27mm | | 2.00 | 0.79 | 1.58 |
| New | 81-22-9-407-104 | Degreaser engine, gallons | | 0.25 | 72.50 | 18.13 |
| Idler arm worn | | | | | | |
| Labor Service - Remove & replace idler arm. KR | | | 1.25 | | 170.00 | 212.50 |
| New | 32-21-1-136-450 | Idler arm | | 1.00 | 103.08 | 103.08 |
| LF speaker problem | | | | | | |
| Labor Service - Confirm no AC voltage to either LF speaker. Check amplifier output: none. Check radio output: none from LF channel, head unit needs repair. LK | | | 1.00 | | 170.00 | 170.00 |
| Windshield washer system not working | | | | | | |
| Labor Service - Remove & replace broken T-fitting for washer system. Clean out washer tank, unclog pump. CK | | | 0.75 | | 170.00 | 127.50 |
| New | 61-66-1-355-939 | "T" washer system | | 1.00 | 6.12 | 6.12 |
| New | 82 | Washer fluid, liters | | 3.00 | 2.89 | 8.67 |
| Trunk interior lights inop | | | | | | |



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____
 Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.
 X _____ Date: _____
 I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 95383

1991 BMW M5

License # CR MOVIE

Inv Date: 3/18/2020 @ 9:48am

Labor Service - Check bulbs: good. Check output of trunk latch/switch: none. Remove & replace trunk latch. LK 1.00 170.00 170.00
 New 51-24-1-973-194 Trunk latch E34 1.00 184.61 184.61

Revisions of Original Estimate - Original Estimate of Services and Parts \$1,560.85

| Rev# | Date and Time | Who Contacted | Method | Contact # | Cont. By | Revise By | Total |
|------|-------------------|--|--------|-----------|----------|-----------|----------|
| 1 | 3/19/2020 12:38PM | | | | EI | 844.15 | 2,405.00 |
| | | Speaker, oil leak, idler arm, washer sys, trunk lights | | | | | |
| 2 | 3/23/2020 10:00AM | | | | EI | 443.98 | 2,848.98 |
| | | Final small small repairs | | | | | |

X _____
 Customer accepts revision to the invoice and agrees to pay revised amount.

Recommended Repairs and Services:

- Odometer illumination out and owner likes it that way
- Radio head unit needs repair (no LF audio output)
- Steering wheel noisy - slip ring \$370 or steering column bearing? 344.03

Add On Charges Breakdown

Haz. Materials 9.25
 FET 0.30

| | | | |
|--|--|------------------------|-----------------|
| <p>X _____ Customer acknowledges receipt of merchandise and services.</p> | | Invoice Summary | |
| | | Parts | 1,009.50 |
| | | Labor | 1,929.50 |
| | | Labor Discount | -192.95 |
| | | Add On Charges | 9.55 |
| | | Sub Total | 2,755.60 |
| | | Sales Tax (DEF) | 93.38 |
| | | Total | 2,848.98 |

BAVARIAN PROFESSIONALS

MAJOR SERVICE CHECKLIST *Late*
 Technician's Signature W. V.

Customer Reynold
 Date 3/18/20 License # CRMOVIE
 Mileage 122295 R/O

- ✓ DRAIN ENGINE OIL
- ✓ REPLACE OIL FILTER
- ✓ REPLACE TRANSMISSION OIL
- Leakage: none slight substantial
- ✓ REPLACE DIFFERENTIAL OIL
- Leakage: none slight substantial
- ✓ FRONT BRAKES
- Pads: good % worn unsafe
- Rotors: good lip bad
- ✓ REAR BRAKES
- Pads: good % worn unsafe
- Rotors: good lip bad
- ✓ DRIVE BELTS: good cracked
- Adjust tension if necessary
- ALTERNATOR BUSHINGS: good some play bad
- ✓ WATER PUMP: good past leakage leaking
- ✓ THERMOSTAT HOUSING: good past leakage leaking
- ✓ BALL JOINTS
- Left: good tor boot worn unsafe *slightly*
- Right: good tor boot worn unsafe
- ✓ IDLER ARM: good worn unsafe *Some play*
- ✓ TIE RODS
- Left: good worn unsafe *slightly*
- Center: good worn unsafe
- Right: good worn unsafe
- ✓ CONTROL ARM BUSHINGS: good torn unsafe
- ✓ BRAKE MASTER: leaking
- ✓ CLUTCH SLAVE: leaking
- ✓ TRANSMISSION MOUNTS: good bad
- SHIFT TOWER MOUNTS: good bad
- ✓ SHIFTER LINKAGE: good worn
- ✓ FLEX DISC: good slightly cracked bad
- ✓ HALF SHAFT JOINTS: good stiff torn boot
- ✓ EXHAUST SYSTEM
- Catalytic converter: good loose element leaking
- Trans/exhaust bracket: good bad
- Heat shielding: good loose broken
- Rear muffler: good loose baffle leaking
- Muffler hangers: good cracked
- ✓ REPLACE FUEL FILTER

- ✓ PRESSURE TEST COOLING SYSTEM
- Radiator hoses/clamps: good marginal unsafe
- Radiator: good leaks cold major leakage
- ✓ COOLANT LEVEL/CONDITION: good low weak old
- last flush:

- ✓ ADD ENGINE OIL
- ✓ COMPRESSION TEST
- 1) 210 2) 205 3) 205 4) 205 5) 210 6) 215
- ✓ ADJUST VALVES
- ✓ TIMING CHAIN/BELT: good worn unsafe
- Small 6cyl.* Replace rocker plugs
- ✓ CAMSHAFT: good grooved pitted
- ✓ ROCKERS: good loose
- ✓ REPLACE VALVE COVER GASKET
- ✓ DISTRIBUTOR CAP: good bad
- ROTOR: good bad
- Motronic:* Recommend inspection
- ✓ GAP & INSTALL SPARK PLUGS

- ✓ REFILL WASHER RESERVOIR qty: 2
- ✓ WASHER SYSTEM: good inop clogged jets *broken pipe*
- ✓ WIPERS: good streaky bad *worn*
- ✓ SHOCK ABSORBERS
- Front: good soft bad
- Rear: good soft bad *Fixing*
- ✓ CHECK/ADJUST PARKING BRAKE
- ✓ CLUTCH MASTER: good leakage
- ✓ LIGHTS
- ✓ HEATER BLOWER: good inop.
- ✓ A/C: good weak inop. 44 degF *LF speaker not work*
- INTERIOR:
- interior lights ✓ stereo ✓ dash illumination ✓ temp control ✓ central locking ✓ seat belts
- ✓ LUBE DOOR, HOOD, AND TRUNK HINGES & SEALS
- ✓ RESET SERVICE INDICATOR

| SET TIRE PRESSURES | CONDITION |
|--|-----------|
| RF: <u>35</u> psi leak good <u>30</u> % worn out | |
| LF: <u>35</u> psi leak good <u>30</u> % worn out | |
| RR: <u>35</u> psi leak good <u>30</u> % worn out | |
| LR: <u>35</u> psi leak good <u>30</u> % worn out | |
| Spare: <u>41</u> psi leak <u>good</u> % worn out | |

- ✓ LOAD TEST BATTERY: pass marginal fail
- ✓ BATTERY VOLTAGE @ IDLE: 19 v
- ✓ CHARGING SYSTEM OUTPUT: 152 amps under max load
- ADJUST ICV CURRENT: _____ mA
- ✓ CHECK O2 SENSOR FUNCTION
- SET AIRFLOW METER: _____ v

- ✓ BRAKE FLUID LEVEL/CONDITION: good low dirty
- last flush:
- ✓ BATTERY ELECTROLYTE LEVEL: good low sealed
- Clean terminals if necessary
- ✓ FUSES: good corroded
- ✓ POWER STEERING FLUID LEVEL: good low
- ✓ REPLACE AIR FILTER
- ✓ CLEAN THROTTLE BODY

✓ STICKER
 STAMP BOOKLET *not found*
Lower ball joints - torn boots
RF and RR engine leaking oil
upper and lower trunk lights out

| inner | center | outer |
|-------|--------|-------|
| 3.10 | 6.47 | 3.39 |
| 3.14 | 6.62 | 2.50 |
| 2.65 | 5.47 | 3.80 |
| 7.20 | 0.00 | 2.00 |

Valve clearance worksheet

INTAKE

| | | | | | | | | | | | | | | | | | | | |
|----------------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|-------|---|--|--|--|
| new clearance | | | | | | | | | | | | | | | | | | | |
| shim installed | | | | | | | | | | | | | | | | | | | |
| shim removed | | | | | | | | | | | | | | | | | | | |
| clearance | 0.012 | 0.013 | 0.012 | 0.012 | 0.012 | 0.012 | 0.012 | 0.012 | 0.011 | 0.013 | 0.013 | 0.011 | 0.012 | 0.012 | 0.011 | | | | |
| | 6 | | 5 | | | | | 4 | | | | 3 | | 2 | | 1 | | | |
| clearance | 0.012 | 0.011 | 0.012 | 0.012 | 0.012 | 0.011 | 0.012 | 0.012 | 0.011 | 0.012 | 0.012 | 0.011 | 0.012 | 0.012 | | | | | |
| shim removed | | | | | | | | | | | | | | | | | | | |
| shim installed | | | | | | | | | | | | | | | | | | | |
| new clearance | | | | | | | | | | | | | | | | | | | |

EXHAUST

| Specifications | (Euro) | inches | mm | Shims removed | Shims installed | Summary |
|----------------|-----------------|---|----------------------------|---------------|-----------------|----------------|
| M88/3 | (E30 M3) | 0.012 - 0.014 | 0.30 - 0.35 | | | clearance |
| S14 | (E30 M3) | 0.010 - 0.014 | 0.26 - 0.35 | | | shim removed |
| S38 B35 | (US M6, E28 M5) | 0.012 - 0.014 | 0.30 - 0.35 | | | shim installed |
| S38 B36 | (E34 M5) | 0.011 - 0.013 | 0.28 - 0.33 | | | clearance |
| S38 B38 | (Euro E34 M5) | 0.011 - 0.013 | 0.28 - 0.33 | | | clearance |
| S54 | (E46 M3) | intake 0.007 - 0.009 exhaust 0.011 - 0.013 | 0.18 - 0.23 0.28 - 0.33 | | | clearance |



1218 7TH STREET, BERKELEY, CA 94710
(510) 524-6000
TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 87011

1991 BMW M5
VIN: BK05515
Engine:
Trans: 5SPD MAN

License # CR MOVIE
Odom: 121946
Color: Glanzschwarz
Mfg. Date: 09/90

Unit #

Inv Date: 12/26/2017 @ 4:20pm
Service Writer: Nat Sears
Status: Complete
Driver:
PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | | Ext |
|---|----------------------|--|------|------|--------|--|--------|
| Car has been sitting for 1 year. Battery has been on charger. Stalled once on the way over. | | | | | | | |
| Labor Service - Safety inspection, including undercar inspection and check of fluid levels, tire pressures and lights. LL | | | 0.50 | | 160.00 | | 80.00 |
| Labor Service - Check & adjust tire pressures. Front 33psi Rear 38psi LL | | | | | | | 0.00 |
| Labor Service - Procure & enter radio code. LK | | | | | | | 0.00 |
| Oil & filter change | | | | | | | |
| Labor Service - Remove and replace engine oil, oil filter, & seal at drain plug. LL | | | 0.25 | | 160.00 | | 40.00 |
| | New | 20W50 VALVOLINE Oil Valvoline, liters | | 6.00 | 6.95 | | 41.70 |
| | New | 11-42-9-063-138 OX41D oil filter kit M30 | | 1.00 | 15.83 | | 15.83 |
| Quote for broken headlight lens | | | | | | | |
| Labor Service - Remove & install grilles, remove & replace L lowbeam headlight unit. LK | | | 1.00 | | 160.00 | | 160.00 |
| | New | 63-12-8-350-135 Headlight E32/34 L lowbeam | | 1.00 | 137.94 | | 137.94 |
| | New | 63-12-1-468-208 Clip headlight white | | 3.00 | 4.30 | | 12.90 |
| | New | 51-13-1-885-399 Rivet grille | | 1.00 | 0.39 | | 0.39 |

Revisions of Original Estimate - Original Estimate of Services and Parts \$144.00

| Rev# | Date and Time | Who Contacted | Method | Contact # | Cont. By | Revise By | Total |
|------|--------------------|---------------|--------|-----------|----------|-----------|--------|
| 1 | 12/27/2017 10:47AM | | | | NS | 325.00 | 469.00 |
| | | L lowbeam | | | | | |

X _____
Customer accepts revision to the invoice and agrees to pay revised amount.

Recommended Repairs and Services:

- Odometer illumination out and owner likes it that way
- Steering wheel noisy - slip ring \$370 or steering column bearing? 344.03
- Brake fluid flush due 11/18, coolant flush 04/18

Add On Charges Breakdown

Haz. Materials 1.50
FET 0.30



1218 7TH STREET, BERKELEY, CA 94710
(510) 524-6000
TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 87011

1991 BMW M5

License # CR MOVIE

Inv Date: 12/26/2017 @ 4:20pm

Continued from previous page

| | | |
|---|--------------------------|---|
| <p>X _____ Customer acknowledges receipt of merchandise and services.</p> | | <p>Invoice Summary</p> <p>Parts 208.76</p> <p>Labor 280.00</p> <p>Labor Discount -28.00</p> <p>Add On Charges 1.80</p> |
| | | <p>Sub Total 462.56</p> <p>Sales Tax (DEF) 19.31</p> <p><i>WJA</i></p> <p>Total 481.87</p> |
| <p>Page 2 of 2</p> | <p>Discard old parts</p> | <p>Original Estimate: 144.00</p> |



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____
 Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.
 X _____ Date: _____
 I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 82812

1991 BMW M5

License # CR MOVIE

Inv Date: 11/29/2016 @ 8:42am

VIN: BK05515

Odom: 121922

Service Writer: Marta Horevajova

Engine:

Color: Glanzschwarz

Status: Complete

Trans: 5SPD MAN

Mfg. Date: 09/90

Driver:

Unit #

PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|--|--|--------------------|------|------|--------|--------|
| Oil & filter change | | | | | | |
| | Labor Service - Remove and replace engine oil, oil filter, & seal at drain plug. CK | | 0.25 | | 160.00 | 40.00 |
| | New 20W50 VALVOLINE Oil Valvoline, liters | | | 6.00 | 6.95 | 41.70 |
| | New 11-42-9-063-138 OX41D oil filter kit M30 | | | 1.00 | 15.31 | 15.31 |
| Brake fluid flush | | | | | | |
| | Labor Service - Brake fluid flush. CK | | 0.60 | | 160.00 | 96.00 |
| | New 81-22-9-407-512 Brake fluid, liters | | | 1.00 | 16.40 | 16.40 |
| LF door brake needs replacement? Door creaks when opening | | | | | | |
| | Labor Service - Check LF door operation, tighten loose door brake bolts & recheck: OK. CK | | | | | 0.00 |
| Safety Inspection needed | | | | | | |
| | Labor Service - Safety inspection, including undercar inspection and check of fluid levels, tire pressures and lights. * valve cover gasket leaking oil, dripping on exhaust * boots torn on front ball joints & tie rods CK | | 0.50 | | 160.00 | 80.00 |
| | Labor Service - Check & adjust tire pressures. Front 33psi Rear 38psi CK | | | | | 0.00 |
| Delivery charge | | | | | | |
| | Labor Service - Delivery Fee JS | | 1.00 | | 60.00 | 60.00 |
| VC gasket leaking | | | | | | |
| | Labor Service - Remove & install valve cover, replace valve cover gaskets. Clean up residue from leakage. SS | | 1.50 | | 160.00 | 240.00 |
| | New 11-12-1-312-172 Gasket VC S38 | | | 1.00 | 55.50 | 55.50 |
| | New 11-12-1-312-173 Gasket VC S14/S38 small | | | 3.00 | 12.69 | 38.07 |

Revisions of Original Estimate - Original Estimate of Services and Parts \$404.33

| Rev# | Date and Time | Who Contacted | Method | Contact # | Cont. By | Revise By | Total |
|------|-------------------|---------------|--------|-----------|----------|-----------|--------|
| 1 | 11/29/2016 2:36PM | | | | NS | 246.46 | 650.79 |
| | VC gaskets | | | | | | |

X _____
 Customer accepts revision to the invoice and agrees to pay revised amount.

Recommended Repairs and Services:

- Odometer illumination out and owner likes it that way
- Lowbeam headlights cracked \$371 345.70
- Steering wheel noisy - slip ring \$370 or steering column bearing? 344.03

Add On Charges Breakdown

Haz. Materials 3.25
 FET 0.30



1218 7TH STREET, BERKELEY, CA 94710
(510) 524-6000
TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 82812

1991 BMW M5

License # CR MOVIE

Inv Date: 11/29/2016 @ 8:42am

Continued from previous page

Invoice Summary

| | |
|----------------|--------|
| Parts | 166.98 |
| Labor | 516.00 |
| Labor Discount | -51.60 |
| Add On Charges | 3.55 |

Paid USA

Customer acknowledges receipt of merchandise and services.

| | |
|-----------------|--------|
| Sub Total | 634.93 |
| Sales Tax (DEF) | 15.86 |



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Invoice # 72253

1991 BMW M5
 VIN: BK05515
 Engine:
 Trans: 5SPD MAN

License # CR MOVIE
 Odom: 120161
 Color: Glanzschwarz
 Mfg. Date: 09/90
 Unit #

Inv Date: 4/29/2014
 Service Writer: Marta Horevajova
 Status: Complete
 Driver:
 PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|-----------------------------------|--|--------------------|------|------|--------|--------|
| Oil & filter change | | | | | | |
| | Labor Service - Remove and replace engine oil, oil filter, & seal at drain plug. LL | | 0.25 | | 140.00 | 35.00 |
| | New 20W-50 VALVOLINE Oil Valvoline, liters | | | 6.00 | 6.95 | 41.70 |
| | New 11-42-9-063-138 OX41D oil filter kit M30 | | | 1.00 | 13.96 | 13.96 |
| | Labor Service - Check & adjust tire pressures. | | | | | 0.00 |
| | Front 33psi | | | | | |
| | Rear 38psi LL | | | | | |
| Brake fluid flush due 5/13 | | | | | | |
| | Labor Service - Brake fluid flush LL | | 0.60 | | 140.00 | 84.00 |
| | New 81-22-9-407-512 Brake fluid, liters | | | 1.00 | 16.40 | 16.40 |
| Coolant flush due 5/14 | | | | | | |
| | Labor Service - Coolant flush, includes replacement of all coolant, pressure testing and bleeding system. LL | | 0.75 | | 140.00 | 105.00 |
| | New 82-14-1-467-704 Antifreeze BMW, gallons | | | 1.50 | 24.98 | 37.47 |
| | New H2O Distilled water | | | 1.50 | 2.00 | 3.00 |
| | New 07-11-9-963-200 Seal ring 14mm al | | | 1.00 | 0.37 | 0.37 |

Recommended Repairs and Services:

- Odometer illumination out and owner likes it that way 345.70
- Lowbeam headlights cracked \$371 344.03
- Steering wheel noisy - slip ring \$370 or steering column bearing?

Add On Charges Breakdown

Haz. Materials 9.25
 FET 0.30

B01 444-6006

Invoice Summary

Parts 112.90
 Labor 224.00
 Labor Discount -22.40
 Add On Charges 9.55

X _____
 Customer acknowledges receipt of merchandise and services

Sub Total 324.05
 Sales Tax (DEF) 10.16

Discard old parts

Original Estimate:

Total 334.21

**BERKELEYS WRIGHT'S AUTOMOTIVE
SERVICE IN**

1425 SAN PABLO AVENUE, BERKELEY, CA 94702
Phone: (510) 841-2740
FAX: (510) 841-7979

Workfile ID: 586de104
Federal ID: 94-3188160
State EPA: CAL000298701
BAR: ARD00176169

Preliminary Estimate

Customer:

Job Number:

Written By: Ryan Chu

Insured:
Type of Loss:
Point of Impact: 06 Rear

Policy #:
Date of Loss:

Claim #: SELFPAY
Days to Repair: 1

Owner:

Inspection Location:
BERKELEYS WRIGHT'S AUTOMOTIVE
SERVICE IN
1425 SAN PABLO AVENUE
BERKELEY, CA 94702
Repair Facility
(510) 841-2740 Business

Insurance Company:
SELF PAY

VEHICLE

| | | | |
|-------------------|--------------------|------------------------|--------------|
| Year: 1991 | Body Style: 4D SED | VIN: WBSHD9310MBK05515 | Mileage In: |
| Make: BMW | Engine: 6-3.6L-FI | License: CRM0VIE | Mileage Out: |
| Model: M5 | Production Date: | State: CA | Vehicle Out: |
| Color: BLACK Int: | Condition: | Job #: | |

TRANSMISSION

Overdrive
5 Speed Transmission

POWER

Power Steering
Power Brakes
Power Windows
Power Locks
Power Mirrors
Heated Mirrors
Power Driver Seat
Power Passenger Seat

DECOR

Dual Mirrors
Tinted Glass
Console/Storage
CONVENIENCE
Air Conditioning
Intermittent Wipers
Tilt Wheel
Cruise Control
Rear Defogger
Telescopic Wheel

RADIO

AM Radio
FM Radio

Stereo
Search/Seek
Cassette
Premium Radio
SAFETY
Drivers Side Air Bag
Anti-Lock Brakes (4)
4 Wheel Disc Brakes
Positraction
ROOF
Electric Steel Sunroof
SEATS
Bucket Seats

Reclining/Lounge Seats
Leather Seats
WHEELS
Aluminum/Alloy Wheels
PAINT
Clear Coat Paint
Metallic Paint
OTHER
Fog Lamps
Rear Spoiler

Preliminary Estimate

Customer:

Job Number:

Vehicle: 1991 BMW M5 4D SED 6-3.6L-FI BLACK

| Line | Oper | Description | Part Number | Qty | Extended Price \$ | Labor | Paint |
|------------------|------|--|-------------|-----|-------------------|------------|------------|
| 1 | | TRUNK LID | | | | | |
| 2 | * | Rpr Lid | | | | 1.0 | 2.5 |
| 3 | | Add for Clear Coat | | | | | 1.0 |
| 4 | # | DEDUCT FOR SPOT PAINT WITH FULL CLEAR COAT | | 1 | | | -1.0 |
| 5 | R&I | Emblem BMW | | | | 0.3 | |
| 6 | R&I | Nameplate M5 | | | | 0.3 | |
| 7 | | MISCELLANEOUS OPERATIONS | | | | | |
| 8 | # | COVER CAR | | 1 | 5.00 X | 0.2 | |
| 9 | # | TINT COLOR | | 1 | X | 0.5 | |
| 10 | # | HAZARDOUS WASTE REMOVAL | | 1 | 5.00 X | | |
| SUBTOTALS | | | | | 10.00 | 2.3 | 2.5 |

ESTIMATE TOTALS

| Category | Basis | Rate | Cost \$ |
|--------------------|------------|--------------|---------------|
| Parts | | | 0.00 |
| Body Labor | 2.3 hrs @ | \$ 75.00 /hr | 172.50 |
| Paint Labor | 2.5 hrs @ | \$ 75.00 /hr | 187.50 |
| Paint Supplies | 2.5 hrs @ | \$ 35.00 /hr | 87.50 |
| Miscellaneous | | | 10.00 |
| Subtotal | | | 457.50 |
| Sales Tax | \$ 87.50 @ | 9.0000 % | 7.88 |
| Grand Total | | | 465.38 |



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

Repair Order # 64792

1991 BMW M5

VIN: BK05515

Engine:

Trans: 5SPD MAN

License # CR MOVIE

Odom: 0

Color: Glanzschwarz

Mfg. Date: 09/90

Unit #

Inv Date: 7/03/2012

Service Writer: Marta Horevajova

Status: Will Return

Driver:

PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|---|--|--------------------|------|------|--------|--------|
| Check tire pressures. Adjust to recommended pressures. | | | | | | |
| Noise from steering | | | | | | |
| | Labor Service - Check & advise | | 1.00 | | 130.00 | 130.00 |
| Oil & filter change | | | | | | |
| | Labor Service - Remove and replace engine oil, oil filter, & seal at drain plug. | | 0.25 | | 130.00 | 32.50 |
| | New 20W-50 VALVOLINE Oil Valvoline, liters | | | 6.00 | 6.95 | 41.70 |
| | New 11-42-9-063-138 OX41D oil filter kit M30 | | | 1.00 | 13.68 | 13.68 |

Recommended Repairs and Services:

- Odometer illumination out and owner likes it that way
- Steering wheel noisy - slip ring \$370 or steering column bearing?

344.03

Estimate only, do not pay.

Repair Order Summary:

| | |
|----------------|--------|
| Parts | 55.38 |
| Labor | 162.50 |
| Labor Discount | -16.25 |
| Haz. Materials | 1.50 |
| FET | 0.30 |

| | |
|-----------------|--------|
| Sub Total | 203.43 |
| Sales Tax (DEF) | 4.85 |

Total 208.28

X _____
 Customer acknowledges receipt of merchandise and services.

Berkeley Wright's Automotive Service, Inc.
1425 San Pablo Ave, Berkeley, CA 94702
(510) 841-2740

LIMITED LIFETIME WARRANTY
(Non-transferable)

FOR AS LONG AS YOU OWN YOUR VEHICLE

The repairs covered by this warranty are only those which relate to the covered loss which occurred on or about 7-21-11 and for which you were subsequently paid under

Claim Number SELF PAY

If, for any reason, you are not satisfied with the quality of workmanship provided by the above named repair facility, contact your claim representative.

TERM AND EXCLUSIONS
(This is a limited warranty)

1. This Limited Warranty is not transferable.
2. This Limited Lifetime Warranty does not cover repairs and / or damage which does not relate to the above-referenced covered loss.
3. This Limited Lifetime Warranty also does not cover normal wear and tear, nor damage caused by improper maintained or unreasonable use.
4. If the workmanship or materials supplied by Berkeley Wright's Automotive Service Inc., are defective or fail while you own your vehicle, than Berkeley Wright's Automotive Service Inc., at its sole-option, will repair, replace the defective work materials, or have the repair work performed again, or will pay you the cost of the same.
5. The warranty for salvage mechanical assemblies (i e. engines, transmissions etc.) identified on our appraisal, and installed as a result of the above-captioned loss is limited to 6 months from the repair date.
6. Berkeley Wright's Automotive Service Inc., must be afforded the first opportunity to correct any and all deficiencies.
7. This Limited Lifetime Warranty will remain in effect for as long as you own your vehicle.
8. This is the sole and complete liability of Berkeley Wright's Automotive Service Inc., hereunder.

BERKELEYS WRIGHT'S AUTOMOTIVE SERVICE IN
License #:BAR AA176169 Federal ID #:943188160
Federal EPA# CAL000298701
1425 SAN PABLO AVENUE
BERKELEY, CA 94702-1023
(510)841-2740 Fax: (510)841-7979

ESTIMATE OF RECORD

Written By: GEORGE MELENDEZ 07/27/2011 12:33 PM
Adjuster:

Insured: Claim #SELF PAY
Owner: Policy #
Address: Deductible:
Date of Loss:
Type of Loss:
Evening: Point of Impact: 6. Rear
Cellular:

Inspect BERKELEYS WRIGHT'S AUTOMOTIVE SE **Business:** (510)841-2740
Location: 1425 SAN PABLO AVENUE
BERKELEY, CA 94702-1023

Insurance SELF PAY
Company: 6 Days to Repair

1991 BMW M5 6-3.6L-FI 4D SED BLACK Int:
VIN: WBSHD9310MBK05515 **Lic:** CR MOVIE CA **Prod Date:** **Odometer:** 117612
Air Conditioning Rear Defogger Tilt Wheel
Cruise Control Telescopic Wheel Intermittent Wipers
On Board Computer Tinted Glass Dual Mirrors
Console/Storage Electric Steel Sunroof Fog Lamps
Rear Spoiler Clear Coat Paint Metallic Paint
Power Steering Power Brakes Power Windows
Power Locks Power Driver Seat Power Passenger Seat
Power Antenna Power Mirrors Heated Mirrors
AM Radio FM Radio Stereo
Cassette Search/Seek Premium Radio
Anti-Lock Brakes (4) Driver Air Bag 4 Wheel Disc Brakes
Positraction Leather Seats Bucket Seats
Recline/Lounge Seats 5 Speed Transmission Overdrive
Aluminum/Alloy Wheels

| NO. | OP. | DESCRIPTION | QTY | EXT. | PRICE | LABOR | PAINT |
|-----|------|---------------------------------|-----|------|-------|-------|-------|
| 1 | | HOOD | | | | | |
| 2* | Refn | Hood w/o 530i, 540i wide grille | | | | | 2.8 |
| 3* | | Add for Clear Coat | | | | | 1.5 |
| 4 | R&I | Nameplate BMW | | | 0.3 | | |
| 5 | | TRUNK LID | | | | | |
| 6* | Rpr | Lid | | | 0.3 | | 2.5 |
| 7 | | Overlap Major Adj. Panel | | | | | -0.4 |

ESTIMATE OF RECORD
1991 BMW M5 6-3.6L-FI 4D SED BLACK Int:

| NO. | OP. | DESCRIPTION | QTY | EXT. | PRICE | LABOR | PAINT |
|---------------|------|---------------------------------|-----|------|-------|-------|-------|
| 8 | | Add for Clear Coat | | | | | |
| 9# | | PARTIAL PAINT | | | | | 0.4 |
| 10 | R&I | Nameplate M5 | 1 | | | | -1.0 |
| 11 | R&I | Emblem BMW | | | | 0.3 | |
| 12 | | REAR LAMPS | | | | 0.3 | |
| 13 | R&I | RT Tail lamp assy | | | | 0.5 | |
| 14 | R&I | LT Tail lamp assy | | | | 0.5 | |
| 15# | | COVER CAR | 1 | | 5.00 | X | 0.2 |
| 16# | | TINT COLOR | 1 | | | X | 0.5 |
| 17# | Subl | HAZARDOUS WASTE REMOVAL | 1 | | 5.00 | X | |
| 18 | R&I | LT Tail lamp assy | | | | 0.5 | |
| 19 | | COWL & WINDSHIELD | | | | | |
| 20 | R&I | Nozzle heated | | | | 0.3 | |
| 21 | R&I | Nozzle heated | | | | 0.3 | |
| 22 | | ROOF | | | | | |
| 23 | Refn | Roof panel w/sunroof | | | | | 4.8 |
| 24 | | Overlap Major Adj. Panel | | | | | -0.4 |
| 25* | | Add for Clear Coat | | | | | 0.9 |
| 26 | Refn | Slide panel from 11/89 | | | | | 1.5 |
| 27 | | Overlap Major Adj. Panel | | | | | -0.4 |
| 28* | | Add for Clear Coat | | | | | 0.2 |
| 29 | R&I | RT Molding front black | | | | 0.5 | |
| 30 | R&I | LT Molding front black | | | | 0.5 | |
| 31* | Repl | Weatherstrip | 1 | | 72.39 | | 1.0 |
| 32 | | CENTER PILLAR & ROCKER PANEL | | | | | |
| 33 | R&I | RT Molding M5 | | | | 0.5 | |
| 34* | Rpr | RT Molding M5 | | | | 0.3 | 1.0 |
| 35* | | Add for Clear Coat | | | | | 0.2 |
| 36 | | QUARTER PANEL | | | | | |
| 37* | Refn | LT Outer panel | | | | | 2.0 |
| 38 | | Overlap Major Adj. Panel | | | | | -0.4 |
| 39* | | Add for Clear Coat | | | | | 0.3 |
| Subtotals ==> | | | | | 82.39 | 6.8 | 15.5 |

| | | |
|--------------|------------------------|---------|
| Parts | | 72.39 |
| Body Labor | 6.8 hrs @ \$ 75.00/hr | 510.00 |
| Paint Labor | 15.5 hrs @ \$ 75.00/hr | 1162.50 |
| Paint | 15.5 hrs @ \$ 32.00/hr | 496.00 |
| Sublet/Misc. | | 10.00 |

| | | |
|--------------------|---------------------|-------------------|
| SUBTOTAL | | \$ 2250.89 |
| Sales Tax | \$ 568.39 @ 8.7500% | 49.73 |
| GRAND TOTAL | | \$ 2300.62 |

07/27/2011 at 12:35 PM
20215

Job Number: 19850

ESTIMATE OF RECORD

1991 BMW M5 6-3.6L-FI 4D SED BLACK Int:

ADJUSTMENTS:

| | |
|---------------|------------|
| Deductible | 0.00 |
| ----- | |
| CUSTOMER PAY | \$ 0.00 |
| INSURANCE PAY | \$ 2300.62 |

FOR YOUR PROTECTION CALIFORNIA LAW REQUIRES THE FOLLOWING TO APPEAR ON THIS FORM:

ANY PERSON WHO KNOWINGLY PRESENTS FALSE OR FRAUDULENT CLAIM FOR THE PAYMENT OF A LOSS IS GUILTY OF A CRIME AND MAY BE SUBJECT TO FINES AND CONFINEMENT IN STATE PRISON.

ESTIMATE OF RECORD

1991 BMW M5 6-3.6L-FI 4D SED BLACK Int:

Estimate based on MOTOR CRASH ESTIMATING GUIDE. Unless otherwise noted all items are derived from the Guide EEE1910, CCC Data Date 06/01/2011, and the parts selected are OEM-parts manufactured by the vehicles Original Equipment Manufacturer. OEM parts are available at OE/Vehicle dealerships. OPT OEM (Optional OEM) or ALT OEM (Alternative OEM) parts are OEM parts that may be provided by or through alternate sources other than the OEM vehicle dealerships. OPT OEM or ALT OEM parts may reflect some specific, special, or unique pricing or discount. OPT OEM or ALT OEM parts may include "Blemished" parts provided by OEM's through OEM vehicle dealerships. Asterisk (*) or Double Asterisk (**) indicates that the parts and/or labor information provided by MOTOR may have been modified or may have come from an alternate data source. Tilde sign (~) items indicate MOTOR Not-Included Labor operations. Non-Original Equipment Manufacturer aftermarket parts are described as AM, Qual Repl Parts or Comp Repl Parts which stands for Competitive Replacement Parts. Used parts are described as LKQ, Qual Recy Parts, RCY, or USED. Reconditioned parts are described as Recond. Recored parts are described as Recore. NAGS Part Numbers and Benchmark Prices are provided by National Auto Glass Specifications. Labor operation times listed on the line with the NAGS information are MOTOR suggested labor operation times. NAGS labor operation times are not included. Pound sign (#) items indicate manual entries. Some 2010 vehicles contain minor changes from the previous year. For those vehicles, prior to receiving updated data from the vehicle manufacturer, labor and parts data from the previous year may be used. The CCC ONE estimator has a complete list of applicable vehicles. Parts numbers and prices should be confirmed with the local dealership.

THE FOLLOWING IS A LIST OF ABBREVIATIONS OR SYMBOLS THAT MAY BE USED TO DESCRIBE WORK TO BE DONE OR PARTS TO BE REPAIRED OR REPLACED: MOTOR ABBREVIATIONS/SYMBOLS: D=DISCONTINUED PART A=APPROXIMATE PRICE LABOR TYPES: B=BODY LABOR D=DIAGNOSTIC E=ELECTRICAL F=FRAME G=GLASS M=MECHANICAL P=PAINT LABOR S=STRUCTURAL T=TAXED MISCELLANEOUS X=NON TAXED MISCELLANEOUS PATHWAYS: ADJ=ADJACENT ALGN=ALIGN A/M=AFTERMARKET BLND=BLEND CAPA=CERTIFIED AUTOMOTIVE PARTS ASSOCIATION NSF=NSF INTERNATIONAL CERTIFIED PART D&R=DISCONNECT AND RECONNECT EST=ESTIMATE EXT. PRICE=UNIT PRICE MULTIPLIED BY THE QUANTITY INCL=INCLUDED MISC=MISCELLANEOUS NAGS=NATIONAL AUTO GLASS SPECIFICATIONS NON-ADJ=NON ADJACENT O/H=OVERHAUL OP=OPERATION NO=LINE NUMBER QTY=QUANTITY QUAL RECY=QUALITY RECYCLED PART QUAL REPL=QUALITY REPLACEMENT PART COMP REPL PARTS=COMPETITIVE REPLACEMENT PARTS RECOND=RECONDITION REFN=REFINISH REPL=REPLACE R&I=REMOVE AND INSTALL R&R=REMOVE AND REPLACE RPR=REPAIR RT=RIGHT SECT=SECTION SUBL=SUBLET LT=LEFT W/O=WITHOUT W/_=WITH/_SYMBOLS: #=MANUAL LINE ENTRY *=OTHER [IE..MOTORS DATABASE INFORMATION WAS CHANGED] **=DATABASE LINE WITH AFTERMARKET N=NOTES ATTACHED TO LINE. OPT OEM=ORIGINAL EQUIPMENT MANUFACTURER PARTS EITHER OPTIONALLY SOURCED OR OTHERWISE PROVIDED WITH SOME UNIQUE PRICING OR DISCOUNT. NWCPP=NATIONWIDE CRASH PARTS PROGRAM.

CCC Pathways - A product of CCC Information Services Inc.

ESTIMATE OF RECORD

1991 BMW M5 6-3.6L-FI 4D SED BLACK Int:

ALTERNATE PARTS USAGE

AFTERMARKET PARTS

Aftermarket Selection Method: Automatically List

No. of times user was notified that an Aftermarket part was available: 0

No. of Aftermarket parts that appear in the final estimate: 0

OPTIONAL OEM PARTS

Optional OEM Selection Method: Manually List

No. of times user was notified that an Optional OEM part was available: 0

No. of Optional OEM parts that appear in the final estimate: 0

RECONDITIONED PARTS

Reconditioned Selection Method: Manually List

No. of times user was notified that a Reconditioned part was available: 0

No. of Reconditioned parts that appear in the final estimate: 0

RECYCLED PARTS

No. of times user was notified that a Recycled part was available: 1

No. of Recycled parts that appear in the final estimate: 0



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____
 Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.
 X _____ Date: _____
 I have read and agree to the Loaner Car Agreement as set forth on the reverse.

1991 BMW M5

VIN: BK05515
 Engine:
 Transmission: 5SPD MAN

License # CR MOVIE

Mileage: 117316
 Color: Glanzschwarz
 Unit #:
 PO #
 Mfg. Date: 09/90

Invoice # 60449

Inv Date: May 17, 2011 @ 9:41am
 Service Writer:
 Status: Complete
 Driver:

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|---|----------------------|-----------------------------|------|------|--------|--------|
| Inspection II Service | | | 4.50 | | 130.00 | 585.00 |
| Labor Service - Inspection II Service, includes all factory-recommended maintenance and additional items. NAI | | | | | | |
| New | 20W-50 VALVOLINE | Oil Valvoline, liters | | 6.00 | 5.98 | 35.88 |
| New | LE1302 | Oil 5-speed, pints | | 3.00 | 7.91 | 23.73 |
| New | LE1605 | Gear oil purple, pints | | 3.60 | 7.91 | 28.48 |
| New | 07-11-9-963-384 | Seal ring 24x29mm M gearbox | | 1.00 | 0.44 | 0.44 |
| New | 07-11-9-963-355 | Seal ring 22x27mm | | 2.00 | 0.49 | 0.98 |
| New | 11-42-9-063-138 | OX41D oil filter kit M30 | | 1.00 | 14.38 | 14.38 |
| New | 13-72-1-726-916 | LX408 air filter | | 1.00 | 25.53 | 25.53 |
| New | 13-32-1-270-038 | KL9 fuel filter | | 1.00 | 46.16 | 46.16 |
| New | 11-12-1-312-172 | Gasket VC S38 | | 1.00 | 39.96 | 39.96 |
| New | 11-12-1-312-173 | Gasket VC S14/S38 small | | 3.00 | 9.37 | 28.11 |
| New | 12-12-9-061-867 | Spark plug Y6DC | | 6.00 | 11.39 | 68.34 |
| New | 82 | Washer fluid, liters | | 1.00 | 1.69 | 1.69 |
| Labor Service - Check & adjust tire pressures. Front 38psi Rear 41psi NAI | | | | | | 0.00 |
| Wiper blades need replacement | | | | | | 0.00 |
| Labor Service - Remove & replace wiper blade inserts. NAI | | | | 2.00 | 16.36 | 32.72 |
| New | 61-61-8-217-711 | Wiper insert 600mm wide | | | | |
| Brake fluid flush due 11/08 | | | 0.60 | | 130.00 | 78.00 |
| Labor Service - Brake fluid flush NAI | | | | 1.00 | 16.40 | 16.40 |
| New | 81-22-9-407-512 | Brake fluid, liters | | | | |
| Coolant flush due 11/10, bleeder hose leaking | | | 0.75 | | 130.00 | 97.50 |
| Labor Service - Dain, refill, bleed & pressure-test cooling system. NAI | | | | 1.50 | 25.35 | 38.03 |
| New | 82-14-1-467-704 | Antifreeze BMW, gallons | | 1.50 | 2.00 | 3.00 |
| New | H2O | Distilled water | | 1.00 | 0.48 | 0.48 |
| New | 07-11-9-963-200 | Seal ring 14mm al | | | | |
| Labor Service - Remove & replace cooling system bleeder hoses. NAI | | | 0.25 | | 130.00 | 32.50 |
| New | 17-12-1-712-736 | Hose 8mm coolant, meters | | 0.15 | 18.13 | 2.72 |
| New | CRIMP 14.5 | Crimp clamp 14.5 | | 4.00 | 2.25 | 9.00 |
| Rear trailing arm link worn | | | 0.75 | | 130.00 | 97.50 |
| Labor Service - Remove & replace rear trailing arm links. CK | | | | 2.00 | 116.64 | 233.28 |
| New | 33-32-1-126-476 | Link rear trailing arm | | | | |

Revisions of Original Estimate - Original Estimate of Services and Parts \$959.42

| Rev# | Date and Time | Who Contacted | Method | Contact # | Cont. By | Revise By | Total |
|------|-------------------------|---------------|--------|-----------|----------|-----------|------------|
| 1 | 5/17/2011 4:31PM | | | | NS | \$215.58 | \$1,175.00 |
| | Flushes | | | | | | |
| 2 | 5/17/2011 5:06PM | | | | NS | \$325.00 | \$1,500.00 |
| | Rear trailing arm links | | | | | | |

X _____
 Customer accepts revision to the invoice and agrees to pay revised amount.

Recommended Repairs and Services:

- Odometer illumination out and owner likes it that way



1218 7TH STREET, BERKELEY, CA 94710
(510) 524-6000
TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

1991 BMW M5

VIN: BK05515
Engine:
Transmission: 5SPD MAN

License # CR MOVIE

Mileage: 117316
Color: Glanzschwarz
Unit #:
PO #
Mfg. Date: 09/90

Invoice # 60449

Inv Date: May 17, 2011 @ 9:41am

Service Writer:
Status: Complete
Driver:

- Steering wheel noisy - slip ring \$370 or steering column bearing?

344.03



1218 7TH STREET, BERKELEY, CA 94710
 (510) 524-6000
 TEAM@BAVPROS.COM • WWW.BAVPROS.COM

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X _____ Date: _____

Terms: CASH unless other arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X _____ Date: _____

I have read and agree to the Loaner Car Agreement as set forth on the reverse.

1991 BMW M5

VIN: BK05515
 Engine:
 Transmission: 5SPD MAN

License # CR MOVIE

Mileage: 117316
 Color: Glanzschwarz
 Unit #:
 PO #
 Mfg. Date: 09/90

Invoice # 60449

Inv Date: May 17, 2011 @ 9:41am

Service Writer:
 Status: Complete
 Driver:

Continued from previous page

X _____
 Customer acknowledges receipt of merchandise and services.

Thanks!

| Invoice Summary | |
|-----------------|----------|
| Parts | \$649.31 |
| Labor | \$890.50 |
| Labor Discount | \$-89.05 |
| Haz. Materials | \$10.04 |
| FET | \$0.43 |

*PAID VISA
5/18/11*

| | |
|-----------------|------------|
| Sub Total | \$1,461.23 |
| Sales Tax (DEF) | \$63.31 |

Discard old parts Original Estimate: \$959.42 **Total \$1,524.54**

BAVARIAN PROFESSIONALS

MAJOR SERVICE CHECKLIST *Late*
 Technician's Signature _____

Customer *Bobyn*

Date *5/17/11*
 Mileage *117316*

License # *CR MOVIE*
 R/O

- ✓ DRAIN ENGINE OIL
- ✓ REPLACE OIL FILTER
- ✓ REPLACE TRANSMISSION OIL - *ATF*
 Leakage: none slight substantial
- ✓ REPLACE DIFFERENTIAL OIL - *Synthetic*
 Leakage: none slight substantial
- ✓ FRONT BRAKES
 Pads: *good* % worn unsafe
 Rotors: good lip bad
- ✓ REAR BRAKES
 Pads: *good* % worn unsafe
 Rotors: good lip bad
- ✓ DRIVE BELTS: *good* cracked
 Adjust tension if necessary
- ✓ ALTERNATOR BUSHINGS: *good* some play bad
- ✓ WATER PUMP: *good* past leakage leaking
- ✓ THERMOSTAT HOUSING: *good* past leakage leaking
- ✓ BALL JOINTS
 Left: good *torn boot* worn unsafe
 Right: good *torn boot* worn unsafe *> upper*
- ✓ IDLER ARM: good *worn* unsafe *slightly*
- ✓ TIE RODS
 Left: *good* worn unsafe
 Center: *good* worn unsafe
 Right: *good* worn unsafe *Torn boots*
- ✓ CONTROL ARM BUSHINGS: *good* torn unsafe
- ✓ BRAKE MASTER: leaking
- ✓ CLUTCH SLAVE: leaking
- ✓ TRANSMISSION MOUNTS: *good* bad
- ✓ SHIFT TOWER MOUNTS: good bad
- ✓ SHIFTER LINKAGE: *good* worn
- ✓ FLEX DISC: *good* slightly cracked bad
- ✓ HALF SHAFT JOINTS: *good* stiff torn boot
- ✓ EXHAUST SYSTEM
 Catalytic converter: *good* loose element leaking
 Trans/exhaust bracket: *good* bad
 Heat shielding: good *loose* broken
 Rear muffler: *good* loose baffle leaking
 Muffler hangers: *good* cracked
- ✓ REPLACE FUEL FILTER

- ✓ PRESSURE TEST COOLING SYSTEM
 Radiator hoses/clamps: *good* marginal unsafe
 Radiator: good *leaks cold* major leakage *at seam*
- ✓ COOLANT LEVEL/CONDITION: good *low* weak old *slightly*
 last flush: *11/06* due *11/10* *flushed*

- ✓ ADD ENGINE OIL - *20W50*
- ✓ COMPRESSION TEST
 1) 200 2) 203 200 4) 205 5) 210 6) 205
- ✓ ADJUST VALVES
- ✓ TIMING CHAIN/BELT: *good* worn unsafe
 Small 6cyl. Replace rocker plugs
- ✓ CAMSHAFT: *good* grooved pitted
- ✓ ROCKERS: good loose
- ✓ REPLACE VALVE COVER GASKET
- ✓ DISTRIBUTOR CAP: good bad
- ✓ ROTOR: good bad
- ✓ Motronic: Recommend inspection
- ✓ GAP & INSTALL SPARK PLUGS

- ✓ REFILL WASHER RESERVOIR qty: *1/L*
- ✓ WASHER SYSTEM: *good* inop. clogged jets
- ✓ WIPERS: good *streaky* bad - *worn & replaced*
- ✓ SHOCK ABSORBERS
 Front: *good* soft bad
 Rear: *good* soft bad
- ✓ CHECK/ADJUST PARKING BRAKE
- ✓ CLUTCH MASTER: *good* leakage
- ✓ LIGHTS
- ✓ HEATER BLOWER: *good* inop.
- ✓ A/C: good weak inop. *44* degF
- ✓ INTERIOR:
 interior lights ✓ stereo ✓ dash illumination ✓ temp control
 window operation ✓ sunroof operation ✓ seat operation ✓ central locking ✓ seat belts
- ✓ LUBE DOOR, HOOD, AND TRUNK HINGES & SEALS
- ✓ RESET SERVICE INDICATOR

✓ FRONT WHEEL BEARINGS: *good* loose rough

✓ SET TIRE PRESSURES

| | PSI | leak | CONDITION | % | worn out |
|--------|-----------|------|-------------|---|----------|
| RF: | <i>38</i> | | <i>good</i> | | worn out |
| LF: | <i>38</i> | | <i>good</i> | | worn out |
| RR: | <i>41</i> | | <i>good</i> | | worn out |
| LR: | <i>41</i> | | <i>good</i> | | worn out |
| Spare: | <i>41</i> | | <i>good</i> | | worn out |

- ✓ LOAD TEST BATTERY: *pass* marginal fail
- ✓ BATTERY VOLTAGE @ IDLE: *13.8* v
- ✓ CHARGING SYSTEM OUTPUT: *120* amps under max load
- ✓ ADJUST IGV CURRENT: _____ mA
- ✓ CHECK O2 SENSOR FUNCTION
- ✓ SET AIRFLOW METER: _____ v

- ✓ BRAKE FLUID LEVEL/CONDITION: good *low* dirty
 last flush: *11/06* - due *11/08* *flushed*
- ✓ BATTERY ELECTROLYTE LEVEL: *good* low sealed
- ✓ CLEAN TERMINALS if necessary
- ✓ FUSES: good corroded
- ✓ POWER STEERING FLUID LEVEL: *good* low
- ✓ REPLACE AIR FILTER
- ✓ CLEAN THROTTLE BODY

✓ STICKER

STAMP BOOKLET *not found*

replaced

- Bleeder hose is leaking @ radiator
- Engine leaks oil
- All 3 trunk lights are out
- Rear trailing arm links worn ← *replaced*

ROBYN

Valve clearance worksheet

INTAKE

| | 6 | 5 | 4 | 3 | 2 | 1 | |
|----------------|------|------|------|------|------|------|----------------|
| new clearance | | | | | | | new clearance |
| shim installed | | | | | | | shim installed |
| shim removed | | | | | | | shim removed |
| clearance | .012 | .013 | .012 | .012 | .012 | .012 | clearance |
| | | | | | | | |
| clearance | .013 | .011 | .012 | .011 | .012 | .013 | clearance |
| shim removed | | | | | | | shim removed |
| shim installed | | | | | | | shim installed |
| new clearance | | | | | | | new clearance |

EXHAUST

| Specifications | inches | mm | Shims removed | Shims installed | Summary |
|-------------------------|-----------------------|-------------|---------------|-----------------|---------|
| M88/3 (Euro) | 0.012 - 0.014 | 0.30 - 0.35 | | | |
| S14 (E30 M3) | 0.010 - 0.014 | 0.26 - 0.35 | | | |
| S38 B35 (US M6, E28 M5) | 0.012 - 0.014 | 0.30 - 0.35 | | | |
| S38 B36 (E34 M5) | 0.011 - 0.013 | 0.28 - 0.33 | | | |
| S38 B38 (Euro E34 M5) | 0.011 - 0.013 | 0.28 - 0.33 | | | |
| S54 (E46 M3) | intake 0.007 - 0.009 | 0.18 - 0.23 | | | |
| | exhaust 0.011 - 0.013 | 0.28 - 0.33 | | | |

IN WORK DONE CALLED

I hereby authorize the repair work listed hereon, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all co-repair costs and/or attorney's fees in the event default is made in any payment due. If automobile is returned to customer without repair service being performed, a diagnostic and handling charge (including gas/assembly) will be made. I have read and understand the above and acknowledge receipt of an estimate.

TERMS: CASH - Unless arrangements made prior to authorization. Cars left after work is completed may be subject to a storage fee.

Buyer hereby acknowledges receipt of merchandise and services set forth herein and a copy of this sales invoice.

DATE 08/28/03

DATE

1991 BMW MS
 LICENSE: 4MRJ65P
 MILEAGE: 99502
 VIN: WBSHD9310MBK05515
 COLOR: C: BLANZSCHWARZ
 PRODUCT: 09/90
 2/ADR.

DATE 8/28/03 ESTIMATE # 28631
 TIME 9:11AM CUSTOMER
 WRITTEN BY _____ PAGE 1 OF 1



1218 7th Street
 Berkeley, CA
 94710
 (510) 524-6000
 BAR # AG111629

| QTY. | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT. PRICE |
|------|------|-----------------|---------------------------|----------|------------|
| 1.00 | N | 0190-5535CK | DINON, STAGE 1 53-MS CONT | 1,547.00 | 1,547.00 |
| 1.00 | N | 11-42-9-063-139 | DY41D OIL FILTER KIT, NEW | 5.90 | 5.90 |
| 5.00 | N | 200-50 TURBO | 017 W/ 20050 TURBO BOL | 2.62 | 13.10 |

| EMP. | HRS. | LABOR OPERATION | PRICE |
|------|------|---|--------|
| | 1.00 | CHECK AND REVISE | 100.00 |
| | 9.00 | ELIMINATE LUBRICATION, INSTAL DINON STAGE 1, | 900.00 |
| | 0.25 | REMOVE AND REPLACE OIL FILTER, RUBBER "O" RING, | 25.00 |
| | | SEAL RING, AND OIL. | |
| | 2.50 | LOAD TEST BATTERY, CHECK ELECTROLYTE, CHECK | 50.00 |
| | | CHARGING, CHECK KEY LIFT DRA. | |
| | 1.50 | ATTEMPT INSTALLATION OF REAR SHAW BAR. | 150.00 |

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

DINON STAGE 1. TEST DRIVE FOR SHIMMY ON BRAKING, FRONT OR REAR ROTORS, OR ONLY NOTICE AT HIGHWAY SPEEDS, HARDER BRAKING, MORE SHIMMY, OIL AND FILTER. REAR SHAW BAR IN TRUNK, ATTEMPT INSTALLATION. BATTERY DOES DEAD AFTER 1 WEEK. DOME LIGHTS NOT WORKING. RECOMMENDED SERVICES / FUTURE VEHICLE NEEDS. DOME LIGHT ILLUMINATION OUT. SLIGHT PULSATION ON BRAKING - WAPPED ROTORS.

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis. If on closer analysis it is found that additional repairs are necessary, you will be contacted for authorization. DESIGNER ESTIMATE \$2,910.58

CUSTOMER SIGNATURE [Signature] DATE 08/28/03

CUSTOMER SIGNATURE _____ DATE _____
 I acknowledge notice and oral approval of an increase in the original estimated price.

| | |
|------------------|-------------------|
| PARTS TOTAL | 1,558.62 |
| LABOR TOTAL | 1,225.80 |
| ADDITIONAL WASTE | 1.50+ |
| LABOR DISCOUNT | -122.50 |
| OIL TAX | 0.30 |
| SUBTOTAL | 2,772.92 |
| TAX-DEF | 137.66 |
| TOTAL | \$2,910.58 |

DUPLICATE

ESTIMATE ONLY

IN WORK DONE CALLED

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs herein. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorney's fees in the event default is made in any payment plan. If automobile is returned to customer without repair service being performed, a diagnostic and handling charge (including reassembling) will be made. I have read and understand the above and acknowledge receipt of an estimate.

X TERMS CASH: Unless arrangements made prior to authorization, cars left after work is completed may be subject to a storage fee.
 DATE: 09/03/03
 By: *John R. Pugh* (Signature)
 I hereby acknowledge receipt of merchandise and services set forth herein and a copy of this sales invoice.

1991 BMW MS
 LICENSE: CR MOVIE
 MILEAGE: 100789
 VIN: 4WSHD9310MBK05515
 COLOR: C:GLANZSCHWARZ
 PRODUCT: 09/90
 2/4DR.

BAVARIAN
 1218 7th Street
 Berkeley, CA
 94710
 (510) 524-6000
PROFESSIONALS BAR # AG111629
 BAR # AG111629

DATE: 8/28/03 INVOICE # 28631
 TIME: 3:07PM CUSTOMER
 WRITTEN BY: PAGE 1 OF 1

| QTY. | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT. PRICE |
|------|------|------------------|---------------------------|----------|------------|
| 1.00 | N | D190-5595K | DIMON STRGE 1 E34MS KONI | 1,647.00 | 1,647.00 |
| 1.00 | N | 11-42-9-063-138 | OX41D OIL FILTER KIT, NEW | 5.90 | 5.90 |
| 6.00 | N | 20W-50 TL880 | OIL VCL 20W50 TL880 Btl. | 2.62 | 15.72 |
| 2.00 | N | 34-11-2-226-385 | BRKKE DISC MS E34 | 184.00 | 368.00 |
| 1.00 | N | D-1131-M | BRKKE PADS FRONT E32, 34 | 82.71 | 82.71 |
| 1.00 | N | 81-22-9-407-103 | PLSTILLUBE | 2.24 | 2.24 |
| 1.00 | N | 34-35-1-180-432 | BRKKE PAD SENSOR MEDIUM | 6.50 | 6.50 |
| 1.00 | N | 81-22-9-407-512 | BRKKE FLUID, LITERS | 16.40 | 16.40 |
| 1.00 | N | MTD-93 | BATTERY INTERSTATE | 122.50 | 122.50 |
| 2.00 | N | 12 BATTERY PROT. | BATTERY TERMINAL PROTECT | 0.50 | 1.00 |
| 1.00 | N | VENT | VENT KIT INTERSTATE | 1.66 | 1.66 |

| EMP. | HRS. | LABOR OPERATION | PRICE |
|------|------|--|--------|
| SS | 9.00 | ELIMINATE L2SUSPENSION, INSTALL DIMON STRGE 1. | 900.00 |
| NP1 | 0.25 | REMOVE AND REPLACE OIL FILTER, RUBBER "O" RING, SEAL RING, AND OIL. | 25.00 |
| SS | 1.25 | INSTALL REAR SWAY BAR. INVOLVES REMOVAL OF REAR TRACK LINK. | 125.00 |
| SU | 1.00 | SUBLET WELD. | 80.00 |
| SS | 0.30 | NOTE THAT REAR BULKHEAD IS SEVERELY CRACKED AT LEFT SHOCK MOUNTING POINT, PREP FOR WELD AND TOUCH UP POST WELD. | 30.00 |
| NP1 | 1.50 | REMOVE AND REPLACE FRONT BRKKE DISCS, PADS, WEAR SENSOR. | 150.00 |
| NP1 | 0.40 | BRKKE FLUID FLUSH | 40.00 |
| JN | 1.00 | TEST DRIVE FOR SHIMMY ON BRAKING, SLIGHT AT FREEWAY SPEEDS. LOAD TEST BATTERY, FALLS, CHECK ELEC. FAIR, CHECK CHARGING, GOOD. REMOVE AND REPLACE BATTERY | 100.00 |
| JN | 1.00 | 4-WHEEL ALIGNMENT | 175.00 |

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

DIMON STRGE 1, X TEST DRIVE FOR SHIMMY ON BRAKING, FRONT DR REAR ROTORS, CAN ONLY NOTICE AT HIGHWAY SPEEDS, HARDER BRAKING, MORE SHIMMY, X FRONT BRKES, OIL AND FILTER. REAR SWAY BAR IN TRUNK, ATTEMPT INSTALLATION, X BATTERY GOES DEAD AFTER 1 WEEK.. NEW BATTERY, X ODOMETER ILLUMINATION, CONSERV ON BRAKES X WHEN CAR STOPPED NEEDS TURN OUT.. DECLINED.

ODOMETER ILLUMINATION OUT AND OWNER LIKES IT THAT WAY.

35314

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis. If on clear analysis it is found that additional repairs are necessary, you will be contacted for authorization.
 ORIGINAL ESTIMATE \$2,910.58

PAID BY VISA 9/03/03

CUSTOMER SIGNATURE DATE: 09/03/03

CUSTOMER SIGNATURE DATE: 09/03/03

| METHOD OF PAYMENT | PARTS | LABOR | TOTAL |
|-------------------|----------|----------|-------------------|
| PAYMENT DATE: / / | 2,869.63 | 1,545.00 | |
| | SUBLET | 80.00 | |
| | H2ZARD | 3.25* | |
| | L. DIS | -154.50 | |
| | OIL TR | 0.30 | |
| | SUB TOT | 3,743.68 | |
| | TAX-DEF | 187.24 | |
| TOTAL | | | \$3,930.92 |

ORIGINAL

Beissbarth ML4000 Wheel Alignment

| | |
|------------------|--------------------------|
| Customer N°. : | Rep. comm. N°. : |
| Customer : ROBYN | Chassis N°. : BK05515 |
| Address : | Reg. plate N°. : 4MRJ652 |
| Town/City : | First reg. : |
| Telephone : | Odometer : |
| Operator : | Date : 08.28.2003/23:59 |

Vehicle type : * BMW-OEM Specs 08/2000 * 5-er E 34 * M 5 * Series * with 18" rims *

Reason for measure. :

| Tire type : | | Tire size : | | Front left | Front right | Rear left | Rear right |
|-----------------------------------|-----------------------------|-------------|-----------------------|-------------------|---|--------------------|------------------|
| Tire pressure (cold) | | bar/psi/kPa | | | | | |
| Tire tread depth (mm) | | | | | | | |
| | | | | Before adjustment | Target data max. Difference left/right | | After adjustment |
| Rear axle | Camber | left | | -2.09°D | -2.25°/ +0.50° -0.50° 0.50° | -2.10°D -1.53°D | |
| | | right | | -1.46°D | | | |
| | Toe | left | | +0.00° | +0.13°/ +0.03° -0.03° | +0.12° | |
| right | | +0.10° | | | | | |
| total | | +0.10° | +0.27°/ +0.07° -0.07° | +0.23° | | | |
| Geometrical driving axis (Thrust) | | | | +0.05° | +0.00°/ +0.25° -0.25° | +0.00° | |
| | Caster | left | | +7.36° | +8.17°/ +0.50° -0.50° | +7.40° | |
| | | right | | +7.48° | | | |
| | K.P.I (Kingpin inclination) | left | | +12.21° | # # # | +12.35° | |
| | | right | | +12.30° | | +4.09° | |
| | Toe out on turns | left | | # | # # # | # | |
| | | right | | # | | # | |
| Front axle | Camber | left | | -0.52° | -0.50°/ +0.50° -0.50° 0.50° | -0.53° | |
| | | right | | -0.33° | | | |
| | Toe | left | | +0.09° | +0.17°/ +0.03° -0.03° | +0.15° | |
| right | | +0.11° | +0.16° | | | | |
| total | | +0.21° | +0.33°/ +0.08° -0.08° | +0.31° | | | |
| | Setback | | | +0.04° | +0.00°/ +0.17° -0.17° | +0.08° | |
| | left side | left | | # | +43.00°/ +1.00° -1.00° | # | |
| | | right | | # | +32.00°/ +1.00° -1.00° | # | |
| Full steering lock | left side | left | | # | +32.00°/ +1.00° -1.00° | # | |
| | right side | right | | # | +43.00°/ +1.00° -1.00° | # | |

IN WORK DONE CALLED

I hereby authorize the repair work, listed hereon, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for purpose of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorney's fees in the event default is made in any payment due. If automobile is returned to customer without repair service being performed, a diagnostic and handling charge (including reassembling) will be made. I have read and understand the above and acknowledge receipt of an estimate.

TERMS CASH: Unless arrangements made prior to authorization. Cars left after work is completed may be subject to a storage fee.

Buyer hereby acknowledges receipt of merchandise and services set forth herein and a copy of this sales invoice.



BAVARIAN
1218 7th Street
Berkeley, CA
94710
(510) 524-6000
BAR # AG111629

1991 BMW MS
LICENSE: 4MRJ652
MILEAGE: 99903
VIN : WBSHD931QMBK05515
COLOR: C:GLANZSCHWARZ
PRODUCT: 09/90
2/4DR.

DATE 4/14/03 INVOICE # 27259
TIME 5:51PM CUSTOMER
WRITTEN BY PAGE 1 OF 1

| QTY. | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT. PRICE |
|------|------|-----------------|---------------------------|-------|------------|
| 1.00 | N | 11-13-1-315-154 | BRACKET OIL PAN 538 B36 | 31.28 | 31.28 |
| 6.00 | N | 204-50 TURBO | OIL VALVOLUME 20-50 TURBO | 2.47 | 14.82 |
| 1.00 | N | 11-42-9-063-138 | OX41D OIL FILTER KIT, NEW | 5.90 | 5.90 |
| 1.00 | N | 07-12-9-925-748 | SPEED NUT 6.3-5 | 0.29 | 0.29 |
| 1.00 | N | 07-11-9-916-967 | SCREW 6.3X19 W/MSHER | 0.20 | 0.20 |
| 0.50 | N | 81-22-9-407-104 | DEGREASER ENGINE, BOLLONS | 19.45 | 9.73 |

| EMP. | HRS. | LABOR OPERATION | PRICE |
|------|------|--|--------|
| CK | 4.25 | DRAIN ENGINE OIL, REMOVE OIL PAN, CLEAN BRACKET SUR FACES, REPLACE PAN BRACKET, REPLACE ENGINE OIL & FI LTER. | 425.00 |
| CK | 0.50 | DEGREASE UNDER SIDE OF ENGINE, RECHECK FOR ADDITIONAL LEAKAGE AFTER TEST DRIVE, RETORQUE VALVE COVER FASTENERS, RECHECK FOR LEAKAGE: 6000. | 50.00 |

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

OIL PAN BRACKET, X
DEGREASE & RECHECK, X
REAR SUSPENSION PROBLEMS; BAD L. ACCUMULATOR, LEAKING R. SHOCK,
DIODEMETER ILLUMINATION OUT, SLIGHT PULSATION ON BRAKING - WARPED ROTORS.
RECOMMENDED SERVICES / FUTURE VEHICLE NEEDS

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis. If on closer analysis it is found that additional repairs are necessary, you will be contacted by authorization.

ORIGINAL ESTIMATE \$496.12
APRD MK 4/14/03

CUSTOMER SIGNATURE DATE
I have read and agree to the Customer Car Agreement as set
forth on the reverse.

CUSTOMER SIGNATURE DATE
I acknowledge notice and oral approval of an increase
in the original estimated price.

NON-TAXED

| METHOD OF PAYMENT | PAYMENT DATE | PARTS | LABOR | HOLIDAY | L. DTS | OIL TA | SUB TOT | TAX-DEF | TOTAL |
|-------------------|--------------|-------|--------|---------|--------|--------|---------|---------|----------|
| | / / | 62.22 | 475.00 | 1.50* | -47.50 | 0.30 | 491.52 | 5.13 | \$496.65 |

ORIGINAL

I hereby authorize the repair work listed hereon, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs hereon. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorney's fees in the event default is made in any payment due. If authorization is returned to customer without repair services being performed, a diagnostic and handling charge (including reassembling) will be made. I have read and understand the above and acknowledge receipt of an estimate.

X TERMS CASH: Unless arrangements made prior to authorization. Cars left after work is completed may be subject to a storage fee.

Buyer hereby acknowledges receipt of merchandise and services set forth herein and a copy of this sales invoice.

BAVARIAN
 1218 7th Street
 Berkeley, CA
 94710
 (510) 524-6000
PROFESSIONALS
 BAR # AG11629

1991 BMW MS
 LICENSE: 4MRJ652
 MILEAGE: 92862
 VIN : WBSHD9310MBK05515
 COLOR C: GLANTZSCHWARZ
 PRODUCT: 09/90
 2/4DR.

DATE 1/24/03 INVOICE # 26493
 TIME 4:48PM CUSTOMER
 WRITTEN BY PAGE 1 OF 1

| QTY | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT-PRICE |
|------|------|-----------------|----------------------------|-------|-----------|
| 6.00 | N | 20M-50 TURBO | OIL WPL VOLUME 20-50 TURBO | 2.47 | 14.82 |
| 1.00 | N | 11-42-9-063-138 | OX41 OIL FILTER KIT, NEW | 5.90 | 5.90 |
| 2.00 | N | 31-35-1-134-582 | LINK SHAWBAR FT. | 29.75 | 59.50 |
| 2.00 | N | 51-23-1-944-119 | HOOD SHOCK E24 | 28.00 | 56.00 |
| 1.00 | N | 32-42-1-469-239 | 10X825 BELT | 7.00 | 7.00 |
| 1.00 | N | 11-72-1-470-033 | 13X970 BELT | 15.90 | 15.90 |
| 1.00 | N | 11-23-1-470-034 | 13X990 BELT | 15.90 | 15.90 |

| EMP. | HRS. | LABOR OPERATION | PRICE |
|------|------|--|--------|
| CK | 1.30 | OIL SERVICE. INCLUDES OIL CHANGE, TOPPING UP FLUID LEVELS, UNDERCAR INSPECTION, AND COMPLETE CHECK OF LIGHTING AND SAFETY SYSTEMS. | 130.00 |
| CK | 0.50 | REMOVE & REPLACE FRONT SHAWBAR LINKS. | 50.00 |
| CK | 0.01 | REPLACE HOOD SHOCKS. | |
| CK | 1.00 | REMOVE AND REPLACE ALL DRIVE BELTS; TENSION TO BMW SPEC. | 100.00 |

PROFESSIONALS
 ORIGINAL ESTIMATE 1/24/03
 PAID

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

MINOR SERVICE, X
 FT. SHAWBAR LINKS, X
 HOOD SHOCKS, X

RECOMMENDED SERVICES / FUTURE VEHICLE NEEDS

SUBSTANTIAL ENGINE OIL LEAKAGE; OIL PAN BRACKET, ETC.?
 REAR SUSPENSION PROBLEMS: BAD L. ACCUMULATOR, LEAKING R. SHOCK.

ODDMEETER ILLUMINATION OUT. SLIGHT PULSATION ON BRAKING - WARPED ROTORS.

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis. If on closer analysis it is found that additional repairs are necessary, you will be contacted for authorization.
 ORIGINAL ESTIMATE \$375.88
 R1 1/24 02:56PM CHR 368-3980 140.00
 DRIVE BELTS
 REVISED ESTIMATE TOTAL \$515.88

X CUSTOMER SIGNATURE
 I have read and agree to the Customer Car Agreement as set forth on the reverse. DATE

X CUSTOMER SIGNATURE
 I acknowledge notice and oral approval of an increase in the original estimated price. DATE

| METHOD OF PAYMENT | PARTS | LABOR | HAZARD | L. DIS | OIL TR | SUB TOT | TAX-DEF |
|-------------------|--------|--------|--------|--------|--------|---------|---------|
| PAYMENT DATE / / | 175.02 | 280.00 | 1.50x | -28.00 | 0.30 | 428.82 | 14.44 |

TOTAL \$443.26

ORIGINAL

BAVARIAN PROFESSIONALS

Customer ROBYN

MINOR SERVICE CHECKLIST Late
Technician's Signature _____

Date 1/24/03
R/O

License # C.R. MOVIE
Mileage 98862

- Change engine oil and oil filter while engine is at normal operating temperature.
- Inspect drive belts and adjust tension if necessary. Substituted
- Check and adjust tire pressures; check low tires for leaks. ↑
- Check coolant level and top up if required. REPLACES
last flush: 05/01 - DUE 5/03
- Inspect coolant hoses and hoseclamps.
- Check oil level in power steering reservoir.
- Check battery electrolyte level and add water if required.
- Check brake and clutch fluid level and top up if required.
last flush: 05/01 DUE 5/03
- Fill windshield washer reservoir. QTY: 0
- Check all lights, warning and safety equipment.
- Check parking brake adjustment.
- Reset service lights.
- Test drive car.

UNDER-CAR & BRAKE INSPECTION

FRONT BRAKES
Pads: good _____ % worn unsafe
Rotors: good lip bad

REAR BRAKES
Pads: good _____ % worn unsafe
Rotors: good lip bad

WATER PUMP: good past leakage leaking

BALL JOINTS
Left: good torn boot worn unsafe
Right: good torn boot worn unsafe

STEERING ARM: good worn unsafe

TIE RODS
Left: good worn unsafe
Center: good worn unsafe
Right: good worn unsafe

PUSHSTRUT BUSHINGS: good torn unsafe

BRAKE MASTER: good leaking

CLUTCH SLAVE: good leaking

TRANSMISSION: good leaking

FLEX DISC: good slightly cracked bad

DIFFERENTIAL: good leaking

EXHAUST SYSTEM
Catalytic converter: good loose element leaking
Trans/exhaust bracket: good bad
Heat shielding: good loose broken
Rear muffler: good loose baffle leaking CORRODED
Muffler hangers: good cracked

ODOMETER ILLUMINATION
LF. SIDE MIRROR AT ← BULB MISSING
OIL PAN GASKET LEAKING BODY
RR. SHOCK LEAKING

STICKER
 STAMP BOOKLET NOT FOUND

IN WORK DONE CALLED

I hereby authorize the repair work listed hereon, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and attorney's fees in the event default is made in any payment due. If automobile is returned to customer without repair service being performed, a diagnostic and handling charge (including reassembling) will be made. I have read and understand the above and acknowledge receipt of an estimate.

TERMS CASH. Unless arrangements made prior to authorization. Cars left after work is completed may be subject to a storage fee.

Buyer hereby acknowledges receipt of merchandise and services set forth herein and a copy of this sales invoice.

1991 BMW MS
 LICENSE: 4MRJ5652
 MILEAGE: 97772
 VIN: WBSHD9310MBK05515
 COLOR C: BLANZSCHWARZ
 PRODUCT: 09/90
 2/4DR.



BAVARIAN
 1218 7th Street
 Berkeley, CA
 94710
 (510) 524-8000
 BAR # AG111629
 PROFESSIONALS BAR # A6111629

DATE 4/19/02 ESTIMATE # 23817
 TIME 8:54AM CUSTOMER
 WRITTEN BY PAGE 1 OF 1

| QTY. | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT. PRICE | EMP. | HRS. | LABOR OPERATION | PRICE |
|------|------|-----------------|-------------------------|--------|------------|------|------|--|--------|
| 1.00 | N | 6A-53-8-390-473 | HOSE A/C COND DRYER | 51.75 | 51.75 | | 2.25 | REMOVE & REPLACE (3) A/C HOSES. | 282.50 |
| 1.00 | N | 64-53-1-391-248 | HOSE A/C EVAPOR COMP | 98.00 | 98.00 | | 1.00 | EVALUATE, REMOVE AND REPLACE A/C SYSTEM. | 94.00 |
| 1.00 | N | 64-53-1-391-249 | HOSE A/C COMP COND | 110.00 | 110.00 | | | | |
| 1.00 | N | | O-RINGS | 6.00 | 6.00 | | | | |
| 2.25 | N | PI2 | FREON REFRIGERANT, LBS. | 65.00 | 143.65 | | | | |

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

A/C REPAIR.

RECOMMENDED SERVICES / FUTURE VEHICLE NEEDS

ENGINE OIL LEAKAGE, SPRINGS DAMAGED.
 WEAR SUSPENSION PARTS ENGS; DRIV L. RECOMMENDATOR, LEARNING R. SHOCK.
 A/C WEAR LEGK, MUSTY SMELL.
 FRONT SHOCKER LIMBS NOISE.
 ODOMETER ILLUMINATION OUT. SLIGHT COLLISION ON BRKING - DAMPED MOTORS.

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis if on closer analysis it is found that additional repairs are necessary. you will be contacted for authorization.
 ORIGINAL ESTIMATE \$735.68

CUSTOMER SIGNATURE
 I have read and agree to the Lender, Car Agreement as set forth on the reverse.

CUSTOMER SIGNATURE
 I acknowledge notice and full approval of an increase in the original estimated price.

| | |
|--------------|-----------------|
| PARTS TOTAL | \$89.40 |
| LABOR TOTAL | 282.50 |
| SUBTOTAL | 701.90 |
| TAX-8% | 53.78 |
| TOTAL | \$735.68 |

DUPLICATE

I hereby authorize the repair work listed hereon, including sublet work, to be done along with necessary material. You and your employees may operate the described vehicle for purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle in the amount of repairs thereon. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorney's fees in the event default is made in any payment due. If automobile is returned to customer without repair service being performed, a diagnostic and handling charge (including reassembly) will be made. I have read and understand the above and acknowledge receipt of estimate.

X TERMS CASH: Unless arrangements made prior to authorization, cars left after work is completed may be subject to a storage fee.

DATE _____
 Buyer hereby acknowledges receipt of merchandise and services set forth herein and a copy of this sales invoice.

1991 BMW MS
 LICENSE: 4MRJ652
 MILEAGE: 97179
 VIN : WBSHD9310MBK05515
 COLOR C: BLANZSCHWARZ
 PRODUCT: 09/90
 2/4DR. #

BAVARIAN
 PROFESSIONALS
 1218 7th Street
 Berkeley, CA
 94710
 (510) 524-6000
 BAR # AG111629

DATE 4/19/02 INVOICE # 23A17
 TIME 5:23PM CUSTOMER
 WRITTEN BY PAGE 1 OF 1

| QTY. | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT-PRICE |
|------|------|-----------------|-------------------------|--------|-----------|
| 1.00 | N | 64-53-8-390-473 | HOSE A/C COND DRIER | 51.75 | 51.75 |
| 1.00 | N | 64-53-1-391-248 | HOSE A/C EVAP/COMP | 98.00 | 98.00 |
| 1.00 | N | 64-53-1-391-249 | HOSE A/C COMP/COND | 110.00 | 110.00 |
| 4.00 | N | 64-50-1-468-463 | O-RING A/C | 0.95 | 3.80 |
| 2.00 | N | 64-50-1-468-464 | O-RING A/C | 0.46 | 0.92 |
| 2.00 | N | 64-50-1-468-466 | O-RING A/C | 0.80 | 1.60 |
| 2.21 | N | R12 | FREON REFRIGERANT, LBS. | 65.00 | 143.65 |

| EMP. | HRS. | LABOR OPERATION | PRICE |
|------|------|---|--------|
| KR | 2.25 | REMOVE & REPLACE (3) A/C HOSES. | 202.50 |
| KR | 0.50 | NOTE: ADDITIONAL LEAKAGE FOUND FROM O-RING FOR HOSE FITTING ON COMPRESSOR. REMOVE & INSTALL FITTING, REPLACE O-RINGS. | 45.00 |
| KR | 1.00 | EVACUATE, RECOVER AND RECHARGE A/C SYSTEM. | 90.00 |

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

A/C REPAIR.
 RECOMMENDED SERVICES / FUTURE VEHICLE NEEDS
 ENGINE OIL LEAKAGE, SOURCE /S UNKNOWN.
 REAR SUSPENSION PROBLEMS: BAD L. ACCUMULATOR, LEAKING R. SHOCK.
 FRONT SHOCKER LINKS WORN.
 ODOMETER ILLUMINATION OUT. SLIGHT PULSATION ON BRAKING - WIPPED ROTORS.

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis. If on closer analysis it is found that additional repairs are necessary, you will be contacted for authorization.
 ORIGINAL ESTIMATE \$755.68

PAID 4/19/02 M/C

X CUSTOMER SIGNATURE
 I have read and agree to the Dealer-Car Agreement as set forth on the reverse.
 DATE _____
X CUSTOMER SIGNATURE
 I acknowledge notice and oral approval of an increase in the original estimate price.
 DATE _____

| METHOD OF PAYMENT | PAYMENT DATE | PARTS | LABOR | TOTAL |
|-------------------|--------------|---------|--------|-----------------|
| | / / | 409.72 | 327.50 | |
| | | L. DIS | -33.75 | |
| | | SUB TOT | 713.47 | |
| | | TRX-DEF | 33.80 | |
| | | | | \$747.27 |

ORIGINAL

IN WORK DONE CALLED

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs therein. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorney's fees in the event default is made in any payment due. If automobile is returned to customer without repair service being performed, a diagnostic and handling charge (including reassembly) will be made. I have read and understand the above and acknowledge receipt of an estimate.

TERMS CASH. Unless arrangements made prior to authorization. Cars left after work is completed may be subject to a storage fee.

Buyer hereby acknowledges receipt of merchandise and services set forth herein and a copy of this sales invoice.

DATE _____ DATE _____

1991 BMW MS
 LICENSE: 4MRJ652
 MILEAGE: 92864
 VIN : WBSHD9310MBK05515
 COLOR C: GLANTZSCHWARZ
 PRODUCT: 09/90
 2/ADR



BAVARIAN
 1218 7th Street
 Berkeley, CA
 94710
 (510) 524-6000
 BAR # AG111629

DATE 5/15/01 INVOICE # 20732
 TIME 12:20PM CUSTOMER
 WRITTEN BY PAGE 1 OF 2

| QTY. | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT-PRICE | EMP. | HRS. | LABOR OPERATION | PRICE |
|------|------|-----------------|---------------------------|-------|-----------|------|------|--|--------|
| 6.00 | N | 20M-50 TURBO | OIL VRL 20W50 TURBO BULK | 2.39 | 14.34 | SS | 4.50 | INSPECTION II INCLUDES ALL FACTORY SUGGESTED MAINT | 405.00 |
| 1.28 | N | ATF MERCON BULK | AUTO. TRNS. FLUID, QUART | 2.99 | 3.59 | | | ENANCE AND ADDITIONAL ITEMS. | |
| 4.00 | N | LE607RLMHS1L | GEAR LUBE (PURPLE), PINTS | 4.75 | 19.00 | BM | 2.70 | RRR EXHAUST SYSTEM, RRR DRIVESHAFT, REPLACE SHIFT | 243.00 |
| 1.00 | N | 07-11-9-963-394 | SEAL RING M GEARBOX | 0.37 | 0.37 | BM | | SHAFT AND OUTPUT FLANGE SEALS AT REAR OF TRNS. | |
| 2.00 | N | 07-11-9-963-355 | SEAL RING OIL DRAIN LARGE | 0.07 | 0.14 | BM | | REPLACE TRANSMISSION MOUNTS. | |
| 1.00 | N | 11-42-9-063-138 | OX41 OIL FILTER KIT, NEW | 5.00 | 5.00 | BM | 0.01 | REMOVE & CORRECTLY INSTALL FLEX DISC. | |
| 1.00 | N | 13-32-1-270-038 | KL9 FUEL FILTER -LATE | 21.00 | 21.00 | BM | 0.50 | M/TRANSMISSION RESEAL, REMOVE & REPLACE WORN | 45.00 |
| 1.00 | N | 13-72-1-726-916 | LX408 AIR FILTER | 16.50 | 16.50 | | | COMPONENTS IN SHIFTER LINKAGE. REPLACE TORN BOOT | |
| 1.00 | N | 11-12-1-312-172 | GASKET V.C. | 34.50 | 34.50 | | | @ REAR OF SHIFTER. NOTE: BUSHING IN BOTTOM OF | |
| 3.00 | N | 11-12-1-312-173 | GASKET V.C. M3 SMALL | 4.75 | 14.25 | | | SHIFT LEVER IS BROKEN, REPLACEMENT NOT LOCALLY | |
| 1.00 | N | 11-32-1-300-217 | SHIM VALVE ADJUST 33X3.65 | 5.70 | 5.70 | BM | 0.75 | COOLANT FLUSH, INCLUDES REPLACEMENT OF ALL | 67.50 |
| 6.00 | N | 12-12-9-061-867 | SPARK PLUG Y6DC | 13.30 | 79.80 | | | COOLANT, PRESSURE TESTING AND BLEEDING SYSTEM | |
| 1.00 | N | B2 | WASHER FLUID, LITERS | 1.50 | 1.50 | BM | 0.60 | BRAKE FLUID FLUSH | 54.00 |
| 1.00 | N | 23-12-1-202-394 | SEAL SHIFTER SHAFT | 8.20 | 8.20 | BM | 1.25 | REMOVE & REPLACE FUEL HOSES BETWEEN TANK & FILTER | 112.50 |
| 1.00 | N | 23-12-1-205-340 | OUTPUT SHAFT SEAL 8X40 | 10.00 | 10.00 | | | AND BETWEEN FILTER & PIPE TO ENGINE COMPARTMENT. | |
| 1.00 | N | 23-21-1-490-120 | LOCK PLATE | 1.05 | 1.05 | | | | |
| 1.00 | N | 23-31-1-228-470 | COVER DETENT | 9.30 | 9.30 | | | | |
| 4.00 | N | 18-30-1-737-774 | COPPER NUT - 10 MM | 0.26 | 1.04 | | | | |

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

RECOMMENDED SERVICES / FUTURE VEHICLE NEEDS

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis. If on deep analysis it is found that additional repairs are necessary, you will be contacted for authorization.

*NON-TAXED

X CUSTOMER SIGNATURE _____ DATE _____
 I have read and agree to the Loaner Car Agreement as set forth on the reverse.

X CUSTOMER SIGNATURE _____ DATE _____
 I acknowledge notice and oral approval of an increase in the original estimated price.

CONTINUED ON NEXT PAGE

ORIGINAL

IN WORK DONE CALLED

I hereby authorize the repair, work listed hereon, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorney's fees in the event default is made in any payment due. If automobile is returned to customer without repair services being performed, a diagnostic and handling charge (including reassembly) will be made. I have read and understand the above and acknowledge receipt of an estimate.

TERMS CASH: Unless arrangements made prior to authorization. Cars left after work is completed may be subject to a storage fee.

DATE 5/12

I hereby acknowledge receipt of merchandise and services set forth herein and a copy of this sales invoice.


1991 BMW MS
 LICENSE: 4MRJ652
 MILEAGE: 92864
 VIN #WBSHD9310MBK05515
 COLOR C: GLANZSCHWARZ
 PRODUCT: 09/90
 P/4DR.

DATE 5/15/01 INVOICE # 20732
 TIME 12:20PM CUSTOMER
 WRITTEN BY PAGE 2 OF 2

BAVARIAN
 PROFESSIONALS

1218 7th Street
 Berkeley, CA 94710
 (510) 524-6000
 BAR # AG111629
 BAR # AG111629

| QTY. | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT-PRICE |
|------|------|-----------------|-------------------------|-------|-----------|
| 2.00 | N | 22-31-1-094-916 | TRANSMISSION MOUNT | 14.70 | 29.40 |
| 1.00 | N | 25-11-1-220-198 | COUPLER | 11.00 | 11.00 |
| 4.00 | N | 25-11-1-220-439 | SHIM AT BASE OF HANDLE | 0.51 | 2.04 |
| 1.00 | N | 25-11-1-434-194 | FORM WASHER | 0.50 | 0.50 |
| 1.00 | N | 23-41-1-466-134 | PIN | 0.51 | 0.51 |
| 1.00 | N | 25-11-1-469-397 | BALL CUP SHIFTER BASE | 7.45 | 7.45 |
| 1.00 | N | 25-11-1-220-832 | BUSHING FRONT EXTENSION | 11.50 | 11.50 |
| 1.00 | N | 25-11-1-220-785 | ROOT SHIF TOWER | 21.50 | 21.50 |
| 1.50 | N | 88-88-6-900-316 | ANTI-FREEZE, GALLONS | 8.95 | 13.43 |
| 1.00 | N | 17-11-1-468-467 | RADIATOR DRAIN PLUG | 2.60 | 2.60 |
| 1.00 | N | 07-11-9-953-200 | SEAL BLOCK DRAIN | 0.25 | 0.25 |
| 1.00 | N | 01-22-9-407-512 | BRAKE FLUID, LITERS | 16.40 | 16.40 |
| 1.00 | N | 13-31-1-722-282 | HOSE BMW FUEL, METERS | 10.00 | 10.00 |
| 4.00 | N | GLOBAL 8-12 | HOSECLAMP GLOBAL 8-12 | 1.25 | 5.00 |

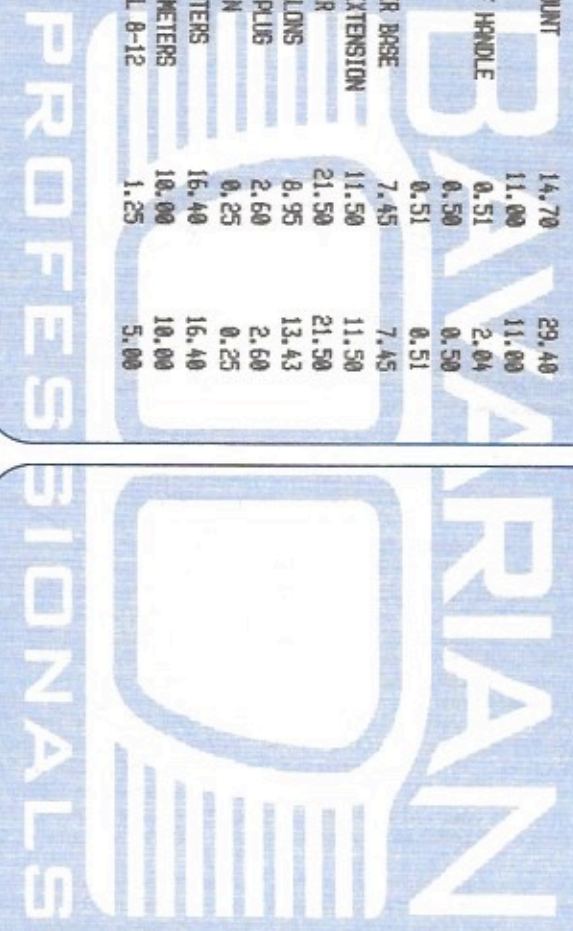

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

INSPECTION 2, X
 OIL SMELL PRESENT, X
 RECOMMENDED SERVICES / FUTURE VEHICLE NEEDS
 ENGINE OIL LEAKAGE, SOURCE/S UNKNOWN,
 BEAR SUSPENSION PROBLEMS; BRD L. ACCUMULATOR, LEAKING R. SHOCK,
 P/C VERY WEAK, MUSTY SMELL,
 FRONT SHAWBAR LINKS WORN,
 ODOMETER ILLUMINATION OUT. SLIGHT PULSATION ON BRAKING - WARPED ROTORS.

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis. If on closer analysis it is found that additional repairs are necessary, you will be contacted by authorization.

ORIGINAL ESTIMATE \$1700.00

CUSTOMER SIGNATURE
 I have read and agree to the Loaner Car Agreement as set forth on the reverse.
 DATE 5/12

PAID #2145 5/17/01

CUSTOMER SIGNATURE
 I acknowledge notice and oral approval of an increase in the original estimated price.
 DATE 5/12

* NON-TRKED

| METHOD OF PAYMENT | DATE | PARTS | LABOR | OIL TR | SUB TOT | TAX |
|-------------------|------|--------|--------|--------|----------|-------|
| | | 376.86 | 927.00 | 10.03* | 1,314.32 | 30.15 |

TOTAL \$1,344.47
 #2145

ORIGINAL

BAVARIAN PROFESSIONALS

MAJOR SERVICE CHECKLIST **Late**

Technician's Signature _____

Customer **ROBYN**

Date **5/15/01**
R/O

License # **4MRJ652**
Mileage **92864**

DRAIN ENGINE OIL

R&R OIL FILTER

REPLACE TRANSMISSION OIL **ATE** *reason*

Trans. leaks: slightly **substantially**

REPLACE DIFFERENTIAL OIL **purple**

Diff leaks: slightly **substantially**

FRONT BRAKES

Pads: **good** _____ % worn unsafe

Rotors: **good** lip bad

REAR BRAKES

Pads: **good** _____ % worn unsafe

Rotors: **good** lip bad

DRIVE BELTS: **good** cracked

Adjust tension if necessary

ALTERNATOR BUSHINGS: **good** some play bad

WATER PUMP: **good** past leakage leaking

THERMOSTAT HOUSING: **good** past leakage leaking

BALL JOINTS

Left: **good** **worn boot** worn unsafe *upper*

Right: **good** tom boot worn unsafe

IDLER ARM: **good** worn unsafe

TIE RODS

Left: **good** worn unsafe

Center: **good** worn unsafe

Right: **good** worn unsafe

PUSHSTRUT BUSHINGS: **good** tom unsafe

BRAKE MASTER: leaking *white plastic inserts*

CLUTCH SLAVE: leaking

REAR TRANSMISSION MOUNT: **good** bad *one is only 2 swollen*

SHIFT TOWER MOUNTS: **good** bad *rotates*

SHIFTER LINKAGE: **good** **worn** *rebuild*

FLEX DISC: **good** slightly cracked bad *backwards*

HALF SHAFT JOINTS: **good** stiff tom boot *connects*

EXHAUST SYSTEM

Catalytic converter: **good** **loose element** leaking *Buzzy*

Trans/exhaust bracket: **good** bad *part is missing*

Heat shielding: **good** loose broken *↑ instructed*

Rear muffler: **good** loose baffle leaking

Muffler hangers: **good** cracked

FUEL FILTER R&R

STEERING BOX OIL LEVEL

AIR FILTER R&R

PRESSURE TEST COOLING SYSTEM

Radiator hoses/clamps: **good** marginal unsafe

Radiator: **good** leaks cold major leakage

COOLANT LEVEL/CONDITION: **good** low weak old

last flush: **UNKNOWN**

ADD ENGINE OIL

COMPRESSION TEST

1) 210 2) 220 3) 220 4) 215 5) 225 6) 220

ADJUST VALVES

TIMING CHAIN/BELT: **good** worn unsafe

Small 6cyl - Replace rocker plugs

CAMSHAFT: **good** grooved pitted

ROCKERS: **good** loose

REPLACE VALVE COVER GASKET - **LEAKING**

DISTRIBUTOR CAP: **good** bad **PREVIOUSLY?**

ROTOR: **good** bad

Motronic: Recommend inspection

GAP & INSTALL SPARK PLUGS

REFILL WASHER RESERVOIR qty: **1 liter**

Washer system: **good** inop. clogged jets

WIPERS: **good** worn

SHOCK ABSORBERS

Front: **good** bad unsafe **L. ACCUMULATOR BAD**

Rear: **good** bad unsafe **R. SHOCK SEPARING**

CHECK/ADJUST PARKING BRAKE

CLUTCH MASTER: **good** leakage

LIGHTS

HEATER BLOWER: **good** inop. **65°F OUTLET**

A/C: **good** **weak** inop. **MUSTY SMALL**

Check freon charge

Interior: Interior light glove box light stereo dash illumination temp. control window operation seat operation central locking seat belts trunk light **out**

LUBE DOOR, HOOD, AND TRUNK HINGES

RESET SERVICE LIGHTS

FRONT WHEEL BEARINGS: **good** loose rough

SET TIRE PRESSURES **CONDITION**

| | | | |
|--------|----------|-------------|------------|
| R/Fr: | low leak | good | % worn out |
| L/Fr: | low leak | good | % worn out |
| R/R: | low leak | good | % worn out |
| L/R: | low leak | good | % worn out |
| Spare: | low leak | good | % worn out |

BRAKE FLUID LEVEL: **good** low **dirty**

last flush: **UNKNOWN** **↑ pushed**

BATTERY ELECTROLYTE LEVEL

Clean terminals if necessary

FUSES: **good** corroded

LOAD TEST BATTERY: pass **marginal** fail

BATTERY VOLTAGE @ IDLE: **13.8** v

CHARGING SYSTEM OUTPUT: **110** amps under max load

CLEAN THROTTLE BODY

ADJUST ICV CURRENT: _____ mA

CHECK O2 SENSOR FUNCTION

SET AIRFLOW METER: _____ v

STICKER

STAMP BOOKLET **no booklet**

IN WORK DONE CALLED

I hereby authorize the repair work listed hereon, including sublet work, to be done along with necessary maintenance. You and your employees may operate the described vehicle for purposes of testing, inspection or assembly, at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs hereon. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorney's fees in the event default is made in any payment due. If automobile is returned to customer without repair service being performed, a diagnostic and handling charge (including reassembly) will be made. I have read and understand the above and acknowledge receipt of an estimate.


X TERMS CASH: Unless arrangements made prior to authorization, cars left after work is completed may be subject to a storage fee.
DATE _____

Buyer hereby acknowledges receipt of merchandise and services set forth herein and a copy of this sales invoice.
DATE _____

1991 BMW MS
LICENSE: 4MRJ652
MILEAGE: 91517
VIN : WBSHD9310MBK05515
COLOR: C:GLANZSCHWARZ
PRODUCT: 09/90
STADDR: _____

BAVARIAN
1218 7th Street
Berkeley, CA
94710
(510) 524-6000
PROFESSIONALS BAR # AG111629
BAR # AG111629

DATE 1/24/01 INVOICE # 19802
TIME 9:31AM CUSTOMER
WRITTEN BY PAGE 1 OF 1
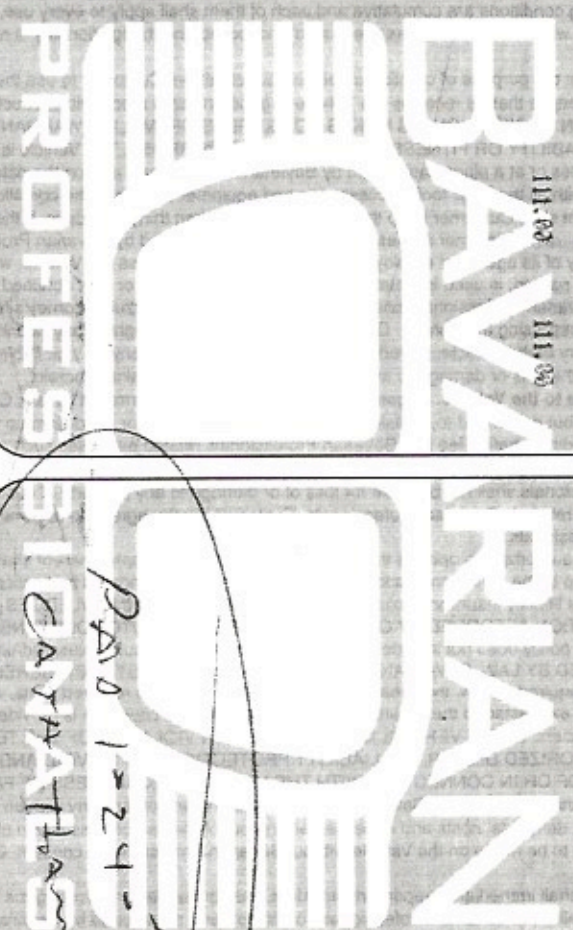
| QTY. | CODE | PART NUMBER | PART DESCRIPTION | PRICE | EXT. PRICE | EMP. | HRS. | LABOR OPERATION | PRICE |
|---|------|-----------------|------------------|--------|------------|------|------|-----------------|-------|
| 1.00 | N | 64-11-1-468-414 | ACTRATOR | 111.00 | 111.00 | | | | |
|  | | | | | | | | | |
| <p><i>PAID 1-24-01</i></p> <p><i>PROFESSIONALS FOR US</i></p> | | | | | | | | | |

REASONS FOR SERVICE / VEHICLE PROBLEM STATEMENTS

RECOMMENDED SERVICES / FUTURE VEHICLE NEEDS

DRIVER'S DOOR DRAGS. ENGINE AND TRAIL, LEAK, TRAIL, OIL LEVEL SHOULD BE CHECKED. INTERMITTENT QUIZ UNDERPASS. SHIFT FOOT IS TORN. FLEX DISC IS BACKWARDS.

ESTIMATE OF REPAIRS: Includes all parts, labor, handling and diagnosis. If on closer analysis it is found that additional repairs are necessary, you will be contacted for authorization.
ORIGINAL ESTIMATE \$119.88

X CUSTOMER SIGNATURE _____ DATE _____
I have read and agree to the Loaner Car Agreement as set forth on the reverse.

X CUSTOMER SIGNATURE _____ DATE _____
I acknowledge notice and oral approval of an increase in the original estimated price.

METHOD OF PAYMENT PARTS 111.00
LABOR 0.00
TAX 8.88

TOTAL \$119.88

DUPLICATE