

Specialty Car Solutions
 PO Box 70829
 Houston, TX 77270
 (713) 702-4864
 Providing complete vehicle service
 at Alara Garage

Invoice # 55493

1986 Ferrari Testarossa Base

VIN: ZFFSA17A7G0061223

Engine: H12 4.9L, 4943cc, DOHC, GAS, FI, 5
 Trans:

License # JMD7309

Odom: 43813

Color: Red

Mfg. Date:

Unit #

InvDate: 8/20/2019

Service Writer: Michael Keith

Status: Complete

Driver:

PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | | Ext |
|------------------|----------------------|--------------------|-----|-----|-------|--|-----|
|------------------|----------------------|--------------------|-----|-----|-------|--|-----|

Customer states that: Engine is losing power and may not be running on all cylinders

| | | | | | | | |
|---|--|--|------|-------|--------|--|--------|
| Labor Service - Diagnose power loss issue: verify prior diagnosis of no spark in bank 1 -6; test ignition amplifiers, coils, flywheel sensors; ignition wires. Test continuity in wiring harness of ignition module. Check for proper grounding. JOSE | | | 4.00 | | 115.00 | | 460.00 |
| Labor Service - Replace ignition ECU provided by customer JOSE | | | 0.50 | | 115.00 | | 57.50 |
| Labor Service - Replace all spark plugs; includes gapping to factory specification where applicable. JOSE | | | 2.00 | | 115.00 | | 230.00 |
| <i>New 2120 Spark plug</i> | | | | 12.00 | 8.72 | | 104.64 |

Technician states: In addition to the module & spark plugs, other ignition system components should be replaced due to age, in order to insure longevity of ignition system operation.

| | | | | | | | |
|---|--|--|------|------|----------|--|----------|
| Labor Service - Replace both flywheel sensors JOSE | | | 0.50 | | 115.00 | | 57.50 |
| <i>New 119052 Flywheel sensor - engine position</i> | | | | 1.00 | 256.62 | | 256.62 |
| <i>New 124241 Flywheel sensor - engine speed</i> | | | | 1.00 | 104.63 | | 104.63 |
| Labor Service - Replace spark plug wires, both distributor caps, both rotors, & both ignition coils (coils provided by customer). Plug wires had to be mocked up & trimmed to fit properly, which made labor time exceed estimate. JOSE | | | 4.00 | | 115.00 | | 460.00 |
| <i>New 99100334 Ignition wire set</i> | | | | 1.00 | 1,192.50 | | 1,192.50 |
| <i>New 95300040R Distributor cap</i> | | | | 2.00 | 530.10 | | 1,060.20 |
| <i>New 126139R Distributor rotor</i> | | | | 2.00 | 76.89 | | 153.78 |
| <i>New SHIPPING-IGN SYS.PTSShipping for ignition components</i> | | | | 1.00 | 52.69 | | 52.69 |

Technician states: There are some fuel system items that should be addressed.

| | | | | | | | |
|---|--|--|------|--|--------|--|--------|
| Labor Service - Repair oxygen sensor connector. We had to replace one of them. JOSE | | | 1.50 | | 115.00 | | 172.50 |
| Labor Service - Check & adjust fuel system mixture. *Only initial tuning was done because the car began leaking fuel.* JOSE | | | 1.00 | | 115.00 | | 115.00 |

Technician states: The engine coolant is extremely rusty in appearance.

| | | | | | | | |
|---|--|--|-------|------|--------|--|----------|
| Labor Service - R&R both radiators. This took more time than estimated due to difficulty of operation being more than that which we expected. JOSE | | | 10.00 | | 115.00 | | 1,150.00 |
| <i>New SHIPPING-WATERHOSESShipping for radiator hoses</i> | | | | 1.00 | 12.74 | | 12.74 |
| <i>New 125010 Radiator seal</i> | | | | 1.00 | 25.30 | | 25.30 |
| <i>New 122696 Radiator hose</i> | | | | 4.00 | 45.79 | | 183.16 |
| <i>Sublet RADIATOR CLEAN Clean, flow, & pressure test radiator; repair as necessary</i> | | | | 2.00 | 418.00 | | 836.00 |
| <i>New SHIPPING8343 Shipping for radiator seal</i> | | | | 1.00 | 13.47 | | 13.47 |
| <i>New CLAMP Hose clamp</i> | | | | 4.00 | 6.70 | | 26.80 |
| Labor Service - Flush & bleed cooling system. This took more time than expected. In order to clean out the rest of the cooling system, it was necessary to run the car with water & repeatedly drain the cooling system until it came out clean. JOSE | | | 3.00 | | 115.00 | | 345.00 |
| <i>New COOLANT Coolant/distilled water - 50/50 mix (per gallon)</i> | | | | 4.00 | 20.81 | | 83.24 |
| Labor Service - Replace coolant reservoir JOSE | | | 1.00 | | 115.00 | | 115.00 |
| <i>New SHIPPING-CAP Shipping for radiator cap</i> | | | | 1.00 | 3.98 | | 3.98 |
| <i>New 137644 Expansion tank cap</i> | | | | 1.00 | 48.67 | | 48.67 |

Technician states: The vehicle needs an Oil and Filter Service.

Specialty Car Solutions
 PO Box 70829
 Houston, TX 77270
 (713) 702-4864
 Providing complete vehicle service
 at Alara Garage

Invoice # 55493

1986 Ferrari Testarossa Base

License # JMD7309

InvDate: 8/20/2019

| | | | | |
|---|------|-------|--------|--------|
| Labor Service - Change engine oil & filter JOSE | 1.00 | | 115.00 | 115.00 |
| New 124228 Oil filter | | 1.00 | 198.73 | 198.73 |
| New 20W50SHELL Engine oil - 20W50 (per quart) | | 16.00 | 9.63 | 154.08 |

Technician states: Brake hydraulic system needs to be flushed.

| | | | | |
|--|------|------|--------|--------|
| Labor Service - Complete flush & refill of brake hydraulic system JOSE | 1.50 | | 115.00 | 172.50 |
| New DOT4 Brake fluid DOT4 (per pint) | | 3.00 | 9.04 | 27.12 |

Technician states: The Horn doesn't work.

| | | | | |
|--|------|--|--------|--------|
| Labor Service - Diagnose inoperable horn, which turned out to be an open ground circuit on the horn compressor. JOSE | 1.00 | | 115.00 | 115.00 |
| Labor Service - Repair horn compressor ground circuit JOSE | 1.00 | | 115.00 | 115.00 |

Technician states: Air filter is extremely dirty & coming apart.

| | | | | |
|---|------|------|--------|--------|
| Labor Service - Replace air filter JOSE | 0.50 | | 115.00 | 57.50 |
| New 137176 Air filter | | 1.00 | 135.79 | 135.79 |

Technician states: During initial run after ignition system work car stalled & would not restart.

| | | | | |
|--|------|--|--------|--------|
| Labor Service - Diagnose no-start as a complete loss of ignition system signal. Check all pins in ignition harness for tightness, & inspect harness for flywheel sensors. JOSE | 1.50 | | 115.00 | 172.50 |
| Labor Service - Repair breaks in flywheel sensor harness JOSE | 2.00 | | 115.00 | 230.00 |

Notes

Customer will supply ignition ECU & ignition coils.
 Vehicle developed a fuel leak while running it during tuning of fuel system.

| | | | | | | | | | | | | | | | | | | | | | | | |
|--|---|------------------------------|-----------------------|-------|----------|----------------|---------|--------|--------|--------|--------|---------------|--------|--|--|-----------|----------|----------------|--------|--|--|--------------|-----------------|
| <p>Warranty All repair work is warranted for 90 days.</p> <p style="font-size: small; color: red;">I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and /or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.</p> <p style="color: red; font-size: 2em; margin-top: 10px;">X</p> <p style="font-size: small; color: red;">Terms: Payment in full is due & vehicle must be picked up (if not a storage customer of Alara Garage) within 5 business days of receipt of this invoice or be subject to storage charges.</p> <p style="color: red; font-size: 2em; margin-top: 10px;">X</p> <p style="font-size: small; color: red;">Customer acknowledges receipt of merchandise and services.</p> | <p>Invoice Summary</p> <table border="0" style="width: 100%; font-size: small;"> <tr><td>Parts</td><td style="text-align: right;">3,600.82</td></tr> <tr><td>Labor</td><td style="text-align: right;">4,140.00</td></tr> <tr><td>Labor Discount</td><td style="text-align: right;">-207.00</td></tr> <tr><td>Sublet</td><td style="text-align: right;">836.00</td></tr> <tr><td>Fluids</td><td style="text-align: right;">237.32</td></tr> <tr><td>Supply Charge</td><td style="text-align: right;">200.00</td></tr> <tr><td colspan="2"> </td></tr> <tr><td>Sub Total</td><td style="text-align: right;">8,807.14</td></tr> <tr><td>Sales Tax (TX)</td><td style="text-align: right;">333.15</td></tr> <tr><td colspan="2"> </td></tr> <tr><td>Total</td><td style="text-align: right;">9,140.29</td></tr> </table> | Parts | 3,600.82 | Labor | 4,140.00 | Labor Discount | -207.00 | Sublet | 836.00 | Fluids | 237.32 | Supply Charge | 200.00 | | | Sub Total | 8,807.14 | Sales Tax (TX) | 333.15 | | | Total | 9,140.29 |
| Parts | 3,600.82 | | | | | | | | | | | | | | | | | | | | | | |
| Labor | 4,140.00 | | | | | | | | | | | | | | | | | | | | | | |
| Labor Discount | -207.00 | | | | | | | | | | | | | | | | | | | | | | |
| Sublet | 836.00 | | | | | | | | | | | | | | | | | | | | | | |
| Fluids | 237.32 | | | | | | | | | | | | | | | | | | | | | | |
| Supply Charge | 200.00 | | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | | | |
| Sub Total | 8,807.14 | | | | | | | | | | | | | | | | | | | | | | |
| Sales Tax (TX) | 333.15 | | | | | | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | | | | | | |
| Total | 9,140.29 | | | | | | | | | | | | | | | | | | | | | | |
| Page 2 of 2 | Discard old parts | Original Estimate: 11,312.94 | Total 9,140.29 | | | | | | | | | | | | | | | | | | | | |

Specialty Car Solutions
 PO Box 70829
 Houston, TX 77270
 (713) 702-4864
 Providing complete vehicle service
 at Alara Garage

Invoice # 55554

1986 Ferrari Testarossa Base

VIN: ZFFSA17A7G0061223

Engine: H12 4.9L, 4943cc, DOHC, GAS, FI,
 Trans:

License # JMD7309
 Odom: 0
 Color: Red
 Mfg. Date:
 Unit #

Inv Date: 10/07/2019
 Service Writer: Michael Keith
 Status: Complete
 Driver: Radom, Tom
 PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Warr. | Ext |
|------------------|----------------------|--------------------|-----|-----|-------|-------|-----|
|------------------|----------------------|--------------------|-----|-----|-------|-------|-----|

Customer states that: Engine intermittently stalls while driving. Tachometer drops to zero, which indicates likely loss of ignition spark.

| | | | | | | | |
|--|------|--|--------|--|--|--|--------|
| Labor Service - Diagnose loss of ignition spark. Test ignition components & associated wiring circuits. Find that bumping fuse panel causes car to stall. Remove fuse panel. Inspect & clean all connections. Inspect fuse panel for visible faults. Reinstall fuse panel & find that stalling is still consistent with bumping fuse panel. Narrow the issue down to an open with the lower right horizontal connector, which contains the circuit sending voltage out to the coil. JOSE | 3.00 | | 115.00 | | | | 345.00 |
|--|------|--|--------|--|--|--|--------|

| | | | | | | | |
|--|------|------|----------|--|--|--|----------|
| Labor Service - R&R fuse panel; includes additional labor time to run new circuits made necessary by modifications to fuse panel. JOSE | 6.00 | | 115.00 | | | | 690.00 |
| Sublet FUSE PANEL REBUILD Rebuild fuse panel & add "Source" upgarded brass buss bar | | 1.00 | 2,666.36 | | | | 2,666.36 |
| New SHIPPING4762 Shipping charges | | 1.00 | 37.89 | | | | 37.89 |

Customer states that: Engine does not hold idle but will immediately restart.

| | | | | | | | |
|---|------|--|--------|--|---------|--|------|
| Labor Service - Tune CIS fuel injection system for proper mixture & idle. Road test & re-tune as necessary. *warranty from previous service* JOSE | 1.00 | | 115.00 | | -115.00 | | 0.00 |
|---|------|--|--------|--|---------|--|------|

Customer requests that: Replace oxygen sensors as recommended during previous service.

| | | | | | | | |
|--|------|------|--------|--|--|--|--------|
| Labor Service - Replace both oxygen sensors JOSE | 2.00 | | 115.00 | | | | 230.00 |
| New DAC 6907 Oxygen sensor with factory-style wire harness connections (OEM) | | 2.00 | 137.56 | | | | 275.12 |

The technician states that: Coolant hoses are old and deformed and leaking.

| | | | | | | | |
|---|------|------|--------|--|--|--|--------|
| Labor Service - Pressure test cooling system, & replace leaking hoses as front of motor; includes R&R of upper & lower covers for access. Re-test system, & replace an additional hose at the front of the motor found to be leaking. Labor charges due to difficulty in accessing leaking hoses with engine in place. JOSE | 6.00 | | 115.00 | | | | 690.00 |
| New 28409 Heater hose 3/8 (per foot) | | 6.00 | 2.38 | | | | 14.28 |

| | | | | | | | | | | | | | | | | | | |
|---|--|--|-------|--------|-------|----------|--------|----------|---------------|-------|--|--|-----------|----------|----------------|-------|--------------|-----------------|
| <p>Warranty All repair work is warranted for 90 days.</p> <p>I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and /or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.</p> <p>X _____ Terms: Payment in full is due & vehicle must be picked up (if not a storage customer of Alara Garage) within 5 business days of receipt of this invoice or be subject to storage charges.</p> <p>X _____ Customer acknowledges receipt of merchandise and services.</p> | <p align="right">Original Estimate: 5,049.77</p> | <p>Invoice Summary</p> <table border="0"> <tr><td>Parts</td><td align="right">327.29</td></tr> <tr><td>Labor</td><td align="right">1,955.00</td></tr> <tr><td>Sublet</td><td align="right">2,666.36</td></tr> <tr><td>Supply Charge</td><td align="right">68.47</td></tr> <tr><td colspan="2"> </td></tr> <tr><td>Sub Total</td><td align="right">5,017.12</td></tr> <tr><td>Sales Tax (TX)</td><td align="right">32.65</td></tr> <tr><td>Total</td><td align="right">5,049.77</td></tr> </table> | Parts | 327.29 | Labor | 1,955.00 | Sublet | 2,666.36 | Supply Charge | 68.47 | | | Sub Total | 5,017.12 | Sales Tax (TX) | 32.65 | Total | 5,049.77 |
| Parts | 327.29 | | | | | | | | | | | | | | | | | |
| Labor | 1,955.00 | | | | | | | | | | | | | | | | | |
| Sublet | 2,666.36 | | | | | | | | | | | | | | | | | |
| Supply Charge | 68.47 | | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | | |
| Sub Total | 5,017.12 | | | | | | | | | | | | | | | | | |
| Sales Tax (TX) | 32.65 | | | | | | | | | | | | | | | | | |
| Total | 5,049.77 | | | | | | | | | | | | | | | | | |

Specialty Car Solutions
 PO Box 70829
 Houston, TX 77270
 (713) 702-4864
 Providing complete vehicle service
 at Alara Garage

Invoice # 55548

1986 Ferrari Testarossa Base

VIN: ZFFSA17A7G0061223

Engine: H12 4.9L, 4943cc, DOHC, GAS, FI, 5

Trans:

License # JMD7309

Odom: 0

Color: Red

Mfg. Date:

Unit #

InvDate: 10/02/2019

Service Writer: Noah Broome

Status: Complete

Driver:

PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Disc. | Ext |
|---|----------------------|---------------------------------------|------|-------|--------|--------|--------|
| Technician states: Vehicle developed a fuel leak while tuning motor. | | | | | | | |
| Labor Service - Replace all four rubber fuel return hoses at rear bulkhead JOSE | | | 4.00 | | 115.00 | | 460.00 |
| | New 65152 | Fuel injection hose - 5/16 (per foot) | | 10.00 | 9.62 | | 96.20 |
| | New CLAMP | Fuel hose clamp | | 8.00 | 6.70 | -21.60 | 32.00 |
| Labor Service - Finish tuning fuel system JOSE | | | 1.00 | | 115.00 | | 115.00 |

| | | |
|--|---|---------------------------|
| <p>Warranty All repair work is warranted for 90 days.</p> <p>I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and /or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.</p> <p>X _____ Terms: Payment in full is due & vehicle must be picked up (if not a storage customer of Alara Garage) within 5 business days of receipt of this invoice or be subject to storage charges.</p> <p>X _____ Customer acknowledges receipt of merchandise and services.</p> | <p align="right">Invoice Summary</p> <p>Parts 128.20 Labor 575.00 Supply Charge 21.10</p> <p align="right">Sub Total 724.30 Sales Tax (TX) 12.32</p> <p align="right">Total 736.62</p> | |
| Page 1 of 1 | Discard old parts | Original Estimate: 736.62 |

Specialty Car Solutions

PO Box 70829
Houston, TX 77270
(713) 702-4864

Providing complete vehicle service
at Alara Garage

Invoice # 55621

1986 Ferrari Testarossa Base

VIN: ZFFSA17A7G0061223

Engine: H12 4.9L, 4943cc, DOHC, GAS, FI,
Trans:

License # JMD7309

Odom: 0

Color: Red

Mfg. Date:

Unit #

Inv Date: 11/27/2019

Service Writer:

Status:

Driver:

PO #

| Vehicle Problems | Requests for Service | Services Performed | Hrs | Qty | Price | Ext |
|------------------|----------------------|--------------------|-----|-----|-------|-----|
|------------------|----------------------|--------------------|-----|-----|-------|-----|

Customer requests that: Major engine-out service

| | | | | | | |
|--|----------------|---|-------|------|----------|----------|
| Labor Service - Major cam belt/water pump service: | | | 45.00 | | 120.00 | 5,400.00 |
| -R&R motor | | | | | | |
| -Replace both cam belts & tensioner pulleys, as well as all accessory drive belts; adjust cam timing as needed | | | | | | |
| -Change engine oil & filter | | | | | | |
| -Change transaxle oil | | | | | | |
| -Replace all front engine seals | | | | | | |
| -Replace water pump & thermostat | | | | | | |
| -Check valve lash; adjust as needed | | | | | | |
| -Replace air filters | | | | | | |
| -Replace spark plugs & ignition wires | | | | | | |
| New | 99100919 | Major service kit | | 1.00 | 1,342.50 | 1,342.50 |
| New | 109671/B | Thermostat | | 2.00 | 264.84 | 529.68 |
| New | 99200114 | Water pump rebuild kit | | 1.00 | 276.75 | 276.75 |
| Part^ | COMMWATERPUMP | Rebuild water pump | | 1.00 | 205.00 | 205.00 |
| New | 3374650 019574 | Motor Oil 10W-40 6100 SYN+ 5L (per 5 liter container) | | 3.00 | 64.93 | 194.79 |
| New | 58305 | Gear Oil 75W-90 NS GL-5 (per gallon) | | 3.00 | 126.98 | 380.94 |
| Labor Service - Complete flush & refill of brake hydraulic system | | | 2.00 | | 120.00 | 240.00 |
| New | DOT4 | Brake fluid DOT4 (per pint) | | 3.00 | 9.04 | 27.12 |
| Labor Service - Replace hydraulic clutch oil | | | 1.00 | | 120.00 | 120.00 |
| New | DOT4 | Brake fluid DOT4 (per pint) | | 1.00 | 9.04 | 9.04 |
| Labor Service - Inspection & adjustment of all items not addressed during cam belt service as prescribed in owner's manual: brakes; suspension; steering; exhaust; battery; starter; alternator; alignment settings; lubricate body hinges; seat belts; bodywork screws; headlamp adjustment; chassis; road test | | | 2.00 | | 120.00 | 240.00 |

| | | | | | | | | | | | | | | | | | |
|--|---|-------|----------|-------|----------|--------|--------|---------------|--------|--|--|-----------|----------|----------------|--------|--------------|-----------------|
| <p>Warranty All repair work is warranted for 90 days.</p> | <p>Quote Summary:</p> <table style="width: 100%;"> <tr> <td>Parts</td> <td style="text-align: right;">2,760.82</td> </tr> <tr> <td>Labor</td> <td style="text-align: right;">6,000.00</td> </tr> <tr> <td>Sublet</td> <td style="text-align: right;">205.00</td> </tr> <tr> <td>Supply Charge</td> <td style="text-align: right;">200.00</td> </tr> <tr> <td colspan="2"> </td> </tr> <tr> <td>Sub Total</td> <td style="text-align: right;">9,165.82</td> </tr> <tr> <td>Sales Tax (TX)</td> <td style="text-align: right;">244.27</td> </tr> <tr> <td>Total</td> <td style="text-align: right;">9,410.09</td> </tr> </table> | Parts | 2,760.82 | Labor | 6,000.00 | Sublet | 205.00 | Supply Charge | 200.00 | | | Sub Total | 9,165.82 | Sales Tax (TX) | 244.27 | Total | 9,410.09 |
| Parts | 2,760.82 | | | | | | | | | | | | | | | | |
| Labor | 6,000.00 | | | | | | | | | | | | | | | | |
| Sublet | 205.00 | | | | | | | | | | | | | | | | |
| Supply Charge | 200.00 | | | | | | | | | | | | | | | | |
| | | | | | | | | | | | | | | | | | |
| Sub Total | 9,165.82 | | | | | | | | | | | | | | | | |
| Sales Tax (TX) | 244.27 | | | | | | | | | | | | | | | | |
| Total | 9,410.09 | | | | | | | | | | | | | | | | |

CUSTOMER #: F4830

55924

INVOICE

PAGE 1



FERRARI OF HOUSTON

6100 Southwest FWY
Houston TX 77057
(713) 772-3868
www.ferrariofhouston.com

SERVICE ADVISOR: 621 GIUSEPPE DIBLASIO

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE, R.O. OPENED, READY, OPTIONS.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Contains service items like ANNUAL SERVICE, OIL RESERVOIR REPAIR, and various filters/gaskets.

PARTS: 955.05 LABOR: 3885.00 OTHER: 0.00 TOTAL LINE A: 4840.05
46269 VEHICLE DUE PERFORMED ANNUAL SERVICE. PERFORMED ENGINE OIL AND FILTER CHANGE, PERFORMED BRAKE FLUID FLUSH, FOR NEXT FLUID FLUSH RECOMMEND REMOVING THE BRAKE FLUID RESERVOIR AND REPLACING SEAL BETWEEN THE RESERVOIR AND MASTER CYLINDER, THIS WILL ALLOW FOR BETTER CLEANING OF THE FRONT COMPARTMENT. DURING OIL CHANGE FOUND DRAIN PLUG TREADS ON OIL RESERVOIR CROSS TREADED, REMOVED LOWER CAP OF RESERVOIR AND INSTALLED NEW HELIX TREAD REPAIR KIT TO PREVENT LEAKS.

Table with columns: WARRANTY DISCLAIMER, SHOP SUPPLY COSTS, DESCRIPTION, TOTALS, ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED, PLEASE PAY THIS AMOUNT.

NOTICE OF WORKER'S LIEN PURSUANT TO TEXAS PROPERTY CODE s. 70.001: The undersigned, being the person who has paid for repairs to the vehicle described in this Repair Invoice, understands that if the Dealership relinquishes possession of the vehicle in return for payment via a check, money order or credit card transaction that is stopped or dishonored due to insufficient funds, no funds, or because the account does not exist or has been closed, the worker's lien continues to exist and the Dealership is entitled to possession of the vehicle in accordance with S. 9.609 of the Texas Business & Commerce Code until the amount due is paid.

CUSTOMER #: F4830

55924

INVOICE

PAGE 2



FERRARI OF HOUSTON

6100 Southwest FWY
Houston TX 77057
(713) 772-3868
www.ferrariofhouston.com

SERVICE ADVISOR: 621 GIUSEPPE DIBLASIO

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes data for ROSSO, 86, FERRARI TESTAROSSA, ZFFSA17A7G0061223, JMD7309, 46269/46274, T61223, 01JAN86 DD, 16:30 01AUG22, CASH, 08AUG22.

Table with columns: R.O. OPENED, READY, OPTIONS, LIST, NET, TOTAL. Includes data: 17:13 27JUL22, 15:46 08AUG22, CUSTOMER PAY SHOP CHARGE FOR REPAIR ORDER, 139.00.

WARRANTY DISCLAIMER: ALL PARTS AND ACCESSORIES ARE SOLD AND ALL REPAIRS ARE PROVIDED BY THE DEALERSHIP AS-IS. THE DEALERSHIP HEREBY DISCLAIMS ALL WARRANTIES, EXPRESS AND IMPLIED, INCLUDING ANY IMPLIED WARRANTIES OF MERCHANTABILITY AND FITNESS FOR A PARTICULAR PURPOSE...

*SHOP SUPPLY COSTS: We have added a charge of 15% of labor with a minimum of \$4.75 and not to exceed \$249.00 for shop supplies used in connection with this repair.

ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.

Table with columns: DESCRIPTION, TOTALS. Includes rows for LABOR AMOUNT (3885.00), PARTS AMOUNT (955.05), GAS, OIL, LUBE (0.00), SUBLET AMOUNT (0.00), MISC. CHARGES * (139.00), TOTAL CHARGES (4979.05), LESS INSURANCE (0.00), SALES TAX (90.26).

DATE CUSTOMER SIGNATURE AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE

PLEASE PAY THIS AMOUNT 5069.31

NOTICE OF WORKER'S LIEN PURSUANT TO TEXAS PROPERTY CODE s. 70.001: The undersigned, being the person who has paid for repairs to the vehicle described in this Repair Invoice, understands that if the Dealership relinquishes possession of the vehicle in return for payment via a check, money order or credit card transaction that is stopped or dishonored due to insufficient funds, no funds, or because the account does not exist or has been closed, the worker's lien continues to exist and the Dealership is entitled to possession of the vehicle in accordance with S. 9.609 of the Texas Business & Commerce Code until the amount due is paid.