PATRICIC OTTIS 1220 TENTH STREET BERKEURY, CAUFORNIA 94710 ARD NO 120777

INVOICE NO. 767371

SHIP TO:	
ADDRESS:	
CITY, STATE, ZIP	

CUSTOMER'S C	ORDER:	SOLD BY:61	TERMS IN YOU	44553 MI	DATESEP	TOMBAZ Z
QUANTITY		DI	ESCRIPTION		PRICE	AMOUNT
SAUG	1 CONTINU	R INVESTIG	ATION WE 'NO	TUR DOWN O	N POWER	1
			CAM S MILES O	1		
	DISCONN	WT BATTER	1. Remode CAR	BURNEON AU	RROG.	
	4 Remare	BOOM IGNITION	J DISTURTORS	. RUN BND	AUBERT	e Boar
	5 OH DITTE	IBUZINZ MACE	HAVE. NOTE ONE	CONTACT SE	7 IN RIG	T
	6 IGNITION I	KTRIBUTER.	IS VIRTURLY CLOS	Sers, Ann Au	4 CONTR	ल इन्द्र
	7 ARE FRE	M DIFFERENT	CENERATIONS OF P	IANUPACTURE	?	
	8 ADOV	POINTS IN A	BOTH DICTUROTOR	S ASSURE (	CORRECT	
	9 macronic	AL ADVANCE	IN BOOK. REING	ENL DISTRIB	rams B	rae
	10 as a mo	enz, curece	LADAUST LANTZUM	s there . I	ZOAD TOS	7

INVOICE

SHIP TO: ADDRESS: CITY, STATE, ZIP									
CUSTOMER'S	OR C	DER:	SOLD BY:	TERMS:		44553 n	1 82 SI	PPT 2022	
QUANTITY				ESCRIPTION			PRICE	AMOUNT	
	1	CMR TO	SAN RAFAL	LBRIDGE	. W174 '	IMPROVINO P	erforma	NCE.	
	2	NOTE M	SO DRONE	/ VIBRAGE	ERON	n Cumssis A	7 70 MF	of,	
	3	AND SCI	entory 15-	1 2 NO G	ena opi	carcios.	Currence		
	4	ADVIET	CARBURATER	- Syrcumo	MIZATION	J (CARBORA	ZURS AR	K FICTURY	
	5	RUNSTA	L CAMB AIR	BOY DEL	IVER CM	L BACK TO F	ANTASY	4.5	
			Mucaon						
	7	than the	STONE POWE	2. our	RECOMME	NOWWOON IS.	5 Spence	e.	
			DISTRUBUTION						
			PREVENCORS	COMPLETE	9 6	COMPRESSION .	TOCT MA	tors.	
	10	RUAD .	TORT TO GO	7 TOMPENA	TOWNER - to	y noun	Zenose	Anna	

767373

NVOICE L721 ©2004 REDIFORM®

						SHIP TO:			<del>-, - 11-1-</del>			
						ADDRESS:						
						CITY, STAT	E, ZIP					
CUSTOMER'S ORI	DER:		SOLD BY:		TERMS:		F445	53 H	4	DATE	-SUPT	202
QUANTITY				DESC	CRIPTION					PRICI		DUNT
1	INSP	0001	SPMEN	. Pwcs	Cure	L Motor	- COM	PROS	Scor	1:		
2		# LZ	2	130PS1	4	14	OPSI	4	. 1			
3		ue	t	BOPSI		14	OPSI	u	2			
4		n le	>	140PS1		14	OPSI	L	3			
5		49		130 PSI		14	SPSI	199	4			
6		~ 8		130 PS 1	Ì	19	SRI	•	8			
7		, 7		ISOPS	1		OPSI	M	6			
8	TO	_ Mo	enz.			DENTER !	ALRB	<b>.</b>	re	me	DISTR	Bra
9						mare Kr		/				
10						T. INSPE						

NVOICE
71.721 ©2004 REDIFORM®

			SHIP TO: ADDRESS: CITY, STAT				
CUSTOMER'S	ORI	DER: SOLD BY: 61 TERMS:		a4ss3n	I DA	12 Se	yam Bar
QUANTITY		DESCRIPTION	N		PR	ICE	AMOUNT
	1	DOUBNER MECHANISMS, REPARE	L CONTOLOT	SOES, RUN	1 4 C	usi	ACE
	2		1.12 DIST	,	-6D	-	
	3	ENGINE SPEED LOOP RAM	0		4	-	
	4	1500 RPM	4°		S		
	5	7000 RPM	(o°		10		
	6	2500 RPM	12°		12	9	
	7	3000 RPM	14°		14		
	8	3500 RPM	150		15	-	
	9	4000 RPM	15° Fun		15	Fu	
	10	ASON PRM					

					SHIP TO:				
					ADDRESS:				
					CITY, STATE	E, ZIP			
CLISTOMERIC	OB	DEB	COLD DV						
CUSTOMER'S	S (	DEK:	SOLD BY:	TERMS:		F. 44553 M	BAT	SIP	misore 7
QUANTITY				DESCRIPTION			PRI	CE	AMOUNT
	1	TEST 6	weck. Res	ISTANCES OF	F ALL SI	MARKER PUB	WIRLA	· Co .	
	2					s instance			- 0
	3			•		CAPS & WI			
	4					TOL FLAP O			
	5					. DRAW FUR	12.00		
			enes time						9.0
31206	7				trons C	OMPLETE.	LTRA	SON	4
	8					TALL PARTS			
						). Resurar			
	10	ASSAMB	urs 4 70P	CHIM GAS	seocs				7.0

	@
U	ORM
	ğ
9	1 400
2	102
Z	7172

					SHIP TO:					
					ADDRESS:					
					CITY, STAT	E, ZIP			(	
CUSTOMER'S C	OR	DER:	SOLD BY:	TERMS:		F.O.B. 44553 M	DA	TE C	00-7	2023
						44223		, C, 31		
QUANTITY				DESCRIPTION			PR	RICE	AMO	TNUC
OISLA	.1	IN STALL	CARBURATO	12. IN SULTE	in Bloc	als with NA	N GI	ASKO	es.	
	2					HRBUNATORS				
	3					Their Citor				
	4					n moreoved ma				
	per-					on timens.				
	-									
	-7	_	COBRUNG TO TEMPERATURE. CURLCU ADIVIT CARBURATURE.							
	8					ML CARRIERE				
	9									
1	10	5	HOP LABOR	- 24.5 We	Se 130	-			ALL	

	@
	B
	P
	2
	004
	©2
7	721
-	7

					SHIP TO: ADDRESS: CITY, STAT					
CUSTOMER'S OR	RD	ER:	SOLD BY:	TERMS:		144553 m	DATE SE	er ?	20Z	
QUANTITY			D	ESCRIPTION			PRICE	AMO	UNT	
1		2 MARL	4 SUDBT U	AD POINT	T Specs 0	1530083	105	210	-	
2						000 B4 = 10		210	_	
3	ľ					7 285 e 19 9			90	
4						T (MISSING IN O		31		
5							DEDIST	2F	-	
6			PACTOR BASE					60		
7		<u>-</u> -				41705.016 c	18	45	<u> </u>	
	8		NEEDUL SH					68	40	
8	Ŀ	3 weson	MR MORDLE SEAL WASHERS 83 102.070 05 - 15 -							
9	1	NEW DIST	RIBYTHA / CA	RBURNEW	L UNROW!	LER SELEVAO	1	30	-	
10										

INVOICE
71/721 ©2004 REDIFORM®

CUSTOMER'S (	ADDRESS:  CITY, STATE, ZIP  DMER'S ORDER:  SOLD BY:  TERMS:  TERMS:				44553 m	DAT	£: 50	P7 2	021	
QUANTITY			D	ESCRIPTION			PRI		AMO	
	1									
	2	3 wesma	PUMP JOT	wasume	4154	0.014 = 5			ıs	-
	3								-	Sø
	4					Cinco 4152	200	L	30	-
	5					41350			814	80
	6								83	51
	7				- 10				0.3	
	8									
	9									
1	0		3	OR TOTAL	L				5063	31

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com Service/Parts hours; M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

Invoice #

60011

#### 1966 Ferrari 330 GT 2+2

VIN: 9161

Engine: V12 4L, 3967cc, Gas, Carb

Trans:

License # 75-916

ODO In:43932 Color: Blue

Out: 43934

Inv Date: 8/05/2019

Promised: 8/06/2019 @ 6:00pm Service Writer: Steve Oldford

Status: Posted

Driver:

Unit #9161

Mfg. Date:

PO#

Vehicle Prob	lems R	lequests for Service	Services Performed	Qty	Price	Disc.	Ext
Client request	s: Install Borra	ni wire wheels and new	tires				16,194.70
Labor Serv JUSTIN	rice - Mounted r	new wire wheels, greased	hub splines. Set tire pressures				232.50
New	RW3812	Borrani RW3	812 7.00x15	4.00	2.900.00		11,600.00
New	DB3127/D	Borrani knoci DB3127/D	k off , 3-Ear Concave, Type 42,	2.00	400.00		800.00
New	DB3127/S	Borrani knoci DB3127/S	k off , 3-Ear Concave, Type 42,	2.00	400.00		800.00
New	215/70VR15	Michelin XW	X Tire, 215/70VR15	4.00	540.00	-180.00	1,980.00
New	600/650L15		600/650L15 metal stem	4.00	108.00	-64.80	367.20
Sublet	MISC	Mount/Baland	ce tires	1.00	140.00	- 18	140.00
Sublet	SHIPPING	Shipping/Har	ndling Fee	1.00	275.00		275.00

#### Technician Certifications:

 JUSTIN Justin Burke

Warranty	Posted 8/16/19 11:11AN	VI .	Invoice Summary	
All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.	MasterCard AUTH: :06532P xx0621	2,166.40	Parts Labor	15,547.20 232.50
Manufacturer's vehicle Warranty expires/expired on There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.	Credit Used	15,000.00	Sublet	415.00
I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An expressilen is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.				
X				
Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.			Sub Total	16,194.70
Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's			Sales Tax (DEF)	971.70
Page 1 of 1 Discard old parts	Original Estimate	17,166.40	Total	17,166.40

D---- - 04540 44 4444

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

Invoice #

59851

1966 Ferrari 330 GT 2+2

VIN: 9161

Engine:V12 4L, 3967cc, Gas, Carb

Trans:

License # 75-916

ODO In43920 Out:43932

Color: Blue

Mfg. Date:

Inv Date: 6/11/2019

Promised: 6/13/2019 @ 6:00pm Service Writer: Steve Oldford

Status: Posted

Driver:

Unit # 9161 PO #

			Unit # 9161		PO#	0.0	
Vehicle Probl	ems Requests	s for Service	Services Performed	Qty	Price	Disc.	Ext
Client requests	s: Replace broken ins	ide door handle	- new part in car		ORGANIA N		155.00
Removed be removed be installed ar			d and ground down the inside to fit				155.00
Client requests	s: replace bumper rub	ber insert					437.50
Labor Serv New	rice - Removed and re 16315185	E CONTRACTOR OF THE PROPERTY O	nper covers 1070 dr rubber inserts, set of 4	1.00	551.23	-191.23	77.50 360.00
Client requests	s: Repair leather on d	river's seat. Rea	r shelf is sticking up on the RH side			w felice it a	800.00
Labor Serv Sublet	rice - LEATHER	Repair leati padding	her - Replace outer bolster and repair	1.00	800.00		0.00 800.00
Client requests	s: Perform Engine Oil	and Filter Servi	ce. General checkover				654.77
Done comp	pleted oil and filter se	rvice brake fluid	form general safety inspection. flush checked over vehicle chicle inspection 1070				232.50
New New	PH2804-1 BPEN 20W50		er 20w50 Brad Penn PennGrade1 High e Oil (BPL71196)	2.00 12.00	27.90 8.95		55.80 107.40
New New	Brake cleaner 6G33-9N228-AA	Brake & Pa WSHR DRN	arts cleaning solvent-(KT14282) I OIL- TNK	1.00 1.00	4.95 7.87		4.95 7.87
	vice - Brake/Clutch Flu	id Flush And Fil	 				232.50
Flushed ar New	nd filled ok 1070 Ima	BRAKE FLU 12614 DOT	JID CASTROL SYNTHETIC (LMA) - 4 (quart)	1.00	13.75		13.75
Client states: 1	The Accessory Drive I	Belt needs repla	cement.	ALCOHOLO DE			215.84
	rice - A/C belts of the 2 a/c belts is t	wisted removed	and replaced with new belts				155.00
New	GAT 9313	Belt - V, al	ternator/waterpump drive	2.00	30.42		60.84
Client request:	s: the ignition stayed	on after removi	ng keykept the engine cranking witho	ut turning the key	y on		414.26
Ignition sw	itch is faulty electrical	part	self with key not in ignition installed and tested now ok				155.00
New	70000707 SHIPPING		ock, Ign switch andling Fee	1.00 1.00	288.96 13.64	-43.34	245.62 13.64
Client states: 1	the front sway bar bu	shings are worn	out and cracking			1.14 C. 16	138.26
Removed a	and replaced sway ba the a/c compressor bel	r bushings bar n	bar bushings are worn bar to frame leeded to be removed lowered to gain				77.50
New	108748	Anti roll bar	rubber, 18mm	2.00	37.98	-15.20	60.76

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

Invoice #

59851

1966 Ferrari 330 GT 2+2

License # 75-916

Inv Date: 6/11/2019

Technician C	ertifications:	
recilincian o		
<ul> <li>1070</li> </ul>	Jason - ASE L1 Master Tech	

Warranty All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.  Manufacturer's vehicle Warranty expires/expired on There are opticavailable for 1 & 2 year Aston Martin Extended Service Contracts. Please inqui	AUTH: :03/16P XX3142	2,890.24	Invoice Summary Parts Labor Sublet Supply/Haz Wast	916.99 1,085.00 813.64 16.28
for your specific model.				
I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.				
Χ				
Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.  X  Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's			Sub Total Sales Tax (DEF)	2,831.91 58.33
Discoul old node	Original Estimat	1 205 65	Total	2.890.24

Page 2 of 2

Discard old parts

Original Estimate: 1,205.65 Total

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

Invoice #

53060

1966 Ferrari 330 GT 2+2

VIN: 9161

Engine: V12 4L, 3967cc, Gas, Carb

Trans:

License #

ODO In:42865 Color: Blue

Out: 42865

Inv Date: 9/23/2013

Promised: 9/24/2013 @ 6:00pm Service Writer: Steve Oldford

Status: Posted

Driver: PO#

Unit #9161

Mfg. Date:

Vehicle Prob	olems Rec	quests for Service	Services Performed	Qty	Price	Disc.	Ext
Client reques	ts:parts only, c	lamps for hoses					
Labor Ser	vice - Parts only	see RO #52747 1005					0.00
New	E0212X	Hose Clamp 1.875 feet x	strapping 9mm / foot (Each strap 12)	22.00	5.67	-24.86	99.88
New	E0212XB	Cotter pin an	d bracket for 9mm strapping	12.00	4.92	-11.76	47.28

Warranty Posted 9/23/13 6:20PM Invoice Summary All retail-priced customer paid repair work is warranted for 12 months or 12000 VISA \$156.36 Parts 147.16 miles which ever comes first. AUTH: 03354C xx1504 Manufacturer's vehicle Warranty expires/expired on available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model. I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate

perform the obligations set forth by the card member's Page 1 of 1

may be subject to a storage fee

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed

Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to

Discard old parts

Original Estimate:

156.36

Total

Sub Total

Sales Tax (DEF)

156.36

147,16

9.20

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com Service/Parts hours: M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

Invoice #

52759

1966 Ferrari 330 GT 2+2

VIN: 9161

Engine: V12 4L, 3967cc, Gas, Carb

Trans:

License #

ODO In:42857 Color: Blue

Out: 42857

Inv Date: 6/10/2013

Promised: 6/10/2013 @ 6:00pm

Service Writer: Steve Oldford

Status: Posted

Driver:

Unit #9161

Mfg. Date:

PO#

Vehicle Proble	ems Reques	sts for Service	Services Performed	Qty	Price	Ext
Client requests	: Repair leaking rad	diator	***************************************			
<ul> <li>removed a</li> <li>removed a</li> <li>removed a</li> <li>Found that a</li> <li>were poorly</li> </ul>	A/C condensor *[note radiator the radiator has been	e - lines to A/C syst n re-cored with a lar he tank and previou	em hand tight, no freon in system] ger size core. The original tanks usly repaired in multiple locations. ed to original size.			440.00
8-19-13						
Rebuilt radia		2000				
	ator, was raw metal		cility in ME			
	iator and secured. 1					
Sublet	MISC		airRecore to correct size and anks to fit. reattach brackets	1.00	2,925.00	2,925.00
Sublet	SHIPPING	Shipping rad	liator to repair facility	1.00	119.51	119.51

Warranty All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.  Manufacturer's vehicle Warranty expires/expired on There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.	Posted 8/30/13 3:54PM A/R Charge \$3,484.51	Invoice Summary Labor Sublet	440.00 3,044.51
I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for altorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.	Overdue accounts are charged 1.5% interest with a minimum finance charge of \$10.00		
X			
Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.			
X		Sub Total	3,484,51
Customer acknowledges receipt of merchandise and services.		Sales Tax (DEF)	5,131.01

Page 1 of 1

Technician Certifications:

Ed Schnurr

1005

Discard old parts

Original Estimate:

638.38

Total

3,484.51

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com Service/Parts hours: M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

Invoice #

52747

1966 Ferrari 330 GT 2+2

License # ODO In:42857

Out: 42865

Inv Date: 6/05/2013

Color: Blue

Promised: 6/05/2013 @ 6:00pm Service Writer: Steve Oldford

Mfg. Date:

Status: Posted

Driver:

Engine: V12 4L, 3967cc, Gas, Carb

Trans:

A/C inop. - lines loose at several connections, been like this for a while

VIN: 9161

Unit #9161

PO#

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Disc.	Ext
Client requests: Refinis	sh cam covers and airboxde	etail engine bay. Replace ignition wi	res and spark plug	s		
Radiator leaking; loc - noticed that A/C c [ photos taken]	inoperative; cable very stiff to us	ing road test en] n to bottom brackets, brackets adrift se, needs removal and rectification			-22.50	142.50

#### Needs\*\*\*

air cleaner elements #3

Paint chip in RH rocker panel

- power steering fluid low

Brake booster hose needs reclamping; loose 1 of the V/C knobs is disintigrating, LH rear

Large RTV patch in the oil pan, over the crossmember

- oil filters
- air cleaner upper seal

	o air cleaner gaskets					
	ug tube grommets					
	ignition wire loom kee	per grommets				
- V/C acc						
	te bracket	complex proposed on the contract of				
Removed	remote Halon system	n; system was depleted				
- remove	d indicator lamp by ig	nition key and plugged hole				
Ck'd fluid	levels					
- different	tial, added 1/2 qt gear	roil				
- oil level						
	pint to P.S. system					
- trans oil	The state of the s					
Ck'd tyre						
Ck'd knoc						
	nasing a looseness in					
		etty much loose at castle nuts				
		ns, tightened castle nuts and replaced cotter pins				
- loosene 1005	ss gone					
1005						
Labor Ser	vice - Removed air cl	eaner assembly			-90.00	900.00
- each ca	rb had 1 stud missing	from top hold down				555.55
Removed	V/C covers, timinna	chain covers, spark plug tubes				
- stripped	paint from items	The state of the s				
- cleaned	and prepped for new	wrinkle paint application				
- painted						
Reinstalle	d painted V/covers ar	nd chain covers with new gaskets				
	d alternator, installed					
Reinstalle	d PS pump 1005					
New	KRY SP201	Paint - Black Wrinkle Finish, 11 oz aerosol	3.00	18.81	-8.46	47.97
New	22108	Cam Cover oring	2.00	6.77	-1.36	12.18
New	160479	Cam Cover gasket	2.00	34.65	-6.94	62.36
New	101239	Cam Cover nut - capnut	40.00	2.15	-8.80	77.20
New	GAR-343	aircraft paint remover - gallon	1.00	65.92	-5.97	59.95
				61010000		30.00

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

I	n	v	o	i	c	e	#	
•	•••		~	•	~	~		

52747

					IIIVOICE	# 52	141
		1966 Ferrari 330 GT 2+2	License #		Inv Date:	6/05/2013	
Labor Serv	ice - Made up new	spark plug wire sets				-50.00	500.00
<ul> <li>replaced</li> </ul>	spark plug tube gre	ommets				-50.00	300.00
Replaced s 1005	park plugs *[ cylino	der 11 + 12 spark plugs were loose, never ti	ghtened]				
New	N3C	Spark Plug Champion N3C		12.00	13.45	-16.20	145.20
New	440 DELCO	Ignition Cable, 7mm black (18512)	08) per foot	30.00	1.81	-5.40	48.90
New	STDSPP29	Ignition Wire Boot - Straight	, po. 100.	12.00	3.19	-3.84	34.44
New	ST106	Ignition Wire (7mm) Cable End - S	nark Plug	12.00	0.58	-0.72	6.24
New	124288	Ignition Rotor	parking	2.00	78.54	-15.70	141.38
New	MF64366	Rubber Grom/Bush RGB 2688F		2.00	1.14	-15.70	2.28
New	MF64363	Rubber Grom/Bush RGB 2688C		15.00	0.63		9.45
New	MF64362	Rubber Grom/Bush RGB 2688B		15.00	0.56		8.40
Labor Serv EDUARD	ice - Strip airbox ar	nd cover - bead blast inside/out and prep for	r paint.	35.05.00.0			165.00
New	KRY BBP	Primer, Sandable Gray - Aerosol		2.00	0.55	4.70	
New	11175 Z	Eastwood Extreme Chassis Black	Cotio	2.00	8.55	-1.72	15.38
Sublet	MISC	Prep and refinish complete airbox	-Saun	1.00	27.50	-5.50	22.00
New	104550	Air filter nut-knurled		1.00	485.00		485.00
New	95180052	Air Filter		3.00	10.50	-3.15	28.35
Sublet	MISC	Foam tape - black		3.00 1.00	29.21 4.65	-13.14	74.49
Labor Serv	ice - Choke cable s			1.00	4.00		4.65
<ul> <li>removed</li> <li>disassem</li> <li>cleaned i</li> </ul>	cable assembly	tened and lubed				-7.50	47.50
Labor Serv	ce - Remove and F	Replace Battery 1005					33.00
New	MTP-27F	Battery - Interstate MTP-27F		1.00	153.37	-23.01	130.36
Client requests	: replace front bo	nnet insulation pad and any missing har	dware on bonnet			20.01	100.00
- removed	ce - Removed bond old quilted under be new quilted pad 10	onnet pad					165.00
New	2432860600	Hood pad 330GTC/S 275GTS		1.00	932.25	-279.68	652.57
Client requests	: Rebuild mechan	nical fuel pump and repl fuel filtercar de	oes not run/idle witho	ut electrical p	ump on.		
<ul> <li>upon rem</li> <li>also foun</li> <li>New battery</li> </ul>	ce - Removed fuel oval found fuel had d pivot pin for drive r hooked up, started at top gasket of fue	leaked through diaghram into 'dry' side of cam has fallen out [hence no pump functio d car	pump n]	1000	**************************************	-65.00	650.00

- fuel leak at top gasket of fuel filter housing

- removed top, Hylomar the sealing surfaces and reassembled

- fuel leak corrected for the moment - needs new gasket

Ran engine until warm, cycled fans

- \*\* found that mechanical fuel pump can't keep up with carburetor demands,

negligable output

- needs dymo pump to still pick up slack

Removed rear fuel filter, removed fuel line to mechanical pump

- blew out line to ck for obstructions

- removed mechanical pump and ck'd function on bench; no issues, pump does work

- tried to get specs for lift of fuel pump drive pin [unsuccessful] pin is not removable [at

least from this car]

- pin is probably worn, rocker pivot in pump is worn

- took 2mm of thickness off phenolic block

- reassembled and cranked engine over with lower pump cover off

- pump is visibly pumping and is also pulling a small vacuum on the inlet side

- reinstalled in car

- reconnected and started car

- mechanical pump now leaks out through diaghram and pump halves

- ran through fuel return line back to tank

- found fitting at tank for return line was soldered closed [photo taken]

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

Invoice #

52747

Client requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005,  EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  Now m6bolt 6mm bolt 6.00  New m6washer 6mm washer 12.00  Client requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  Client requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system  including all heater hoses  replaced hose clamps; first tried repopped Ferrari clamps  used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional]  Refilled coolant New radiator clamps 1005  New GAT 7330 Belt - Gates V-belt 1.00	invoice	<del>2</del> #	52/4/
Reassembled and started; pump still leaking around diaphram "need diaphram and phenolic block] 8-30-13 [need a fuel fiter housing gasket] 8-30-13 - pressure regulator Removed fuel pump Replaced pump diaghram [block sanded contact surfaces again] Made up 2 gaskets for phenolic block Removed pump diaghram [block sanded contact surfaces again] Made up 2 gaskets for phenolic block Reinstalled pump and ran engine - no pump action Removed pump, removed 1 gasket, reinstalled Ran engine, pump now functional Cridered fibre gaskets for fuel rail to carbs Road tested car 105 [need to 105] [need 105	Inv Date: 6	6/05/2013	
Reassembled and started; pump still leaking around diaphram " [need a fuel fiter housing gasket] 8-30-13   [need a fuel fiter housing gasket] 8-30-13 - pressure regulator Removed fuel pump Replaced pump diaphram [block sanded contact surfaces again] Made up 2 gaskets for phenolic block Removed pump diaphram [block sanded contact surfaces again] Made up 2 gaskets for phenolic block Reinstalled pump and ran engine - no pump action Removed pump, removed 1 gasket, reinstalled Ran engine, pump now functional Ordered fibre gaskets for fuel rall to carbs Road tested car 105   New 95180132   Fuel Pump Diaphragm   1.00   New 95180132   Gasket info m/TBE fuel   1.00   New 95180133   Fuel regulator diaphragm   1.00   New 95180049   Filter bowl gasket   1.00   New 95180033   Fuel filter small   1.00   New 95180035   Fuel filter small   1.00   New 951801305   Fuel filter small   1.00   New 951801305   Fuel filter small   1.00   New 95180130D   Fuel Pump Diaphragm   1.00   New 95180130D   Fuel Pump Diaphragm   1.00   New 95180130D   Fuel for fuel Pump Diaphragm   1.00   New 95180130D   Gasket - Neter Pump Diaphragm   1.00   New 401800   New 95180130D   Subibat   New 95180130D   New 95180130D   Subibat   New 95180130D   New 95180130D   New 95180130D   New 95180130D   New 95180130D   New 95180130D   New 95180130D			
* [need diaphram and phenolic block] 8-30-13			
Ineed a fuel filter housing gasket] 8-30-13 - pressure regulator   Rebmitt fleel pressure regulator   Removed fuel pump   Replaced pump diaghram [block sanded contact surfaces again]   Made up 2 gaskets for phenolic block   Reinstalled pump and ran engine - no pump action   Removed pump, removed 1 gasket, reinstalled   Ran engine, pump now functional   Ordered fibre gaskets for fuel rail to carbs   Road tested car 1005   New 95:180/132   Gasket kit for MTBE fuel   1,00   New 95:180/133   Fuel regulator diaphragm   1,00   New 95:180/133   Fuel regulator diaphragm   1,00   New 95:180/049   Filter bowl gasket   1,00   New 95:180/033   Fuel filter small   1,00   New 95:180/035   Fuel filter small   1,00   New 95:180/130   Gasket - water   2,00   New 95:180/130D   Fuel Pump Diaphragm   1,00   New 95:180/130D   Fuel Pump Diaphragm   1,00   New 95:180/130D   Fuel Flump Diaphragm   1,00   New 95:180/130D   Fuel Flump Diaphragm   1,00   New 95:180/130D   Fuel Flump Diaphragm   1,00   New 95:180/130D   Fuel Pump Diaphragm   1,00   New 95:180/130D   Fuel Pump Diaphragm   1,00   New 95:180/130D   Fuel Pump Diaphragm   1,00   New 95:180/130D   Gasket - Fiber 20MM OD   3,00   New 14:39.500/14   Gasket - Fiber 180/140D   New 14:59.500/140   Gasket - Fiber 180/140D   3,00   New 41:59.500/140   Gasket - Fiber 180/140D   3,00   Gasket - Fiber 220   Gas			
Rebuilt fuel pressure regulator Removed fuel pump Replaced pump diaghram [block sanded contact surfaces again] Made up 2 gaskets for phenolic block Reinstalled pump and ran engine - no pump action Removed pump, removed 1 gasket, reinstalled Ran engine, pump now functional Ordered fibre gaskets for fuel rail to carbs Road tested car 1005 New 95180130 New 95180131 Fuel regulator diaphragm 1.00 New 95180133 Fuel regulator diaphragm 1.00 New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 1.00 New 95180053 Fuel filter small 1.00 New 95180053 Fuel filter small 1.00 New 95180130D Fuel Pump Diaphragm 1.00 New 95180130D Fuel Pump Diaphragm 1.00 New 95180130D New 95180130D Fuel Pump Diaphragm 1.00 New 16395 Gasket - water 1.00 New 16395 Gasket - water 1.00 New 16395 New 95180130D Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Client requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, poish tail pipes and apply new ANSA decals 1005. EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipesrepair and patch several area. Repaint exhaust, poish tail pipes and apply new ANSA decals 1005. EDUARD New RPY SP102 Paint - V+TT flat black, high temp aerosol 2.00 New mobout Gmm bott Gmm washer 1.200 New mobout Gmm bott Gmm washer 1.200 New mobout Gmm bott Gmm washer 1.200 New mobouster 1.200 New			
Removed fuel pump Replaced pump diaghram [block sanded contact surfaces again] Made up 2 gaskets for phenolic block Reinstalled pump and ran engine - no pump action Removed pump, removed 1 gasket, reinstalled Ran engine, pump now functional Ordered fibre gaskets for fuel rail to carbs Road tested car 1005  New 95180130  New 95180132  Gasket kit for MTBE fuel 1.00  New 95180049  Fuel Pump Diaphragm 1.00  New 95180049  Fuel regulator diaphragm 1.00  New 95180049  Fuel regulator diaphragm 1.00  New 95180049  Fuel filter small 1.00  New 16395  Gasket - water 2.00  New 16395  Gasket - water 2.00  New 95180130D  Fuel Pump Diaphragm 1.00  New 16395  Gasket - water 2.00  New 16395  Gasket - water 2.00  New 95180130D  Fuel Pump Diaphragm 1.00  Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled  Working OK now  Refitted air cleaner assembly  RT smoke from tail pipes is much diminished from initial RT 1005  New 41530.004  Gasket - Fiber 18MM OD 3.00  New 41530.001  Ray 2nth and water state from headers to tailpipes repair and patch several area. Repaint exhaust leaks patch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005.  Elient requests: Trunk doesn't latchadjust  Labor Service - Rehose cooling system  - including all heater hoses  - replaced hose clamps; first tried repopped Ferrari clamps  - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair  (radiator had a very bad repair done by previous owner]  Reimitsalled old A/C condensor per customer request [A/C is non functional]  Refilled coolant  New radiator clamps 10			
Replaced pump diaghtram [block sanded contact surfaces again] Made up 2 gaskets for phenolic block Reinstalled pump and ran engine - no pump action Removed pump, removed 1 gasket, reinstalled Ran engine, pump now functional Ordered fibre gaskets for fuel rail to carbs Road tested car 1005 New 95180130D Fuel Pump Diaphragm New 951801321 Gasket kit for MTBE fuel 1.00 New 951801321 Fuel regulator diaphragm 1.00 New 95180033 Fuel regulator diaphragm 1.00 New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 1.00 New 95180053 Fuel filter small 1.00 New 95180130D Fuel Pump Diaphragm 1.00 New 16395 Gasket - water puel Pump Diaphragm 1.00 New 95180130D Fuel Pump Diaphragm 1.00 Now Norking Ok now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005 New 41530.001 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00			
Made up 2 gaskets for phenolic block Reinstalled pump and ran engine - no pump action Removed pump, removed 1 gasket, reinstalled Ran engine, pump now functional Ordered fibre gaskets for fuel rall to carbs Road tested car 1005  New 95180132 Fuel Pump Diaphragm 1,00  New 95180133 Fuel regulator diaphragm 1,00  New 95180049 Filter bowl gasket 1,00  New 95180049 Filter bowl gasket 1,00  New 95180033 Fuel filter small 1,00  New 95180030 Fuel Pump Diaphragm 1,00  Labor Service - Replaced fuel rall fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005  New 41530.004 Gasket - Fiber 22MM OD 3,00  New 41530.004 Gasket - Fiber 22MM OD 3,00  Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1,00  Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1,00  Labor Service - Removed exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4,00  New Messher 6mm washer 12,00  New Messher 6mm washer 12,00  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator hose a variety and repair done by previous owner] Reinstalled repaired radiator nistalled of A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005  New GAT 7330 Belt - Gates V-belt 1,00			
Reinstalled pump and ran engine - no pump action Removed pump, removed 1 gasket, reinstalled Ran engine, pump now functional Ordered fibre gaskets for fuel rail to carbs Road tested car 1005 New 95180130 Fuel Pump Diaphragm 1.00 New 95180131 Fuel regulator diaphragm 1.00 New 95180133 Fuel regulator diaphragm 1.00 New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 1.00 New 16335 Gasket - water 2.00 New 95180130D Fuel Pump Diaphragm 1.00 New 16335 Gasket - water 2.00 New 95180130D Fuel Pump Diaphragm 1.00 Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial RT 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00 Labor Service - Removed exhaust system from headers to tailpipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 New Mew KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 New m6bott 6mm washer 12.00 litent requests: runk doesn't latchadjust Labor Service - Adjusted trunk latch 1005 lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Adjusted trunk latch 1005 lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Edicated repair done by previous owner] Reinstalled repaired radiator (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
Removed pump, removed 1 gasket, reinstalled Ran engine, pump now functional Ordered fibre gaskets for fuel rail to carbs Road tested car 1005  New 95180132			
Ran engine, pump now functional Ordered fibre gaskets for fuel rail to carbs Road tested car 1005  New 95180130D Fuel Pump Diaphragm 1.00  New 951801312 Gasket kit for MTBE fuel 1.00  New 95180049 Filter bowl gasket 1.00  New 95180049 Filter small 1.00  New 95180049 Filter small 1.00  New 95180053 Fuel filter small 1.00  New 95180053 Fuel filter small 1.00  New 95180130D Fuel Pump Diaphragm 2.00  New 95180130D Fuel Pump Diaphragm 1.00  Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005  New 41530.001 Gasket - Fiber 22MM OD 3.00  New 41530.001 Gasket - Fiber 18MM OD 3.00  Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00  Labor Service - Removed exhaust system from headers to talipipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005.  EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New mbout Germ bout 6.00  New mbout 6.0			
Ordered fibre gaskets for fuel rail to carbs Road tested car 1005 New 95180130D Fuel Pump Diaphragm 1.00 New 95180133 Fuel regulator diaphragm 1.00 New 95180133 Fuel regulator diaphragm 1.00 New 95180049 Filter bowl gasket 1.00 New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 1.00 New 16395 Gasket - water 2.00 New 16395 Gasket - water 2.00 New 95180130D Fuel Pump Diaphragm 1.00 Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly R7T smoke from tail pipes is much diminished from initial R/T 1005 New 41530.001 Gasket - Fiber 12MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00 litent requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes New RFY SP102 Paint - VHT flat black, high temp aerosol 6.00 New m6bolt Gmm bolt Gmm washer Gmm bolt Gmm washer Gmm bolt Gmm bolt Gmm bolt Gmm bolt Gmm washer Gmm bolt Gmm washer Gmm bolt Gmm			
Road tested car 1005 New 95180130D Fuel Pump Diaphragm 1.00 New 95180132 Gasket kit for MTBE fuel 1.00 New 95180133 Fuel regulator diaphragm 1.00 New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 1.00 New 16395 Gasket - water 2.00 New 95180130D Fuel Pump Diaphragm 1.00 Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00 lient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 New m6bott Grim bott Grim bo			
New 95180130 Fuel Pump Diaphragm 1.00 New 95180132 Gasket kit for MTBE fuel 1.00 New 95180133 Fuel regulator diaphragm 1.00 New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 1.00 New 16395 Gasket - water 2.00 New 16395 Gasket - water 2.00 New 95180130D Fuel Pump Diaphragm 1.00 Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.004 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00 litent requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New m6bolt Grim bolt Grim			
New 95180132 Gasket kit for MTBE fuel 1.00 New 95180133 Fuel regulator diaphragm 1.00 New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 1.00 New 95180130 Fuel filter small 1.00 New 95180130D Fuel filter small 1.00 New 95180130D Fuel pump Diaphragm 1.00 Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 12MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00 lient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New Mebolt Ginn washer 5.00 New mebousher 5.00 New meboster 5.00 New meboster 5.00 New Mebolt Ginn washer 5.00 New meboster 6.00 New meboster 7.00 New meboster 6.00 New meboster 6.00 New meboster 7.00 New meboster 7.00 New meboster 7.00 New meboster 7.00 New Mebolt 6.00 New Me		12012	
New 95180133 Fuel regulator diaphragm 1.00 New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 1.00 New 16395 Gasket - water 2.00 New 95180130D Fuel Pump Diaphragm 1.00 Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly R/T smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Filber 18MM OD 3.00 New 41530.001 Gasket - Filber 18MM OD 3.00 Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00 Labor Service - Removed exhaust system from headers to tailpipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New Messher Gmm washer 12.00 New Messher Gmm washer 12.00 Labor Service - Adjusted trunk latch 1005 Lient requests: Trunk doesn't latchadjust Labor Service - Adjusted trunk latch 1005 Lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Adjusted trunk latch 1005 Lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps, first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00	145.94	-21.89	
New 95180049 Filter bowl gasket 1.00 New 95180053 Fuel filter small 2.00 New 16395 Gasket - water 2.00 New 95180130D Fuel Pump Diaphragm 1.00 Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RTI smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.004 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00 Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 New m6bott 6mm bott 6mw washer 12.00 Labor Service - Adjusted trunk latch 1005 lient requests: Trunk doesn't latchadjust Labor Service - Adjusted trunk latch 1005 lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New GAT 7330 Belt - Gates V-belt 1.00	41.25	-6.19	
New 95180053 Fuel filter small 1.00 New 16395 Gasket - water 2.00 New 95180130D Fuel Pump Diaphragm 1.00 Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RVT smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00 litent requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New M6bot 6mm bott 6mm bott 6.00 New m6bot 6mm bott 6mm bott 6.00 New m6bot 6mm bott 6.00 New m6bot 12.00 litent requests: Trunk doesn't latchadjust Labor Service - Adjusted trunk latch 1005 litent requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps, first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00	74.25	-11.14	63.1
New 16395 Gasket - water Fuel Pump Diaphragm 1.00  Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005  New 41530.001 Gasket - Fiber 22MM OD 3.00  Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00  ient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  New m6bott 6mm bott 6mm washer 12.00  ient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  ient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005  New GAT 7330 Belt - Gates V-belt 1.00	6.60	-0.99	5.6
New 95180130D Fuel Pump Diaphragm 1.00  Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00  lient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005.  EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 New m6bolt Gmm bolt 6mm washer 12.00  lient requests: Trunk doesn't latchadjust Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1,00	14.85	-2.23	12.6
Labor Service - Replaced fuel rail fibre washers with new Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly R/T smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 12MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00 Lient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 New m6bolt 6mm bolt 6.00 New m6bolt 6mm bolt 6.00 New m6washer 6mm washer 12.00 lient requests: Trunk doesn't latchadjust Labor Service - Adjusted trunk latch 1005 lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00	1.82	-0.54	3.10
Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly RT smoke from tail pipes is much diminished from initial R/T 1005  New 41530.004 Gasket - Fiber 22MM OD 3.00  New 41530.001 Gasket - Fiber 18MM OD 3.00  Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00  ient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005,  EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  Now m6bolt Grim bolt 6.00  New m6washer 6mm washer 12.00  ient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  ient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Removed radiator for repair (radiator repaired radiator per customer request [A/C is non functional]  Refilled coolant  New GAT 7330 Belt - Gates V-belt 1,00	145.94	-50.94	95.00
Ran engine, then front carb started to flood - disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly R7 smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00 ient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 Now m6bolt Grim bolt 6.00 New m6washer 6mm washer 12.00 ient requests: Trunk doesn't latchadjust Labor Service - Adjusted trunk latch 1005 ient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New GAT 7330 Belt - Gates V-belt 1,00			0.00
- disassembled front carb, found debris in needle and seat; cleaned and reaseembled Working OK now Refitted air cleaner assembly R/T smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00  ient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 Now m6bott Gmm bott 6.00 New m6washer 6mm washer 12.00  ient requests: Trunk doesn't latchadjust Labor Service - Adjusted trunk latch 1005 ient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps, first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1,00			0.0
Working OK now Refitted air cleaner assembly R/T smoke from tail pipes is much diminished from initial R/T 1005 New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00 litent requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 Now m6bolt Grim bolt 6.00 New m6wsher 6mm washer 12.00 litent requests: Trunk doesn't latchadjust Labor Service - Adjusted trunk latch 1005 litent requests: inspect all hoses, fuel hoses, and replace cooling hose clamps Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
Refitted air cleaner assembly RVT smoke from tail pipes is much diminished from initial RVT 1005  New 41530.004 Gasket - Fiber 22MM OD 3.00  New 41530.001 Gasket - Fiber 18MM OD 3.00  Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00  ient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005,  EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  Now m6bott 6mm bott 6.00  New m6washer 6mm washer 12.00  ient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  ient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system  including all heater hoses  replaced hose clamps; first tried repopped Ferrari clamps  used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional]  Refilled coolant  New radiator clamps 1005  New GAT 7330 Belt - Gates V-belt 1.00			
R/T smoke from tail pipes is much diminished from initial R/T 1005  New 41530.004 Gasket - Fiber 22MM OD 3.00  Sublet CHROME Chrome Plating Restore fuel pipe to carbs 1.00  lient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipes repair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005,  EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  Now m6bolt 6mm bolt 6.00  New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional]  Refilled coolant  New GAT 7330 Belt - Gates V-belt 1.00			
New 41530.004 Gasket - Fiber 22MM OD 3.00 New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00  lient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005,  EDUARD New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 Now m6bolt 6mm bolt 6.00 New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional]  Refilled coolant New GAT 7330 Belt - Gates V-belt 1.00			
New 41530.001 Gasket - Fiber 18MM OD 3.00 Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00  Itent requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005,  EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 New m6bolt 6mm bolt 6.00 New m6wsher 6mm washer 12.00  Itent requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  Itent requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Reinstalled old A/C condensor per customer request [A/C is non functional]  Refilled coolant New GAT 7330 Belt - Gates V-belt 1.00	0.40		
Sublet CHROME Chrome PlatingRestore fuel pipe to carbs 1.00  lient requests: repair exhaust leakspatch and weld as necessary, paint exhaust and replace ANSA decals  Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005,  EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  New m6bolt 6mm bolt 6.00  New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional]  Refilled coolant  New GAT 7330 Belt - Gates V-belt 1.00	2.48	-1.11	0.00
Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  New m6bolt 6mm bolt 6.00  New m6washer 6mm washer 12.00  ient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  ient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system  - including all heater hoses  - replaced hose clamps; first tried repopped Ferrari clamps  - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Reinstalled old A/C condensor per customer request [A/C is non functional]  Refilled coolant  New GAT 7330 Belt - Gates V-belt 1.00	2.48	-1.11	
Labor Service - Removed exhaust system from headers to tailpipesrepair and patch several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  Now m6bolt 6mm bolt 6.00  New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005  New GAT 7330 Belt - Gates V-belt 1.00	220.56		220.56
several area. Repaint exhaust, polish tail pipes and apply new ANSA decals 1005, EDUARD  New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00  New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00  Now m6bolt 6mm bolt 6.00  New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner]  Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional]  Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 Now m6bolt 6rmm bolt 6cmm bolt 12.00 New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			1,100.00
New ANSA-STICKER ANSA sticker for exhaust tailpipes 4.00 New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 Now m6bolt 6mm bolt 6.00 New m6washer 6mm washer 12.00  Ilient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  Ilient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
New KRY SP102 Paint - VHT flat black, high temp aerosol 2.00 Now m6bolt 6mm bolt 6.00 New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
New m6bolt 6mm bolt 6.00 New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00	17.33	-10.40	58.92
New m6washer 6mm washer 12.00  lient requests: Trunk doesn't latchadjust  Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330  Belt - Gates V-belt  1.00	19.64	-5.90	33.38
Labor Service - Adjusted trunk latch 1005  lient requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330  Belt - Gates V-belt  1.00	0.41	-0.24	
Labor Service - Adjusted trunk latch 1005  itent requests: inspect all hoses, fuel hoses, and replace cooling hose clamps  Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00	0.35	-0.48	3.72
Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead, much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead, much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00		-5.00	50.00
Labor Service - Rehose cooling system - including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00		-5.00	50.00
- including all heater hoses - replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
- replaced hose clamps; first tried repopped Ferrari clamps - used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			330.00
- used Jubilee clams instead. much nicer and they work; #4 32-45mm, #2 30-40mm  Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
Removed radiator for repair (radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
(radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
(radiator had a very bad repair done by previous owner] Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
Reinstalled repaired radiator Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
Installed old A/C condensor per customer request [A/C is non functional] Refilled coolant New radiator clamps 1005 New GAT 7330 Belt - Gates V-belt 1.00			
Refilled coolant   New radiator clamps   1005     New   GAT 7330   Belt - Gates V-belt   1.00			
New radiator clamps 1005         Belt - Gates V-belt         1.00			
New GAT 7330 Belt - Gates V-belt 1.00			
1.00			
	18.15	-1.82	16.33
New 101484 Radiator Cap 1.00	81.35	-12.20	
New BS55 Jubilee Clip 304SS 40-55mm 2.00	14.21	-2.84	
New BS45 Jubillee Clip, 32-45mm SS 4.00	7.34	-2.92	
Labor Service - Replaced front rebound blocks, both collapsed			110.00

Greased chassis at all zirc fittings

85 Linden Street, Waltham, MA 02452 www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM





Voice 781-547-5959 Service x-223, Parts x-226 Fax 781-547-5960

				Invoice	#	52747
	1966 Ferrari 330 GT 2+2	License #		Inv Date: 6		
<ul> <li>1 zirc broken; replaced [LF New 61429 New FITTING</li> </ul>	upper control arm] 1005 Bump Stop - front suspension Grease Fitting		2.00 1.00	155.68 8.25	-46.70	264.66 8.25
Client requests: Replace missir	ng bolts for belly pans					
Labor Service - Replaced mis	ssing hardware and secured undertray 1005				-4.50	28.50
Client requests: replace wiper I					1100	20.00
Labor Service - Not replaced	at this time 1005					0.00
	on drivers seat, and shifter boot. Repair s	agging sun visors				0.00
Labor Service - Replaced two padding in cushion.	outer bolsters on driver's seat lower cushion	n. Rebuilt			-30.00	190.00
Repair wear hole in leather or	n drivers seat backrest bolster					
Repaired torn shifter boot						
DATE TO BRIDGE DESCRIPTION OF	sors, saved original vinyl and resecured with	binding on				
Replaced filling in both sunvis	Repair drivers seat, shifter boot an		1.00	1,675.00		1,675.00
Replaced filling in both sunvis back edge. EDUARD	Repair drivers seat, shifter boot an See detailed notes		93.07.6			100000000000000000000000000000000000000
Replaced filling in both sunvisiback edge. EDUARD Sublet LEATHER Sublet MISC	Repair drivers seat, shifter boot an See detailed notes New driver's floor carpet		1.00	1,675.00 425.00		1,675.00 425.00
Replaced filling in both sunvisiback edge. EDUARD Sublet LEATHER Sublet MISC Client requests: State Safety An	Repair drivers seat, shifter boot an See detailed notes New driver's floor carpet		93.07.6			100000000000000000000000000000000000000

14	Ila	WW.	ands.
V	٧a	rra	THEY

1005

**EDUARD** 

HUGO

All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.

Ed Schnurr

Hugo Marquez

Eduardo Granados

Manufacturer's vehicle Warranty expires/expired on available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed

Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's

Page 4 of 4

Posted 9/23/13 3:39PM

AUTH: 07897C xx1504

Original Estimate: 6,742.65

Invoice Summary

Supply/Haz wast

2,438.96

4,411.50

2,839,21

9.704.17

153.34

14.50

Parts

Labor

Sublet

\$9,857.51

Sub Total Sales Tax (DEF)

9,857.51 Total

Discard old parts