65 Vette

Actuals	Amount	Description
Invoice 201	\$58,044.91	Purchase price, inspection, and delivery fees
Invoice 202	\$4,935.00	Sales tax and registration
Invoice 203	\$13,200.00	1st installment for chassis build
Invoice 204	\$13,200.00	2nd installment for chassis build
Invoice 205	\$30,027.00	Final payment for chassis build
Invoice 206	\$11,361.00	Progress payment
Invoice 207	\$13,078.90	Progress payment
Invoice 208	\$17,781.87	Final Invoice
Total Cost	\$161,628.68	



61 Orinda Way, Orinda, Ca 94563

Phone: 925-254-5454 @ Orinda Motors Inc.

BAR# AK191519 EPA# CAL00050068



RO#: 5046604 Invoiced: 01/31/2019

Page: 1

Customer:

Vehicle:

1965 Chevy Corvette RWD Eng: 350 LS3 Tran: STANDARD

VIN: CHECKV1N1 Mileage In: 62821 Out:

P Date: Cir:

Lic: 7AMS372 St: CA

Repair Order:

Service Writer: J Vanek

PO Number:

Date In: 01/10/2019 Date Out: 01/31/2019

Brakes

Customer States:

Towed In

Reports active leakage at passenger side front brake hose.

Reports humming noise under braking.

Report concern about tire balance.

Tire pressures must be checked when tires are off. Use temporary valve stem in glove box.

Diagnosis:

Removed tires and inspected all brake pads at 10mm or 98% Noticed low fluid and found right front brake steel braided hose leaking and rubber looks melted. Recommend replacing both front steel braided hoses and recheck for cause of right front brake overheat..

Checked parking brake operation and found lever only pull a small amount and wont lock due to not pulling far enough. Parking lever not pulling far enough due to cable was bent and jamming up due to bad bracket position. Straightened out bracket and cable is free and handle locks up now but wheels still spin slightly and needs adjustment at the parking brake shoes. To adjust the parking brake shoes will need to remove rear calipers and rotors.

(2.5hrs)

Fabricate parking brake cable.

Recommendation:

Replace both front brake hoses with correct length steel braided type. Check brake system to determine if right front brake is getting hot. Disassemble rear brake to adjust parking brake shoes.

Remove wheels and inspect brakes. Inspect for fluid leakage at right front.

Check parking brake operation. Adjust parking brake cable for proper operation.

Replace both front brake hoses with correct length steel braided type and remove
inspection.

Disassemble rear brake to adjust parking brake shoes.

AO 585.00

Check brake system to determine if right front brake is getting hose. Parking brake not holding on hills.

Labor Sub Total: 3412.50

AO

GS

195.00

975.00

682.50

Part Num Parts: Cond Description Price Ea. Qty Extended WTL-220-13001 BRAKE HOSE KIT 170.63 1.00 170.63 Emergency Brake Cable 231.00 1.00 231.00 EC-80FU N 6256437 Park Brake Cable Equalizer 33.75 1.00 33.75

Parts Sub Total: 435.38

Misc: Description Sold Price Qty Extended

 Description
 Sold Price
 Qty
 Extended

 Shipping and Handling Fees
 22.59
 1.00
 22.59

 Shipping and Handling Fees
 38.00
 1.00
 38.00

 Misc Sub Total:
 60.59

 Job Sub Total:
 3908.47

Wheels and Tires



61 Orinda Way, Orinda, Ca 94563

Phone: 925-254-5454 @ Orinda Motors Inc.

BAR# AK191519 EPA# CAL00050068



5046604 Invoiced: 01/31/2019

2 Page:

Customer:

Vehicle:

1965 Chevy Corvette RWD Eng: 350 LS3 Tran: STANDARD

VIN: CHECKV1N1 Mileage In: 62821 Out:

P Date: Clr:

Lic: 7AMS372 St: CA

Repair Order:

Service Writer: J Vanek

PO Number:

Date In: 01/10/2019 Date Out: 01/31/2019

Customer States:

Balance tires per customer request

Labor:

Description Balance tires per customer request. Balance on all four wheels was off, two off

by 1.50 oz and two by 1.25 oz. right rear has most weight 4.50oz.

Labor Sub Total: 195.00

Techs Extended

Parts:

No parts on job

Description

Part Num

Job Sub Total:

195.00

195.00

Drivetrain

Customer States:

Reports clutch chatter and is very stiff to operate.

Labor:

Replace clutch kit as required.

Cond Description

Replace clutch kit as required. Road test and check clutch operation

MO

1560.00 195.00

1755.00

Techs Extended

Parts:

DF017010 Clutch Kit Pilot Bearing CT1082 Clutch Bearing Councils of California N 614037

Price Ea. Qty Extended

Labor Sub Total:

Parts Sub Total:

689.72 1.00 689.72 36.75 1.00 36.75 94.68 94.68 1.00

Sublets:

Description Send Flywheel out for Repairs Price 150 00

Sublets Sub Total:

Job Sub Total:

2726.15

821.15

Extended

150 00

150.00

Starting and Charging

Customer States:

Reports battery loose in tray. Battery correct for space?

Labor:

Description Check and report

195.00 195.00

Techs Extended

Parts:

No parts on job

Job Sub Total:

Labor Sub Total:

195.00

Drivetrain



61 Orinda Way, Orinda, Ca 94563

Phone: 925-254-5454 @ Orinda Motors Inc.

BAR# AK191519 EPA# CAL00050068

5046604 Invoiced: 01/31/2019

Page:

Customer:

Vehicle:

1965 Chevy Corvette RWD Eng: 350 LS3 Tran: STANDARD

VIN: CHECKV1N1 Mileage In: 62821 Out:

P Date: Clr:

Lic: 7AMS372 St: CA

Repair Order:

Service Writer: J Vanek

PO Number:

Date In: 01/10/2019 Date Out: 01/31/2019

Recommendation:

Re-locate clutch pedal pivot

Wheels and Tires: Tire/Wheel Service

Recommendation:

California Required Tire Pressure Test

Contact Log

As of 02/12/2019 at 1:04 pm

Date:	Time:	By:	Method: # / Addr:	Auth By: Ad	ditional Amt:	Revised Estimate:
01/10/2019	12:35 pm	J Vanek	Phone	Ellis, Steve	390.00	390.00
01/16/2019	11:29 am	J Vanek	Phone	Baum, Ronnie	2781.00	3171.00
		.Repair parking	remove wheels. Replace b brake bracket. Disass brake shoes. Adjust p	emble rear brake t	0	
01/23/2019	11:33 am		In Person kit as required. Re icate new parking brak			7071.00

M O

Payments

As of 02/12/2019 at 1:04 pm

Transactions:	Ledgerld:	Date: nessionals in Au	Accepted By:	Method:	Type/Check#:	Amount:
Payment	933538	01/31/2019	John	Credit Card	Visa	7134.57
•			1658		021 75 D	

I acknowledge notice and oral approval of an increase in the original estimated price.

by the cardmember's agreement with the issuer.

Parts: 1256.53 Labor: 5557.50

Sublets: 150.00

Misc: 60.59

Subtotal: 7024.62 Sales Tax: 109.95

TOTAL: 7134.57 Balance:

Customer Signature

Date

Cardmember Signature

0.00



61 Orinda Way, Orinda, Ca 94563

Phone: 925-254-5454 @ Orinda Motors Inc.

BAR# AK191519 EPA# CAL00050068



5046625

Invoiced:

Page:

Customer:

Vehicle:

1965 Chevy Corvette RWD Eng: 350 LS3 Tran: STANDARD

VIN: CHECKV1N1 Mileage In: 62838 Out:

P Date: Clr:

Cond Description

Lic: 7AMS372 St: CA

Repair Order:

Service Writer: J Vanek

PO Number:

Date In: 01/31/2019

Date Out:

Drivetrain

Parts:

Reports clutch has "notchy" release after clutch replaced. Check and report. **Customer States:**

Labor:	Description	Techs Extended
	Inspect clutch linkage and found the Z bar off at a forward angle causing the geometry to be off. Perform research and found a bracket that mounts to the bell housing for LS engine swap in early Corvettes with mechanical clutch linkage. Also found an adjustable clutch fork pivot is required to finish proper through adjustment and during installing new pivot found the clutch fork won\'t stay on the pivot and has a slight different angle then the Chevrolet performance unit that is for 1965 Corvette.	GS 200.00
	Re-locate clutch pedal pivot with new bracket. Remove transmission. Install new	GS, AO 1405.00

GM Performance clutch fork and adjust pivot.. Re-nstall transmission. Test drive and have smooth operation now at this time.

> Labor Sub Total: 1605.00 Price Ea.

Qty

Extended

	PZ00803 15501 555-601025	N N N	Push Rod Clip Clutch Fork Pivot Ball Pivot Ball Bracket	15.20 54.50 95.98	1.00 1.00 1.00	15.20 54.50 95.98
	3887177	N	Clutch Fork	82.75 Parts Sub	1.00 Total :	82.75
Misc:	Description			Sold Price	Qty	Extended
	Shipping and Handling Fees make Service Councils of California Shipping and Handling Fees sionals in Automotive Service ~ Since 1940 Shipping and Handling Fees			21.79 36.98 22.59	1.00 1.00 1.00	21.79 36.98 22.59
				Misc Sub	Total:	81.36
				Joh Suh	Total:	1934.79

Thank You! We appreciate your business

Part Num

Labor:	Description Techs	Extended
	****Thank you for allowing Orinda Motors Inc. the opportunity to service your vehicle. We know you have a choice in Automotive repair, and appreciate your trust in us!	0.00
	Labor Sub Total:	0.00
Parts:	No parts on job	

RO Not Yet Finalized

0.00

 
Job Sub Total:



61 Orinda Way, Orinda, Ca 94563

Phone: 925-254-5454 @ Orinda Motors Inc.

BAR# AK191519 EPA# CAL00050068



O#: 504662

Invoiced:

Page: 2

Customer:

Vehicle:

1965 Chevy Corvette RWD Eng: 350 LS3 Tran: STANDARD

VIN: CHECKV1N1 Mileage In: 62838 Out:

P Date: Clr:

Lic: 7AMS372 St: CA

Repair Order:

Service Writer: J Vanek

PO Number:

Date In: 01/31/2019

Date Out:

Date:	Time:	Ву:	Method: #	/ Addr:	Auth By	: Additi	onal Amt:	Revised Estimate:
02/07/2019	2:33 pm	J Vanek	Phone		Baum, Ro	nnie	0.00	0.00
		phone message	e Ronnie					
02/07/2019	2:47 pm	J Vanek	Phone		Baum, Ro	nnie	1958.45	1958.45
		Re-locate clutch pedal pivot with new bracket. Remove						
		transmission	. Install new	GM Performance	clutch fo	ork and		
		adjust pivot	Re-nstall to	cansmission. Tes	st drive a	nd have		
		smooth operat	tion now at this	time.				

Payments

Transactions:

No payments received.

As of 02/12/2019 at 1:05 pm

GREEN BUSINESS PROGRAM indapendently Fizies Highast in Equility



Automotive Service Councils of California
Professionals in Automotive Service & Since 1940

I acknowledge notice and oral approval of an increase in the original estimated price.

Parts: Labor: 248.43 1605.00

Sublets:

0.00 81.36

Misc:

Subtotal: Sales Tax: 1934.79 21.74

TOTAL: Balance:

1956.53

Customer Signature

Date

1956.53