

From: CoverkingUSA support@coverking.com
Subject: Order #136384 confirmed
Date: May 18, 2022 at 8:19 AM
To:

Engineered & Assembled in The USA Since 1986!



[SHOP](#)

[INSTALLATION VIDEOS](#)

[ABOUT](#)

[HELP CENTER](#)

ORDER #136384

Thank you for your purchase!

, we're getting your order ready to be shipped. We will notify you when it has been sent.

[VIEW YOUR ORDER](#)

Order summary



Satin Stretch™ Car Cover x 1
CVC3 / 1-tone

\$406.99

Subtotal

\$406.99

Shipping

\$9.45

Taxes

\$36.44

TOTAL

\$452.88 USD




Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE #5047562
 Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

CUS1	YEAR:: 1965	TRANS./DRIVE:: MANUAL/RWD
Cell:	MAKE/MODEL:: CHEVROLET STINGRAY	LICENSE/STATE:: 9BJF612/CA
	VIN:: 194675S123104	MILES IN/MILES 67042/
	ENGINE:: 327 CID	Other Inform TREMEC 5 SPD

In: 6/15/2022 Out: 7/7/2022 Sub-Model: STINGRAY Car Name: Email:

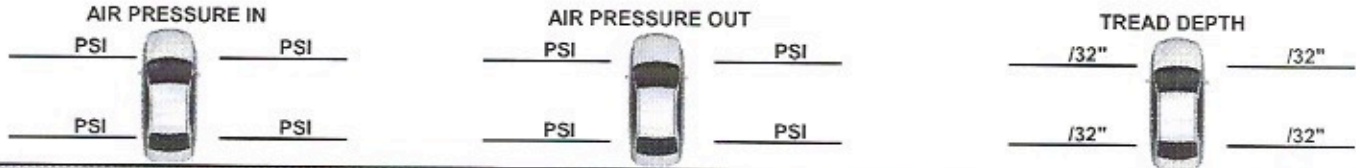

VEHICLE ISSUE #1: ENGINE ASSESSMENT AND TUNE RECOMMENDATIONS

ADV NOTES: CRANKING COMPRESSION EVEN AND MEASURED AT 127 PSI IN ALL CYLINDERS. VACUUM PULL IS EVEN FROM CYLINDER TO CYLINDER DURING IDLE EVENT AND ENGINE RUNNING EVENT. MEASURED 18" VACUUM AT IDLE AND STEADY. IGNITION TIMING BASE SET TO 14 DEGREES BTDC, MAXIMUM ADVANCE WITH VACUUM CAPPED OFF IS 40 DEGREES. CARBURETOR IS A DRAG RACING TYPE CARBURETOR AT 750 CFM. USING CFM CALCULATOR, WE HAVE CALCULATED BEST SIZED CARB AT 689 CFM, WE HAVE FOUND A 675 CFM VAC SECONDARY HOLLEY THAT IS A STREET TYPE CARB AND IS CALIBRATED FOR NORMAL TYPE DRIVING RATHER THAN RACING. THE BASE ENGINE IS IN SOUND CONDITION WITH NO OBVIOUS MECHANICAL FAULTS AT THIS TIME.

LABOR:	CHECK & REPORT	(Discount: \$300.00)	LABOR \$0.00
Total for "ENGINE ASSESSMENT AND TUNE RECOMMENDATIONS": \$0.00			

VEHICLE ISSUE #2: MAINTENANCE INSPECTION FOR MAINTENANCE OR REPAIR NEEDS

ADV NOTES: FOUND CARBURETOR INCORRECT TYPE AND TOO BIG, RECOMMEND REPLACE. FOUND PCV VALVE HOSE IS KINKED, RECOMMEND REPLACE HOSE. FOUND EXHAUST FLANGES ARE LOOSE AND LEAKING EXHAUST, RECOMMEND REPLACE GASKETS. FOUND ENGINE TO CHASSIS GROUND STRAP IS NOT ATTACHED AND LEFT ENGINE MOUNT IS MISSING BOLTS, RECOMMEND REPLACE MISSING HARDWARE AND SECURED GROUND STRAP. FOUND ALTERNATOR OVERCHARGING, RECOMMEND MODIFY CHARGING SYSTEM TO INTERNALLY REGULATED AND ELIMINATE EXTERNAL VOLTAGE REGULATOR. FOR MAINTENANCE WE RECOMMEND REPLACEMENT ENGINE OIL AND FILTER, TRANSMISSION DRAIN AND REFILL AND DIFFERENTIAL DRAIN AND REFILL.

LABOR:	MAINTENANCE INSPECTION COMPLETED	(Discount: \$600.00)	LABOR \$0.00
Total for "MAINTENANCE INSPECTION FOR MAINTENANCE OR REPAIR NEEDS": \$0.00			

VEHICLE ISSUE #3: REPLACE CARBURETOR DUE TO OVERSIZED POOR-QUALITY CHOICE - CANNOT ADJUST COLD START WITHOUT OPERABLE CHOKE.
 AFTERMARKET CHOICE IS NEEDED TO MATCH MANIFOLD WHICH IS A EDELBROCK STAMPING # 3344461
 PCV VALVE AND HOSE ROUTING REPAIRS - OIL TUBE HAS BEEN MODIFIED SO ORIGINAL PCV VALVE WILL NOT SCREW INTO OIL FILL TUBE, HOSE OPTION POSSIBLE.

Recommended Repairs:	Labor/Jobs	\$4,350.00
	Parts	\$3,508.67
Warranty: From the date of delivery for a period of 3 months or 3000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 40.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$125.00
	Total Fees	\$185.00
	Subtotal	\$8,168.67
	Tax @ 9.75%	\$342.10
	Total	\$8,510.77
	Payments	\$8,510.77
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.

X _____ Date 7/7/2022



Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE #5047562
 Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

CUS:	YEAR:: 1965	TRANS:/DRIVE:: MANUAL/RWD
Cell:	MAKE:/MODEL:: CHEVROLET STINGRAY	LICENSE:/STATE:: 9BJF612/CA
	VIN:: 194675S123104	MILES IN/OUT: 67042
	ENGINE:: 327 CID	Other Inform TREMEC 5 SPD

ADV NOTES: REMOVED OLD CARBURETOR, REMOVED OLD PCV VALVE HOSES. THE THREADS IN THE INTAKE MANIFOLD FOR THE CARBURETOR STUDS ARE STRIPPED. WE HAVE DRILLED AND HELI-0COILED ALL BOLT HOLES FOR CARB MOUNTING. INSTALLED AND SECURED NEW STUDS. INSTALLED NEW CARBURETOR, HEAT INSULATOR AND GASKETS, TIGHTENED RETAINING HARDWARE, INSTALLED NEW FUEL FEED PIPE AND FABRICATED STEEL FEED TUBE FROM MANIFOLD TO FUEL FILTER. SECURED FUEL CONNECTIONS. REPLACE DAMAGED / WARN THROTTLE LINKAGE BUSHINGS AND ADJUSTED THROTTLE LINKAGE AND VERIFIED CLOSED HOT SLOW IDLE AND WOT POSITIONS ARE ACCESSIBLE. REPLACE VAC HOSES FOR BRAKE BOOSTER AND PCV VALVE. SECURED BOTH HOT CHOKE TUBE AND PCV VALVE AT CARBURETOR FITTINGS. STARTED ENGINE, ADJUSTED FLOAT LEVELS, CHOKE SETTING, FAST IDLE, HOT SLOW IDLE AND IDLE MIXTURE. FOR BEST RESULTS WE HAVE ADJUSTED ACCELERATOR PUMP CAM AND NOZZLE TO MATCH ENGINE FUEL NEEDS ON ACCELERATION.

TEST DROVE VEHICLE ON BOTH HOT AND COLD CONDITIONS. AT THIS TIME ENGINE PERFORMANCE IS AS EXPECTED WITH SMOOTH THROTTLE RESPONSE UNDER IN TOWN AND FREEWAY TYPE DRIVING.

WE ASK THAT YOU FOLLOW THESE STARTING INSTRUCTIONS. WHEN COLD PUMP ACCELERATOR 2 TIMES, START ENGINE AND ALLOW TO RUN FOR ABOUT 60 SECONDS THEN TAP THROTTLE TO LOWER ENGINE RPM AND START TO DRIVE. WHEN HOT THE ACCELERATOR SHOULD NOT NEED TO BE DEPRESSED, IF THE ENGINE DOES NOT START HOT THEN TAP THROTTLE ABOUT 1/8 OPEN AND START.

WE ASK THAT YOU RETURN IN 250 TO 500 MILES FOR A CHECK OF SPARK PLUG WEAR TO VERIFY PROPER FUEL MIXTURE BASED ON SPARK PLUG DEPOSITS. FURTHER INTERNAL CARBURETOR ADJUSTMENTS MAY BE NEEDED BASED ON FINDINGS.

PART: HLY-0-80670	CARBURETOR, STREET AVENGER, 670 CFM, SQUARE BORE, 4-BARREL, ELECTRIC CHOKE, DUAL INLET, SILVER, EACH	1 @ \$1,117.90	\$1,117.90	NEW
PART: 152002	PAPER AIR FILTER ELEMENT	2 @ \$59.85	\$119.70	NEW
PART: OER-3969835	CARBURETOR HEAT SHIELD	1 @ \$131.97	\$131.97	NEW
PART: 61	CARBURETOR STUDS	1 @ \$37.59	\$37.59	NEW
PART: HLY-34-150	DUAL FUEL FEED TUBE	1 @ \$133.80	\$133.80	NEW
PART: MRG-1512	LINKAGE BUSHING	1 @ \$34.65	\$34.65	NEW
PART: STF-6367	THROTTLE LINKAGE BUSHING	1 @ \$47.25	\$47.25	NFW
PART: STF-1060	THROTTLE RETURN KIT	2 @ \$23.63	\$47.26	NEW
PART: QFT-21-35QFT	ACCEL NOZZLE	1 @ \$78.00	\$78.00	NEW
PART: HLY-20-12	ACCEL CAM	1 @ \$102.30	\$102.30	NEW



Recommended Repairs:	Labor/Jobs	\$4,350.00
	Parts	\$3,508.67
	Sublet	\$125.00
	Total Fees	\$185.00
	Subtotal	\$8,168.67
Warranty: From the date of delivery for a period of 3 months or 3000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 40.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Tax @ 9.75%	\$342.10
	Total	\$8,510.77
	Payments	\$8,510.77
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.

X _____ Date 7/7/2022



Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE #5047562
 Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

CUS:	YEAR:: 1965	TRANS:/DRIVE:: MANUAL/RWD
Cell:	MAKE:/MODEL:: CHEVROLET STINGRAY	LICENSE:/STATE:: 9BJF612/CA
	VIN:: 194675S123104	MILES IN/OUT: 67042
	ENGINE:: 327 CID	Other Inform TREMEC 5 SPD

LABOR:	INSTALL NEW CARB AND SET FLOAT LEVEL, CHOKE AND IDLE SETTING, ASSESS AND REPORT BACK TO CUSTOMER	\$1,200.00	LABOR
--------	--	------------	-------

Total for *REPLACE CARBURETOR DUE TO OVERSIZED POOR-QUALITY CHOICE - CANNOT ADJUST COLD START WITHOUT OPERABLE CHOKE. # 3344461
 AFTERMARKET CHOICE IS NEEDED TO MATCH MANIFOLD WHICH IS A EDELBROCK STAMPING # 3344461
 PCV VALVE AND HOSE ROUTING REPAIRS - OIL TUBE HAS BEEN MODIFIED SO ORIGINAL PCV VALVE WILL NOT SCREW INTO OIL FILL TUBE, HOSE OPTION POSSIBLE. *: \$3,050.42

VEHICLE ISSUE #4: CHARGING SYSTEM UPGRADE TO INTERNALLY REGULATED SECURE CHASSIS GROUND AT ENGINE BLOCK

ADV NOTES: NOTE THE ALTERNATOR BELT ROUTING RUNS THE BELT WITHIN 1/2 INCH OF THE RADIATOR HOSES. THERE ARE MARKS ON RADIATOR HOSE FROM BELT CONTACT BEFORE WE BEGAN. REMOVE AND REPLACE ALTERNATOR. REMOVE VOLTAGE REGULATOR FROM THE VEHICLE. ATTACHED BATTERY FLOW AND GROUND WIRES TO ALTERNATOR. USED EXISTING STATOR AND FLIED WIRES FOR LIGHT CIRCUIT AND IGNITION SENSE CIRCUITS, WIRED IN NEW ALTERNATOR PIGTAIL CONNECTOR. MODIFIED AND REMOVE VOLTAGE REGULATOR CONNECTOR, FEED IGNITION SENSOR TO ALTERNATOR MOUNTED VOLTAGE REGULATOR. INSTALLED SHORTER BELT AND SET BELT TENSION. TIGHTENED ALL POWER STEERING, ALTERNATOR BRACKET MOUNTING HARDWARE. THE FRAME GROUND STRAP WILL NOT FIT ON ENGINE MOUNT BOLT, WE HAVE SECURED TO POWER STEERING BRACKET BOLT WHICH IS SECURED TO ENGINE BLOCK. THE MISSING ENGINE MOUNT BOLT WAS REPLACED, AND ALL ENGINE MOUNT BOLTS WERE TIGHTENED. WE HAVE WRAPPED THE UPPER RADIATOR HOSE WITH HEAT SHRINK PROTECTIVE SLEEVE IN THE AREA WHERE THE BELT IS CLOSE TO PROVIDE EXTRA HOSE PROTECTION.

STARTED ENGINE AND VERIFIED PROPER CHARGING SYSTEM OPERATION, WE HAVE VERIFIED THAT AFTER TEST DRIVE THERE WAS NO BELT TO HOSE CONTACT.

PART: PWM-47293	INTERNALLY REGUALTED ALT 100 AMPS	1 @ \$371.23	\$371.23	NEW
PART: 7575	DRIVE BELT	1 @ \$69.86	\$69.86	NEW
PART: ADO-PT2288	REGUALTOR CONNECTOR	1 @ \$20.44	\$20.44	NEW
PART: VH	VACUUM HOSE	2 @ \$10.00	\$20.00	NEW
PART: SPR	SPACER	8 @ \$11.68	\$93.44	NEW
PART: TCX-H2F2-36BK6	HEAT SHRINK TUBE 2"	1 @ \$59.15	\$59.15	NEW

Recommended Repairs:	Labor/Jobs	\$4,350.00
	Parts	\$3,508.67
Warranty: From the date of delivery for a period of 3 months or 3000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 40.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$125.00
	Total Fees	\$185.00
	Subtotal	\$8,168.67
	Tax @ 9.75%	\$342.10
	Total	\$8,510.77
	Payments	\$8,510.77
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.

X _____ Date 7/7/2022



Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE #5047562
 Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

CUST	YEAR:: 1965	TRANS:/DRIVE:: MANUAL/RWD
Cell:	MAKE:/MODEL:: CHEVROLET STINGRAY	LICENSE:/STATE:: 9BJF612/CA
	VIN:: 194675S123104	MILES IN/OUT: 67042
	ENGINE:: 327 CID	Other Inform TREMEC 5 SPD

LABOR:	REMOVE AND REPLACE ALTERNATOR, CHANGE BELT AS NEEDED, MODIFY REGULATOR CONENCTIONS AND ALTERNATOR CONENCTIONS TO MATCH UPGRADED ALTERNATOR, TEST AND REPORT	\$1,200.00	LABOR
LABOR:	ATTACH GROUND STRAP	\$150.00	LABOR
LABOR:	WRAP UPPER RADIATOR HOSE TO PROTECT FROM ALT / P-S BELT CONTACT	(Discount: \$200.00) \$0.00	LABOR

Total for "CHARGING SYSTEM UPGRADE TO INTERNALLY REGULATED SECURE CHASSIS GROUND AT ENGINE BLOCK": \$1,984.12

VEHICLE ISSUE #5: ENGINE OIL , FILTER AND LUBRICATION SERVICE			
ADV NOTES: LUBRICATED ALL ZERK FITTINGS, CHANGE OIL AND FILTER, ADDED ZINC ADDITIVE			
PART: CHV 46637	15W-40 OIL	6 @ \$17.05	\$102.30 NEW
PART: 51060	OIL FILTER	1 @ \$22.89	\$22.89 NEW
PART: 81403	RED LINE BREAK IN ADDITIVE	1 @ \$45.08	\$45.08 NEW
LABOR:	ENGINE OIL AND FILTER CHANGE WITH CHASSIS LUBRICATION	\$300.00	LABOR

Total for "ENGINE OIL , FILTER AND LUBRICATION SERVICE": \$470.27

VEHICLE ISSUE #6: EXHAUST FLANGE GASKETS			
ADV NOTES: THE EXHAUST STUDS IN THE RIGHT MANIFOLD ARE TOO SHORT FOR CURRENT HEAT RISE SPACER. HEAT RISER WAS MILLED TO REDUCE THICKNESS TO ALLOW REUSE OF CURRENT STUDS. THE RIGHT EXHAUST STUDS WERE CHANGED. NEW FLANGE GASKETS AND HEAT RISER GASKETS WERE INSTALLED, RETAINING HARDWARE TIGHTENED AND ENGINE STARTED, AND NO LEAKS VERIFIED.			
PART: 8194-9587	EXHAUST FLANGE GASKET	1 @ \$59.50	\$59.50 NEW
PART: 60083-9097	HEAT RISEER GASKET	1 @ \$39.83	\$39.83 NEW
PART: RNB-03112	EXHAUST FLANGE HARDWARE	2 @ \$17.96	\$35.92 NEW
PART: 3816LN	3/8 X 16 LOCK NUT	6 @ \$6.72	\$40.32 NEW
PART: 03113	EXHAUST MANIFOLD FLANGE STUD	2 @ \$19.18	\$38.36 NEW

Recommended Repairs:	Labor/Jobs	\$4,350.00
	Parts	\$3,508.67
Warranty: From the date of delivery for a period of 3 months or 3000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 40.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$125.00
	Total Fees	\$185.00
	Subtotal	\$8,168.67
	Tax @ 9.75%	\$342.10
	Total	\$8,510.77
	Payments	\$8,510.77
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.

X _____ Date 7/7/2022



Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE #5047562
 Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

CUS:	YEAR:: 1965	TRANS/DRIVE:: MANUAL/RWD
Cell:	MAKE/MODEL:: CHEVROLET STINGRAY	LICENSE/STATE:: 9BJF612/CA
	VIN:: 194675S123104	MILES IN/OUT: 67042
	ENGINE:: 327 CID	Other Inform TREMEC 5 SPD

LABOR:	REMOVE AND REPLACE XHAUST FLANGE GASKETS AND HARDWARE AS NEEDED TO REMIDY EXHAUST LEAKS. DOES NOT INCLUDE DRILLING BROKEN BOLTS	\$600.00	LABOR
SUBLET	REDUCE THICKNESS BY MACHINING FLAT SURFACE BY 3/8" FOR CLEARANCE DUE TO SIEZED EXHAUST STUDS	\$125.00	SUBLET

Total for "EXHAUST FLANGE GASKETS": \$938.93

VEHICLE ISSUE #7: DRAIN AND REFILL TRANSMISSION & DIFFERENTIAL			
ADV NOTES: FILLED WITH PROPER FLUID			
PART:	MANUAL TRANSMISSION FLUID, MINERAL, 75W85, 1 QUART, EACH	4 @ \$69.27	\$277.08 NEW
PART:	10042 85W-140 GEAR OIL	3 @ \$32.31	\$96.93 NEW
LABOR:	DRAIN AND REFILL TRANSMISSION & DIFFERENTIAL		\$300.00 LABOR
Total for "DRAIN AND REFILL TRANSMISSION & DIFFERENTIAL": \$674.01			

VEHICLE ISSUE #8: BRAKE FLUID EXCHANGE			
ADV NOTES: COMPLETED			
PART:	DOT 3 1 PINT DOT 3 BRAKE FLUID	4 @ \$31.32	\$125.28 NEW
PART:	05084 PARTS CLEANER	1 @ \$5.16	\$5.16 NEW
LABOR:	BRAKE FLUID EXCHANGE		\$300.00 LABOR
Total for "BRAKE FLUID EXCHANGE": \$430.44			

VEHICLE ISSUE #9: COOLANT EXCHANGE			
ADV NOTES: DRAIN COOLANT, FILL WITH DISTILLED WATER, RUN TO OPERATING TEMPERATURE, DRAIN WATER. FILLED WITH FRESH PREMIXED COOLANT / WATER MIX AT 50/50 RATIO, VERIFIED NO LEAKS AFTER REPAIRS. NOTED 195 DEGREES ON TEMPERATURE GAUGE DURING TEST DRIVE AFTER REPAIRS.			
PART:	GCC GREEN GYLCOL PREMIX RECYCLED COOLANT GALLON	3 @ \$35.06	\$105.18 NEW
PART:	DISWATER DISTILLED WATER GAL	2 @ \$5.99	\$11.98 NEW
PART:	61104 DRAIN COCK	1 @ \$18.32	\$18.32 NEW

Recommended Repairs:	Labor/Jobs	\$4,350.00
	Parts	\$3,508.67
Warranty: From the date of delivery for a period of 3 months or 3000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 40.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$125.00
	Total Fees	\$185.00
	Subtotal	\$8,168.67
	Tax @ 9.75%	\$342.10
	Total	\$8,510.77
	Payments	\$8,510.77
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.

X _____ Date 7/7/2022



Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE #5047562
 Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

CUS:	YEAR:: 1965	TRANS:/DRIVE:: MANUAL/RWD
Cell:	MAKE:/MODEL:: CHEVROLET STINGRAY	LICENSE:/STATE:: 9BJF612/CA
	VIN:: 194675S123104	MILES IN/OUT: 67042
	ENGINE:: 327 CID	Other Inform TREMEC 5 SPD

LABOR:	DRAIN & REFILL COOLING SYSTEM	\$300.00	LABOR
			Total for "COOLANT EXCHANGE": \$435.48

VEHICLE ISSUE #10: FEE DESCRIPTION:			
LABOR:	S&H : IS SHIPPING & HANDLING FEE DESCRIPTION	\$0.00	LABOR
	AM(7691728) - \$30.00		
	CC(SO-0471956) - \$40.00		
	AM(1984481) - \$25.00		
	AM (1093011) - \$30.00		
	AM(17356475) - \$30.00		
	AM (1338461) - \$30.00		
LABOR:	AF: = ADDED FUEL FEE:	\$0.00	LABOR
LABOR:	HWD: = HAZARDOUS WASTE DISPOSAL FEE DESCRIPTION:	\$0.00	LABOR
LABOR:	ST = STORAGE FEE:	\$0.00	LABOR
			Total for "FEE DESCRIPTION:": \$0.00

VEHICLE ISSUE #11: THANKS			
ADV NOTES: THANK YOU! FOR THE TRUST YOU HAVE IN US TO REPAIR YOUR RIDE!. IF YOU ARE SATISFIED PLEASE SHARE WITH OTHERS. IF WE SOMEHOW LET YOU DOWN, PLEASE CALL US WE WILL ADDRESS YOUR CONCERNS IMMEDIATELY			
			Total for "THANKS": \$0.00

REVISIONS			
Original Estimate: (\$1,189.23)		Total Revisions: \$9,700.00	Total RO: \$8,510.77
Additional Cost: \$900.00	Revised Estimate: (\$289.23) Additional Work: Initial Inspection	Date: 6/15/2022 Time: 08:03	Approval Method: In Person H.Hiller
Additional Cost: \$8,800.00	Revised Estimate: \$7,610.77 Additional Work: See Attached Email	Date: 6/16/2022 Time: 14:45	Approval Method: Email On File
			SHIPPING : \$185.00
Payment Rec'd	visa - AuthCode 05935D - CC# 8646	Date: 6/16/2022	\$2,500.00

Recommended Repairs:	Labor/Jobs	\$4,350.00
	Parts	\$3,508.67
Warranty: From the date of delivery for a period of 3 months or 3000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 40.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$125.00
	Total Fees	\$185.00
	Subtotal	\$8,168.67
	Tax @ 9.75%	\$342.10
	Total	\$8,510.77
	Payments	\$8,510.77
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.



Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE #5047562
 Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

CUS	YEAR:: 1965	TRANS/DRIVE:: MANUAL/RWD
Cell:	MAKE/MODEL:: CHEVROLET STINGRAY	LICENSE/STATE:: 9BJF612/CA
	VIN:: 194675S123104	MILES IN/OUT: 67042
	ENGINE:: 327 CID	Other Inform TREMEC 5 SPD

Payment Rec'd	Visa - AuthCode 02938D - CC# 7293	Date: 7/7/2022	\$6,010.77
6/30/2022 10:52:47 AM - HANS HILLER	SENT VIA TEXT MESSAGE: FROM MACHINIST, HE IS DONE WITH THE PART, I WILL PICK UP AT LUNCH. I HEARD FROM THE ALTERNATOR, ITS BELT AND THE UPPER RADIATOR HOSE. I WANT TO TALK ABOUT MY SOLUTION THAT I WOULD LIKE TO ADD. CAN YOU GIVE ME A CALL, IM OUT TO LUNCH BETWEEN 11:30 AND 1:30, THANKS, HANS		
6/30/2022 11:19:11 AM - Customer	RECEIVED VIA TEXT MESSAGE THANKS FOR THE UPDATE AND ALL OF YOUR HELP, HANS. APPRECIATE YOU GETTING MY VETTE DIALED IN AND RUNNING RIGHT. AND THANKS FOR KEEPING OVER THE WEEKEND.		
7/3/2022 1:51:05 PM - HANS HILLER	SENT VIA TEXT MESSAGE: FROM JUST WANTED TO LET YOU KNOW I WILL HAVE TO DO SOME ADJUSTMENTS ON CARB, I DON'T KNOW IF READY TO PICK UP FIRST THING TUESDAY, I PLAN TO DRIVE IT TOMORROW. ILL LET YOU KNOW AFTER THE TEST DRIVE. HANS		
7/3/2022 1:54:48 PM - Customer	RECEIVED VIA TEXT MESSAGE THANKS FOR THE UPDATE, HANS. LET ME KNOW ONCE READY. I WILL BE HOME MID-DAY TUESDAY AND CAN PICK IT UP LATER THAT DAY OR THE FOLLOWING MORNING. APPRECIATE YOU GETTING IT RUNNING PERFECTLY!		
7/5/2022 11:31:10 AM - Customer	RECEIVED VIA TEXT MESSAGE THX...SHAWN GOOD MORNING, HANS. DO YOU HAVE AN UPDATE ON MY CORVETTE?		
7/5/2022 1:36:29 PM - HANS HILLER	SENT VIA TEXT MESSAGE: FROM IS NOT STRONG ENOUGH TO DRIVE. I HAVE THE PARTS I NEED TO ADJUST ON THE WAY WILL BE HERE TOMORROW. EVERYTHING ELSE IS DONE. I GET MY UPS & FED EX BY NOON; I WILL BE ABLE TO DRIVE THEN. CHOKE ADJUSTMENT SEEMS GOOD, AND IT PURRS LIKE A TIGER! HANS		
7/5/2022 2:11:49 PM - Customer	RECEIVED VIA TEXT MESSAGE TOMORROW? THANKS FOR THE UPDATE, HANS. SO HOPING END OF DAY		
7/6/2022 3:54:25 PM - Customer	RECEIVED VIA TEXT MESSAGE ANY UPDATE, HANS?		
7/6/2022 4:30:35 PM - HANS HILLER	SENT VIA TEXT MESSAGE: WORKING ON TUNING ACCELERATOR PUMP FOR BEST DRIVEABILTY, BEAR WITH ME SHAWN, PLEASE, ITS INSIDE AT ALL TIMES.		
7/6/2022 4:31:47 PM - Customer	RECEIVED VIA TEXT MESSAGE APPRECIATE YOU TAKING TIME TO GET IT RIGHT. JUST TRYING TO MANAGE SCHEDULE. CAME DOWN FROM TAHOE YESTERDAY, HEADING BACK TOMORROW. THX!		
7/7/2022 7:41:06 AM - HANS HILLER	SENT VIA TEXT MESSAGE: SHAWN, I FOUND THE PROBLEM, I HAVE TO MODIFY INSULATOR PLATE IT IS INTERFERING WITH THE ACCELERATOR PUMP OPERATION, SO CARB IS COMING OFF THIS MORNING, I WILL KEEP YOU POSTED WITH MY PROGRESS.		

Recommended Repairs:	Labor/Jobs	\$4,350.00
	Parts	\$3,508.67
Warranty: From the date of delivery for a period of 3 months or 3000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 40.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$125.00
	Total Fees	\$185.00
	Subtotal	\$8,168.67
	Tax @ 9.75%	\$342.10
	Total	\$8,510.77
	Payments	\$8,510.77
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.

X _____ Date 7/7/2022



Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE #5047562
 Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

CUS:	YEAR:: 1965	TRANS:/DRIVE:: MANUAL/RWD
Cell:	MAKE:/MODEL:: CHEVROLET STINGRAY	LICENSE:/STATE:: 9BJF612/CA
	VIN:: 194675S123104	MILES IN/OUT: 67042
	ENGINE:: 327 CID	Other Inform TREMEC 5 SPD

7/7/2022 7:49:30 AM - Customer	RECEIVED VIA TEXT MESSAGE PLATE IT IS INTERFERING WITH THE ACCELERATOR PUMP OPERATION, SO CARB IS COMING OFF THIS MORNING, I WILL KEEP YOU POSTED WITH MY PROGRESS."	I FOUND THE PROBLEM, I HAVE TO MODIFY INSULATOR
7/7/2022 7:58:19 AM - HANS HILLER	SENT VIA TEXT MESSAGE: THANKS!	
7/7/2022 3:39:42 PM - Customer	RECEIVED VIA TEXT MESSAGE	ARE YOU ABLE TO SHARE A PROGRESS REPORT? THX HANS.



Recommended Repairs:	Labor/Jobs	\$4,350.00
	Parts	\$3,508.67
Warranty: From the date of delivery for a period of 3 months or 3000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of 40.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Sublet	\$125.00
	Total Fees	\$185.00
	Subtotal	\$8,168.67
	Tax @ 9.75%	\$342.10
	Total	\$8,510.77
	Payments	\$8,510.77
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.

X _____

Date 7/7/2022

From: Coker Tire Co marketing@email.cokertirecompany.com
Subject: Invoice for your Coker Tire Company order
Date: June 17, 2022 at 9:44 AM
To:



Thank you for your order from Coker Tire Company. If you have questions about your order, you can email us at support@coker.com or call us at 866-516-3215.

Your Invoice #3000101421 for Order #3000215580

Billing Info

Shipping Info

Payment Method

PayPal

Payer Email

Shipping Method

FedEx - Ground

Items	Qty	Subtotal
BF Goodrich Silvertown Radial Goldline 205/75R15 SKU: 579700	4	\$1,344.00
	Subtotal	\$1,344.00
	Shipping & Handling	\$155.19
	Grand Total (Excl.Tax)	\$1,506.19
	Tire Tax	\$7.00
	Tax	\$117.60
	CA STATE TAX (6%)	\$80.64
	CA COUNTY TAX (0.25%)	\$3.36
	CA SPECIAL TAX (1.5%)	\$20.16
	CA SPECIAL TAX (1%)	\$13.44
	Grand Total (Incl.Tax)	\$1,623.79

PACKING LIST

Invoice Number	
11005796	
Invoice Date	Page
6/21/2022 08:23:22	1 of 1
ORDER NUMBER	
2693949	

Ship To:

Customer ID: 563522

PO Number	Order Date	Pick Ticket No	Taker	Carrier	Carrier Tracking Number
3000215580	6/17/2022 11:47:08	1994227	INTERNET	FedEx Ground	

Quantities				Item ID	UOM
Ordered	Shipped	Remaining	Disp.	Item Description	Unit Size

Carrier: FedEx Ground

Tracking #: 074783113265935

Carrier: FedEx Ground

Tracking #: 074783113265942

4	4	0		579700 P205/75R15 BFG 3/8" GOLDLINE	TIRE 1.0
1	1	0		ADJ PRICE / TAX ADJUSTMENT	OTHER 1.0

Total Pieces: 5 **Total Lines:** 2 **Total Weight:** 102.08




Orinda Classic Car center
 61 ORINDA WAY
 ORINDA, CA. 94563
 (925) 254-5454
 Writer: HANS HILLER

INVOICE # 5047683

Service@orindaclassiccarcenter.com
 WWW.OCCC.SHOP
 BAR# BAR/ARD191519
 EPA# CAL0050068

YEAR::	1965	TRANS./DRIVE::	MANUAL/RWD
MAKE/MODEL::	CHEVROLET STINGRAY	LICENSE/STATE::	9BJF612/CA
VIN::	194675S123104	MILES IN/MILES OUT:	67623/
ENGINE:	327 CID		

In: 4/10/2023 Out: 4/18/2023 Sub-Model: STINGRAY Car Name: Email:

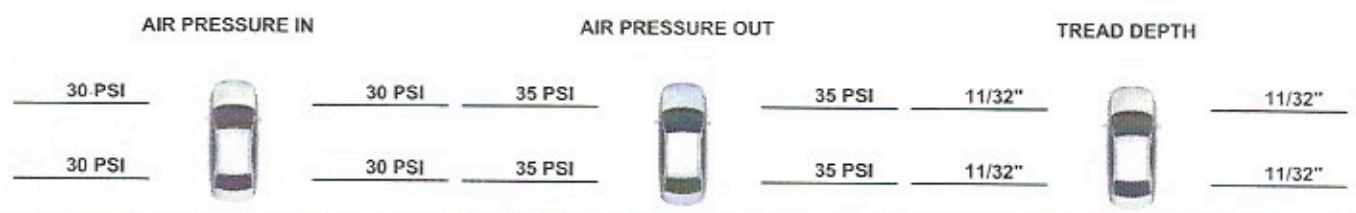

VEHICLE ISSUE #1: MOUNT AND BALANCE CUSTOMER SUPPLIED TIRES, SUPPLY WITH LEAD KNOCK OFF HAMMER				
ADV NOTES: REMOVE KNOCK OFF HUB CAPS: NOTE THE HUB CAPS ARE A KNOCK OFF DESIGN WITH POP OUT CENTER CAP AND LOCK PIN TO KEEP KNOCK OFF LUG NUT FROM COMING OFF. WE HAVE REMOVED THE KNOCK OFFS AND WHEELS FROM VEHICLE. MOUNTED AND BALANCED THE WHEELS AND TIRES. THE 2 HEAVIEST TIRES WERE PLACED ON THE REAR WHEELS. LUG NUTS WERE TIGHTENED TO 100 FT LBS, AND KNOCK OFF HUB CAPS WERE INSTALLED AND LOCKED IN PLACE. TIRE PRESSURES SET TO 35 PSI FRONT AND REAR				
PART: KOWLH	KNOCK-OFF WHEEL LEAD HAMMER	1 @ \$106.50	\$53.25	NEW
PART: HRDWR	HUB CAP RETAINING HARDWARE 1/4 X 20	1 @ \$17.50	\$8.75	NEW
LABOR:	MOUNT & BALANCE TIRES		(Discount: \$740.00)	LABOR
			\$740.00	
Total for "MOUNT AND BALANCE CUSTOMER SUPPLIED TIRES, SUPPLY WITH LEAD KNOCK OFF HAMMER": \$802.00				

REVISIONS

Original Estimate: \$-1.95 Total Revisions: \$810.00 Total RO: \$808.05

Additional Cost: \$810.00	Revised Estimate: \$808.05 Additional Work: Mount & Balance	Authorized By:	Date: 4/18/2023 Time: 12:08:00 pm	Approval Method: In Person H.Hiller
Payment Rec'd	Visa - AuthCode 08189D - CC# 7293	Date: 4/18/2023	\$808.05	

Automotive Service Councils of California
 Professionals in Automotive Service ~ Since 1940

Recommended Repairs: Warranty: From the date of delivery for a period of 6 months or 6,000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of \$25 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.	Labor/Jobs	\$740.00
	Parts	\$62.00
	Sublet	\$0.00
	Total Fees	\$0.00
	Subtotal	\$802.00
	Tax @ 9.75%	\$6.05
	Total	\$808.05
	Payments	\$808.05
	Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond our control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I acknowledge notice and oral approval of an increase in the original estimated price. I have read the above and acknowledge receipt of an estimate.

X _____ Date 4/18/2023

BURLINGAME MOTORS, INC.

Independent Mercedes Benz Dept.

Since 1979

1295 Rollins Road

BURLINGAME, CA 94010-2416

(650) 343-8858 Fax (650) 343-9261

Since 1979

EPA #CAL 000398238

BAR # ARD275257

Date 12.7.23 022232
 Time Received Written By RENE
 A.M. P.M. Cust. Order No.
 Promised A.M. P.M. Phone when ready Yes No

QTY	* PART NO. OR DESCRIPTION	SALE
1	OIL FILTER	9.86
1	TEAMATEX	23.98
	VALVE COVER GASKETS	23.48
1	BATTERY 24F	212.00
1	HEAD GASKET	85.95
1	INTAKE GASKET SET	29.71
1	EXHAUST GASKET SET	18.56
1	COOLANT	26.50
2	K SEAL	23.85 47.70
1	W/MECHANICAL BOREWORK	

Name _____ Home Phone _____
 Address _____ Apt. No. _____ Work Phone _____
 City _____ Other _____

Year-Make-Model CORVETTE License No. 65C2VET Odometer 61237

Estimate Amount \$	Engine Size	VIN Number			
Revised Estimate \$	Date	Time	Description	Authorized By	INITIAL
Revised Estimate \$	Date	Time	Description	Authorized By	INITIAL

ALL PARTS REMOVED WILL BE DISCARDED UNLESS INSTRUCTED OTHERWISE. SAVE DISCARD

TEAR DOWN ESTIMATE: I understand that my vehicle will be reassembled in _____ days shown here if I choose not to authorize the service recommended.

OPER NO.	REPAIR ORDER — LABOR INSTRUCTION	LABOR CHG.
	CAR TOWED IN COOLANT IN N° 7 CYL	
	RIP INTAKE MANIFOLD RHD DINNER CYLINDER HEAD SEND OUT FOR PRESSURE TEST CLEAN SPARKPLUGS REPLACE HEADGASKET RE-TORQUE CYL HEAD	
	REPLACE BATTERY (2017)	
	PAID VISA 1/9/24	

TIRE PRESSURE CHECK SERVICE COMPLETED BY _____
 TIRE PRESSURE: LF _____ RF _____ LR _____ RR _____ (psi)
 DECLINED Initial REASON: _____

SUBLET REPAIRS

Tow	456.00
MACHINE SHOP	175.00
TOTAL SUBLET REPAIRS	631.00

WARRANTY ON PARTS & LABOR

3 MONTHS OR 4,000 MILES WHICHEVER COMES FIRST.
 6 MONTHS OR 8,000 MILES WHICHEVER COMES FIRST.
 9 MONTHS OR 9,000 MILES WHICHEVER COMES FIRST.
 12 MONTHS OR 12,000 MILES WHICHEVER COMES FIRST.
 NOT GUARANTEED - NEED ADDITIONAL SERVICE(S).
 WARRANTY WORK MUST BE DONE AT THIS FACILITY AND DOES NOT INCLUDE TOW CHARGES OR CUSTOMER SUPPLIED PARTS OR USED PARTS. WARRANTY VOID IF DEFECT CAUSED BY MISUSE, ABUSE OR PERSONAL DAMAGE. A \$25 PER DAY STORAGE FEE WILL BE CHARGED IF VEHICLE IS NOT PICKED UP AFTER 48 HRS OF COMPLETION OF REPAIRS.

RECOMMENDED SERVICE:

1. _____
 2. _____
 3. _____

I hereby authorize the repair work above to be done along with the necessary material, and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

QTY.	SALE
QTS. OIL	
5 QTS. OIL 20/50	775
LBS. GREASE	
TOTAL OIL, GREASE	775

Authorized By P. Howe

TOTAL LABOR	3600.00
PARTS	487.74
SUBLET REPAIRS	631.00
OIL & GREASE	38.75
GAS	20.00
SALES TAX	50.67
HAZARDOUS WASTE DISPOSAL FEE	6.00
TOTAL AMOUNT	4834.16

INVOICE COPY