American Classics and Performance

545 Portal St.

Cotati, CA. 94931

Phone: 707-664-8722 Fax: 707-664-8770

LET US TAKE CARE OF YOUR DREAM CAR!!!

1351

ARD00257737 CAL000399739

INVOICE

Print Date: 09/24/2025

1967 JAGUAR - XKE

4.2L

Lic #: 7CBF930 - CA

Work Completed: 09/23/2025

Odometer In: 30,777 Odometer Out: 30,778

	VIN # :				
Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
SPARK PLUGS	6.00	9.50	57.00	WORK PERFORMED	9,945.00
7734 CONDENSOR DCB101	1.00	28.56	28.56	DIAGNOSE EXCESSIVE SMOKE, BLACK-RICH MIXTURE, REMOVE AND INSPECT SPARK PLUGS, ALL PLUGS RUNNING RICH. CHECK COMPRESSION, ALL CYLINDERS BETWEEN 150 AND 155 PSI. REPLACE SPARK PLUGS AND GAP TO .032.	
IGNITION POINT SET	1.00	29.50	29.50		
DSB101 RADIATOR CAP-(7 LB)	1.00	16.42	16.42	DRAIN FUEL TANK AND REFILL WITH FRESH FUEL. INSPECT IGNITION POINTS, REMOVE DISTRIBUTOR, CLEAN ALL RUST OFF DISTRIBUTOR CAM, REMAKE NEW IGNITION PIG TAIL WIRE FROM SIDE COVER TO POINTS. LUBE AND FREE UP	
7031696 50/50 PRE-MIXED COOLANT (PER GALLON) PMC	0.50	19.00	9.50	MECHANICAL ADVANCE WEIGHTS, REPLAC CONDENSER, SET POINT GAP TO .016, INST DISTRIBUTOR, SET TIMING, 10* BASE.	E POINTS AND
FLOATS-(BRASS)	3.00	33.00	99.00	CHECK OIL LEVEL-LOW, ADD 4 QTS, TOP UP COOLANT AND	
370-010				PRESSURE TEST RADIATOR CAP-NO GOOD	
FLOAT BOWL GASKETS	3.00	5.67	17.01	RADIATOR CAP.	
G18F OIL FILTER 51183	1.00	19.50	19.50	INSPECT CARBURETORS FOR CORRECT SE REMOVE SLIDES, JETS AT DIFFERENT HEIG FLOAT BOWLS, DIFFERENT LEVELS AND ON SINKING. REMOVE CARBURETORS, DISASS	SHTS, INSPECT NE FLOAT
NAPA 20W-50 MOTOR OIL (QT) 75-140	8.00	8.50	68.00	CLEAN, REPAIR DAMAGED JET SLEEVE, INS AND SET AT BASE HEIGHT. READJUST ALL F	STALL ALL JETS FLOAT LEVELS,
SPEEDBOX W/CABLE A-304	1.00	694.00	694.00	REPLACE FLOATS AND FLOAT BOWL GASKI REASSEMBLE ALL CARBURETORS, INSTALL ADJUSTMENTS AND BALANCE ALL CARBUR	, MAKE ALL
BRAKE MASTER CYLINDER- (NEW) C26767APL	1.00	633.00	633.00	REMOVE INCORRECT FUEL FILTER, CLEAN REASSEMBLE SCREEN AND BOWL.	AND
Shop Supplies			75.00	TEST DRIVE AND FOUND BLUE SMOKE FRODRAIN ENGINE OIL AND REPLACE OIL FILTE ENGINE WITH 8 QUARTS OF 20W-50, DIPSTI CORRECT AT ADD MARK (SYSTEM CAPACIT RESEARCH AND FOUND RUNNING 1 QT LOVEXHAUST SMOKE.	R AND FILL CK READS Y 9 QTS).
				TEST DRIVE AND NOTED BRAKES DO NOT VOCCASIONALLY, SPEEDOMETER AND TACH	

SHOP FLOOR.

(LEAKING).

Page 1 of 2

DIAGNOSE TACHOMETER NOT FUNCTIONING, PULSE GENERATOR NOT WORKING, REMOVE AND DISASSEMBLE, ALL CONNECTIONS WORKING, REASSEMBLE AND INSPECT

STOPPED WORKING AND THERE IS COOLANT LEAKING ON

TIGHTEN ALL COOLANT HOSE CLAMPS, INSPECT BRAKE CALIPERS AND LINES, TIGHTEN LEFT REAR CALIPER LINE

American Classics and Performance

545 Portal St.

Cotati, CA. 94931

Phone: 707-664-8722 Fax: 707-664-8770

LET US TAKE CARE OF YOUR DREAM CAR!!!

1351

ARD00257737 CAL000399739

INVOICE



Print Date: 09/24/2025

1967 JAGUAR - XKE

4.2L

Lic #: 7CBF930 - CA

Work Completed: 09/23/2025

Odometer In: 30,777 Odometer Out: 30,778

VIN #:

Part Description / Number

Qty

Ext Labor Description Sale

Extended

DRIVE ASSEMBLY, REMOVE INTAKE CAM COVER AND REAR BEARING CAP, DIAGNOSE CLEARANCE ISSUES WITH TACHOMETER DRIVE, MODIFY CAM TACHOMETER DRIVE GEAR TO REACH PULSE GENERATOR, REASSEMBLE CAM BEARING CAP AND COVER. INSTALL PULSE GENERATOR AND TEST.

INSPECT SPEEDOMETER, REMOVE CABLE AND TEST, NO MOTION FROM TRANSMISSION DRIVE GEAR, REMOVE SPEEDOMETER AND FOUND EXCESSIVE DRAG, LUBE SPEEDOMETER INPUT TO REDUCE DRAG, INSTALL SPEEDOMETER AND INSTALL AUXILIARY GPS SPEEDOMETER DRIVE ASSEMBLY AND BYPASS ORIGINAL CABLE DRIVE AND TEST. REASSEMBLE DASH.

DIAGNOSE INTERMITTENT BRAKE PROBLEM, INSPECTALL VACUUM HOSES AND BRAKE COMPONENTS, INSPECT PEDAL AND LINKAGE. REMOVE MASTER CYLINDER AND REACTION VALVE, DISASSEMBLE BOTH COMPONENTS, FOUND MASTER BORE AND PISTON DAMAGED, REPLACE MASTER CYLINDER AND REBUILD REACTION VALVE AND INSTALL, BLEED SYSTEM AND TEST.

SUBLET SHIPPING

FUFL

35.00

Hazardous Materials

5.00

284.71

[Technicians : CHURIN, JOE; MILLS, GREG Nubee; SALAS, STEVE;

HORNBACK, JED 1

Org. Estimate \$10,591.84 Revisions \$0.00

Current Estimate \$ 10,591.84

Additional Cost Revised Estimate

Labor: Parts:

9.945.00 1,746.49

Sublet:

319.71

Sub: Tax:

12,011.20 179.02

HazMat: Total:

5.00 \$12,195.22

Bal Due:

\$12,195.22

[Payments -]

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. No warranty on parts or labor.

Signature..... Written By: BORDESSA, MONICA

Page 2 of 2

Copyright (c) 2025 Mitchell Repair Information Company, LLC InvStkPaperHrs GM101421