Allen Bradley

@Jaguar South

3404C Rutherford Rd. Ext.
Taylors SC 29687



Invoice # 1 1968 E-Type OTS 9 December 2008

Labor

- Ignition warning light stays on >>> Remove alternator and send to shop for a rebuild. Replace.
- 2) Noise in rear end>> Replace LH wheel bearings and seals
- 3) Replace engine cooling fan otter switch, leave override switch connected
- 4) Remove heater control valve and reseal
- 5) Adjust throttle linkage to remove excess play
- 6) Clutch or Transmission problem.>> Checked clutch slave cylinder, it has been recently replaced and was in very good condition. Checked clutch master cylinder, it was leaking inside the car, so I replaced it. Drained transmission gear oil, found it to be about 1qt. low, refilled with Mobil 1. Noticed that after the transmission gets warm, it it still difficult to get into gear, particularly third gear. Suspect that the culprit is the synchronizers in the transmission, which requires a complete tear-down to repair.

Hours 20.0	Per 1 \$ 50.	Hour 00		Total Labor \$ 1000.00
Parts QTY 2 qt	Description Mobil 1 gear oil	Price Each \$ 11.75	Extension \$ 23.50	Note
Total Parts				\$23.50
Total Parts	and Labor			\$1,023.50

Notes

1)

Invoice

Invoice #: 200802

Invoice Date: December 9, 2008 1968 Jaguar E-Type 4.2 O.T.S.

Vin #: 1E17077 Mileage: 74, 023

Quantity	Part #	Units	Description	Unit Price	Total
1	C17779		Heater Hose		14.50
1	C10351		Trunnion		2.55
1	53K1016		Screw, Trunnion Heater		1.00
1	QWB137C		Rear Wheel Bearing Kit		85.01
1	PND127		Clutch Master Cylinder		175.35
1	C27328/5		Clutch Slave Rod Clip		1.50
1		Pint	Castrol GT/LMA Brake Fluid		4.95
1	Rebuilt		Alternator, 45 amp		250.00
				Total Part	534.86
	due in full upon			Shipping/Handling	g 28.17
Thank you fo	or your continue	ed business.		Total Amount Du	e 537.03



Allen Bradley @Jaguar South

3404C Rutherford Rd. Ext. Taylors SC 29687

Invoice #1

1 September 2009

Green 1968 E-Type OTS

Miles

Labor

1) Remove engine and transmission

 Disassemble transmission, clean, replace seals, syncro-rings, roller bearings, and gaskets. Reassemble.

3) Remove and Replace clutch assembly. Turn flywheel. Replace pilot shaft bushing

 Remove engine oil pan, take to machine shop for repair of stripped threads at drain plug. Replace front oil seal and by-pass hose, Reinstall pan.

5) Replace horns

Reinstall engine. Replace rear engine (transmission) mount rubber parts.

 Replace RH engine mount to prevent the fouling of the throttle linkage against the subframe

8) Replace air cleaner rubber grommet.

Hours	Per Hour	Total Labor
57.0	\$ 50.00	\$ 2850.00

QTY	Description	Price Each	Extension	Note
Machine	Turn Flywheel	\$	\$ 45.00	
Work	Repair oil pan		\$ 55.00	

Total Parts \$100.00

Total Parts and Labor \$2,950.00

Notes. Please make check payable to Allen Bradley



Invoice

Invoice #: 200901

Invoice Date: September 2, 2009 1968 Jaguar E-Type 4.2 O.T.S.

Vin #: 1E17077 Mileage: 76,809

Quantity	Part #	Units	Description	Unit Price	Total
1	C32592J		Oil Seal SP/Drive		6.25
1	C12265		Gear Box Center Mounting Bush		4.46
2	CBC2517		Spring Seat Pad	3.66	7.32
1	C2226		Crank Spigot Bush		9.66
1	C21340		Gear Box Oil Seal Rear		5.79
1	C18739		Gear Box Seal Front		14.07
342	C231093		Needle Roller Bearing	.36	123.12
4	C22391		Gear Synchro Ring	55.50	222.00
58	C38573		Needle Roller Bearing	.80	46.40
1	C21100		Thrush Washer		.81
1	C21618		Tab Washer		5.70
1	C21299USED		Transmission Rear End Cover		200.00
1	C9177		Seal		2.10
1	GK42		Transmission Gasket Kit		10.50
1	C23006		Shift Lever Cone		15.00
1	C39665		Counter Shaft		149.50
2	C2227		Gasket	2.00	4.00

Invoice

Invoice #: 200901

Invoice Date: September 2, 2009 1968 Jaguar E-Type 4.2 O.T.S.

Vin #: 1E17077 Mileage: 76,809

Quantity	Part #	Units	Description	Unit Price	Total
1	C36499		Oil Pan Seal		17.45
1	CO23435		Oil Drain Plug		8.98
1	CO2296-1		5/8" Copper Washer		1.25
1	403		Oil Filter w/Seal		10.50
1	C9797USED		Clutch Fork		50.00
1	KT9702		Clutch Assembly Kit		437.54
1	GGE1645	Pair	High Note & Low Note Horn		36.66
1	GEG258		Conversion Set		73.30
1	C20552		Oil Sump Bypass Hose		8.94
1	C9857		Shaft, Clutch Fork		10.80
1	C23128		Clutch Fork Screw		2.85
1	C24291		Fan Belt, Grooved		24.87
2		Quarts	Mobile 1 Synthetic Gear Oil 75W90	15.75	31.50
9		Quarts	Castrol GTX 20W50 Motor Oil	4.25	38.25
2		Gallons	Prestone Anti-freeze/Coolant	14.95	29.90
2		Gallons	Distilled Water	2.00	4.00

Invoice

Invoice #: 200901

Invoice Date: September 2, 2009 1968 Jaguar E-Type 4.2 O.T.S.

Vin #: 1E17077 Mileage: 76,809

Quantity	Part #	Units	Description	Unit Price	Total
1	C8397		Double Muffler Exhaust Hanger		8.75
1	JLM9542		Rear Exhaust Hanger		8.45
1	C19018		Rear Exhaust Safety Bracket		19.00
8.199		Gallons	Fuel	2.44	20.00
1	C17546		Air Cleaner Seal		13.00
1	C18556		Engine Mount, RH		19.90
				Total Parts	1,702.57
	ue in full upor			Shipping/Handling	95.17
i nank you to	r your continu	ea business.		Total Amount Due	1,797.74



Invoice

Invoice #: 201001

Invoice Date: December 21 2009 1968 Jaguar E-Type 4.2 O.T.S.

Vin #: 1E17077 Mileage: 79,711

Quantity	Part #	Units	Description	Unit Price	Total
1	C27306		Valve Check Brake Resend		38.42
3		Quarts	Castrol GTX 20W50 Motor Oil	4.95	14.85

Total Parts	53.27
S/H Charges	NC
Total Amount Due	53.27

Allen Bradley @Jaguar South

3404C Rutherford Rd. Ext. Taylors SC 29687

> Invoice #1 21 December 2010 Green 1968 E-Type OTS Miles

Labor

- 1) Weber carbs stutter at 2500 rpm >> Troubleshoot and test drive. Found vacuum tank one-way valve to be leaking causing a vacuum leak on rear carb, replaced same. Synchronized linkages. Tried various jet combinations and finally settled on a 60F8 idle jet and the 165 main jet combination. Works great except at idle where it tends to pop back at times.
- 2) Attached choke cable to all three carbs
- Installed air cleaners.

Hours	Total Labor			
33.5	\$ 1172.50			
Parts				
QTY	Description	Price Each	Extension	Note
6	60F8 idle jets	\$	\$ 27.10	
3	K&N air filters	\$ 75.00	\$ 225.00	
N/A	Gasoline		\$ 48.25	
6	404 Champ		\$ 12.66	
Total Parts	17.0			\$313.01
Total Parts an	nd Labor			\$1,485.51

Notes. Please make check payable to Allen Bradley

- Throttle linkage levers tend to move on the shaft. I have tightened them as much as I dare. Hope they will stay in place.
- 2) Idle screw in the #4 carb is bent. Seems to work ok, but could be an issue.
- 3) Noticed that the butterflies on each carb are not perfectly in sync with each other. Thus there is no way to get all 6 of the butterflies to be in perfect sync. Don't know if this is an issue or not. Could be normal tolerance.
- Engine runs better when cold, no spitting at all, suggesting that the mixture is still too rich. Maybe going to a 55F8 or 55F9 idle jet.

5) Rear brake Plaid bottle South Float sunk

		THE NO OF RECORDING			SA	TEA			36066 DATE 5/22/14			
TY.		PART NO. OR DESCRIPTION			SA			В	BRIARCLIFF 90 WOODSIDE AVENUE VIN / E17077			
-		4 0 4		H			0.1	1 (D. O. L. C. BORDER BRIARCLIFF MANOR, NY 10510			
7								A	TEL. (914) 762-1200 ENG#	-		_
4		5 Speed TRANSMISSION				20	-	11	— Н			
		(ONUEN SION	100	4	51	00	C	A R	SERVICE LTD. bcicarservice@verizon.net briarcliffclassic.com			
		HIPPING ON KIT	1	-	-	00	Name		hereby authorize the above repair wor cessary material, and hereby grant you.	k to be done alo	ng with the	e ne-
1	(CLUTCH COVER	1	15	0.1	1			sion to operate the car, truck or vehicle h ways or elsewhere for the purpose of te	verein described (on streets.	megn-
1	1	LUTCH DISC	/	0	8,5	0	Addres		press mechanica lien is hereby acknow wehicle to secure the amount of repairs	wiedged on abov	re car, truc	CK OF
/		THEON OUT BILL.		1	13.	56	City_		sponsible for loss or damage to vehicle of fire, theft, accident or any other cause	or articles left in	vehicle in	case
/		BERR ENCINE MOUNT	-	1	25	00	Year-M	ake-M				
1		BRAKO- LIGHT SWITCH			16	30			Model Acute XKE GEV 7028 S5775 Authorized By	INTERNAL		
1		XYS INSPECTION		1	10	00	OPEF			INTERNAL		
2	_	BRANG FLOATS		1	19.0	00	4/24	14	CHARGE AM CHELL BATTERY, CIKELL CHARGIAL SYSTEM			
3/		REDLINE OIL		1	5	R	5/2	2	OUTPUT			
7	-			Ĭ	7	50	5/13	8	Bomo O BON BUMP STOPS GRIND MOA CLEAN MIND		0 -	
1		WHISS WHEEL			7	50	1/5	4	Innercont. Lugarine Road Splines;	3	690	00
2		CLEUIS PIN			1	50	10	8	Peniare Temenissian, convert over 10 5 speno,			
3	-	CETTER PINS	1		K	0	Kh.	8	Remove pm replace CLUTCH;			
4		CLERTINS	-	20	13	44	-	K	Remove mas Regione parie Enjoines recent;			
-	-		160	P	00.	1)	30:	16				
			+			-	1	/ Dho	finere im regione BRAKE LIENT SWITCH;			
			+-	-				- 17	Ramore Arm regime BOTH BRING FLOATS;			
				-		-		-	name, Am pague boll Bure,			
						-		-				
			-					-				
								-				
											-	
				-				- 6	The state of the s			
								1				
								-				
	-											
	-											
	- 23			-								
	- 2			-		-	53000		RECOMMENDED SERVICE: 3/90 00 =			
				+		-	-		3690.00	OTAL LABOR	BKK	Co.
		TOTAL PARTS	-	-		-	3.		63.58.44	PARTS /	(3%)	17
			do by M		moder	turor	2.		10048 44 5	SUB TOTAL	385	
		rranties on the products sold hereby are those mad ller (above named dealership) hereby expressly di							Mid 5 189 51 741 07 5	SALES TAX	XX	
		its report implied, including any implied warranty of raparticular purpose, and neither assumes nor authome for it any liability in connection with the sale of si	Offizes a	anv o	mer o	erson	THE REAL PROPERTY.	-	10789.51	TOTAL AMOUNT	*	
to a	ssur	me for it any liability in connection with the sale of st	ala proc				5.	nii gis			1	11

QTY	*	PART NO. OR DESCRIPTION		SA	LE		В	RIARCLIFF 37345 DATE 9/1/	15	KKE	
X	80		XXX	NZ.	XX.	r I	10	90 WOODSIDE AVENUE WIN E 1707 BRIARCLIFF MANOR, NY 10510 TEL. (914) 762-1200 VIN E 1707	Z		1
/		EAC3424 FLAT CAP		7	76	l li	A J	0 1 M T U N T L D R260 1240			
1		FIN BELT		2/	95	CA	R	SERVICE LTD. bcicarservice@verizon.net C briarcliffclassic.com			
1		ALTERNATOR BRAUET		65	00			I hereby authorize the above of	pair work to be done a	ong with th	no no-
2		BANIC MISTER CYLING	e /	-		Name		cessary material, and hereby of sign to operate the car, truck of	ant you and/or your en wehicle herein described	ployees, pe on streets,	ermis- high-
/		WATER Pump	/	49	00			ways or elsewhere for the pur oress mechanic's lien is heret	ose of testing and/or in acknowledged on abo	spection. A	kn ex-
		SHIPPING		30	00	City_		vehicle to secure the amount sponsible for loss or dayage to fire, theft, accident of the secure that the secure the secure the secure that th	vehicle or apricles left in transperse bewond your o	n vehicle in ontrol	case
3		Ots REDUNE MTL		22	41	Year-Mak	в-Мос	el Lipense No. 1 3 00 Odorpeter (11 /	1		
4		Chense FITTINUS		7	80	1967	CONTROL OF THE PERSON	NA6 ETHRE GEV 1028 8 6 6 7 () Authorized By REPAIR ORDER-LABOR INSTRUCTION	INTERNAL		
		OIL FILTER		11	00	OPER N	2/	TRANS FLUID, OHF, BRAKE I CIAPPIN			
4	-	Copper WASHERS	-	6	00	4/15	74	CHECK CLUTCH - LAGS (PEDAL JACK)	0		
10	-	015		10	90	0/1	V.		H		
1	-	ZOOP ADDITIE	-	1/2	90	9/46	21	YOAD TEST CAR, CHECK FOR BRANCS AND CLUT			
2		Resevoir Hose		1=	00	1/40	2	PAIN MOD BEFOR GEARBOX W/ REDLING, MTZ.			
4	-	LEANERS		15	00		1	MINOR SERVICE INCLUDING; CHANGE OIL AM	Tital		
C		Fred Injection Comps		15	00		1	LUBRICATE CHASSIS. REPLACE FATTINGS AT REA			
-		BOANE FLUID		25	00			OUTER WISHBONES MAS OUTER UNIVERSAL Dist TO			
7)		BOSTER HOSE		45	50			Accept Grease; CHELL AND PROJECT THE PIRESUL	, 23	437	15
14		E.I. CLAMPO		35	00			CHEUR AND TOPLEAU FLUID; CHECK BELTS AND	. /		
1		T Spline 20101 CQ	- 1	12	99		1	Penare, Am Reglere, ALTERNATOR BERT MIN			
1		BYPUS HOSE CZG853		7	50		1	SHOWN BENGIOT FUR ADJUSTOR; (HELL BUTT CO	ALANCE		
T		HISTERS HOSE		3	50			STRAIGHTEN ALTERNATOR FAN, HOLHERS CLETHA	ice;		
7	C	5 Anti Frage		43	75		1	Iscard Lincolne WATER Pump, Panere, 17ms nay			
		V	9	30	96		-	WHITER DUMP AMD BY-PASS HUSE; PROSSUR CHECK SY	KW.		
				-	-			BEFILL LATH COOLANT			
							1	HOLL BANKING System; Famore Ann Deplaces per to			
		7		-			-	Decision to the course of the state of the s	MICO		
-	-				-		+	MASTER (YLINDER, Pentere Hose to A Sevens, DEMIN	Arms		
-	-	See h					1	TRUE ASM DEPLOS PRESE TO CLUTCH RESERVER, FLUIN ANY	Bienn		
-		7 8 2		-		0	,	OUT CLUTCH;	Jucey		
		3 8				18%	1111	X WEST HIGH ING SCHOOL ON CARBLASTONS ROAD TO	ST		
-		6,00				107	1 115	RECOMMENDED SERVICE:			
		4				1.7	RI	ILING ARM BUSHINGS;	TOTAL LABOR	2343	75
		TOTAL PARTS				2. Ne	ew	CHOKE CABLES.	PARTS	936	16
Ar	y w	arranties on the products sold hereby are those made I	by the n	nanufac	turer.	3.			SUB TOTAL	3274	71
pii	her	eller (above named dealership) hereby expressly disc express or implied, including any implied warranty of m or a particular purpose, and neither assumes nor authoriz	nerchant	ability of	or fit-	4.			SALES TAX	241 5	21
to	8886	ume for it any liability in connection with the sale of said	product	ls.		5.			TOTAL AMOUNT	3516 12	12



XKs Unlimited 850 Fiero Lane San Luis Obispo, CA 93401

PH: 805-544-7864 TF: 800-444-5247 FX: 805-544-1664 Remit To: 850 Flero Lane San Luis Obispo, CA 93401

Email: Parts@xks.com

INIVOICE# 14000

SOLD

Order Ref. No. Ctr.No. Time Trk. No. Page Invoice No. W1*14351 413 11:29am 16902 1 Customer P.O. No. Terms SNO Invoice Date Shipped Via SP 413 AMERICAN EXPRESS 04-29-16 UPS Line Ord Ship B/O Part Number Description List Price Unit Price Extended Price 1. 1 0 1 CO 18638 CIGAR LIGHTER 34.80 0.00 2. 1 1 0 BD 20722 BLANKING PANEL 13.61 13.61 3. 1 1 0 CO 27398 THUMB SCREW 10.57 10.57 5. 1 1 0 18 2009 LAMP PAD PAIR 19.73 19.73 6. 1 1 0 16 5018L W/S DECAL, LATE 4.88 4.88 7. 2 2 0 16 6498 SPARE KEY "FS" 5.61 5.09 10.18 2 0 2 JA 12528 FINISHER/KNOB 13.79 12.15 0.00 Promotion price from 02/15/16 to 05/31/16 58.97 Parts: Sales Tax: 4.42 Invoice Total: \$63.39

WE APPRECIATE YOUR BUSINESS EVERY DAY!

Long Dr.

Charged ****3000 Approval 211455

CUSTOMER COPY

CUSTOMER'S SIGNATURE:

PARTS SOLD HEREIN ARE WARRANTED ONLY TO THE EXTENT OF THE WARRANTY FURNISHED BY THE MANUFACTURER OF SUCH PARTS. ITEMS RETURNED MUST BE IN NEW CONDITION, ORIGINAL BOX, AND ACCOMPANIED BY THE PURCHASE INVOICE. THERE WILL BE NO RETURNS OR REFUNDS ALLOWED ON THE FOLLOWING: 1) PARTS RETURNED AFTER 30 DAYS, 2) ANY ELECTRICAL EQUIPMENT OR PARTS, 3) BROKEN OR PARTIAL KITS AND GASKET SETS, 4) TOOLS THAT HAVE BEEN USED, 5) SPECIAL ORDER ITEMS, OR 6) PARTS NOT IN THEIR ORIGINAL PACKAGE. 1-1/2% CHARGE ON INVOICES 30 DAYS PAST DUE (18% ANNUALLY). CORE RETURNS MIST BE IDENTICAL TO UNIT PURCHASED, ASSEMBLED AND DRAINED OF ALL LUBRICANT. CORES MUST BE RETURNED IN THE ORIGINAL BOX WITHIN 30 DAYS FROM THE DATE OF PURCHASE. A 20% RESTOCKING FEE WILL BE CHARGED ON ALL RETURNS.

*** JOIN OUR FACEBOOK GROUP AT WWW.XKS.COM ***



XKs Unlimited 850 Fiero Lane San Luis Obispo, CA 93401

PH: 805-544-7864 TF: 800-444-5247 FX: 805-544-1664 Remit To: 850 Fiero Lane San Luis Obispo, CA 93401

Email: Parts@xks.com

INIVOIOE# 17240

S O L D

Order Ref. No. Ctr No Time Trk. No. Page Invoice No. 1755 W1*14351 413 01:16pm 17340 1 Customer P.O. No. SNO Terms Invoice Date Shipped Via SP 413 AMERICAN EXPRESS 05-05-16 UPS Line Ord Ship B/O Part Number Description List Price Unit Price | Extended Price 2 0 JA 12528 FINISHER/KNOB 13.79 12.15 24.30 Promotion price from 02/15/16 to 05/31/16 Tracking Numbers: 1Z 937 815 03 0004 1131 Parts: 214 115:00 24.30 100 Sales Tax: 1.82 Freight Out: 10.54 Invoice Total: \$36.66 Charged ****3000 Approval 133305

WE APPRECIATE YOUR BUSINESS EVERY DAY!

CUSTOMER COPY

CUSTOMER'S SIGNATURE:

PARTS SOLD HEREIN ARE WARRANTED ONLY TO THE EXTENT OF THE WARRANTY FURNISHED BY THE MANUFACTURER OF SUCH PARTS. ITEMS RETURNED MUST BE IN NEW CONDITION, ORIGINAL BOX, AND ACCOMPANIED BY THE PURCHASE INVOICE. THERE WILL BE NO RETURNS OR REFUNDS ALLOWED ON THE FOLLOWING: 1) PARTS RETURNED AFTER 30 DAYS, 2) ANY ELECTRICAL EQUIPMENT OR PARTS, 3) BROKEN OR PARTIAL KITS AND GASKET SETS, 4) TOOLS THAT HAVE BEEN USED, 5) SPECIAL ORDER ITEMS, OR 6) PARTS NOT IN THEIR ORIGINAL PACKAGE. 1-1/2% CHARGE ON INVOICES 30 DAYS PAST DUE (18% ANNUALLY). CORE RETURNS MUST BE IDENTICAL TO UNIT PURCHASED, ASSEMBLED AND DRAINED OF ALL LUBRICANT. CORES MUST BE RETURNED IN THE ORIGINAL BOX WITHIN 30 DAYS FROM THE DATE OF PURCHASE. A 20% RESTOCKING FEE WILL BE CHARGED ON ALL RETURNS.

*** JOIN OUR FACEBOOK GROUP AT WWW.XKS.COM ***



clint@britishcarrepair.com 142 Mill Street, San Rafael, CA, USA, 94901 Business/GST#: Created: Apr 19, 2021 Service advisor: Olivia Wright

1968 JAGUAR XKE

VIN: 1E17077 Mileage: 90659 License Plate: 9T 2038

Customer notes

REPLACE OIL PRESSURE SENDING UNIT.

REAR UNIVERSAL JOINT SHOULD BE REPLACED.

FRONT BALL JOINTS NEED TO BE REPLACED.

LOWER RADIATOR HOSE NEEDS TO BE REPLACED AND WATER PUMP SHOWING SIGNS OF LEAKING.

SERVICE & INSPECTION			Pending aut	horisation
Name	Description	Price	QTY/HRS	Amount
1 Labor	CHANGE ENGINE OIL AND FILTER. CHECK\TOP-UP FLUID LEVELS. INSPECT LIGHTS, BRAKE PADS, WHEEL BEARINGS, FAN BELT TENSION, TIRE PRESSURE AND SPARE. ROTATE TIRES WHERE NECESSARY. LUBRICATE CHASSIS AND GREASE FITTINGS.	\$125.00	2.5	\$312.50
<i>3</i>	CUSTOMER REPORTS:			
10 20	RUNS RICH AND INTERMITTENTLY IDLES POORLY.			
	REPAIR VACUUM LEAK.			
	CHECK IGNITION TIMING AND ADVANCE. FUEL MIXTURE IS RICH.			
	ROAD TEST VEHICLE.			
2 950-560	OIL FILTER - FELT STYLE	\$20.00	1	\$20.00
3 OIL 20\50	ENGINE OIL 20\50	\$10.00	9	\$90.00
4 81403	OIL ADDITIVE REDLINE	\$22.00	0.5	\$11.00
5 HAZARDOUS WASTE		\$3.75	1	\$3.75
				tal: \$437.25

В	RAKE HYDRAULICS			Pending aut	horisation
	Name	Description	Price	QTY/HRS	Amount
1	Labor	REPLACE BRAKE MASTER CYLINDER, BLEED BRAKE HYDRAULIC SYSTEM AND ROAD TEST VEHICLE.	\$150.00	3.5	\$525.00
2	PMA705	BRAKE MASTER CYLINDER	\$300.00	1	\$300.00
3	BRAKE CLEANER		\$5.00	1	\$5.00
4	B\F	BRAKE FLUID	\$2.50	4	\$10.00
5	HAZARDOUS WASTE		\$4.50	1	\$4.50
6.	FREIGHT		\$9.25	1	\$9.25
				To	otal: \$853.75



clint@britishcarrepair.com 142 Mill Street, San Rafael, CA, USA, 94901 Business/GST#: Created: Apr 19, 2021 Service advisor: Olivia Wright

I hereby authorize the above repair work to be done along with procurement of all necessary materials. British Car Repa... may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. British Car Repa... will not be held responsible for any loss or damage to the vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond the control of British Car Repa.... In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs.

Part	\$436.00
Labor	\$837.50
Other	\$,17.50
Amount	\$1,291.00
Tax	\$40.33
Grand total	\$1,331.33
Paid to date	\$0.00
Remaining balance	\$1,331.33

Signature:



British Car Repair, Inc.

(415) 457-1707 ocwbcr@gmail.com 142 Mill Street, San Rafael, CA, USA, 94901 Business/GST#: AB 220451

Invoice # 50222

Against Estimate#: 10287 Created: Aug 2, 2021 Invoiced: Aug 12, 2021

Service advisor: Olivia Wright

1968 JAGUAR XKE VIN: 1E17077 Mileage: 90796 mi License Plate: 9T 2038

	Name	Description	Price	QTY/HRS	Amount
1	Labor	REPLACE ALL COOLING AND HEATER HOSES. REPLACE THERMOSTAT. ADD ANTIFREEZE AND PRESSURE TEST SYSTEM. ROAD TEST VEHICLE.	\$150,00	4	\$600.00
2	HK010	COOLING AND HEATER HOSES W/ CLAMPS KIT - SERIES 2 E-TYPE	\$100.00	1	\$100.00
3	071-226	THERMOSTAT 180 - JAGUAR, TRIUMPH STAG, TR7 & TR8, MGC	\$13.00	1	\$13.00
4	C28222	WATER OUTLET GASKET - E-TYPE S1.5 & S2	\$3.00	1	\$3.00
5	EAC7044	THERMOSTAT GASKET - E-TYPE S1.5 & S2, XJ6, JAG 240 & 340	\$2.00	1	\$2.00
6	ANTIFREEZE	And the second s	\$25.00	1	\$25.00
7	HAZARDOUS WASTE - ANTIFREEZE		\$2.00	1	\$2.00
8	FREIGHT	FREIGHT	\$13.52	1	\$13.52
		1000 1000 1000 1000 1000 1000 1000 100		Service to	tal: \$758.52

BA	ALL JOINTS				Authorized
	Name	Description	Price	QTY/HRS	Amount
1	Labor	REPLACE UPPER AND LOWER BALL JOINTS. BLEED BRAKE HYDRAULIC SYSTEM. ROAD TEST VEHICLE.	\$150.00	8	\$1,200.00
2	RTC2203	UPPER BALL JOINT - E-TYPE S1	\$35.00	2	\$70.00
3	JLM 11860	BALL JOINT LOWER - JAG XJ & E-TYPE	\$60.00	2	\$120.00
4	NUTS\BOLTS		\$15.00	1	\$15.00
5	BVF	BRAKE FLUID	\$2.50	3	\$7.50
6	HAZARDOUS WASTE - BRAKE FLUID		\$0.55	3	\$1.65
7	FREIGHT	FREIGHT	\$13.45	1	\$13.45
		The state of the s		Service tot	al: \$1,427.60

Name	Description	Price	QTY/HRS	Amount
SUBLET	PERFORM TWO WHEEL ALIGNMENT. ROAD TEST VEHICLE.	\$181.00	1	\$181.00



British Car Repair, Inc.

(415) 457-1707 ocwbcr@gmail.com 142 Mill Street, San Rafael, CA, USA, 94901 Business/GST#: AB 220451 Invoice # 50222 Against Estimate#: 10287 Created: Aug 2, 2021

Invoiced: Aug 12, 2021 Service advisor: Olivia Wright

Thank you for your business. The work is complete and your payment is due upon pickup of the vehicle. Mechanics liens may be placed on vehicles until repairs are paid for in full. Please contact us promptly if you have any questions about anything we did.

We warranty our labor service and new parts for 12 months or 6000 miles, whichever occurs first. If our repair or replacement part fails within warranty duration, you must return your vehicle to us and we will repair or replace those items free of charge. There is no other warranty written or implied. Warranties for sublet repairs are done under the terms of the sublet company.

Part ······	\$355.50
Labor	\$1,800.00
Other	\$181.00
Amount	\$2,336.50
Fees (Hazmat / EPA)	\$30.62
Subtotal	\$2,367.12
Tax	\$32.88
Grand total	\$2,400.00
Paid to date	\$2,400.00
Remaining balance	\$0.00
	30.00

Signature:



ocwbcr@gmail.com 142 Mill Street, San Rafael, CA, USA, 94901 Business/GST#: AB 220451

TIMING.

ROAD TEST VEHICLE.

Created: Sep 2, 2021 Service advisor: Olivia Wright

1968 JAGUAR XKE

VIN: 1E17077 Mileage: 90796 mi License Plate: 9T 2038

D	ISTRIBUTOR & CAR	BURETOR			
	Name *	Description	Price	QTY/HRS	Amount
1	Labor	REMOVE DISTRIBUTOR FOR SUBLET REBUILDING AND REPAIRS.	\$150.00	6	\$900.00
		REMOVE FRONT CARBURETOR TO HAVE HOLE DRILLED			
		FOR PORTED VACUUM.			
		REASSEMBLE, SYNCRONIZE CARRURETION, SET IGNITION			

TEST CENTRIFUGAL AND VACUUM ADVANCE.

3

Service total: \$900.00

Pending authorisation

	Name	Description	Price	QTY/HRS	Amount
1	SUBLET	REBUILD AND RE-CURVE DISTRIBUTOR.	\$425.00	1	\$425.00
2	SUBLET	REPAIR AND RE-PLATE CLAMP RING.	\$45.00	1	\$45.00
. 3	SUBLET	PORT CARBURETOR.	\$85.00	1	\$85.00
4	FREIGHT	FREIGHT	\$45.00	-1	\$45.00
				Service to	otal: \$600.00

I hereby authorize the above repair work to be done along with procurement of all necessary materials.

British Car Repa... may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. British Car Repa... will not be held responsible for any loss or damage to the vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond the control of British Car Repa....

In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs.

Part	\$0.00	
Labor	\$900.00	
Other	\$555.00	
Amount	\$1,455.00	
Fees (Hazmat / EPA)	\$45.00	
Subtotal	\$1,500.00	
Tax	\$0.00	
Grand total	\$1,500.00	
Paid to date	\$0.00	
Remaining balance	\$1,500.00	

Signature:

FREIGHT



6 FREIGHT

1968 JAGUAR XKE

VIN: 1E17077 Mileage: 93001 mi License Plate: 9T 2038

\$45.00

\$45.00

Service subtotal: \$2,517.39

			Lice	nse Plate: 9T 2038	
SE	RVICE			Pending	authorization
	Name	Description	Price	QTY/HRS	Amount
1	Labor	CHANGE ENGINE OIL AND FILTER. CHECK/TOP-UP FLUID LEVELS. INSPECT LIGHTS, WHEEL BEARINGS, FAN BELT TENSION, TIRE PRESSURE AND SPARE. LUBRICATE CHASSIS AND GREASE FITTINGS. REFIT UNDER DASH CARPETING.	\$150.00	1.5	\$225.00
2	OIL 20\50	ENGINE OIL 20\S0	\$10.00	12	\$120.00
3	GFE 101	OIL FIL EARLY JAG CANISTER	\$20.00	1	\$20.00
4	81403	OIL ADDITIVE REDLINE	\$22.00	0.5	\$11.00
5	HAZARDOUS WASTE - OIL		\$0.65	12.5	\$8.13
6	HAZARDOUS WASTE - OIL FILTER		\$2.00	1	\$2.00
				Service sub	total: \$386.13
RE	AR BRAKES			Pending a	uthorization
	Name	Description	Price	QTY/HRS	Amount
1	Labor	REPLACE REAR BRAKE PADS AND CALIPERS. BLEED BRAKE HYDRAULIC SYSTEM. ROAD TEST VEHICLE TO SEAT PADS.			\$1,575.00
2	10821#	Brake Pad set XKE S1	\$65.00	1	\$65.00
3	8778G	Brake Callper Piston Assem Rear Jag	\$200.00	4	\$800.00
4	B\F	BRAKE FLUID, ATE - 1 QUART	\$18.00	1.5	\$27.00
5	HAZARDOUS WASTE		\$5.39	1	\$5.39

I hereby authorize the above repair work to be done along with procurement of all necessary materials.

This estimate is based on our inspection or by your request, it does not cover any additional parts or labor which may be required after the components have been disassembled. Occasionally, after the work has begun worn or damaged parts are discovered which are not evident on the first inspection.

British Car Repair, Inc. may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. British Car Repair, Inc. will not be held responsible for any loss or damage to the vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond the control of British Car Repair, Inc.

Beginning 08/01/2022, a new fee tier will occur for merchant transaction costs. If you pay by cash or check, there is no extra fee. If you pay by credit card, there will be an extra fee of 3,5%.

In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs. Payment is due upon pickup of the vehicle. Mechanics liens may be placed on vehicles until repairs are paid for in full. If the vehicle is not picked up after two days of completing repairs, a storage fee of \$75 per day will commence.

Signature:			

Part		\$1,043.00	
Labor		\$1,800.00	
Amount	500	\$2,843.00	
Total Service Level Fees		\$60.52	
Subtotal		\$2,903.52	
Tax		\$96.48	
Grand total		\$3,000.00	
Paid to date		\$1,000.00	
Remaining balance		\$2,000.00	