Page 1

201809036

Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am

Ref: TRANSFERED TO A/P NO AD

BAR #: AK105357

630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

69 Ferrari Dino 246 GT BLUE/ 7450 Mi.Last in 9/17/2018

Lic: ? V6Cyl 2.0 Eng

Vin: 00550

Eq:

Quotes
1 09/17/18 09:13am 0.00
SEAN in person.

**DUE: OCT 12 2018** 

- 1- REPAIR HEADLIGHT STALK
- 2- REPAIR FUALTY TURN SIGNAL SWITCH
- 3- REPAIR AND MAKE AN I.D CARD FOR ALL ELECTRICAL SWITCHES
- 4- REPAIR INTERMITENT HORN SWITCH
- 5- TIGHTEN LOOSE REARVIEW MIRROR
- 6- ADJUST E-BRAKE CABLE
- 7- CHECK DOORS FOR PROPER RESTRAINTS TO KEEP DOOR FROM OPENING TO MUCH
- 8- TOUCH UP PAINT DAMAGE ON PASSENGER DOOR
- 9- REPAIR LOOSE PASSENGER DOOR LOCK
- 10- SECURE RELAY HANGING UNDER DRIVERS SIDE DASH
- 11- SECURE WIRING HANGING FROM VENT HOLE UNDER FRONT RIGHT BUMPER
- 12- REPAIR LATCH ON ENGINE BAY LID
- 13- CHECK AND ADVISE ON ALL OIL LEAKS

authorised 10/04/2018

above repairs for \$12k

authorised 10/08/2018 \$1000 add time for door stay repair

total with tax \$16,627

Job01 4915 TRANSPORT LONG DISTANCE

Sublet: \$650,00

SEPT 4 - TRANSPORT CAR FROM FANTASY JUNCTION TO FAST CARS, LTD

Job02 PARTS	\$	WA	Labor: \$0.00			
246WH	STEERING WHEEL-S	1.0 @ 2500.00 =\$	2500.00			
110664	OIL LIGHT SWITCH-S	1.0 @ 48.93 =\$	48.93			
FPN00191993	FILTER, OIL,288,246,27-N	1.0 @ 39.95 =\$	39.95			
>>>>>>						

201809036

Ref:

Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am TRANSFERED TO A/P NO AD

BAR #: AK105357

630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

#### Job02 PARTS

JOBUZ PARTS					
95180050	FILTER, FUEL-N	1.0 @	36.95 =\$	36.95	
95180053	FILTER, FUEL-N	1.0 @	16.95 =\$	16.95	
SHOP MATERIALS	MISC. SHOP SUPPLIES-N CLUTCH FORK BOOT-S	1.0 @	20.00 =\$	20.00	
16325307	CLUTCH FORK BOOT-S	1.0 @	111.78 =\$	111.78	
99100108	GASKET, V/C SET 246-N	1.0 @	168.70 =\$	168.70	
524524	GASKET,V/C SET 246-N MOUNT ENG/TRANS-S	4.0 @	215.49 =\$	861.96	
95860404	CV BOOT-N	1 O A	23.83 =\$	95.32	
117956	CLAMP, CV BOOT SM-N	4.0 @	5.45 =\$	21.80	
117957	CLAMP, CV BOOT LG-N	5.0 @	6.01 =\$	30.05	
40000210	CLAMP, CV BOOT SM-N CLAMP, CV BOOT LG-N OIL SEAL-S Q-BOND-S	1.0 @			
900002	Q-BOND-S	1.0 @	17.54 =\$	17.54	
95180050	FILTER, FUEL-N	1.0 @	36.95 =\$	36.95	
95180053	Q-BOND-S FILTER, FUEL-N FILTER, FUEL-N HOSE, FULE 1 3/8"-N WATER PIPE-S C/V JOINTS-S SNAP RING-S OIL, VALVOLINE 40W VRI-N WASHER, COPPER 18X24-N	1.0 @	16.95 =\$	16.95	
24702	HOSE, FULE 1 3/8"-N	1.0 @	31.14 =\$	31.14	
103470	WATER PIPE-S	1.0 @	60.75 =\$	60.75	
9303320340	C/V JOINTS-S	4.0 @	103.02 =\$	412.08	
103885	SNAP RING-S	4.0 @	2.32 =\$	9.28	
229	OIL, VALVOLINE 40W VRI-N	8.0 @	4.05 =\$	32.40	
460.10.16	WASHER, COPPER 10X16 MM-N	1.0 @	0.50 =\$		
460.18.24				1.44	
2556	FLUID, BRAKE LMA CASTR-N SWITCH, BRAKE-N CAM END PLATE-S	1.0 @	10.68 =\$	10.68	
101663	SWITCH, BRAKE-N	1.0 @	13.43 =\$	13.43	
4146627	CAM END PLATE-S	1.0 @	95.01 =\$	95.01	
55103	CHOCK CABLE-S	1.0 @	12.35 =S	12.35	
7447	SCOTCH BRITE PAD RED-N WIPER ARM BENT-S COOLANT, ZEREX-N	1.0 @	1.79 =\$	1.79	
24604296	WIPER ARM BENT-S	1.0 @	43.85 =\$	43.85	
ZX001	COOLANT, ZEREX-N	1.0 @	10.46 =\$	10.46	
GAS2	Gasoline 92 Octane-N	15.0 @	3.89 =\$	58.35	
168008	SWITCH, FAN-N	1.0 @	67.88 =\$	67.88	
BP6ES	SPARK PLUG, NGK 7333-N WASHER LOCK-N	6.0 @	5.70 =\$	34.20	
GBL	WASHER, LOCK-N	32.0 @	0.90 =\$	28.80	
NGB-F	SPARK PLUG, NGK 7333-N WASHER,LOCK-N WASHER,FLAT-N NUT,HEX BLK OX-N BATTERY/MT34-N	32.0 @			
NGW-HEX	NUT, HEX BLK OX-N	32.0 @		27.20	
MT-34	BATTERY/MT34-N	1.0 @	144.51 =\$	144.51	5173.24

Status: Completed Tech: 02

Job03 SEPTEMBER 20 - TECH # 64

Labor: N

SEPTEMBER 20 - RACKED CAR, TOOK PHOTOS OF CAR

Status: Completed Tech: 64

Job04 SEPTEMBER 21 - TECH # 64

Labor: \$300 00

SEPTEMBER 21 - MADE I.D. CARD FOR ELECTRICAL SWITCHES, TIGHTENED LOOSE REAR VIEW MIRROR, FOUND MOUNTING BRACKET INSTALLED UPSIDE DOWN. INSPECTED VEHICLE AND COMPLETED SAFETY CHECK - SEE INSPECTION REPORT, CHECKED FOR OIL LEAKS, DEGREASED ENGINE

---->--->--->--->--->

Page 3

201809036 Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am

Ref: TRANSFERED TO A/P NO AD

BAR #: AK105357

630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

# Job04 SEPTEMBER 21 - TECH # 64

Status: Completed Tech: 64

### Job05 4850 SHIPPING

SEP-25 G.T. CAR PARTS

OCT-09 T RUTLANDS

OCT-17 SUMMIT

OCT-19 GT.CAR PARTS

OCT-30 GARY ARENTZ

NOV-27 SUPERFORMANCE UK

### Job06 SEPTEMBER - TECH # 05

Labor:

Sublet: \$77 99

SEPTEMBER 21 - CREATE AN INSTRUMENT AND CONTROL CHEAT SHEET

Status: Completed Tech: 05

### Job07 OCTOBER 4 - TECH # 64

Labor: \$400 100

OCTOBER 4 - REPAIR LATCH ON ENGINE BAY, FOUND WRONG HARDWARE WHICH CAUSED BINDING, STRAIGHTENED AND LUBRICATED THEN PAINTED, REPAIRED LOOSE PASSENGER DOOR LOCK, REMOVED DOOR PANEL AND ADJUSTED, TOUCHED UP PAINT, REPAIRED HORN SWITCH, REMOVED STEERING WHEEL, REMOVED HEADLIGHT STALK FOR REPAIR, CLEANED ALL CONTACTS, DOCUMENTED WIRING AT STEERING COLUMN

Status: Completed Tech: 64

### Job08 OCTOBER - 4530 MACHINE SHOP

OCTOBER 4 - MODIFY TWO HEXAGONAL NUTS TO PROVIDE SECURING FOR THE HOOD SUPPORT STRUTS

OCTOBER 8 - BEGAN TO ROUGH MODIFY THE DOOR PINS

OCTOBER 9 - REAM MODIFY TWO DRIVER SIDE DOOR HINGES AND MODIFY TOOLING TO MODIFY THE PASSENGER SIDE LOWER HINGES

OCTOBER 16 - COMPLETE THE FINISHING OPERATIONS OF THE FOUR DOOR PINS INCLUDING THE GREASE HOLES AND LUBRICATION GROOVES

Status: Completed Tech: 08

### Job09 OCTOBER - 4540 METAL SHOP

OCTOBER 4 - MARCO - STARTED REPAIRING LIGHT SWITCH STALK ON STEERING COLUMN

----->--->---->---->---->---->

Page 4

Labor: \$200 00

Labor:

Labor: \$100

201809036

Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am

Ref: TRANSFERED TO A/P NO AD

BAR #: AK105357

630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

### Job09 OCTOBER - 4540 METAL SHOP

OCTOBER 5 - MARCO- REPAIRING HEADLIGHT SWITCH STALK

OCTOBER 8 - MARCO - FINISH REPAIRING HEADLIGHT SWITCH STALK

OCT. 15TH - MARCO - WELDED DOOR STOP TO TOP HINGE ON DOOR.

OCTOBER 16 - MARCO - ASSIST WITH DOOR STOP AND INSTALLATION OF RIGHT DOOR

OCTOBER 23 - MARCO - REPAIRING STEERING COLUMN LIGHT SWITCH STALK

OCTOBER 24 - MARCO - FINISH REPAIRING HEADLIGHT SWITCH STALK

Status: Completed Tech: 02

Job10 OCTOBER 8 - TECH # 64

OCTOBER 8 - REMOVED UNECESSARY AFTERMARKET SWITCH, BEGAN DOOR REPAIR, REMOVED BOTH DOORS,

FOUND PASSENGER DOOR HAD BROKEN DOOR STOP

Status: Completed Tech: 64

Job11 OCTOBER 9 - TECH # 64

OCTOBER 9 - ASSIST WITH DOOR PIN REPAIR

Status: Completed Tech: 64

Job12 OCTOBER 11 - TECH # 64

OCTOBER 11 - CONTINUE WITH DOOR REPAIR, REAMED DRIVER SIDE DOOR HINGES

Status: Completed Tech: 64

Job13 OCTOBER 15 - TECH # 64

Labor: \$100

Oct. 15th - BEGAN REASSEMBLY OF SWITCH MECHANISIM

Status: Completed Tech: 64

Job14 OCTOBER 15 - TECH # 69

--->--->--->--->--->

Page 5

201809036

Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am

Ref: TRANSFERED TO A/P NO AD

BAR #: AK105357

630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

### Job14 OCTOBER 15 - TECH # 69

Oct. 15th - REPLACED U-JOINTS. CLEANED AND PAINTED SHIFTER PARTS. CLEANED FORWARD SUSPENSION COMPONTENTS. PREP FRO INSTALL. LUKE HELPED TO MODFY U- JOINTS, CLEANED ORGANIZED.

Status: Completed Tech: 69

### Job15 OCTOBER 16 - TECH # 64

Labor: \$300,00

OCTOBER 16 - CONTINUE REASSEMBLY OF LIGHT SWITCH, REQUIRED TEST FITTING AND MODIFICATION, SOLDERED WIRING FOR SWITCH, TESTED ALL SWITCHES, CONTINUE DOOR PIN REPLACEMENT, TEST FIT DRIVER SIDE DOOR -- REQUIRES FURTHER ADJUSTMENT, TEST FIT PASSENGER DOOR STOP CLEARANCE, REMOVE FOR FURTHER ADJUSTMENT

Status: Completed Tech: 64

#### Job16 OCTOBER 17 -TECH # 64

Labor: \$600100

OCTOBET 17 - COMPLETE PASSENGER DOOR REPAIR, REPLACED MISSING DOOR SEAL, TEST FIT DOOR PINS AND PERMANENTLY INSTALL, CONNECT DOOR LIGHT SWITCHES, REPAIR PASSENGER SIDE MARKER, REMOVE WHEEL WELL COVER, REPLACED MISSING BULB HOUSING AND BROKEN LENS, TEST -- PASS, SEALED CONNECTIONS, BEGAN CROSSTUBE FUEL HOSE REPAIR, DRAIN 10 GALLONS OF FUEL, CONTINUE WITH HEADLIGHT STALK, REMOVED FOR ADDITIONAL ADJUSTMENT

Status: Completed Tech: 64

#### Job17 4820 GENERAL REPAIR

Sublet: \$162 0

OCT-19 CLEAN AND TEST POIL COOLER INV# 25255611

# Job18 OCTOBER 18 - TECH # 64

Labor: \$50010

OCTOBER 18 - REPLACE FUEL FILTERS, REPLACE CLUTCH BOOT, DRAINED OIL AND COOLANT, REMOVED COOLANT T CONNECTOR AND FOUND PITTED, WILL REPLACE, REMOVED OIL COOLER, SENT OUT FOR LEAK TESTING, REMOVED REAR AXLES AND BEGAN DISASSEMBLY

Status: Completed Tech: 64

#### <u> Job19 OCTOBER 19 - TECH # 64</u>

Labor: \$50010

OCTOBER 19 - CV REBUILD, CLEAN AND INSPECT, DETERMINE THAT CV JOINTS ARE EXTREMELY WORN, REPLACE WITH NEW CV JOINTS, REASSEMBLE, INTSALL FROM AND REAR MOTOR MOUNTS, INSTALL OIL COOLER AND T CONNECTOR

Status: Completed Tech: 64

#### Job20 OCTOBER 19 - TECH # 71

Labor: \$100,00

----->--->---->---->---->---->

Page 6

Labor: \$600.

Labor: \$200

Labor:

Labor: \$200 00

Labor: \$300100

Labor: \$100 00

Labor: \$100 00

201809036

Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am

TRANSFERED TO A/P NO AD Ref:

BAR #: AK105357 630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

# Job20 OCTOBER 19 - TECH # 71 OCTOBER 19 - CLEANED AND PAINTED DRIVE AXLES

Status: Completed Tech: 71

### Job21 OCTOBER 22 - TECH # 64

OCTOBER 22 - COMPLETE CV INSTALL, GREASE CV'S AND INSTALL BOOT CLAMPS, COMPLETE BRAKE FLUID FLUSH, REPAIR STARTER WIRE, ADJUST HEAT SHIELD, REPLACE CONNECTOR AND ADDED PROTECTIVE SLEEVE, BEGAN BRAKE SWITCH REPAIR, REMOVE BRAKE SWITCH, ADJUST PARKING BRAKE

Status: Completed Tech: 64

### Job22 OCTOBER 23 - TECH # 64

OCTOBER 23 - INSTALLED NEW BRAKE SWITCH, REMOVED AFTERMARKETB BRAKE SWITCH SET UP

Status: Completed Tech: 64

#### Job23 OCTOBER 24 - TECH # 64

OCTOBER 24 - PREP AND PAINT HEAD LIGHT STALK

Status: Completed Tech: 64

#### Job24 OCTOBER 25 - TECH # 64

OCTOBER 25 - COMPLETE HEADLIGHT STACK REPAIR, SOLDER WIRING, REASSEMBLE, INSTALL NEW WOODEN STEERING WHEEL, TEST ALL FUNCTIONALITY

Status: Completed Tech: 64

### <u> Job25 OCTOBER 26 - TECH # 64</u>

OCTOBER 26 - BEGAN VALVE COVER REMOVAL, FOUND SMOG PUMP NOT IN USE AND BEGAN SUPPORTED BY FABRICATED BRACKET, BRACKET DOES NOT CREATE A TIGHT SEAL WITH VALVE COVER CAUSING LEAK,

RECOMMEND REMOVE AND INSTALL ORIGINAL COVER

Status: Completed Tech: 02

### Job26 OCTOBER 26 - TECH # 71

OCTOBER 26 - PAINT STRIPPED AND CLEANED VALVE COVERS

Status: Completed Tech: 71

### Job27 OCTOBER 29 - TECH # 64

OCTOBER 29 - REMOVE AIR PUMP AND BRACKET, MODIFY BRACKET TO SUPPORT OIL COOLER, PREP VALVE

----->--->--->--->--->--->--->--->

Page 7

201809036

Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am

TRANSFERED TO A/P NO AD Ref:

BAR #: AK105357

630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

Job27 OCTOBER 29 - TECH # 64 COVERS FOR FINAL FINISH Status: Completed Tech: 64 Job28 OCTOBER 29 - TECH # 71 Labor: OCTOBER 29 - RETRIEVE VALVE COVERS FROM SOAKING OVER THE WEEKEND IN PARTS WASHER AND CLEANED Status: Completed Tech: 71

Job29 OCTOBER 31 - TECH # 68

OCTOBER 31 - CONTINUE WITH DOOR PIN REMOVAL ON DRIVER SIDE

Status: Completed Tech: 64

Job30 NOVEMBER 8 - TECH # 64

Labor: \$77 28

NOVEMBER 8 - CONTINUE WITH WIPER REPAIR, REMOVE TANGLED WIRING FROM WIPER MOTOR -- MOTOR IS FUNCTIONAL, FOUND WIPER ARM SPLINES STRIPPED -- NEED TO REPLACE

Status: Completed Tech: 64

Job31 NOVEMBER - 4540 METAL SHOP

NOVEMBER 27 - MARCO - ASSIST WITH FINAL FIT OF LEFT DOOR HINGE PINS AND INSTALL DOOR,

SOLDERED LEAKING RADIATOR OVERFLOW TANK

Status: Completed Tech: 11

Job32 NOVEMBER 9 - TECH #64

Nov. 9 - CONTINUED WITH WIPER REPAIR. REMOVED OBSOLETE WIRING. CONTINUED WITH DOOR PIN

REMOVAL

Status: Completed Tech: 64

Job33 NOVEMBER - 4530 MACHINE SHOP

Labor:

Labor: \$100,00

Labor:

Labor:

Labor: \$200 00

Nov. 9 - ATTEMPT TO EXTRICATE THE BOTTOM HINGE PIN FROM THE DRIVERS SIDE DOOR

Status: Completed Tech: 02

Job34 NOVEMBER 12 - TECH #64

Nov 9 - COMPLETED WIRING REPAIR. SECURED LOOSE WIRING AND CORRECTED COOLING FAN ROUTING ----->--->--->--->--->--->--->

Page 8

201809036

Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am

Ref: TRANSFERED TO A/P NO AD

BAR #: AK105357 630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

#### Job34 NOVEMBER 12 - TECH #64

Status: Completed Tech: 64

Job35 4840 PLATING

Sublet: \$249]

NOV-14 DOW TREATMENT OF BOTH VALVE COVERS AND END PLATES,

### Job36 NOVEMBER 19 - TECH # 64

Labor: \$200 \ 00

NOVEMBER 19 - CONTINUE VALVE COVER ASSEMBLY, REINSTALLED ALL STUDS ON VALVE COVERS, REPLACE DAMAGED OR WORN STUDS, REPAIRED THREADS ON VALVE COVER, CLEANED MOUNTING SURFACES

Status: Completed Tech: 64

#### Job37 NOVEMBER 20 - TECH # 64

Labor: \$100 00

NOVEMBER 20 - CONTINUE VALVE COVER INSTALLATION

Status: Completed Tech: 64

# Job38 NOVEMBER 26 - TECH # 64

Labor: \$800 00

NOVEMBER 26 - CONTINUE VALVE COVER INSTALLATION, INSTALL VALVE COVERS AND END CAPS, REMOVAL OF DISTRIBUTOR REQUIRED AND CHANGED SEALS, CONNECTED LINKAGE AND HOSES, CONTINUE WITH DRIVER SIDE DOOR REPAIR, TEST FIT PIN, ADJUSTMENT REQUIRED

Status: Completed Tech: 64

#### Job39 NOVEMBER 27 - TECH # 64

Labor: \$60010

NOVEMBER 27 - COMPLETED DOOR INSTALLATION, INTALLED MISSING RUBBER SEAL BY DOOR HINES, REINSTALLED PANELS, COMPLETED VALVE COVER INSTALLATION, REINSTALL HOOD PANELS HOOD AND SPARE TIRE, ADDED FLUIDS, OIL AND COOLANT, FOUND LEAK AT COOLANT EXPANSION TANK, LEAKING FROM OLD WELD, REPAIRED

Status: Completed Tech: 64

### Job40 NOVEMBER 28 - TECH # 64

Labor: \$500 0

NOVEMBER 28 - CLEANED ENGINE BAY, INTALLED AIRBOX, INSTALLED EXPANSION TANK AND PRESSURE TESTED COOLING SYSTEM - PASSED, ADDED 5 GALLONS OF FUEL, RAN ENGINE TO OPERATING TEMPERATURE AND CHECKED FOR LEAKS - PASS, TEST DROVE CAR- FOUND COOLING FANS NOT OPERATING, DETERMINED FAN SWITCH IS BAD, WILL REPLACE

Status: Completed Tech: 64

#### Job41 NOVEMBER - TECH # 05

Labor:

oor: N/

----->--->--->--->---Continued on the next page--->---->---->

Page 9

201809036

Order Date 09/17/18 08:48 am

Closed/Paid: 12/03/18 08:15 am

Ref: TRANSFERED TO A/P NO AD

BAR #: AK105357 630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

#### Job41 NOVEMBER - TECH # 05

NOVEMBER 28 - PICK UP 5 GALLONS OF FUEL

Status: Completed Tech: 05

Job42 NOVEMBER 29 - TECH # 64

Labor: \$100 00

NOVEMBER 29 - REPLACE FAN SWITCH AND TESTED

Status: Completed Tech: 64

### Job43 NOVEMBER 30 - TECH # 64

Labor: \$500.00

NOVEMBER 30 - TESTED BATTERY - FAILED TO HOLD CHARGE, REPLACED, TEST DROVE CAR -- HARD START, FOUND CARBS DRIPPING CAUSING EXCESS FUEL, INSPECTED FLOATS AND NEEDLE VAVLES, FOUND CARB #2 NEEDLE VALVE IS STICKING, MAY NEED REBUILD IF PROBLEM CONTINUES TUNED CARBS, DETAILED VEHICLE

Status: Completed Tech: 64

### Job44 NOVEMBER 30- TECH # 12

Labor:

NOVEMBER 30 - ASSIST WITH TUNING AND SETTING IGNITION TIMING NOTE\* TIMING MARKS ON PULLEY ARE 180° OUT, TUNED CARBS

Status: Completed Tech: 12

I agree to pay reasonable attorney fees if legal action becomes necessary to enforce collection of debt. All warranties on products sold hereby are those made by the manufacturer. Fast Cars Ltd. hereby expressly disclaims all warranties, either expressed or implied, including implied warranty of merchantability or fitness for any items on this invoice. Should I Choose to use Visa/Master card or American Express for payment of this invoice, it is understood that I will be responsible for any credit card processing fees.

Work accepted by\_

Date

Fast Cars, Ltd. offers service & restoration for the most unique, complex & expensive automobiles made. The business philosophy of this company is to offer the highest standard of work available without compromise. The guidelines of the State of California, Consumer Protection Act covering automotive repair were drafted to cover main stream automotive repair & do not take into consideration the unique characteristics of the automobiles nor the long term nature of the work performed by this company. Therefor there are unique stipulations imposed by Fast Cars, Ltd.

As the owner or authorized agent of the above referenced automobile, I authorize the repair or restoration work detailed above, along with the necessary parts & materials. I also request the examination of any system that may appear to be deficient.

I acknowledge the unique hand built nature of my automobile & understand that it is impossible for Fast Cars, Ltd. to estimate the exact cost of repairs. Therefore I agree ---->--->---->---->---->

201809036

Order Date 09/17/18 08:48 am Closed/Paid: 12/03/18 08:15 am

TRANSFERED TO A/P NO AD

BAR #: AK105357

630 Mary Ann Drive

Redondo Beach, Ca 90278

Phone: 310-937-6700 FAX: 310-376-3392

that this estimate is an approximation of charges & is not a binding absolute ceiling to the final cost of repairs or restoration.

I acknowledge that the extraordinary value of my vehicle dictates that I maintain full liability & comprehensive insurance coverage while my vehicle is in possession of Fast Cars, Ltd. I understand that my insurance is the primary coverage & therefore I will not hold Fast Cars, Ltd. responsible for loss or damage to the vehicle or it's contents, in the case of accident, fire, theft, or any other cause beyond reasonable control. I authorize the employees of Fast Cars, Ltd. to operate my vehicle for the purposes of testing, inspection or delivery at my sole risk.

I acknowledge an expressed mechanics lien on this vehicle to secure payment to Fast Cars, Ltd. in the full amount due for repairs. I agree to pay reasonable attorney's fees if legal action becomes necessary to enforce the collection of debt. I agree to pay any difference between the total cost of repairs & payments made by my insurance company. Billing will be sent out on the completion of, biweekly or monthly basis dependant on the duration & work load. Billing is due & payable on receipt, absolutely no term applies. Interest, calculated at 10% per year will be charged on an unpaid balance. Storage at \$50.00 per day will be charged, beginning the day after notification

I take full responsibility for the operation of my high performance or racing car, acknowledging the dangers of operation therein & the potentially lethal consequences.

Owner or agent

Date

Payments to Fast Cars Ltd		Cost Summary	7
Status: Closed Work Order		Labor	9677.28
		Parts	5173.24
Payments: \$16,500.00	Sublet	1139.74	
1 10/18/18 8000.00 Check	chq # 1005	Haz Waste	18.28
2 12/03/18 8500.00 Check	CHQ # 1007	Tax	491.46
		Total	\$16500.00
		Payments	16500.00
		Bal Due	0.00

Thank you for choosing Fast Cars Ltd