## **Griffin Motorwerke Inc**

1146 6th Street Berkeley, CA 94710

(510) 524-7447

BAR#ARD00107264

Invoice 0016799 Original Estimate #:0010107 1979 Porshe 911 turbo slant 3.0L TURBO

VIN: 9309800439

Mileage In 91818 Out 91864 Trans: MANUAL 4 S

License : 5CED912

Colr : WHITE **6/29/2022**Body : SLANT 2:56 pm

Advisor: HUMBERTO ORTIZ

PL	1ST TIME INITIAL INSPECTION-						
	GAS TANK DRAINED AND CLEA NEEDS	HAS NOT BEEN DRIVEN IN 12 YEARS - W NED IF NECESSARY - SEE TERRY ABOUT				0.00	
L	DRAIN FUEL TANK, REMOVE FU	EL TANK AND FLUSH ALL FUEL LINES. R	EINSTALL FUEL	***************************************	33.93	1000.00	1033.93
	TANK AFTER TANK CLEANING S	SERVICE. PUT IN 5.58 GALLONS OF 91 OC	TANE FUEL		00.00	1000.00	1000.50
		Part Description	Part Price Each	Quantity	Extended		
	CHEVRON91	GAS	6.08	5.58	33.93		
L	SEND FUEL TANK OUT FOR CLE	EANING A RESEAL COATING.		ALAMOT MONTHUM COMMISSION OF	A A CONTROL OF THE STREET AND	0.00	A CONTRACTOR OF THE PARTY OF TH
L L	REPLACE FUEL FILTER			Action Control Control	67.50	150.00	217.50
	Part Number	Part Description	Part Price Each	Quantity	Extended	100.00	211.00
	930 110 139 00	FUEL FILTER BOSCH	67.50	, 1	67.50		
L J		ASSEMBLE - CLEAN CV JOINTS AND INS			72.56	1000.00	1072.56
	WEAR - REPACK JOINTS WITH S						
	AND OUTER CV BOOTS - AND R	E INSTALL IN CAR - RE TORQUE BOLTS	O 25 FOOT PUN	DS			
	Part Number	Part Description	Part Price Each	Quantity	Extended		
************	901 332 293 12 REI	AXLE BOOT INNER/OUTER	18.14	4	72.56		
PL	INSTALL NEW HOOD SHOCKS				86.46	100.00	186.46
	Part Number	Part Description	Part Price Each	Quantity	Extended		
L	911 511 331 00 OIL AND INSPECTION SERVICE	HOOD SHOCK	43.23	2	86.46		
-					189.76	250.00	439.76
	-REPLACE OIL AND FILTER						
	-TOP UP ACCESSIBLE UNDERHO	DOD FLUIDS					
	-INSPECT BRAKES AND TIRES						
	-RESET SERVICE REMINDER IF	APPLICABLE					
	-SET TIRE PRESSURES						
	Part Number	Part Description	Part Price Each	Quantity	Extended		
	900 031 011 30	WASHER 6MM	1.12	12	13.44		
	DRIV.20W50 GP-1	DRIVEN SYNTH BLEND 20W50 HIGH ZINC	10.88	12	130.56		
	930 101 391 01 900 910 047 09	OIL SUMP PLATE GASKET NYLOCK NUT	10.18 5.06	2	20.36		
	930 107 764 01	OIL FILTER	20.34	1	5.06 20.34		
PL	REPLACE BOTH LEAKING LOW		20.07		21.32	400.00	421.32
	Part Number	Part Description	Part Price Each	Quantity	Extended	400.00	421.02
	930 105 195 07	GASKET, LOWER VALVE COVER	10.66	2	21.32		
	REPLACE ALTERNATOR AND A/	C DRIVE BELTS AND ADJUST TENSION			45.10	300.00	345.10
	Part Number	Part Description	Part Price Each	Quantity	Extended		
	999 192 176 5A	DRIVER BELT ALT 10X710	16.00	1	16.00		
PL	025 260 849 B	_ <i>DRIVE BELT 13 X 1150</i> ANCE 4 NEW TIRES REARS 245/45X16 PII	29.10 PELLI POSSO	1	29.10 1321.00	320.00	1641.00
	FRONTS 225/50X16 PIRELLI ROS		KELLI KOSSO		1321.00	320.00	1041.00
	Part Number	Part Description	Part Price Each	Quantity	Extended		
	225/50/16 PIR PZROSS	PIRELLI PZERO ROSSO ASIM N5	290.00	2	580.00		
		STATE TIRE FEE	1.75	2	3.50		
		TIRE DISPOSAL	6.00	2	12.00		
	Tire 1 DOT: Tire 2 DOT:	93CP 696F 5021 93CP 696F 5021					
		PIRELLI PZERO ROSSO ASIM N5	355.00	2	710.00		
	2,0,10,10,10,2,000	STATE TIRE FEE	1.75	2	3.50		
		TIRE DISPOSAL	6.00	2	12.00		
		93FX 695F 2221					
		93FX 695F 2221					
PL	CLEAN BATTERY TERMINALS A		D-4 D4 56	0	168.74	100.00	268.74
	48/H6 730	Part Description H6 BATTERY 48 SERIES 730 CCA	Part Price Each 168.74	Quantity	Extended 168.74		
PL		GN ALL FOUR WHEELS - GIVE THE CUST	OMER THE BEEC	RF	100.74	400.00	400.00
	AND AFTER PRINT OUT	ON ALL TOOK WILLES - GIVE THE GOOT	OMER THE BEI	NL .	)	400.00	400.00
L		E AT THE PRESSURE WASHER - HAD A L	OT OF OPENCE			400.00	400.00
_			OI OF GREASE			100.00	100.00
	AND DIRT ON THE BOTTOM OF					100	
S		ROVE TO SMOG TO GET THE CAR UP TO	OPERATING TEN	IP-		120.00	120.00
	FAILED						
	INITIAL INSPECTION BECAUSE IDLE WAS AT 1250 RPM - NEED TO GET IDLE DOWN TO						
	UNDER 1000 RPM						
	*********						
		sent car to smog again and it passed	•				`

## Griffin Motorwerke Inc

1146 6th Street Berkeley, CA 94710

(510) 524-7447

BAR#ARD00107264

Invoice 0016799 Original Estimate #:0010107 1979 Porshe 911 turbo slant

3.0L TURBO VIN: 9309800439

Mileage In 91818 Out 91864 Trans: MANUAL 4 S

60.00

60.00

License: 5CED912 Colr : WHITE

Body: SLANT

6/29/2022 2:56 pm

Advisor: HUMBERTO ORTIZ

Techi	nician Service Description		Parts	Labor	Job Tota
	CHECK ALL SETTINGS AND ADJUST AS				
	NECESSARY- KEEP TRACK OF TIME AND ADVISE CUSTOMER -				
	TAKE BACK TO SMOG				
TG	HAVE CAR DETAILED	WASHING STREET, MANAGEMENT OF THE STREET, STRE		135.00	135.00
PL	PRE-DELIVERY TECH CHECK			0.00	eta filologia eta alba ilako eta
	-CHECK AND REPLACE ACCESSIBLE LIGHTS				
	-CHECK FRONT BRAKE PADS- 4MM				
	-CHECK REAR BRAKE PADS- 3MM				
	-CHECK AND TOP UP ALL ACCESSIBLE FLUIDS				
	-REPORT IF ANY WARNING LIGHTS ARE ON				
	-CHECK A/C & HEAT				
	-CHECK AND SET TIRE PRESSURES				
	FRONT PSI- 29PSI	/			
	REAR PSI- 34PSI				
CS	6/28/22 ADDED CHEVRON 91			60.00	60.00

Services Recommended to Customer

WILL STILL NEED BRAKE ROTORS AND PADS AND BRAKE FLUID FLUSH ESTIMATE- REPLACEMENT OF STEERING COLUMN BEARING UPPER

Parts Recommended To Customer

1 911 347 771 02

BEARING, STEERING COLUMN UPPER 40MM

Approved	By Approval Given to:	Authorizations Date	Time	Difference	Total Authorized	Method
Reason:	FUEL TANK AND FUEL FIERERY, @ AND FUEL FIERERY, FI	4/12/22 1945, BELTS	4:33 pm	\$5,772.67	\$5,772.67	By Email



## Griffin Motorwerke Inc.

1146 6th Street Berkeley, CA 94710

(510) 524-7447

BAR#ARD00107264

Invoice 0016799 Original Estimate #:0010107

1979 Porshe 911 turbo slant 3.0L TURBO

VIN: 9309800439

Mileage In 91818 Out 91864 Trans: MANUAL 4 S

License: 5CED912

**Parts** 

Colr: WHITE 6/29/2022 2:56 pm Body: SLANT

Labor

Job Total

Advisor: HUMBERTO ORTIZ

Repair Order Notes

4/7/22 PL

Technician

-REAR OUTER AND INNER AXLE BOOTS TORN AND SLINGING GREASE EVERYWHERE. - done

-TRANSMISSION LOOKS LIKE ITS LEAKING FRONT THE SHIFT ROD AREA. -COULD USE NEW SHOCKS. HAS ORIGINAL "GREEN" BILSTEIN SHOCKS.

Service Description

-A LOT OF OIL RESIDUE ON BOTTOM OF TRANNY, ENGINE, AND VALVE COVERS. - VC done

-TRANSMISSION SHOULD BE PULLED AND SENT TO RON FOR INSPECTION AND POSSIBLE REBUILD. -VALVE COVERS AND GASKETS SHOULD BE CHECKED DUE TO OIL RESIDUE.

-OIL ON TURBO AND INTERCOOLER PIPING.

-TRANSMISSION MOUNT BUSHINGS LOOK LIKE THEY ARE CRACKING -TIRES ARE 20 YEARS OLD. NEEDS ALL 4 NEW TIRES. - done

-RECOMMEND FULL BRAKE JOB. PADS ARE LOW AND ROTORS LOOK GROOVED. -FRONT WHEELS BEARINGS FELT LOOSE. INSPECT FURTHER. -TANK NEEDS TO BE REMOVED AND REFRESHED AS ITS BEEN SITTING FOR 12YRS. IT HAS A DRAIN PLUG ON THE BOTTOM.

-FRONT BUSHINGS AND TIE RODS LOOK OKAY AT THE MOMENT. - drained and filled -IF OWNER WANTS TO KEEP AND USE A/C, COMPRESSOR SHOULD BE CHECKED AND NEEDS AN R134 CONVERSION KIT.

-ALL BELTS SHOULD BE REPLACED, AS WELL AS ALL FILTERS, AND ALL FLUIDS.

-NEEDS NEW HOOD SHOCKS. - done

-NEEDS ALL 3 NEW WINDSHIELD WIPERS. done

-NEEDS NEW BATTERY. done

-BACK SEATS ARE MISSING MECHANISM THAT LOCKS THEM INTO PLACE

-FRONT SEATS ARE NOT ABLE TO MOVE. EITHER SEAT MOTORS OR WIRING -STEERING COLUMN BUSHING IS WASTE.

-AFTER ALIGNING, FOUND FRONT AND REAR CAMBERS COULD NOT COME INTO SPEC. TOE IS SET BUT SOMETIMES CAR FEELS LIKE ITS PULLING TO THE RIGHT.

-CAR SMOKES WHEN PARKED AFTER GETTING UP TO TEMP. COULD BE RESIDU ROM VALVE COVER GASKET INSTALL. - monitor -TURN SIGNALS IN FRONT ARE NOT WORKING - WIRES HAVE BEEN CUT - REPAIRING THIS REQUIRES REMOVING BUMPER AT LEAST.

- -l acknowledge receipt of a copy of this repair order.
- -I have gone over and agree to all costs of services.
- -Factory/OEM parts and labor are covered by a 12 month, 12000 mile warranty.
- -All parts shown are new unless otherwise specified.
- -All special order parts are non-refundable unless the item is incorrect due
- solely to Griffin Motorwerke error. Full payment required to order parts.
- -Special order deposits will be lost if customer cancels order.
- -An express mechanic's lien is hereby granted.
- -A \$275 per day storage fee applies once owner is contacted that all work has been completed.
- -All "Off Road Use Only" parts & components come with no warranty, owner acknowledges and accepts all risks and liabilities associated with said parts.
  - I acknowledge notice and oral approval of an increase in the original estimated price.

Customer Signature:	
	Date:

1	TOTAL PARTS	\$1,975.37	
	TOTAL LABOR	\$5,424.00	
	SUBLET	\$315.00	
	SHOP SUPPLY	\$0.00	
	SUBTOTAL	\$7,745.37	
	OTHER FEES	\$31.00	
	SALES TAX	\$199.00	
	TOTAL REPAIR ORDER	\$7,944.37	
	PAID	\$7,944.37	
	DUE	\$0.00	

