

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARDO96296 073104
CAL 000 001 214

Invoice # 55451

Richard Muller
512 Calle Aparejo
Santa Barbara, CA 931110000
(805) 967-6134 Home

1959 Porsche 356A
VIN: 151926
Engine: H4 1.6L, 97cid, Gas, Carb
Trans:

License # JTJ 965
ODO In: 51099 Out: 51100
Color: Yellow
Mfg. Date:
Unit #

Inv Date: 7/18/2012
Promised: 7/18/2012 @ 5:00pm
Service Writer:
Status: Complete
Driver: Muller, Richard
PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Finish assembly of electrical components.
Sort wiring.

1,282.50

- Labor Service - .
Sort electrics.
—Install tail lights and license/backup console.
—Check turn signals. Repair connection for right front.
—Finish assembly of headlights. install and aim.
—Sort wiring for horn circuit. Note: Horn circuit now functions properly but horns are bad.
—Sort wiring for radio. Speakers are not connected. Car wiring does not match radio.
—Sort wiring for ignition switch, headlight switch and instruments.
—Gas gauge doesn't work. Check electrics. Gauge is OK. Sending unit is bad.
—Notes: Need longer screw for right headlight bucket.
—Horns don't work. JOE

New	FENDER	Washer	5.00	0.50	2.50
New	NPN TERMINAL	Wire terminal	4.00	1.20	4.80
New	5MM SPLIT	Lock washer	6.00	0.10	0.60
New	6X25MM	Capscrew	1.00	0.30	0.30
New	6MM FLAT	Washer	1.00	0.20	0.20
Used	NPN HL	Headlight lens retainer clip	12.00	0.25	3.00
New	644.631.413.01	Seal, turn signal	2.00	4.20	8.40
New	N.17.718.1	Bulb 6v 5w	1.00	3.16	3.16
New	N.17.121.4	Fuse 16 Amp Ceramic	1.00	0.33	0.33
New	N.17.722.2	Bulb 12v 2w	2.00	2.23	4.46
New	4MM	Nut	1.00	0.15	0.15
Used	NPN GS	Ground socket	1.00	2.00	2.00

Adjust valves. Tune engine.

270.00

- Labor Service - .
Check engine.
—adjust valves. Found #4 exhaust valve very tight.
—Check compression. 120, 130, 140, 125
—Replace spark plugs.
—Check ignition dwell and reset timing.
—Balance and adjust carburetors.
—Notes:
—#4 exhaust valve was very tight! Check again soon.
—1150 rpm indicated = 750 rpm true.
—Brakes pull and grab. Sticky wheel cylinders.
—Clutch chatters badly. Adjustments look OK. JOE
New W8AC Spark plug

4.00 4.00 16.00
135.00

- Labor Service - .
Adjust handbrake.
—Found car had been jacked up on front handbrake mechanism bending front cable.
—Adjust right side cable bowden for proper seating. JOE

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARD096296 073104
CAL 000 001 214

Invoice # 55451

Richard Muller

1959 Porsche 356A

License # J TJ 965

Inv Date: 7/18/2012

Continued from previous page

Warranty
All repair work is warranted for 24 Months or 24,000 Miles, Unless Specified Otherwise.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

Invoice Summary
Parts 45.90
Labor 1,687.50

Sub Total 1,733.40
Sales Tax (CA) 3.56

Original Estimate: 1,854.72 **Total 1,736.96**

Discard old parts

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARDO96296 073104
CAL 000 001 214

Richard Muller
512 Calle Aparejo
Santa Barbara, CA 931110000

1959 Porsche 356A
VIN: 151926
Engine: H4 1.6L, 97cid, Gas, Carb
Trans:

License # JTJ 965
ODO In: 51420
Color: Yellow
Mfg. Date:
Unit #

Inv Date: 8/29/2012
Promised: 8/30/2012 @ 5:00pm
Service Writer:
Status: Complete
Driver: Muller, Richard
PO #

(805) 967-6134 Home

Check engine. Lots of brass filings on sump plate.

Labor Service - Check engine only as delivered by customer.
---Disassemble, clean and inspect engine. Found no source for brass filings. Engine has been apart not many miles ago. Perhaps residue from earlier failure trapped in oil cooler???

---Found compression leaks on both sides. Head nuts were snug but not properly torqued. Exhaust guides worn. Found 2 early type non-progressive valve springs.
---#4 connecting rod bearing was worn heavily on one side. Engine has early type connecting rods. Recommend replacing with updated type.
---Crankcase, crankshaft, pistons and cylinders all look good.
---Clean pistons and cylinders. De-glaze cylinders. Replace piston rings.
---Check engine balance. Pistons and connecting rods are within 0.3 grams.
---Assemble and test engine.
---Readjust valves after run-in. JOE

4,792.50

New	C1129	Piston ring set	1.00	88.29	-28.29	60.00
New	616.116.012.01	Clutch cover 180mm	1.00	335.04	-5.04	330.00
New	111.141.031F	Clutch disc	1.00	141.25	-71.25	70.00
New	616.100.184.03	Top gasket set	1.00	129.95	-59.95	70.00
New	616.101.901.01	Lower gasket set	1.00	143.24	-73.24	70.00
New	FREIGHT	From Stoddard	1.00	21.80		21.80
New	NLA.103.012.05	Crower connecting rod set	1.00	1590.00	-50.00	1,540.00
New	NLA.102.025.01	Gland nut	1.00	44.00	-4.00	40.00
New	546.101.901.00	Main bearing set	1.00	495.00	-95.00	400.00
New	616.103.142.02	Rod bearing set	1.00	112.95	-52.95	60.00
New	IAP GUIDE	Valve guide	4.00	15.00		60.00
New	616.105.432.03	Valve spring	2.00	29.95	-22.90	37.00
New	616.104.391.00	Valve spring shim, 1.5mm	8.00	3.00		24.00
New	6X10MM AL	Sealing washer	10.00	0.20		2.00
Used	616.101.171.00	Case through bolt	1.00	12.76	-4.76	8.00
Used	616.101.191.00	Case washer	7.00	7.70	-18.90	35.00
New	356.41.446	Rocker pedestal shim	4.00	1.50		6.00
New	8X12MM CU	Lock nut	8.00	1.00		8.00
New	8MM	Nut	9.00	0.30		2.70
New	8MM WAVY	Washer	9.00	0.12		1.08
New	03 019	Distributor cap 356/912	1.00	18.05		18.05
New	111.905.449A	Elephant ears	4.00	0.80		3.20
New	FT. 7MM BRAIDED	Fuel hose	0.75	3.00		2.25
New	539.09.314	Generator pulley spacer	4.00	2.95	-2.20	9.60
New	8MM FLAT	Washer	2.00	0.20		0.40
New	BRAKLEEN	Cleaning fluid	1.00	6.95		6.95
New	021.919.081B	Oil pressure switch	1.00	22.80	-14.80	8.00
New	539.07.826	Oil line, oil filter outlet	1.00	49.30	-17.30	32.00
New	BRAD PENN BREAK IN	Brad Penn 30W Break-in oil	4.00	8.95		35.80
Sublet	IAP CRANK	Clean and polish crank.	1.00	100.00		100.00
Sublet	IAP PITMON2	Balance engine rotating assembly.	1.00	250.00		250.00
Sublet	IAP38	Resurface heads	1.00	350.00		350.00
		Cut valve seats				
		R & R guides				
Sublet	IAP4	Resurface flywheel	1.00	65.00		65.00

Labor Service -
Repair fuel leaks at both carburetors.

67.50

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARDO96296 073104
CAL 000 001 214

Invoice # 55640

chard Muller

1969 Porsche 356A

License # JTJ 965

Inv Date: 8/29/2012

R & R and reseal jet covers. JOE
New 616.100.838.00

Jet cover seal

2.00

15.01

-22.02

8.00

0.00

Labor Service -

Notes:

- Oil slinger behind rear crank seal is missing.
- Engine is filled with Brad-Penn 30 wt. break-in oil. Change to your oil and adjust valves at 300 miles. JOE

Warranty

All repair work is warranted for 24 Months or 24,000 Miles, Unless Specified otherwise.

hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs hereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

Invoice Summary

Parts	2,934.03
Labor	4,860.00
Sublet	765.00
Fluids	35.80

*Pricey
Thank
You*

Sub Total	8,594.83
Sales Tax (CA)	230.16

Original Estimate: 8,824.99 **Total 8,824.99**

Discard old parts

X

Customer acknowledges receipt of merchandise and services.

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105

(805) 962-8015

BAR ARDO96296 073104

CAL 000 001 214

Invoice # 55968

hard Muller
Calle Aparejo
la Barbara, CA 931110000

1959 Porsche 356A

VIN: 151926

Engine: H4 1.6L, 97cid, Gas, Carb

Trans:

License # JTJ 965

ODO In: 51795

Color: Yellow

Mfg. Date:

Unit #

Inv Date: 11/06/2012

Promised: 11/06/2012 @ 5:00pm

Service Writer:

Status: Complete

Driver: Muller, Richard

PO #

i) 967-6134 Home

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
horn is not working.					101.25
Labor Service -					
Re-wire horn relay and steering column. JOE					
turn signal lights not working.					0.00
Labor Service -					
Check electrics.					
Problem found to be in tunnel.					
customer declined further work.					
JOE					
check voltage regulator.					101.25
Labor Service -					
Check and replace voltage regulator. JOE					
Used USED REGULATOR Voltage regulator			1.00	50.00	50.00

warranty
repair work is warranted for 24 Months or 24,000 Miles, Unless Specified
otherwise.

Invoice Summary

Parts 50.00
Labor 202.50

hereby authorize the repair work listed herein, including sublet work, to be done along with necessary
materials. You and your employees may operate the described vehicle for the purposes of testing, inspection
delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs
owed. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire,
theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for
any fees in the event that default is made in any payment due. If vehicle is returned to customer
without repair service being performed, a diagnostic and handling fee (including reassembly) may be
charged. I have read and understand the above and acknowledge receipt of an estimate.

Customer acknowledges receipt of merchandise and services.

Sub Total 252.50
Sales Tax (CA) 3.88

SCHNEIDER AUTOHAUS

2703 De La Vina Street
Santa Barbara, CA 93105
(805) 962-8015
BAR ARDO96296 073104
CAL 000 001 214

Invoice # 58902

Richard Muller
512 Calle Aparejo
Santa Barbara, CA 931110000

(805) 967-6134 Home

1959 Porsche 356A

VIN: 151926

Engine: H4 1.6L, 97cid, Gas, Carb

Trans:

License # JTJ 965

ODO In: 54935

Color: Yellow

Mfg. Date:

Unit #

Inv Date: 8/11/2014

Promised: 8/11/2014 @ 5:00pm

Service Writer:

Status: Complete

Driver: Muller, Richard

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
Check brakes, they intermittently pull to the left and right.					

Labor Service -

Check front and rear brakes.

- Rear brakes are fine.
- Front wheel cylinders leaking, lining worn, return springs incorrectly positioned.
- Found front brake hoses too short. Limiting factor for steering angle.
- Replace front brake wheel cylinders and lining.
- Replace front brake hoses.
- Bleed and adjust brakes.

—Note: Master cylinder has excessive free play. JOE

New	695.351.511.00NLA	Front wheel cylinder	2.00	99.95	199.90
New	695.351.512.00NLA	Front wheel cylinder	2.00	99.95	199.90
New	178	Brake shoe set	1.00	89.95	89.95
New	LMA	Pt. Castrol brake fluid, dot 4	3.00	12.95	38.85
New	5X45MM	Cotter pin	2.00	0.25	0.50
New	10X16MM CU	Sealing washer	4.00	0.60	2.40
New	12X18MM CU	Sealing washer	4.00	0.60	2.40
New	113.611.701DMY	Brake hose	2.00	24.00	48.00

Warranties and Notices

- Tire pressures: 24 front, 28 rear.

Warranty

All repair work is warranted for 24 Months or 24,000 Miles, Unless Specified Otherwise.

Invoice Summary

Parts	581.90
Labor	770.00

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorney's fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

Baid
Thank You

Sub Total	1,351.90
Sales Tax (CA)	46.55

Customer acknowledges receipt of merchandise and services.

Discard old parts

Original Estimate: 1,398.45 Total 1,398.45

Klasse 356 Parts

4040 Spencer St. Ste L
Torrance, CA 90503
1-800-634-7862
parts@klasse356.com

Invoice

Date	Invoice #
4/23/2015	6836

Bill To
Bob Devlin 3331 Jackson St San Francisco, Ca 94118

Ship To
Bob Devlin 3331 Jackson St San Francisco, CA 94118

Ship Date		Ship Via	Project		
4/23/2015		UPS			
Qty	Item	Description	Price Ea.	Amount	
1	ACS5.1	Travel Bag, Everyday - Custom Kit.	325.00	325.00T	
1	EMB1.1	Emblem - "PORSCHE", Gold. 5-Stud, 215mm 8 1/2" length. Fits Speedster & 356A.	62.25	62.25T	
	Shipping	Shipping & Insurance	20.78	20.78	

Subtotal	\$408.03
Sales Tax (8.5%)	\$32.92
Total	\$440.95
Payments/Credits	\$0.00
Balance Due	\$440.95

1959 A Cabriolet
Bob Devlin

Klasse 356 Werkstatt

12/25/2014

OPER NO	LABOR	
1	Install Voltage Regulator Decal	
2	Install Valve Adjustment Decal	
3	Install Einlass Decal	
4	Replace all 6 front sway bar bushings, including steel inserts	
5	Lube front end grease fittings	
6	Install new rubber boot on e-brake cable, adjust accordingly	
7	Replace front pulley seal, includes installing a "speedi" sleeve over seal surface	
8	R&R muffler - Install new exhaust gaskets. Replaced copper nylocks with brass nuts	
9	Replaced mismatched bolts & nuts which consistent sizes	
10	Adjust door closure fit - Both sides. Reinstall both lower door seals and trim back carpet for the correct fit of the aluminum trim	
11	Adjust vent window frame - PS	
12	Hook up heater cables & heater control rods.	
13	Readjust heater cables @ the control tower	
14	Install missing suspension straps and arrange in the correct sequence	
15	Correctly route fuel line	
16	Correctly route tach cable, install missing clamp	
17	Adjust clutch free play	
18	Adjust brake pedal free play	
19	Replace worn pedal buffers	
20	Adjust accelerator rod length for full throttle	
21	Repair radio fuse holder - bare wire exposed caused fuse to blow	
22	Install LED Lights in all gauges - Locate each in the correct location.	
23	Replace missing signal light relay and check functionality - OK	
24	Configure both the horn ring & signal light button in steering wheel	
25	Install new rubber and foam ring for horn cup	
26	Install new center PORSCHE crest button	
27	Install new speakers and correctly install speaker grills	
28	Install missing turnbuckle ball cap - Interior DS	
29	R & R fuel cock to replace mssing filter screen	
30	Both Carb tops weeping - Very Loose - Tighten all top screws	
31	Properly adjust rear E-brake cables to assure BOTH wheels brake	
32	Clean around trans drain plug - check for leaks - Not leaking	
33	Install new fan belt	
34	Change Oil	
35	Change Oil Filter	
36	Adjust valves	
37	Check compression #1-120 #2-120 #3-120 #4-120	
38	Reset carb balance	
39	Regapped spark plugs & reinstall	
40	Install battery tender plug in lead	
41	Install 4 very good hub caps - Boxed up originals	
42	Install correct tire valve stem retainers and caps	
43	Install consistent size washers and screws in sheetmetal tray	
44	Adjust Carb pre-heat system	
45		
46		
47	Part & Labor	2,500.00
48	Extras	
49	Owners Manual - New Reproduction	148.00
50	Battery Tender	70.00

4040 Spencer St. Ste L Torrance, CA 90503
310-370-3014

1959 A Cabriolet
Bob Devlin

Klasse 356 Werkstatt

12/25/2014

51	4 x Mon Hubcaps - Very Good condition	160.00
52	1 x Car Cover	315.00
53		
54		
55		
56		
57		
58		
	SubTotal	3,193.00
	Total	\$3,193.00

BURLINGAME MOTORS, INC.

Independent Mercedes Benz Dept.

Since 1979

1295 Rollins Road
BURLINGAME, CA 94010-2416
(650) 343-8858 Fax (650) 343-9261

Written By
Cust. Order No.

Phone when ready
Yes ☐ No ☐

EPA #CAL 000088609

BAR # ARD275257

Name

MR. BOB DEWITT

Address

Apt. No.

City

Year-Make-Model

License No.

Odometer

Estimate Amount \$

Engine Size

VIN Number

Revised Estimate \$

Date

Description

Revised Estimate \$

Date

Description

TEAR DOWN ESTIMATE: I understand that my vehicle will be reassembled in _____ days shown here if I choose not to authorize the service recommended.

OPER. NO.

REPAIR ORDER — LABOR INSTRUCTION

LABOR CHG.

WARRANTY ON PARTS & LABOR

- ☐ 3 MONTHS OR 4,000 MILES WHICHEVER COMES FIRST.
- ☐ 6 MONTHS OR 6,000 MILES WHICHEVER COMES FIRST.
- ☐ 9 MONTHS OR 9,000 MILES WHICHEVER COMES FIRST.
- ☐ 12 MONTHS OR 12,000 MILES WHICHEVER COMES FIRST.
- ☐ NOT GUARANTEED - NEED ADDITIONAL SERVICE(S). WARRANTY WORK MUST BE DONE AT THIS FACILITY AND DOES NOT INCLUDE TOW CHARGES OR CUSTOMER SUPPLIED PARTS OR USED PARTS. WARRANTY VOID IF DEFECT CAUSED BY MISUSE, ABUSE OR PERSONAL DAMAGE. A \$25 PER DAY STORAGE FEE WILL BE CHARGED IF VEHICLE IS NOT PICKED UP AFTER 48 HRS OF COMPLETION OF REPAIRS.

QTY.

QTS. OIL

QTS. OIL

LBS. GREASE

SALE

TOTAL SUBLET REPAIRS

TOTAL OIL, GREASE

RECOMMENDED SERVICE:

1.

2.

3.

4.

5.

I hereby authorize the repair work above to be done along with the necessary material, and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By

TOTAL LABOR

PARTS

SUBLET REPAIRS

OIL & GREASE

GAS

SALES TAX

HAZARDOUS WASTE DISPOSAL FEE

TOTAL AMOUNT

TOTAL PARTS

TIRE PRESSURE CHECK SERVICE COMPLETED ☐

TIRE PRESSURE: LF _____ RF _____ LR _____ RR _____ (psi)

DECLINED ☐ Initial _____ REASON:

SUBLET REPAIRS

TOTAL SUBLET REPAIRS

TOTAL OIL, GREASE

ROBERT POTTS RESTORATIONS

1327 N. Carolan Avenue
Unit D
Burlingame
California 94010
(650) 343-2465

To: Bob Devlin
For: Porsche 356

June 4, 2019

Labor:

Replace old battery with Optima 6 volt, install on-board
battery charger, straighten and fit Porsche script on front
nose.

2.5 hrs ~~2~~ ^{@ \$} 105.00 per hour.\$262.50

Expenses:

Optima 6 volt battery	\$176.83
On-board battery charger	\$ 63.33

Total	\$502.66
-------	----------

Thank-you