

PATRICK OTTIS

1220 TENTH STREET


BERKELEY, CALIFORNIA 94710

ARB NO 120777

INVOICE NO.

353673

10/24/18

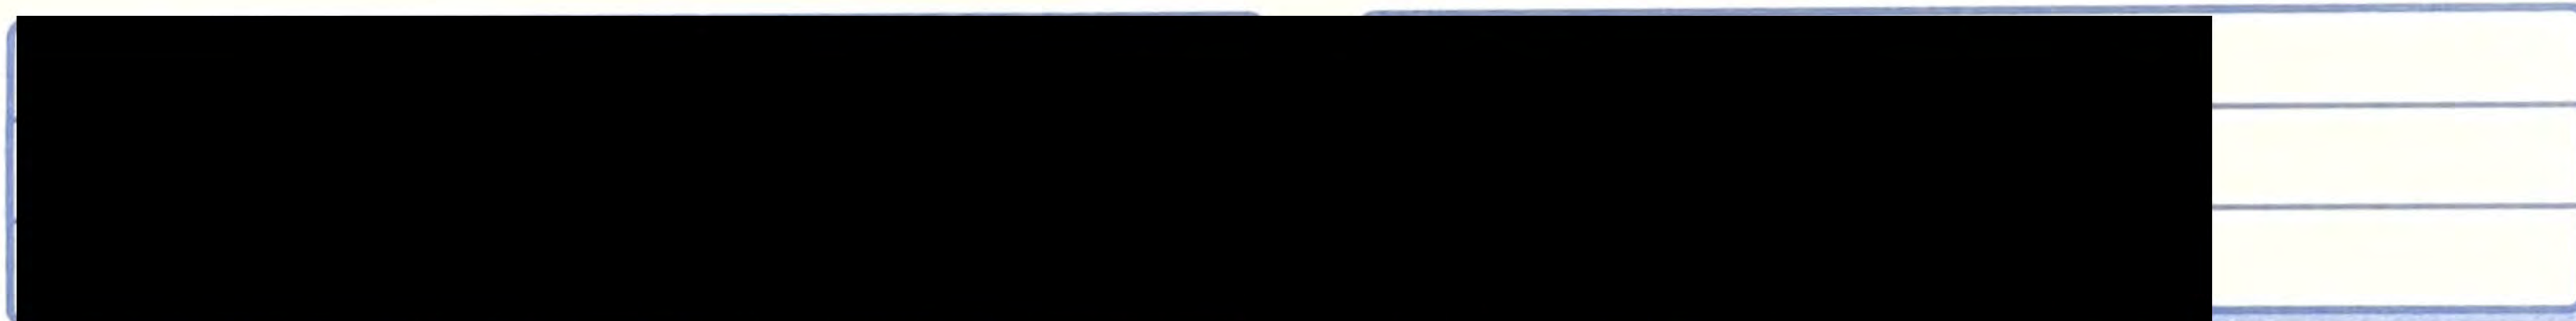

CUSTOMER'S ORDER: 250 GTR / CALIF.	SOLD BY: 4487	TERMS: THANK YOU	FOR: 39353 KMS	DATE: 17 OCTOBER 18
---------------------------------------	------------------	---------------------	-------------------	------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
27 SEPT	BEGIN INVESTIGATION OF 'NOISE FROM RIGHT SIDE BANK OF		
	CYLINDERS.' START RUN MOTOR & VERIFY SIGHT 'TICKING'		
	NOISE FROM WHAT SOUNDS LIKE VALVE TRAIN. ROAD TEST CAR.		
	SEVERAL MILES. WITH MOTOR AT TEMP, CHECK COMPRESSION		
	#12 240 PSI	240 PSI	#1
	#11 235 PSI	235 PSI	#2
	#10 240 PSI	240 PSI	#3
	#9 240 PSI	240 PSI	#4
	#8 240 PSI	240 PSI	#5
	#7 235 PSI	240 PSI	#6

INVOICE
71721 ©2004 REDIFORM®

PATRICK OTTIS

INVOICE NO.

353674

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

2506TR/CAUF

SOLD BY:

4487

TERMS:

F.O.B.

39353 KMS

DATE:

17 OCTOBER, 18

QUANTITY

DESCRIPTION

PRICE

AMOUNT

	1	GAP, INSTALL NEW SET OF SPARK PLUGS, TORQUE & CONNECT.		
	2	BEGIN DISASSEMBLY FOR VALVE TRAIN INSPECTION / VALVE		
	3	ADJUSTMENT, REMOVE HOOD, REMOVE RIGHT SIDE CAM		
	4	COVER.		5.5
28 SEPT	5	CONTINUE WITH DISASSEMBLY FOR VALVE ADJUST & CHECK.		
	6	REMOVE LEFT CAM COVER, BOTH CHAIN COVERS. REMOVE		
	7	IGNITION SWITCH, CONNECT HAND REMOTE STARTER BUTTON.		
	8	REMOVE EACH ROCKER BOX ASSEMBLY ONE AT A TIME, WASH,		
	9	DRY. INSPECT EACH CAM FOLLOWING AND ROCKER ARM FOR		
	10	PLAY. NONE WITHNOTED. NOTE VALVES WERE PREVIOUSLY		

INVOICE

7L721 ©2004 REDIFORM®

PATRICK OTTIS

INVOICE NO.

353675

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 CAUF

SOLD BY:

4487

TERMS:

E.O.B.

39353 KMS

DATE:

17 OCTOBER 18

QUANTITY	DESCRIPTION	PRICE	AMOUNT
	1 ADJUSTED TO .008 INT & 010 RYCH. SPEC. IS .006 AND .008.		
	2 SEVERAL RPH VALVES WERE @ 012 TO .014. ALSO THERE IS		
	3 MORE THAN NORMAL SIDE CLEARANCE ON ROCKER ARMS.		
	4 TORQUE ALL ROCKER BOX HARDWARE.		8.0
01 OUT	5 BEGIN CLEANING - SCRAPING CAM COVER MATING SURFACES ON		
	6 CYLINDER HEADS, CAM AND CHAIN COVERS. UNSH ALL REMNED		
	7 HARDWARE.		3.0
15 OUT	8 FINISH CLEANING GASKET MATING SURFACES & ALL REMNED PARTS.		
	9 CUT & PUT NEW CAM COVER GASKETS BOTH BANKS		2.5
16 OUT	10 SEAL AND INSTALL CHAIN & CAM COVERS. CONNECT TIMOTHIE.		

INVOICE

7L721 ©2004 REDIFORM®

PATRICK OTTIS

INVOICE NO.

353676

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 CAMF

SOLD BY:

4487

TERMS:

F.O.B.

39353 KMS

DATE:

17 OCTOBER 18

QUANTITY

DESCRIPTION

PRICE

AMOUNT

1 LINKAGE, AND IGNITION WIRES. INSTALL BREATHER TUBE.

2 CLEAN CAPTIVE THREADS ON HOOD. INSTALL HOOD. START

3 RUN MOTOR. NO ABNORMAL VALVE TRAIN NOISE HEARD.

4 ROAD TEST CAR - STILL NO NOISE HEARD. TRICKLE CHARGE

5 BATTERY OVERNIGHT 6.0

6

7 SHOP LABOR 25.0 HRS @ 140 3500

8

9

10

INVOICE

7L721 ©2004 REDIFORM®

PATRICK OTTIS

INVOICE NO.

353677

PR
10/24/08
J

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 ENR

SOLD BY:

4487

TERMS:

F.O.B.

39353 kms

DATE:

17 OCTOBER 18

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1			
2	12 NGK B6ES SPARK PLUGS e 7 50		90 -
3	LEFT CAM COVER GASKET 160477		67 50
4	RIGHT CAM COVER GASKET 160478		67 50
5	CHAIN COVER END GASKET 22609		10 -
6	PARTS TOTAL		235 -
7	TAX ON PARTS		22 32
8	WASH DETAIL CAR		NO CHARGE
9			
10	JOB TOTAL		375 32

INVOICE

71721 ©2004 REDIFORM®

PATRICK OTTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA 94710
ARD NO 120777

INVOICE NO.

541412

INVOICE
71721 ©2004 REDIFORM®

CUSTOMER'S ORDER: 250 GTE/CALIF SOLD BY: 4487 TERMS: THANK YOU F.O.B. DATE: 18 MARCH 2019

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1			
2	NEW ORIGINAL CAM IGNITION SWITCH (PADONA)		950 -
3			
4			
5			
6			
7	TAP ON SWITCH		90 25
8	FED. EXP SHIP WITH INSURANCE		20 -
9			
10	TOTAL		1060 25

PATRICK OTTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA 94710
ARD NO 120777

INVOICE NO.

541415



CUSTOMER'S ORDER: 250 GTR / CALIF SOLD BY: 4487 TERMS: THANK YOU FOR 39925 KMS DATE: 28 MARCH 2019

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1			
2	REMOVE, REPLACE CEMM IGNITION SWITCH. TEST OPERATION		
3	Geord.		1.0 hr.
4			
5			
6			
7			
8	WASH/DETAIL CAR.	NO CHARGE.	
9			
10	SHOP LABOR.		140 -

Paid 280
4/11/19

PATRICK OTTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA 94710
ARD NO 120777

INVOICE NO.

369235



CUSTOMER'S ORDER: 250 GTR / CAUF	SOLD BY: 4487	TERMS: THANK YOU	F.O.B. 41480 KMS	DATE: 04 DECEMBER 20
-------------------------------------	------------------	---------------------	---------------------	-------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
20 OCT.	1 GO OVER CUSTOMER SUPPLIED 'TO DO' LIST. RUN MOTOR ON		
	2 SEVERAL OCCASIONS FROM COLD IN ATTEMPT TO IDENTIFY 'VALVE		
	3 NOISE'. TRACE SOURCE OF NOISE TO EXHAUST LEAK FROM RIGHT		
	4 REAR EXHAUST HEADER AGAINST CYLINDER HEAD. ROAD TEST,		
	5 DRIVE CAR TO ASSESS/REVALUATE OPERATION & TO BRING MOTOR		
	6 OIL TO TEMPERATURE. LEFT CAR, INSPECT SUSPENSION/BRAKES.		
	7 SAFETY CHECK. DRAIN MOTOR OIL, CLEAN INTERNAL DRAIN PLUG		
	8 WITH NEW SEAL RING / SAFETY WIRE. REPLACE OIL TEMPERATURE		
	9 SENDING UNIT. FILL MOTOR SUMP WITH OIL. REPLACE BOTH OIL		
	10 FILTERS. INVESTIGATE NON OP. FUEL GAUGE. REMOVE FUEL		

PATRICK OTTIS

INVOICE NO.

369236

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 GTR / CAUF

SOLD BY:

4487

TERMS:

F.O.B.

41480KMS

DATE:

04 DECEMBER 20

QUANTITY	DESCRIPTION	PRICE	AMOUNT
	1 GAUGE SENDING UNIT. TEST RESISTANCE ON BENCH. SENDING		
	2 UNIT NON OP.		4.0
28 OUT	3 CONTINUE WITH NON-OP FUEL GAUGE INVESTIGATION. MOCK UP		
	4 CONNECT NEW FUEL GAUGE SENDING UNIT FROM OUR STOCK. +		
	5 TEST WITH INSTRUMENT IN DASH. STILL GAUGE NON-OP. UNBOLT		
	6 REMNR, RIGHT (1-6) REAR EXHAUST WRAPPER. CLEAN GASKET		
	7 MATING SURFACES. REINSTALL EXHAUST HEADER WITH NEW GASKETS.		
	8 START & RUN MOTOR. OFFENDING NOISE APPEARS TO BE GONE	5.0	
29 OUT	9 RETORQUE EXHAUST HEADER HARDWARE AFTER HEAT CYCLE.		
	10 FROM YESTERDAY - NOISE GONE		.5

INVOICE

71721 ©2004 REDIFORM®

PATRICK OTTIS

INVOICE NO.

369237

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 CALIFORNIA

SOLD BY:

4407

TERMS:

F.O.B.

41480 KMS

DATE:

04 December 20

QUANTITY		DESCRIPTION	PRICE	AMOUNT
02 UN.	1	DISASSEMBLE FUEL GAUGE SENDING UNIT. CLEAN RESISTOR, CONTACTS		
	2	AND COIL. SODA BLAST SENDING BODY. FABRICATE NEW RESISTOR		
	3	HOUSING GASKET. REASSEMBLE COMPLETE. TEST OPERATION,		
	4	SENDING OPERATES FROM 10 OHM LOW TO 95 OHM FULL.		3.0
04 UN.	5	REMOVE FUEL GAUGE FROM DASH, PACK & RE-EXP SHIP FNR		
	6	REPAIR.		1.0
27 UN.	7	MAKE PIGTAILS, BENCH TEST FUEL GAUGE WITH NEWLY SERVICED		
	8	SENDING UNIT - GOOD		.5
01 DDC.	9	INSTALL FUEL GAUGE. WELD EXTEND GAUGE BRACKET TO ACCOMMODATE		
	10	NEW GAUGE HOUSING. INSTALL SENDING UNIT - TEST GOOD		1.5

PATRICK OTTIS

INVOICE NO.

369238

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 CALIFORNIA

SOLD BY:

4487

TERMS:

F.O.B.

41480 KMS

DATE:

04 DECEMBER 20

QUANTITY	DESCRIPTION	PRICE	AMOUNT
03 DEC	1 DELIVERY, RETRIEVE CAR. TO/FROM DETAIL SHOP.		1.0
	2 SHOP LABOR, 16.5 HRS @ 150		2475
	3		
	4		
	5 OIL TEMPERATURE SENDING UNIT 100453		29 50
	6 8 QTS PTH 20.50 RACING OIL @ 18 95		151 60
	7 FRAM PH 2BIS OIL FILTER		34 50
	8 FRAM PB. 50 OIL BYPASS FILTER		19 95
	9 3 EXHAUST WRAPPR TO CYL. HEAD GASKETS 17454 @ 28 50		85 50
	10 2 EXHAUST WRAPPR FLANGE GASKETS 20768 @ 24 50		49

INVOICE

71721 ©2004 REDIFORM®

PATRICK OTTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA 94710
ARD NO 120777

INVOICE NO.
767250

INVOICE
7L721 ©2004 REDIFORM®

CUSTOMER'S ORDER: 250 GTE / CAUF SOLD BY: 4487 TERMS: THANK YOU F.O.B. 45246 KMS DATE: 19 July 2022

QUANTITY	DESCRIPTION	PRICE	AMOUNT
17 July	1 GO OVER CUSTOMER SUPPLIED 'TO DO' LIST. TIGHTEN		
	2 PASSENGER SIDE INNER DOOR HANDLE. ATTEMPT CHECKING		
	3 SPARE TIRE PRESSURE. AND NOTE SPARE TIRE CAN'T BE		
	4 REMOVED BECAUSE OF FUEL FILL TUBE CLAMPS. RELOCATE CLAMPS,		
	5 REMOVE SPARE. (NO PRESSURE) ADJUST TO 32 PSI, REINSTALL.		
	6 BEGIN CLEANING RIGHT SIDE OF ENGINE BAY		2.0
18 July.	7 MAKE SHORT TEST DRIVE TO GET MOTOR OIL TO TEMPERATURE.		
	8 LEFT CAR. DRAIN MOTOR OIL. CLEAN, REMOVE OIL AND		
	9 DUST FROM BOTTOM OF CAR - MOTOR, BELLY PAN, DIFFERENTIAL		
	10 AND FUEL TANK. CLEAN OIL DRAIN AUG, REPLACE COPPER.		

PATRICK OTTIS

INVOICE NO.

767251

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

ZSO CAUF

SOLD BY:

4487

TERMS:

F.O.B.

45246 KMS

DATE:

19 July 2022

QUANTITY

DESCRIPTION

PRICE

AMOUNT

1	SEAL RING, INSTALL AND SAFETY WIRE. REPLACE BOTH OIL		
2	FILTERS. RUN MOTOR SUMP WITH OIL.		
3	REMOVE ROAD WHEELS, WASH-DEGREASE INSIDE AND OUT OF		
4	FOUR WHEELS WITH SIMPLE GREEN 9-SOAP/WATER. REMOVE		
5	STICK-ON WHEEL WRIGITS FROM INSIDES OF FOUR WHEELS.		
6	REMOVE WHEELS WITH NEW AERIAL TIRES TO TIRE SHOP FOR		
7	MOUNT BALANCE.		
8	CONTINUE, FINISH CLEANING RIGHT SIDE OF MOTOR COMPARTMENT.		
9	FINISH, BLEED BRAKE HYDRAULIC SYSTEM. CLEAN ALL BLEED		
10	PORTS, CHECK ALL FTR LEAKS - GOOD		

INVOICE

7L721 ©2004 REDIFORM®

PATRICK OTTIS

INVOICE NO.

767252

SOLD

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 CALIFORNIA

SOLD BY:

4487

TERMS:

F.O.B.

45246 KMS

DATE:

19 JUN 2022

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	RETRIEVE NEWLY MOUNTED AND BALANCED WHEEL/TIRES. INSTALL		
2	DUCT TAPE OVER WHEEL WEIGHTS, ADJUST ALL TIRE PRESSURES TO		
3	34 PSI. INSTALL ROAD WHEELS. HAND POLISH RIGHT SIDE.		
4	WHEELS WITH SEMI CHROME POLISH		10.0
19 JUN	5 HAND POLISH LEFT SIDE ROAD WHEELS WITH SEMI CHROME POLISH.		
6	TORQUE ALL WHEEL NUTS TO 220 FT LB. REMNIE INSPECT SPARK		
7	PLUGS. SODA BEAST CLEAN PLUGS, GAP, REINSTALL & TORQUE		
8	SPARK PLUGS. CONNECT IGNITION WIRES. CLEAN DETAIL LEFT SIDE		
9	OF ENGINE BAY, MOTOR COMPARTMENT. REPAIR BROKEN WIRE		
10	AT COOLING FAN SWITCH. REMNIE CAR FROM UPT. ROAD		

INVOICE

7L721 ©2004 REDIFORM®

PATRICK OTTIS

INVOICE NO.

767253

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

280 CALIFORNIA

SOLD BY:

4487

TERMS:

F.O.B.

45246 KMS

DATE:

19 JUN 2022

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	TEST TO SAN RAFAEL BRIDGE TO ASSESS RUNNING AND TIRE.		
2	BRUNNER - GOOD. GIVE CAR FUEL FULL LOAD. RE EXAMINE ALL		
3	FUEL LEAKS - GOOD.		6.0
4			
5	SHOP LABOR 18.0 HRS @ 170		3060
6			
7	4 PIRELLI CINTURATO 185 VR 15 @ 395		1580
8	4 MICHELIN 185/195. 15 TUBES @ 49.50		198
9	FRAM PH 2804. 1 OIL FILTER		49.50
10	FRAM PS. 50 OIL FILTER		39.95

INVOICE
71721 ©2004 REDIFORM®

PATRICK OTTIS

INVOICE NO.

767255

SOLD TO:

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 CALIFORNIA

SOLD BY:

4487

TERMS:

F.O.B.

45246 KMS

DATE:

19 JUN 2022

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	8 QTS ELORSA 20.50 RACING OIL = 18 ⁹⁵		151 ⁶⁰
2	2 LITERS CASTROL LMA DOT 4 BRAKE FLUID = 15 ⁻		30 ⁻
3	PARTS TOTAL		2049 ⁰⁵
4	TAX ON PARTS		210 ⁰²
SUBTOTAL	WONT BALANCE 4 WHEELS - TIRES = 25 ⁻ PER, DON'S TIRE		100 ⁻
6	TIRE DISPOSAL FEE 4 AT 8 ⁻		32 ⁻
7	FREIGHT IN ON TIRES FROM LONG BEACH		98 ⁻
8	91 OUTLINE FUEL		50 ⁻
9			
10	JOB TOTAL		\$599 ⁰⁷

INVOICE
71721 ©2004 REDIFORM®

PATRICK OTTIS

1220 TENTH STREET

BERKELEY, CALIFORNIA 94710


ARD NO 120777

INVOICE NO.

paid

317648

10/9/23

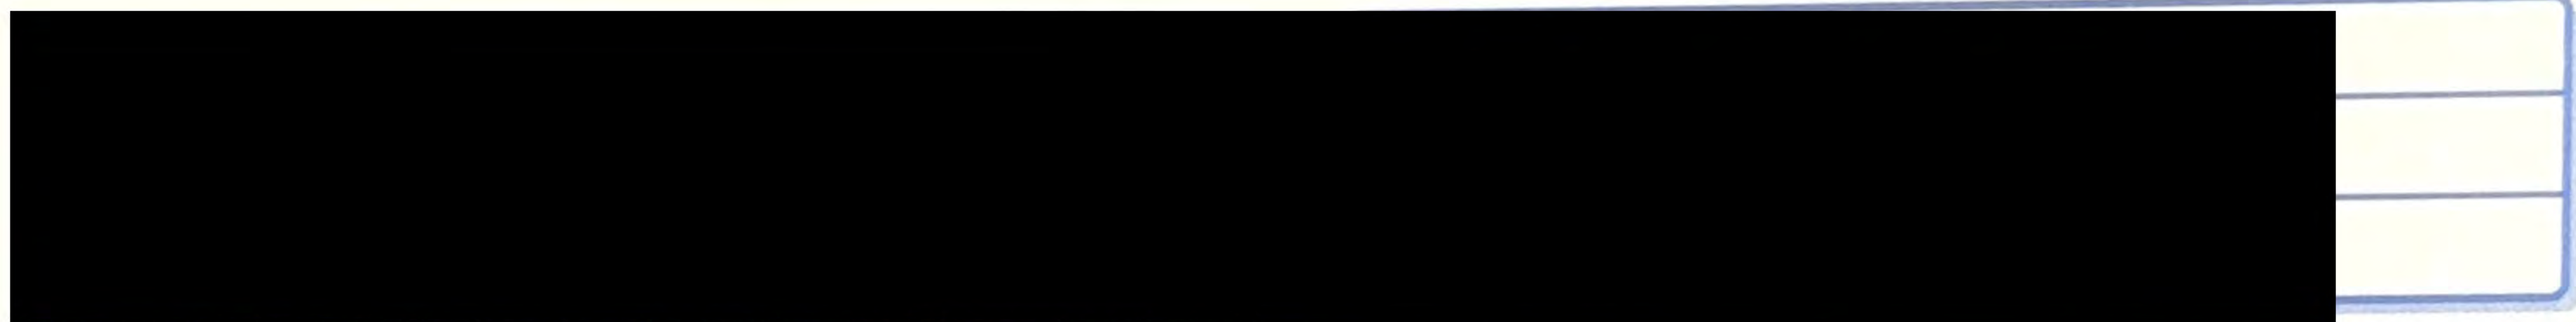

CUSTOMER'S ORDER:

250 GTE/CAUF

SOLD BY:

4487

TERMS:

THANK YOU

F.O.B.

46116 KM

DATE:

29 AUGUST 2023

QUANTITY	DESCRIPTION	PRICE	AMOUNT
26 AUG	1 INVESTIGATE NO MOTOR START SITUATION. CHECK FOR		
	2 GOOD BATTERY CRANK, GOOD MOTOR GROUNDS, CHECK FOR		
	3 B+ TO IGNITION COILS - OK. REMOVE CARB AIR BOX TOP & CHECK		
	4 FOR FUEL FROM CARB DISCHARGE NOZZLES - GOOD.		
	5 TRACK ISSUE TO FAULTY B+ SIGNAL FROM IGNITION SWITCH TO		
	6 IGNITION COILS DURING CRANK. REMOVE IGNITION SWITCHES,		
	7 DISASSEMBLE, CLEAN ADJUST CONTACTS, BENCH TEST GOOD.		
	8 INSTALL SWITCH, CRANK START & RUN MOTOR.		
	9 REMOVE, INSPECT SPARK PLUGS. ALL WERE WITH FUEL. GAP		
	10 INSTALL NEW CUSTOMER SUPPLIED SPARK PLUGS - TORQUE		

INVOICE

© REDIFORM®

71721

PATRICK OTTIS

INVOICE NO.

INVOICE NO.

317649

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 GTC / CAUF

SOLD BY:

4487

TERMS:

F.O.B.

46116 KMS

DATE:

29 AUG 17 2023

QUANTITY

DESCRIPTION

PRICE

AMOUNT

	1	AND CONTINUT. TRUCKLE CHARGE BATTERY OVERNIGHT		6.0
27 AUG	2	START, WARM UP & ROAD TEST CAR. LEFT CAR & INSPECT.		
	3	WITH MOTOR AT TEMPERATURE, DRAIN MOTOR OIL, REPLACE		
	4	OIL FILTERS. CLEAN DRAIN PUG. REPLACE SEAL RING & TORQUE		
	5	PUG & SAFETY WIRE. INSPECT DRIVELINE FOR OIL LEAKAGE.		
	6	SOME GEAR OIL LEAKING FROM REAR AXLE PINION SEAL & SOME		
	7	OIL SEEPAGE FROM BOTTOM OF TIMING CASE. CHECK TIGHTNESS OF		
	8	MOTOR FASTENERS. FILL MOTOR SUMP WITH OIL. CLEAN ALL		
	9	OIL RESIDUE FROM REAR AXLE, FUEL TANK, UNDER TRAM/BEAM		
	10	PAN & BOTTOM OF MOTOR.		

INVOICE

7L721 © REDIFORM®

PATRICK OTTI

INVOICE NO.

INVOICE NO.

317650

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

200 GTR / CAUR

SOLD BY:

4487

TERMS:

F.O.B.

46 116 KMS

DATE:

29 AUGUST 2021

QUANTITY

DESCRIPTION

PRICE

AMOUNT

1	REMOVE ROAD WHEELS - INSPECT BRAKES, SUSPENSION FOR ANY		
2	SAFETY CONCERNS. FLUSH, BLEED BRAKE HYDRAULIC SYSTEM.		
3	CLEAN ALL BRAKE BLEED PORTS, FILL FLUID RESERVOIR.		
4	CHECK & ADJUST ALL TIRE PRESSURES INCLUDING SPARE. LOWER		
5	ROAD WHEELS, TORQUE WHEEL NUTS TO 220 FT-LBS. REMOVE		
6	CAR FROM LIFT.		4.0
28 AUG	ASSURE GOOD MORNING COLD START, ROAD TEST AGAIN TO SAN		
8	RAFAEL BRIDGE, ADD FUEL & DETAIL CAR.		1.0
9			
10	SHOP LABOR 11.0 HRS @ 180		1980

INVOICE
7L721 © REDIFORM®

PATRICK OTTIS

INVOICE NO.

317651

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 GTE/CAUF

SOLD BY:

4487

TERMS:

F.O.B.

46116 KMS

DATE

29 AUG 05 23

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1			
2	BALDWIN OIL FILTER B 253		49 ⁵⁰
3	BALDWIN BYPASS FILTER B 50		39 ⁹⁵
4	8 QTS ELORSA 20-50 RACING OIL - 18 ⁹⁵		151 ⁶⁰
5	2 LITRES MOTUL DOT 4 RACING BRAKE FLUID - 20		40 ⁻
6	PARTS TOTAL		281 ⁰⁵
7	TAX ON PARTS		28 ⁸⁰
8	91 OCTANE FUEL		62 ⁻
9	WASH, DETAIL CAR	NO CHARGE	
10	JOB TOTAL		2351 ⁸⁵

INVOICE

7L721 © REDIFORM®

PATRICK OTT'S
1220 TENTH STREET
BERKELEY, CALIFORNIA 94710
ARD NO 120777

Paid in full INVOICE NO.
4/4/2024 959857

SHIP TO:

CUSTOMER'S ORDER:

250 GREY CALIF.

SOLD BY:

4487

TERMS:

THANK YOU

F.O.B.

46874 KMS

DATE:

29 MARCH 2024

QUANTITY	DESCRIPTION	PRICE	AMOUNT
19 MARCH	REINVESTIGATE INABILITY OF MOTOR TO START AND RUN.		
2	REPAIR CARBURATOR AIR BOX (DIRTY - WASH - FILTER ELEMENTS		
3	SHOULD BE REPLACED) CHECK AUTOFLUX ELECTRIC FUEL PUMP		
4	FUNCTION AND FUEL DELIVERY FROM DISCHARGE NOZZLES IN		
5	CARBURATORS - GOOD.		
6	CHECK B ⁺ SIGNAL AT IGNITION COILS - GOOD AT 12 VOLTS AND		
7	7 VOLTS FROM BALLAST RESISTORS TO IGNITION DISTRIBUTORS. -		
8	NORMAL. REPAIR DISTRIBUTOR CAPS AND VISUALLY INSPECT		
9	CONTACT SPES, CORRODED AND POINT CONTACTS FITTED AND POOR.		
10	REPAIR BOTH IGNITION DISTRIBUTORS AND RUN / CHECK CALIBRATION		

PATRICK JTT S

INVOICE NO.

959858

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 GTE / CAUF

SOLD BY:

4487

TERMS:

F.O.B.

46874 KMS

DATE:

29 MAR 24

INVOICE

71721 © REDIFORM.

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	ON DISTRIBUTOR MACHINE. NOTE ONE CONTACT SET IN 1-6		
2	DISTRIBUTOR BASICALLY DOES NOT FUNCTION. LOAD TEST BOTH		
3	CAPACITORS AND TEST FOR SERIES RESISTANCE AND		
4	LEAKAGE - GOOD		4.0
21 MAR 24	DISASSEMBLE BOTH IGNITION DISTRIBUTORS, REPLACE FOUR CONTACT		
6	SETS AND UPPER SHAFT BEARINGS. RUN, CALIBRATE AND		
7	ASSURE PROPER MECHANICAL ADVANCE FUNCTION. REINSTALL		
8	BOTH IGNITION DISTRIBUTORS AND SET TIME. INSTALL DIST		
9	CAPS & CONNECT ALL. MOTOR STARTS & RUNS CORRECTLY		4.0
10	CHECK START FUNCTION EVERY OTHER DAY - OK!		

PATRICK OTTIS

INVOICE NO.

959859

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 GTE/CAMF

SOLD BY:

4487

TERMS:

F.O.B.

46874 KMS

DATE:

29 MARCH 24

INVOICE
71721 © REDIFORM

QUANTITY	DESCRIPTION	PRICE	AMOUNT
28 MARCH	INSTALL CARBURATOR AIR BOX, ROAD TEST CAR, SIX MILES, FILL		
2	WITH FUEL, TRUCKLE CHARGE BATTERY OVERNIGHT		1.0
3	SHOP LABOR. 9.0 HRS @ 200		1800 -
4	2 MARRELLI SHORT LEAD CONTACT SETS 953000B3 @ 105		210 -
5	2 MARRELLI LONG LEAD CONTACT SETS 953000B4 @ 105		210 -
6	2 UPPER DISTRIBUTOR SHIPT BEARINGS B 2272RS @ 19 ⁹⁵		39 90
7	PARTS TOTAL		459 90
8	TAX ON PARTS		47 13
9	91 OCTANE FUEL		43 -
10	JOB TOTAL		2350 03

PATRICK OTTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA 94710
ARD NO 120777

INVOICE NO.

960277

CUSTOMER'S ORDER: 250 GTR / CALIF	SOLD BY: 4487	TERMS: THANK YOU	F.O.B. 47264 KMS	DATE: 10 OCTOBER 24
--------------------------------------	------------------	---------------------	---------------------	------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
12 SEPTEMBER	INVESTIGATE INABILITY OF ENGINE TO START. CHECK ELECTRIC		
2	FUEL PUMP FUNCTION - GOOD. REMOVE CARB AIR BOX TOP, INSURE FUEL		
3	COMING FROM ALL DISCHARGE NOZZLES - GOOD. CHECK FOR FLOW AT		
4	IGNITION COILS - GOOD. START & RUN MOTOR. REINSURE CARB		
5	AIR BOX TOP		.5
13 SEPTEMBER	GO OVER CUSTOMER SUPPLIED 'TO DO' LIST.		
7	CHECK OIL LEVEL, JUST BELOW MAXIMUM MARK. LIFT CAR WITH		
8	MOTOR AT TEMPERATURE. DRAIN MOTOR OIL, INSPECT ENGINE FOR		
9	OIL LEAKS, INSPECT STEERING, BRAKES AND SUSPENSION. NOTE		
10	PINION SEAL LEAKS BADLY. MAJORITY OF OIL LEAKAGE APPEARS		

INVOICE

71721 © REDIFORM

PATRICK OTTIS

INVOICE NO.

960278

SOLD TO:

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 CAMP

SOLD BY:

4487

TERMS:

F.O.B.

47264 KMS

DATE:

10 OCTOBER 24

INVOICE
71721 © REDIFORM

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	TO BE FROM OIL SEAL LEFT CYLINDER HEAD TO TIMING CASE.		
2	REMOVE SPARK PLUGS, CHECK MOTORS COMPRESSION		
3	# 12 195 PSI	210 PSI # 1	
4	# 11 210 PSI	200 PSI # 2	
5	# 10 210 PSI	200 PSI # 3	
6	# 9 210 PSI	200 PSI # 4	
7	# 8 200 PSI	200 PSI # 5	
8	# 7 200 PSI	210 PSI # 6	
9	CHECK RESISTANCE OF ALL SPARK PLUG WIRDS - GOOD. SODA BLAST		
10	SPARK PLUGS, WASH, GAP, INSTALL TORQUE. FILL MOTOR		

PATRICK OTTIS

INVOICE NO.

960279

SOLD TO	
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER: 250 CRUF	SOLD BY: 4487	TERMS:	F.O.B. 47264 KMS	DATE: 10 OCTOBER 24
-------------------------------	------------------	--------	---------------------	------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	WITH OIL, REMOVE REAR OIL FILTERS		
2	BEGIN DISASSEMBLY FOR REPLACEMENT OF PINION SEAL. REMOVE		
3	DRIVESHAFT. DRAIN DIFFERENTIAL OF OIL. UNSCUT REMOVE		
4	PINION YOK. WITH WRENCH, REMOVE PINION SEAL HOUSING. PRESS		
5	REMOVE SEAL. WASH ALL REMOVED HARDWARE. SOAP BLAST HOUSING		
6	WASHER & RING NUT. CLEAN REMOVE LOCTITE RESIDUE FROM THREADS.		
7	PRESS INSTALL NEW PINION SEAL INTO HOUSING, THIS ASSEMBLY		
8	BACK ONTO NOSE OF DIFFERENTIAL HOUSING		8.0
9	16 SEPTEMBER. CONTINUE WITH, FINISH PINION SEAL INSTALLATION. TORQUE		
10	PINION NUT & COTTER PIN. REINSTALL FLY JOINT / U-JOINT WITH		

INVOICE
7L721 © REDIFORM

PATRICK OTTIS

INVOICE NO.

960280

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

280 CAMP

SOLD BY:

4487

TERMS:

F.O.B.

47264 KMS

DATE:

10 OCTOBER 24

INVOICE
71721 © REDIFORM

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	DRIVE SHAFT - COUPLER PIN AND SAFETY WIRE. LUBRICATE		
2	U-JOINT. REMARK 1 CLEAN BELLY PAN OF OIL. CLEAN BOTTOM		
3	OF CAR AS WELL OF OIL FROM MOTOR AND DIFFERENTIAL.		
4	BEGIN DISASSEMBLY FOR REPLACEMENT OF OIL SEAL RING AT LEFT		
5	TIMING CHAIN END TO TIMING CASE. REMARK THROTTLE LINKAGE		
6	AND LEFT BANK IGNITION WIRES. CLEAN ALL CAM END GASKET		
7	MATING SURFACES - REMARK LEFT CAM AND CHAIN ENDS. MANAGE		
8	TO INSTALL NEW OIL SEAL RING IN REGISTERS BETWEEN TIMING CASE AND		
9	LEFT CYLINDER HEAD.		7.0
10	17 SEPTEMBER. INSURE ADEQUATE SEALANT AT O-RING SEAL. CUT FIT NEW		

PATRICK OTTIS

INVOICE NO.

960281

SOLD	
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER: 250 CAMF	SOLD BY: 4487	TERMS:	F.O.B. 47264 KMS	DATE: 10 OCTOBER 24
-------------------------------	------------------	--------	---------------------	------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	CAM CNTR GASKET. NOTE ONE CAM CNTR STUD STRIPPED. TIME		
2	SEPT REPAIR. INSTALL CHAIN & CAM CNTR. - TORQUE HARDWARE		
3	REINSTALL IGNITION WIRES, CONNECT THROTTLE LINKAGE & RETURN		
4	SPRING. CLEAN CARB AIR BOX, CAM-CNTR & ENGINE BAY		
5	FILL DIFFERENTIAL WITH NEW GEAR OIL, NEW CRUSH WASHER		5.0
6	18 SEPTEMBER. RUN MOTOR ON LEFT, IN GEAR FOR SEVERAL MINUTES.		
7	RECHECK ALL FIVE LEAKS - GOOD. REINSTALL BRKY PIN		1.0
8	26 SEPTEMBER. CONTINUE LOCAL INVESTIGATION INTO POOR MOTOR RUN SITUATION.		
9	DRIVE CAR TO SAN RAFAEL BRIDGE. NO ISSUE SEEN		NO CHARGE
10	27 SEPTEMBER. DRIVE TOWARDS BRIDGE AGAIN. OPENING ABOUT THREE MILES,		

INVOICE

7L721 © REDIFORM.

PATRICK OTTIS

INVOICE NO.

960282

SOLD TO:

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER:

250 CAMF

SOLD BY:

4487

TERMS:

F.O.B.

47264 KMS

DATE:

10 00630 24

INVOICE

7L721 © REDIFORM

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	MOTOR APPEARED TO IMMEDIATELY RUN ON 9 CYLINDERS. RETURN		
2	TO SHOP, MOTOR NOW STARTS & RUNS ON ALL TWELVE. ?? NO CHARGE		
01 - 04	OCTOBER. REPLACE IGNITION COILS WITH BOSCH COILS - DRIVE		
4	AGAIN MULTIPLE TIMES - NO ISSUE SEEN		NO CHARGE
07	OCTOBER. REMOVE EACH IGNITION DISTRIBUTOR, ONE AT A TIME, RUN AND		
6	CHECK CALIBRATION ON DISTRIBUTOR MACHINE. MAKE MINUTE		
7	ADJUSTMENTS, REINITIAL & ADJUST IGNITION TIMING - MINUTE ADJUSTMENT		
8	MADE. AGAIN - NO REAL ISSUE SEEN. SYNCHRONIZE AND ADJUST		
9	CALIBRATION REC. ROAD TEST. 6.0 HRS SPENT		3.0
08	OCTOBER. REMOVE RIGHT SIDE WINDSHIELD WIPER ARM/BLADE - ASSEMBLY		

PATRICK OTTIS

INVOICE NO.

960283

SOLD	[REDACTED]
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER: 250 CAMR	SOLD BY: 4407	TERMS:	F.O.B. 47264 VMS	DATE: 10 OCTOBER 24
-------------------------------	------------------	--------	---------------------	------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	COMING APART. STRAIGHT, REPAIR & REINSTALL		1.0
2	09 OCTOBER. CUSTOMER ASKS TO HAVE IGNITION COILS REPLACED. REMAIN		
3	MARVELL IGNITION COILS WITH EXTERNAL BALLAST RESISTORS AND REPLACE		
4	WITH MODERN INTERMEDIATE RESISTED COILS.		
5	DISCONNECT TACHOMETER & SPEEDOMETER CABLES, REMAIN, CLEAN		
6	REWIRE CABLES - REASSEMBLE.		3.0
7			
8	SHOP LABOR. 28.5 HRS @ 200		57.00 -
9			
10			

INVOICE
71721 © REDIFORM.

PATRICK OTTIS

INVOICE NO.

960284

SOLD TO: [REDACTED]
ADDRESS:
CITY, STATE, ZIP

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER: 250 CAUF	SOLD BY: 4487	TERMS:	F.O.B. 47264 KMS	DATE: 10 OCTOBER 24
-------------------------------	------------------	--------	---------------------	------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	FRAM PR-50 OIL BYPASS FILTER		50 -
2	FRAM PH 2804-1 OIL FILTER		50 -
3	8 QTS EVOLVE 20.50 RACING OIL @ 19 ⁹⁵		159 ⁶⁰
4	HEPTANE/ALCOHOL SOLVENT (DE OIL AGENT FOR UNDERSIDE OF CAR)		70 -
5	PINION SEAL 426010 9585030B		40
6	2 LITERS SHEL SPIRAX 75W 90 GEAR OIL @ 37 ⁻		74 -
7	CAM COVER GASKET LEFT SIDE 9160477		68 ⁵⁰
8	SQUARE CUT OIL SEAL RING, TUNING CASE TO CYL HEAD 2210B		16 ⁵⁰
9	2 BOSCH IGNITION COILS 00012 @ 150 ⁻		300 -
10	2 GENERAL COIL BRACKETS @ 10 ⁻		20 -

INVOICE
7L721 © REDIFORM

PATRICK OTTIS

INVOICE NO.

960285

SOLD TO	
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:	
ADDRESS:	
CITY, STATE, ZIP	

CUSTOMER'S ORDER: 250 CALIF.	SOLD BY: 4487	TERMS:	F.O.B. 47264 KMS	DATE: 10 OCTOBER 24
---------------------------------	------------------	--------	---------------------	------------------------

QUANTITY		DESCRIPTION	PRICE	AMOUNT
	1			
	2	PARTS TOTAL		848 60
	3	TAX ON PARTS		86 98
	4			
	5			
	6	91 OCTANE FUEL		60
	7	WASH DETAIL CAR	NO CHARGE	
	8			
	9			
	10	JOB TOTAL		669 58

INVOICE
71721 © REDIFORM