

CUSTOMER #: 564270

347415



Price-Simms PA LLC.

4190 EL CAMINO REAL · PALO ALTO, CA 94306
(650) 815-4477

www.volvopaloalto.com
www.fiskersiliconvalley.com
www.mclarensanfrancisco.com
Service Center Hours:
Monday-Friday 7:30am - 5:30pm

FANTASY JUNCTION
1145 PARK AVE
EMERYVILLE, CA 94608
HOME: CONT: [REDACTED]
BUS: 510-653-7555 CELL: [REDACTED]

INVOICE

PAGE 1

SERVICE ADVISOR: 578 BILLY EDMONDS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
ORANGE	12	MCLAREN MP4-12C	SBM11AAA7CW000813		6776/6776	T6181	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31MAY12 DD		30MAY2015	17:00 24SEP21		250.00	CASH	04OCT21

R.O. OPENED	READY	OPTIONS:
12:31 23SEP21	13:20 04OCT21	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A PERFORM ENGINE OIL AND FILTER SERVICE & RESET MAINTENANCE REMINDER
 CAUSE: PERFORM ENGINE OIL AND FILTER SERVICE WITH FULL SYNTHETIC OIL
 AND FILTER. REST SERVICE LIGHT AS REQUESTED WITH VIDA.
 01 ENGINE OIL & FILTER SERVICE
 594 CM 2.50 625.00 625.00
 8 0W40 MOBIL1 15.24 15.24 121.92
 1 1211F0107CP OIL-FILTER 48.73 48.73 48.73
 1 1200RC042 WASHER 7.50 7.50 7.50
 1 11998 2 GASKET 2.92 2.92 2.92

6776
 PERFORMED ENGINE OIL & FILTER CHANGE AS REQUESTED. RESET
 MAINTENANCE REMINDER. DURING OIL CHANGE, NOTED OIL LEAK FOUND AT FRONT
 COVER AND POSSIBLE REAR MAIN SEAL
 FOUND RADIATOR HOSES TO BE LEAKING. HVAC CONTROL PANEL DISPLAYS
 INOPERATIVE. SUPPLIED ESTIMATE FOR REPAIRS, DECLINED. NOTE: COMPLETE
 VEHICLE INSPECTION NOT PERFORMED. ENGINE OIL & FILTER SERVICE ONLY.

 C CONTACT: BRUCE AT FANTASY JUNCTION - 510-653-7555. VEHICLE OWNER:
 [REDACTED]
 00 SERVICE/MAINTENCE
 594 IM 0.00 (N/C)

EST: 800.00 24SEP21 11:18 SA: 578

CONTACT: [REDACTED]



THANK YOU FOR CHOOSING PRICE-SIMMS PA. YOU
 MAY BE SENT AN EMAIL FROM THE MANUFACTURER
 TO GRADE TODAY'S OVERALL SERVICE. IF FOR ANY
 REASON YOUR OVERALL OPINION OF THIS DEALER-
 SHIP WAS NOT TRULY EXCEPTIONAL, PLEASE CALL
 BRANDON MADEIROS @ 650-815-4486 CUSTOMER
 SATISFACTION IS OUR #1 GOAL

Volvo Palo Alto BAR # ARD273268 EPA # CAL000385871	ORIGINAL ESTIMATE: \$		FINAL REVISED ESTIMATE: \$			DESCRIPTION	TOTALS
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	
Fisker Silicon Valley McLaren San Francisco BAR # ARD00266636 EPA # CAL000366986	I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.		I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.			LABOR AMOUNT	625.00
						PARTS AMOUNT	181.07
					GAS, OIL, LUBE	0.00	
					SUBLET AMOUNT	0.00	
					MISC. CHARGES	0.00	
					TOTAL CHARGES	806.07	
					LESS ADJUSTMENTS	0.00	
					SALES TAX	16.52	
					PLEASE PAY THIS AMOUNT	822.59	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

CUSTOMER #: 564270

324554

INVOICE

PAGE 1

SERVICE ADVISOR: 475 CARLOS CONTRERAS



McLaren
SAN FRANCISCO

Price-Simms PA LLC.

4190 EL CAMINO REAL - PALO ALTO, CA 94306
(650) 815-4477

www.volvopaloalto.com
www.fiskersiliconvalley.com
www.mclarensanfrancisco.com
Service Center Hours:
Monday-Friday 7:30am - 5:30pm

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
ORANGE	12	MCLAREN MP4-12C	SBM11AAA7CW000813		6533/6535	T6274	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31MAY12 DD		30MAY2015	17:00 21DEC17		210.00	CASH	21DEC17

R.O. OPENED	READY	OPTIONS:
10:05 21DEC17	15:57 21DEC17	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A 11 N 015 PASSENGER FRONT AIRBAG MODULE REPLACEMENT NA RECALL
REFERENCE 011
CAUSE: PASSENGER FRONT AIRBAG MODULE REPLACEMENT CPCPC101A11A9901
AIR-BAG PASS-SIDE-LHD
11N015 11 N 015 PASSENGER FRONT AIRBAG MODULE
REPLACEMENT NA RECALL REFERENCE 011
2048 WM 5.00 (N/C)
1 1211NA010CP AIRBAG-PASS-LHD-NON-AN CAMPAIGN (N/C)
6533 CARRIED OUT PASSENGER FRONT AIRBAG REPLACEMENT CAMP. INSTALLED
NEW PASSENGER FRONT AIRBAG. WP#204896

B** SERVICE CAMPAIGN- 02C-Fuel Rail Procedure MP4-12C
CAUSE: NO
5000 NO WORK PERFORMED AT THIS TIME
2048 WM 0.00 (N/C)
6533 PARTS ON ORDER

THANK YOU FOR CHOOSING PRICE-SIMMS PA. YOU MAY BE SENT AN EMAIL FROM THE MANUFACTURER TO GRADE TODAY'S OVERALL SERVICE. IF FOR ANY REASON YOUR OVERALL OPINION OF THIS DEALERSHIP WAS NOT TRULY EXCEPTIONAL, PLEASE CALL DAN POKARNEY AT 650-815-4472. CUSTOMER SATISFACTION IS OUR #1 GOAL

Volvo Palo Alto BAR # ARD273268 EPA # CAL000385871	ORIGINAL ESTIMATE: \$			FINAL REVISED ESTIMATE: \$			DESCRIPTION	TOTALS
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	0.00
Fisker Silicon Valley McLaren San Francisco							PARTS AMOUNT	0.00
							GAS, OIL, LUBE	0.00
BAR # ARD00266636 EPA # CAL000366986	I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.			I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.			SUBLET AMOUNT	0.00
							MISC. CHARGES	0.00
							TOTAL CHARGES	0.00
							LESS ADJUSTMENTS	0.00
							SALES TAX	0.00
							PLEASE PAY THIS AMOUNT	0.00

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

CUSTOMER #: 564270

321146



Price-Simms PA LLC.

4190 EL CAMINO REAL - PALO ALTO, CA 94306 (650) 815-4477

www.volvopaloalto.com
www.fiskersiliconvalley.com
www.mclarensanfrancisco.com
Service Center Hours:
Monday-Friday 7:30am - 5:30pm

INVOICE

PAGE 1

SERVICE ADVISOR: 475 CARLOS CONTRERAS

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG. Row 1: ORANGE, 12, MCLAREN MP4-12C, SBM11AAA7CW000813, 6300/6300, T2086. Row 2: DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Row 3: 31MAY12 DD, 30MAY2015, 17:00, 16MAY17, 195.00, CASH, 18MAY17.

Table with columns: R.O. OPENED, READY, OPTIONS. Row 1: 15:08 11MAY17, 11:34 18MAY17.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL.

A PICK UP/ DELIVER VEHICLE
5003 NO FAULT FOUND AT THIS TIME
488 CM 0.00 125.00 125.00

B 5 YEAR/50,000 MILE SERVICE 12C COUPE
SYM 5 YEAR/50,000 MILE SERVICE 12C COUPE
2048 CM 7.50 1462.50 1462.50
8 0W40 MOBIL1 15.24 15.24 121.92
1 1211A3694CP WIPER BLADE - LHD - FED 50.48 50.48 50.48
1 1211F0107CP OIL-FILTER 25.82 25.82 25.82
2 1211M1213CP CR2032 9.95 9.95 19.90
1 1200RC042 WASHER-ALUMINIUM CRUSH-14X18X1.35 1.24 1.24 1.24
1 11998 2 GASKET 1.35 1.35 1.35

6300 CARRIED OUT 5 YEAR SERVICE INCLUDING INSPECTIONS OF POWER TRAIN CHASSIS AND ELECTRICAL SYSTEMS. CARRIED OUT OIL AND FILTER CHANGE. R AND R HEY BATTERIES, WIPER BLADE, AND COOLANT. FRONT TIRES AT 10/32 AND SET TO 29PSI. REAR TIRES AT 7/32 AND SET TO 32PSI. TIRES ARE THE ORIGINAL ON THE VEHICLE. RECOMMEND R AND R TIRES DUE TO AGE. BRAKES AT 10MM ALL AROUND. WP#190140

C C/S MOISTURE IN HEADLIGHTS
5003 NO FAULT FOUND AT THIS TIME
2048 CM 0.00 0.00 0.00
6300 RECOMMEND R AND R HEAD LAMPS

D FLAT BATTERY
5003 REPLACED FLAT BATTERY WITH NEW BATTERY
2048 CM 2.00 390.00 390.00
1 1213MA037CP LI-ION BATTERY 2469.58 2469.58 2469.58
1 1211M3340CP GEN2 BATTERY UPGRADE KIT 728.80 728.80 728.80
6300 R AND R BATTERY AND INSTALLED UPDATED BATTERY HOLD DOWN KIT

E LEFT SIDE HEADLIGHT COVER FOGS UP
5003 NO FAULT FOUND AT THIS TIME

Table with columns: ORIGINAL ESTIMATE, FINAL REVISED ESTIMATE, DESCRIPTION, TOTALS. Includes sub-tables for LABOR AMOUNT, PARTS AMOUNT, GAS, OIL, LUBE, SUBLET AMOUNT, MISC. CHARGES, TOTAL CHARGES, LESS ADJUSTMENTS, SALES TAX, PLEASE PAY THIS AMOUNT.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

CUSTOMER #: 564270

321146



Price-Simms PA LLC.

4190 EL CAMINO REAL · PALO ALTO, CA 94306
(650) 815-4477

www.volvopaloalto.com
www.fiskersiliconvalley.com
www.mclarensanfrancisco.com
Service Center Hours:
Monday-Friday 7:30am - 5:30pm

INVOICE

PAGE 2

SERVICE ADVISOR: 475 CARLOS CONTRERAS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
ORANGE	12	MCLAREN MP4-12C	SBM11AAA7CW000813		6300/6300	T2086	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31MAY12 DD		30MAY2015	17:00 16MAY17		195.00	CASH	18MAY17

R.O. OPENED	READY	OPTIONS:
15:08 11MAY17	11:34 18MAY17	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
		2048	CM	0.00		0.00	0.00

6300 RECOMMEND R AND R HEADLAMPS

F C/S PASSENGER DOOR DOES NOT ALWAYS OPEN, IT CLICKS BUT DOES NOT FULLY UNLATCH

5003 ADJUSTED DOOR TO MID POINT

2048 CM 0.00 0.00 0.00

6300 CARRIED OUT DOOR ADJUSTMENT ON THE PASSENGER SIDE DOOR. NOTE: THERE IS A MID POINT OF ADJUSTMENT WHERE THE DOOR WILL STILL BE EASY TO OPEN AND CLOSE. DOOR SET TO THE OPTIMUM ADJUSTMENT AT THIS POINT

G C/S QUOTE TO REMOVE RADAR DETECTOR

5003 REMOVED RADAR DETECTOR WIRES

2048 CM 0.00 0.00 0.00

6300 REMOVED RADAR DETECTOR WIRES

H C/S BATTERY MAINTAINER NEEDS TO BE CHECKED

5003 NO FAULT FOUND AT THIS TIME

2048 CM 0.00 0.00 0.00

6300 BATTERY MAINTAINER CHECKS OUT OK AT THIS TIME

I** 03H 11 C 008 - Electronic Parking Brake (EPB) Caliper Bolt Check - US-McLaren 12C Coupe and Spider

CAUSE: 03H 11 C 008 - Electronic Parking Brake (EPB) Caliper Bolt Check - US-McLaren 12C Coupe and Spider

11C008 03H 11 C 008 - Electronic Parking Brake (EPB) Caliper Bolt Check - US-McLaren 12C Coupe and Spider

2048 WM 0.70 (N/C)

6300 CARRIED OUT EPB BOLT CHECK FOUND ALL OK AT THIS TIME WP#125151

J** SERVICE CAMPAIGN-03B-11 G 013-Clutch Oil Cooler and Coolant Return Hose Replacement: McLaren 12C, 650S and 625C Coupe and Spider

CAUSE: SERVICE CAMPAIGN-03B-11 G 013-Clutch Oil Cooler and Coolant

Volvo Palo Alto BAR # ARD273268 EPA # CAL000385871	ORIGINAL ESTIMATE: \$			FINAL REVISED ESTIMATE: \$			DESCRIPTION	TOTALS
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	
Fisker Silicon Valley McLaren San Francisco BAR # ARD00266636 EPA # CAL000366986							PARTS AMOUNT	
							GAS, OIL, LUBE	
							SUBLET AMOUNT	
							MISC. CHARGES	
							TOTAL CHARGES	
							LESS ADJUSTMENTS	
							SALES TAX	
							PLEASE PAY THIS AMOUNT	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

CUSTOMER #: 564270

321146



Price-Simms PA LLC.

4190 EL CAMINO REAL · PALO ALTO, CA 94306
(650) 815-4477

www.volvopaloalto.com
www.fiskersiliconvalley.com
www.mclarensanfrancisco.com

Service Center Hours:
Monday-Friday 7:30am - 5:30pm

INVOICE

PAGE 3

SERVICE ADVISOR: 475 CARLOS CONTRERAS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
ORANGE	12	MCLAREN MP4-12C	SBM11AAA7CW000813		6300/6300	T2086	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31MAY12 DD		30MAY2015	17:00 16MAY17		195.00	CASH	18MAY17

R.O. OPENED	READY	OPTIONS:
15:08 11MAY17	11:34 18MAY17	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

Return Hose Replacement: McLaren 12C, 650S and 625C Coupe and Spider

03C SERVICE CAMPAIGN-03C-11 G 012-Clutch Oil Cooler and Coolant Hoses Replacement-11 G 012:McLaren 12C, 650S and 625C Coupe and Spider

2048 WM 2.40

1 1211G0288CP OIL CLUTCH COOLER SERVICE KIT

1 31439821 5 ANTI-FREEZE

(N/C)

(N/C)

(N/C)

6300 CARRIED OUT CLUTCH OIL COOLER CAMP. WP#107696

K** SERVICE CAMPAIGN McLAREN MODULE SOFTWARE PLATFORM UPDATE TO 13.0
CAUSE: Module Software Platform Update to 13 -Quality Engineering at McLaren Automotive have released a new software platform for the McLaren 12C

02M SERVICE CAMPAIGN McLAREN MODULE SOFTWARE PLATFORM UPDATE TO 13.0

2048 WM 1.50

(N/C)

6300 CARRIED OUT 13.0 UPDATE WP#75176

EST: 2,400.00 11MAY17 15:08 SA: 475

THANK YOU FOR CHOOSING PRICE-SIMMS PA. YOU MAY BE SENT AN EMAIL FROM THE MANUFACTURER TO GRADE TODAY'S OVERALL SERVICE. IF FOR ANY REASON YOUR OVERALL OPINION OF THIS DEALERSHIP WAS NOT TRULY EXCEPTIONAL, PLEASE CALL DAN POKARNEY AT 650-815-4472. CUSTOMER SATISFACTION IS OUR #1 GOAL

Volvo Palo Alto BAR # ARD273268 EPA # CAL000385871	ORIGINAL ESTIMATE: \$			FINAL REVISED ESTIMATE: \$			DESCRIPTION	TOTALS
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL		
Fisker Silicon Valley McLaren San Francisco BAR # ARD00266636 EPA # CAL000366986							LABOR AMOUNT	1977.50
							PARTS AMOUNT	3419.09
							GAS, OIL, LUBE	0.00
							SUBLET AMOUNT	0.00
							MISC. CHARGES	0.00
							TOTAL CHARGES	5396.59
						LESS ADJUSTMENTS	0.00	
						SALES TAX	307.72	
						PLEASE PAY THIS AMOUNT	5704.31	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

McLAREN 12C




5th Service (5 years or 75,000 km (50,000 miles))

and date of registration against Mileage and Periodic Dependant Operations prior to carrying out service		Coupe service time: 6.05 units Spider service time: 6.15 units
VIN: CW1000813 km/miles: 6300	Date: 5-18-17 Invoice/job number: 321146	
Address:	Customer contact details: (Telephone number) (Email address)	

VEHICLE ACCEPTANCE (CUSTOMER PRESENT FROM 1.1 TO 1.4)

1.0 Vehicle pre-checks	Completed	Not Completed	Comments
1.1 Check for wheel locking key (if supplied) and towing eye	✓		
1.2 Check tyres for damage, crack formations and correct orientation	✓		
1.3 Check condition of wheel rims and wheel bolts (mark graphic below where applicable)	✓		
1.4 Check condition of paint and bodywork (mark graphic below where applicable)	✓		

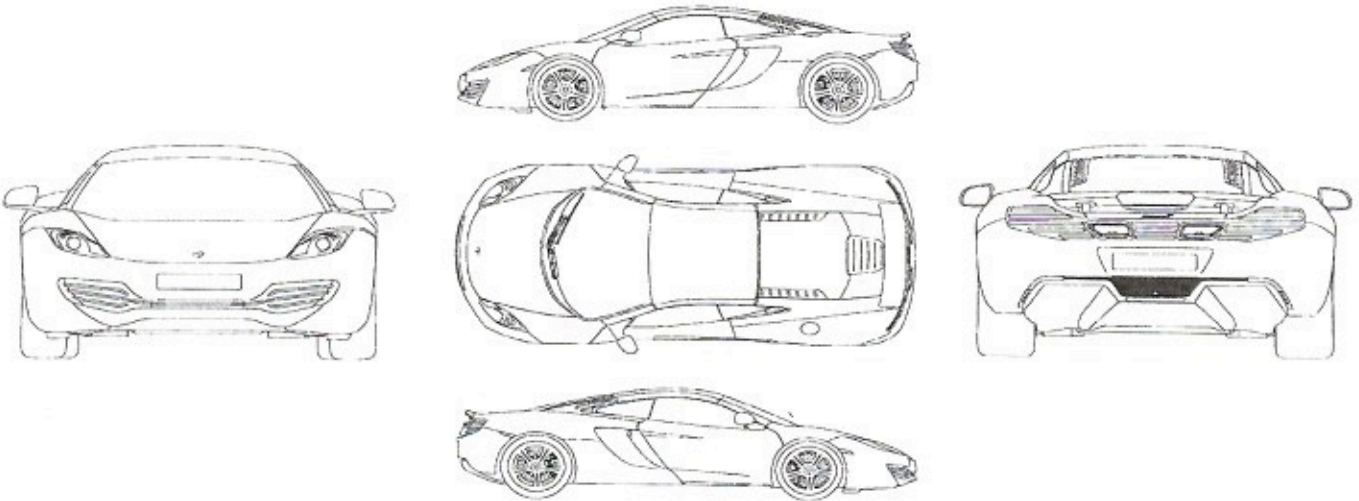

(D = dent, S = scratch, X = damage, C = chip)

Comments:

1.5 Check McLaren Retailer Portal for any outstanding campaigns applicable to the vehicle	✓		
---	---	--	--



MECHANICAL CHECKS - SPIDER ONLY

13.0 Retractable hard top	Completed	Not Completed	Comments
13.1 Set Retractable Hard Top (RHT) to maintenance position, clean and grease rollers between shell panels with Kluber Polyub GLY 801			
13.2 Apply Carbalfo XTRS-50F lubricant on Retractable Hard Top (RHT) seals - Refer to Service Information Bulletin 11 A 041			

DYNAMIC TEST

14.0 Road test	Completed	Not Completed	Comments
14.1 Carry out road test - maximum 15 minutes/10 km (6 miles)	✓		
14.2 Check operation of navigation system (if fitted)	✓		

FINAL OPERATIONS

15.0 Carry out final vehicle diagnostic check using McLaren Diagnostic System (MDS)	Completed	Not Completed	Comments
15.1 Check vehicle software level (update if required)	✓		
15.2 Read out fault memory and clear errors	✓		
15.3 Carry out service indicator reset	✓		
16.0 Carry out final vehicle check and documentation sign off	Completed	Not Completed	Comments
16.1 Clean key fob battery contacts with Electrolube CCS and replace key fob batteries	✓		
16.2 Check operation of all keys, locks and key fobs	✓		
16.3 Check expiry dates of fire extinguisher/tyre inflation kit (if fitted)			
16.4 Report and rectify all recorded defects	✓		
16.5 Complete, sign and stamp Service and Warranty Guide	✓		

Comments:

Technician Name:

Michael Riser

Technician Signature:

[Signature]

Dealer Stamp:

**MCLAREN SAN FRANCISCO
4192 EL CAMINO REAL
PALO ALTO, CA 94306**

ASSOCIATED PROCEDURES

Step Reference	Document Number	Document Title
2.4	AA-RM-02A02-04-003	Adjust headlamp
2.9, 2.10	AA-RM-02A02-03-004	Remove/Install luggage bin - Rear
3.3	AA-RM-04F02-01-007	Check oil level
5.0	AA-RM-02AD4-04-007	Lift vehicle on lifting platform
6.0, 12.1	AA-RM-03B03-01-001	Remove/Install wheel
6.2	AA-RM-03C01-01-006	Cleaning/Checking carbon ceramic brake disc (CCM) / Iron brake disc (Fe)
7.0, 12.0	AA-RM-02A02-03-001	Remove/Install wheel arch liner - Rear
8.0, 11.0	AA-RM-02A02-03-002	Remove/Install wheel arch liner - Front
9.0, 10.0	AA-RM-02AD4-04-001	Remove/Install floor panel - Engine / fuel tank
9.0, 10.0	AA-RM-02AD4-04-002	Remove/Install floor panel - Front - Up to MY14
9.0, 10.0	AA-RM-02AD4-04-003	Remove/Install floor panel - Tunnel
9.0, 10.0	AA-RM-02AD4-04-004	Remove/Install floor panel - rear diffuser
9.0, 10.0	AA-RM-02AD4-04-005	Remove/Install floor panel - Rear lower extension
9.0, 10.0	AA-RM-02AD4-04-008	Remove/Install floor panel - Transmission
9.0, 10.0	AA-RM-02A04-04-006	Remove/Install tyre spoilers / front guide vanes / rear guide vanes
9.5	AA-RM-03L01-01-005	Drain/Fill fluid - Coolant
9.8	AA-RM-04F01-02-002	Remove/Install air filter
9.12	AA-RM-04F02-01-011	Drain/Fill fluid - Engine oil
9.15	AA-RM-02A02-04-004	Remove/Install Xenon bulb / Silicone bags
13.2	11 A 041	Retractable Hard Top seal lubricant application procedure

McLAREN 650S/625C

Post Service, Maintenance & Repair Quality Control Checklist

--


VIN: CW000813	Date: 05/18/2017
km/miles: 6300	Invoice/job number: 321146

Address:	Customer contact details: (Telephone number) (Email address)
----------	--

Customer Requests/Complaints:	Work Package Number:
1 - SEE RO	
2 -	
3 -	
4 -	
5 -	
6 -	
7 -	
8 -	

ADMINISTRATION CHECKS

1.0 Administration	OK	Not OK	Comments
1.1 Customer contact details completed, mileage recorded and Repair Order signed	✓		
1.2 Work package description accurate and detailed	✓		
1.3 Technician's description of completed work signed and dated	✓		
1.4 Technician's clockings/description of completed work detailed, itemised and accurate	✓		
1.5 Check McLaren Retailer Portal for any outstanding campaigns applicable to the vehicle	✓		
1.6 Post repair bodywork inspection	✓		

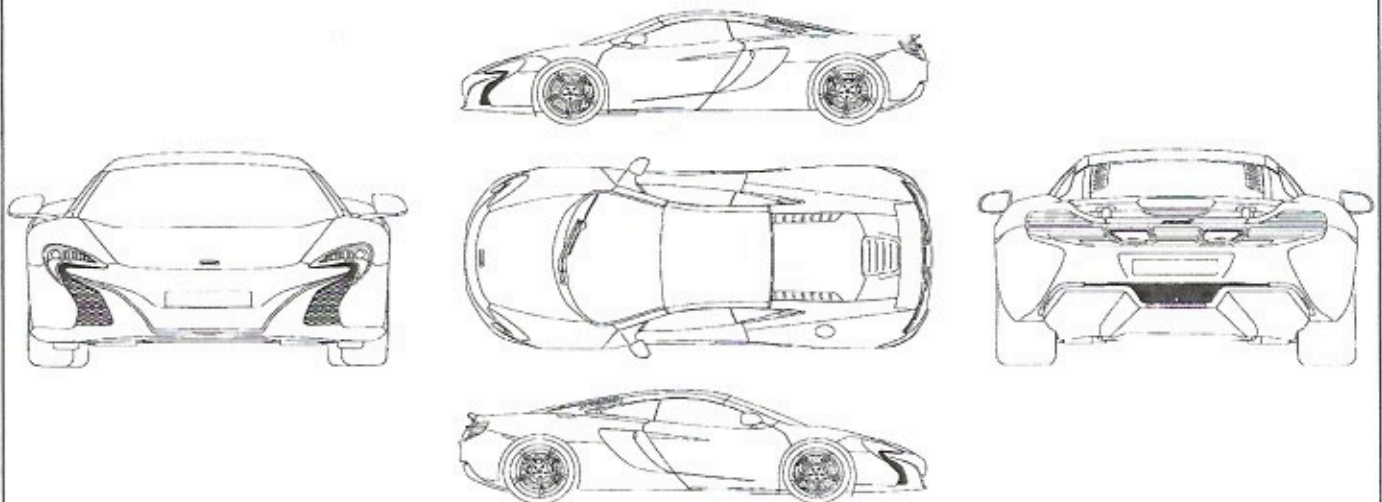

(D = dent, S = scratch, X = damage, C = chip)

CUSTOMER #: 564270

305347



Price-Simms PA LLC.

4190 EL CAMINO REAL · PALO ALTO, CA 94306
(650) 815-4477

www.volvopaloalto.com
www.fiskersiliconvalley.com
www.mclarensanfrancisco.com

Service Center Hours:
Monday - Saturday 8:00 am - 6:00 pm

INVOICE

PAGE 1

SERVICE ADVISOR: 466 DANIEL POKARNEY

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
ORANGE	12	MCLAREN MP4-12C	SBM11AAA7CW000813		5970/5975	T7899	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31MAY12 DD		30MAY2015	17:00 13MAY14		170.00	CASH	16MAY14

R.O. OPENED	READY	OPTIONS:
12:35 13MAY14	18:21 16MAY14	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A	MP4-12C	Coupe:	2nd year or 30,000 km (20,000 miles) Service				
	2YM	MP4-12C	Coupe: 2nd year or 30,000 km (20,000 miles) Service				
		2048	CM	8.00		1512.00	1512.00
	9	0W40	MOBIL1		15.24	15.24	137.16
	1	1211A3694CP	WIPER BLADE - LHD - FED		59.02	59.02	59.02
	1	1211F0107CP	OIL-FILTER		27.39	27.39	27.39
	1	1211M1213CP	CR2032		9.95	9.95	9.95
	1	1200RC042	WASHER-ALUMINIUM CRUSH-14X18X1.35		0.83	0.83	0.83
	1	853619459	BRAKE FLUID		29.50	29.50	29.50

Claimed 5/20

5975 CARRIED OUT 2 YEAR MCLAREN MP4-12C SERVICE. WP#72707

B	SERVICE CAMPAIGN-	02C-Fuel Rail Procedure MP4-12C					
	5001	PARTS HAVE BEEN PLACED ON ORDER FOR THIS VEHICLE					
		2048	CM	0.00		0.00	0.00

5975 NOT DONE AT THIS TIME

C	PICK UP/ DELIVER VEHICLE						
	5005	PICK UP/ DELIVER VEHICLE					
		2048	CM	0.00		75.00	75.00

D	COMPLIMENTARY CAR WASH						
	WASH COMPLIMENTARY CAR WASH						
		2048	CM	0.00		0.00	0.00

EST: 75.00 13MAY14 12:35 SA: 466

Volvo Palo Alto BAR # ARD273268 EPA # CAL000385871	ORIGINAL ESTIMATE: \$			FINAL REVISED ESTIMATE: \$			DESCRIPTION	TOTALS
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	
Fisker Silicon Valley McLaren San Francisco							PARTS AMOUNT	
							GAS, OIL, LUBE	
BAR # ARD00266636 EPA # CAL000366986							SUBLET AMOUNT	
							MISC. CHARGES	
							TOTAL CHARGES	
							LESS ADJUSTMENTS	
							SALES TAX	
							PLEASE PAY THIS AMOUNT	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

CUSTOMER #: 564270

305347



McLaren
SAN FRANCISCO

Price-Simms PA LLC.

4190 EL CAMINO REAL - PALO ALTO, CA 94306
(650) 815-4477

www.volvopaloalto.com
www.fiskersiliconvalley.com
www.mclarensanfrancisco.com

Service Center Hours:
Monday - Saturday 8:00 am - 6:00 pm

INVOICE

PAGE 2

SERVICE ADVISOR: 466 DANIEL POKARNEY

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
ORANGE	12	MCLAREN MP4-12C	SBM11AAA7CW000813		5970/5975	T7899	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
31MAY12 DD		30MAY2015	17:00 13MAY14		170.00	CASH	16MAY14

R.O. OPENED	READY	OPTIONS:
12:35 13MAY14	18:21 16MAY14	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

THANK YOU FOR CHOOSING VOLVO PALO ALTO. YOU MAY BE SENT AN EMAIL FROM VOLVO TO GRADE TODAY'S OVERALL SERVICE. IF FOR ANY REASON YOUR OVERALL OPINION OF THIS DEALERSHIP WAS NOT OUTSTANDING PLEASE CALL DAN POKARNEY AT 650-815-4472 PRIOR TO FILLING OUT YOUR SURVEY CUSTOMER SATISFACTION IS OUR #1 GOAL

Volvo Palo Alto BAR # ARD273268 EPA # CAL000385871 Fisker Silicon Valley McLaren San Francisco BAR # ARD00266636 EPA # CAL000366986	ORIGINAL ESTIMATE: \$			FINAL REVISED ESTIMATE: \$			DESCRIPTION	TOTALS
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	1587.00
						PARTS AMOUNT	263.85	
						GAS, OIL, LUBE	0.00	
						SUBLET AMOUNT	0.00	
						MISC. CHARGES	0.00	
						TOTAL CHARGES	1850.85	
						LESS ADJUSTMENTS	0.00	
						SALES TAX	23.09	
						PLEASE PAY THIS AMOUNT	1873.94	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

Service sheet : 2nd year or 30,000 km (20,000 miles)


Please check vehicle odometer reading against mileage dependant task service sheet before carrying out service

Customer:	km / miles: 5970
Vehicle registration :	Date: 5-15-14
Colour:	Service Time: 6.8 units
Address :	Invoice / Job no: 305347

Vehicle acceptance (customer present from 1.1 to 1.4)

1.0 - Vehicle pre-checks	Completed	Not Completed	Comments
1.1 Check for wheel locking key (if supplied)	<input type="radio"/>	<input type="radio"/>	
1.2 Check tyre orientation, damage, and crack formations	<input checked="" type="checkbox"/>	<input type="radio"/>	
1.3 Inspect wheel rim condition	<input checked="" type="checkbox"/>	<input type="radio"/>	
1.4 Check bodywork	<input checked="" type="checkbox"/>	<input type="radio"/>	
1.5 Check McLaren Retailer Portal for any outstanding campaigns on vehicle	<input checked="" type="checkbox"/>	<input type="radio"/>	

Check paint and panels for defects - please mark the picture as following: (D dent - S scratch - X damage)

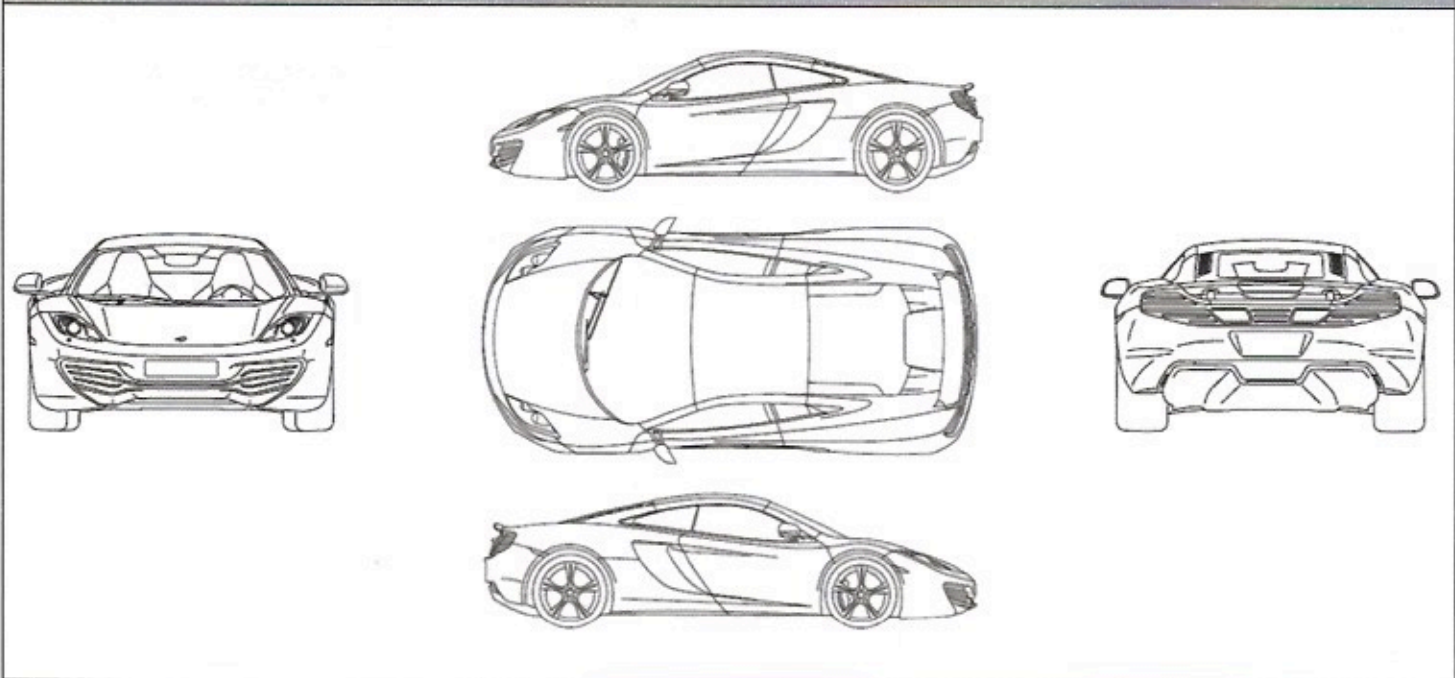
Vehicle exterior/fluid and battery checks - (ensure battery charger and body protection are fitted)

2.0 - Two technicians will be required for steps 2.1 and 2.2	Completed	Not Completed	Comments
2.1 Check exterior lighting function	<input checked="" type="checkbox"/>	<input type="radio"/>	
2.2 Check headlamp/windscreen washer system	<input checked="" type="checkbox"/>	<input type="radio"/>	
2.3 Check headlamp adjustment - Ref. AA-RM-02A02-04-003	<input checked="" type="checkbox"/>	<input type="radio"/>	
2.4 Replace wiper blade	<input checked="" type="checkbox"/>	<input type="radio"/>	
2.5 Check window glazing	<input checked="" type="checkbox"/>	<input type="radio"/>	
2.6 Check exterior light glazing	<input checked="" type="checkbox"/>	<input type="radio"/>	
2.7 Check gaps and seals of doors, engine cover, and luggage compartment lid	<input checked="" type="checkbox"/>	<input type="radio"/>	
2.8 Check fuel filler flap manual opening	<input checked="" type="checkbox"/>	<input type="radio"/>	

	Completed	Not Completed	Comments
2.9 Check controls and adjusters in general (hinges, doors, luggage lid and engine cover)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.10 Check battery connections and charge (physical check) - Ref. AA-RM-02A02-03-004	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.11 Replace cabin filter - Ref. AA-RM-02A02-03-004	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
2.12 Bleed brake fluid system as required (while servicing) - Ref. AA-RM-03C01-01-005	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.13 Check/adjust fluid level of power steering - Ref. AA-RM-03D01-01-008	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.14 Check/adjust fluid level of windshield washer system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	

Interior function checks

3.0 - Carry out cluster checks	Completed	Not Completed	Comments
3.1 Check battery condition	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
3.2 Check engine oil level - Ref. AA-RM-04F02-01-007	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
3.3 Check TPMS (Tyre Pressure Monitoring System)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
3.4 Check indicator lamps and warning lamps	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
4.0 - Carry out IRIS checks	Completed	Not Completed	Comments
4.1 Check operation of IRIS system (audio/phone/sat nav/pc/cameras)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.0 - Carry out interior functional checks	Completed	Not Completed	Comments
5.1 Check central locking and alarm system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.2 Check interior controls (switches, lights, windows) and parking sensors (if fitted)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.3 Check heated rear window function	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.4 Check operation of heating, ventilation and air conditioning system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.5 Check condition of interior trim (seats, door casings, centre console, fascia, carpets)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.6 Check exterior door mirrors function and powerfold, rear view mirror, and sun visors	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.7 Check condition and operation of seat belts/buckles (ensure belts are not twisted)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.8 Check brake pedal free play	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.9 Check operation of EPB (Electronic Parking Brake)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	

Mechanical checks

6.0 - Secure/lift vehicle on lifting platform - Ref. AA-RM-02A04-04-005					Completed	Not Completed	Comments
6.1 Check/enter tyre pressure	FL	FR	RL	RR	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
	29	29	32	32			
6.2 Measure tread depth (mm)	FL	FR	RL	RR	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
	Outside						
	Center	8/32	8/32	9/32	9/32		
	Inside						
6.3 Check front/rear axle wheel bearing play					<input checked="" type="checkbox"/>	<input type="checkbox"/>	
6.4 Check front/rear ball joints for play					<input checked="" type="checkbox"/>	<input type="checkbox"/>	
6.5 Check front/rear track rods for play					<input checked="" type="checkbox"/>	<input type="checkbox"/>	

7.0 - Remove wheels - Ref. AA-RM-03B03-01-001	Completed	Not Completed	Comments
7.1 Check brake pads (replace if necessary)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
7.2 Check condition of brake discs (weigh all of them if CCM) - Ref. AA-RM-03C01-01-006	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
7.3 Replace electronic parking brake pads (every 2 years) - Ref. AA-RM-03C02-01-001	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
7.4 Check brake system for leaks/damage (bleed as required) - Ref. AA-RM-03C01-01-005	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
7.5 Check/clean air ducts of brake system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
8.0 - Remove all under floors - Ref. AA-RM-02A04-04-001/002/003/005/006/008	Completed	Not Completed	Comments
8.1 Check all visible parts for routing, leaks, and damage (cooling system)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
8.2 Check powertrain system for leaks (engine, transmission, and exhaust)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
8.3 Check all visible steering components for leaks and damage	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
8.4 Check engine mounts	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
8.5 Tighten screws, nuts, and bolts (including exhaust system, clips and strips in general)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
8.6 Check torques on suspension - Ref. AA-RM-03B01-02-002/003, 03B02-01-001/002	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
8.7 Check condition of drive shafts	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
9.0 - Remove rear wheel arch liners (carry out steps 9.2 to 9.6 while oil is draining)	Completed	Not Completed	Comments
Replace clutch oil and filter (Every 30,000km or 20,000 miles only)			
9.1 Drain engine oil - Ref. AA-RM-04F02-01-011	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
9.2 Check Z-bar drop links for play	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
9.3 Replace air filter - Ref. AA-RM-04F01-02-002	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
9.4 Check radiator/low temp cooler condition, check for any damage (clean as necessary)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
9.5 Check transmission and clutch fluids (when mileage is not achieved) are not overfilled	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
9.6 Replace clutch oil and filter (only if mileage achieved) - Ref. AA-RM-04G01-01-015/021	<input type="checkbox"/>	<input type="checkbox"/>	
9.7 Visually check condenser area for debris	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
10.0 - Lower vehicle	Completed	Not Completed	Comments
10.1 Replace engine oil filter - Ref. AA-RM-04F02-01-003	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
10.2 Fill engine oil (5 litres to start) - Ref. AA-RM-04F02-01-011	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
10.3 Check engine oil level - Ref. AA-RM-04F02-01-007	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
10.4 Top up and re-check level as required	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
11.0 - Lift vehicle	Completed	Not Completed	Comments
11.1 Visual inspection for general leaks	<input checked="" type="checkbox"/>	<input type="checkbox"/>	

Underside of vehicle

12.0 - Install all under floors - Ref. AA-RM-02A04-04-001/002/003/005/006/008	Completed	Not Completed	Comments
12.1 Check tyre orientation, damage, and crack formations	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
12.2 Replace wheel nut bolts	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
12.3 Install wheels - Ref. AA-RM-03B03-01-001	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.0 - Lower vehicle to ground	Completed	Not Completed	Comments
13.1 Check wheel bolt torque values (130 Nm)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.2 Replace engine ISG (Intake Sound Generator) - Ref. AA-RM-04F01-01-037	<input type="checkbox"/>	<input checked="" type="checkbox"/>	
13.3 Check corrosion/antifreeze protection and enter here: °C	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.4 Check exhaust emission label (market specific)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.5 Check injection/ignition system connections and harness	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.6 Check/adjust fluid level of cooling system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.7 Check vehicle steering alignment (adjust as required)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
14.0 - Road test (carry out 14.1 and 14.2 whilst on test. Max 30 min / 6 miles)	Completed	Not Completed	Comments
14.1 Check airbrake function	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
14.2 Check navigation system (if fitted)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.0 - Finish road test and carry out documents/safety device/final checks	Completed	Not Completed	Comments
15.1 Replace key fob battery and clean contacts with Electrolube CCS	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.2 Check function of all keys, locks, and fobs	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.3 Check for towing eye	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.4 Read out fault memory, clear errors, and zero service interval counter via MDS	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.5 Report and rectify all recorded defects	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.6 Check/stamp service and warranty guide	<input checked="" type="checkbox"/>	<input type="checkbox"/>	


Associated Documents

Step Reference	Document Number	Document Title
2.10 and 2.11	AA-RM-02A02-03-004	Remove/install luggage bin - Rear
2.12 and 7.4	AA-RM-03C01-01-005	Fill/bleed fluid - Brake system
2.13	AA-RM-03D01-01-008	Fill/bleed fluid - Steering system
6.0	AA-RM-02A04-04-007	Secure/lift vehicle on lifting platform
7.0 and 12.3	AA-RM-03B03-01-001	Remove/install Wheel
7.2	AA-RM-03C01-01-006	Cleaning/checking CCM brake discs
7.3	AA-RM-03C02-01-001	Remove/install pads - parking brake
8.0 and 12.0	AA-RM-02A04-04-001	Remove/install floor panel - Engine/fuel tank
8.0 and 12.0	AA-RM-02A04-04-002	Remove/install floor panel - Front
8.0 and 12.0	AA-RM-02A04-04-003	Remove/install floor panel - Tunnel
8.0 and 12.0	AA-RM-02A04-04-005	Remove/install floor panel - Rear lower extension
8.0 and 12.0	AA-RM-02A04-04-006	Remove/install guide vane
8.0 and 12.0	AA-RM-02A04-04-008	Remove/install transmission floor panel
8.6	AA-RM-03B01-02-002	Remove/install lower wishbone - front
8.6	AA-RM-03B01-02-003	Remove/install upper wishbone - front
8.6	AA-RM-03B02-01-001	Remove/install upper wishbone - rear
8.6	AA-RM-03B02-01-002	Remove/install lower wishbone - rear
9.1 and 10.2	AA-RM-04F02-01-011	Drain and refill engine oil
9.3	AA-RM-04F01-02-002	Remove/install air filter
9.7	AA-RM-04G01-01-015	Remove/install fluid - Transmission / Clutch
9.7	AA-RM-04G01-01-017	Remove/install filter - Transmission / Clutch fluid
10.1	AA-RM-04F02-01-003	Remove/install Oil Filter
10.3	AA-RM-04F02-01-007	Check engine oil level
13.2	AA-RM-04F01-01-037	Remove/install intake sound generator

Consumables / Sundries

Comments

Technician Name:

Technician Signature: 

Dealer Stamp:

MCLAREN SAN FRANCISCO
4190 EL CAMINO REAL
PALO ALTO, CA 94306

CUSTOMER #: NBC000813

10920



BEVERLY HILLS

WORKORDER

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819

PAGE 1

Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR: 388 CHAVEZ, TRAVIS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
MCLAREN OR	12	MCLAREN MP4-12C	SBM11AAA7CW000813		5881/	T0813
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
17MAY12 DD			17:00 05NOV13		CASH	
R.O. OPENED	READY	OPTIONS: STK:NBC000813 ENG:GAS TRN:AUTO				
05NOV2013 12:50						

LINE	OP CODE	TECH...	TYPE	DESCRIPTIONS/INSTRUCTIONS
# A	028		WMC	Perform open service campaign #028, Document #11 M 064, Module Software Platform Update to 12. CC:
# B	0025		WMC	Perform open service campaign #025, Document #11 M 058, Horn bracket installation. CC:

THE AUTO GALLERY


PHONE WHEN READY
 YES NO

ALL PARTS REMOVED WILL BE DISCARDED UNLESS REQUESTED BY THE CUSTOMER SAVE

"By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary."

"HAZARDOUS WASTE DISPOSAL" WHICH INCLUDE SUCH ITEMS AS ENGINE OIL, AUTOMATIC TRANSMISSION FLUID, ANTIFREEZE, FILTERS, DIFFERENTIAL FLUID, BATTERIES, ETC. WILL BE CHARGED AS A SEPARATED CHARGE IF REMOVED IN THE SERVICING OF YOUR VEHICLE.

NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT, OR ANY OTHER CAUSE BEYOND CONTROL. PLEASE REMOVE ALL PERSONAL BELONGINGS FROM VEHICLE.

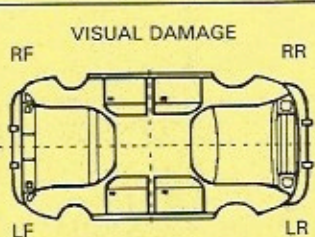

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within _____ days of the date shown above if I choose not to authorize the services recommended.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

ALL PARTS ARE NEW UNLESS OTHERWISE SPECIFIED

HAZARDOUS WASTE DISPOSAL \$ _____

TEARDOWN ESTIMATE \$ _____

PRELIMINARY ESTIMATE \$ _____

REVISED ESTIMATE #	DATE	TIME	BY	CONTACTED VIA	PERSON CONTACTED
				PHONE	
				MAIL	
				TEXT	

CUSTOMER SIGNATURE **X**

"DESIGNATION OF PERSON TO AUTHORIZE ADDITIONAL WORK OR PARTS"
I hereby designate the individual named below to authorize any additional work not specified or parts not included in the original written estimated price for parts and labor:

Name of Designee: _____ Phone Number: _____
 Fax Number: _____ E-Mail Address: _____
 Date: _____ Customer's Signature: _____

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and parts and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brake, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, greases, gins, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. *Posted in accordance with Proposition 65 in Cal. Health & Safety Code § 25249.2 et seq. For further information about Proposition 65, visit: <http://www.p65.ca.gov>

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819

Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

DATE WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
05NOV13	05NOV13	C000813	SBM11AAA7CW000813	C000813	T0813		05NOV13	10920
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
12:50	17:48	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
5881	5886							

A Perform open service campaign #028, Document #11 M 064, Module Software Platform Update to 12.
CAUSE: Campaign #028, Software Platform Update to 12. Service Booking #15021, Work Package #50571.
028 PERFORM OPEN CAMPAIGN #028, SOFTWARE UPDATE 12
573 WMC 1.50 (N/C)
FC: MOM30110A33I4A07
PART#: **THE AUTO GALLERY**
COUNT:
CLAIM TYPE:
AUTH CODE:

Performed campaign #028, Document #11 M 064 per McLaren specifications. Installed software platform 12, all software installed successfully. Vehicle now up to McLaren specifications. The most noticeable changes of this software are;
o New procedure for Oil level acquisition.
o Odometer back-up to improve robustness.
o Chinese language is now supported in the instrument cluster menu.
o

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.
 CUSTOMER SIGNATURE
NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.
CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
05NOV13	05NOV13	C000813	SBM11AAA7CW000813	C000813	T0813		05NOV13	10920
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABEL RATE	DELIVERY DATE	PREPARED BY	S/A
12:50	17:48	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
5881	5886							

Improved Suspension Displacement Sensor Calibration Sequence.
 o New PCCU Sequence
 Airbrake Contamination Cleaning.
 o DTC added for Real Time Clock.
 o Improved Engine cover and Luggage compartment Latch drive logic.
 Vehicle now up to McLaren specifications.
 B Perform open service campaign #025, Document #11 M 058, Horn bracket installation.
 CAUSE: Campaign #025, Horn bracket installation. Service Booking #15021, Work Package #43651
0025 HORN REPLACEMENT AND BRACKET FITMENT
 573 WMC 0.50 (N/C)
 1 1211M0427CP ASSY-HORN-HI (N/C)
 1 1211M0428CP ASSY-HORN-LO (N/C)
 1 1211M2872CP HORN BRACKET RH (N/C)
 1 1211M2873CP HORN BRACKET LH (N/C)
 FC: M0M20110A33A9901
 PART#:

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.
 CUSTOMER SIGNATURE
 NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.
 CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819

Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

DATE WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
05NOV13	05NOV13	C000813	SBM11AAA7CW000813	C000813	T0813		05NOV13	10920
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
12:50	17:48	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
5881	5886							

TECH	TYPE	HOURS	LIST/UNIT	NET/AMT	TOTAL
COUNT: CLAIM TYPE: AUTH CODE: Performed Campaign #025 per McLaren specifications. Replaced both horns and installed new mounting brackets to allow water to drain from the horn units. New mounting will prevent possible water ingress in horns which may affect sound of horns. Vehicle now up to McLaren specifications.					

** PRE-INVOICE **		DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
		LABOR AMOUNT	0.00	\$	\$
		PARTS AMOUNT	0.00		
		GAS,OIL, LUBE	0.00		
		SUBLET AMOUNT	0.00		
		MISC. CHARGES	0.00		
		TOTAL CHARGES	0.00		
		LESS INS./ADJ.	0.00		
		SALES TAX	0.00		
		PLEASE PAY THIS AMOUNT	0.00		
				I acknowledge notice and oral approval of an increase in the original estimated price. <input checked="" type="checkbox"/> CUSTOMER SIGNATURE NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE. CUSTOMER SIGNATURE <input checked="" type="checkbox"/>	

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY

CUSTOMER #: NBC000813

10603



BEVERLY HILLS

WORKORDER

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819

PAGE 1

Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR: 388 CHAVEZ, TRAVIS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
MCLAREN OR	12	MCLAREN MP4-12C	SBM11AAA7CW000813		3307/	T813
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
17MAY12 DD			17:00 22MAR13		CASH	
R.O. OPENED	READY	OPTIONS: STK:NBC000813 ENG:GAS TRN:AUTO				

22MAR2013 10:50

LINE	OP CODE	TECH...	TYPE	DESCRIPTIONS/INSTRUCTIONS
# A	MC2		CMC	Perform 1 year/10k service

B MCT1 CMC Replace left front tire due to sidewall damage.

C 01N WMC Perform open service campaign #01N, Document #11 B 005, Replacement of the displacement sensor brackets and drop link rods. | CC:

THE AUTO GALLERY


PHONE WHEN READY
 YES NO

ALL PARTS REMOVED WILL BE DISCARDED UNLESS REQUESTED BY THE CUSTOMER SAVE

"By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary."

"HAZARDOUS WASTE DISPOSAL" WHICH INCLUDE SUCH ITEMS AS ENGINE OIL, AUTOMATIC TRANSMISSION FLUID, ANTIFREEZE, FILTERS, DIFFERENTIAL FLUID, BATTERIES, ETC. WILL BE CHARGED AS A SEPARATED CHARGE IF REMOVED IN THE SERVICING OF YOUR VEHICLE.

NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT, OR ANY OTHER CAUSE BEYOND CONTROL. PLEASE REMOVE ALL PERSONAL BELONGINGS FROM VEHICLE.

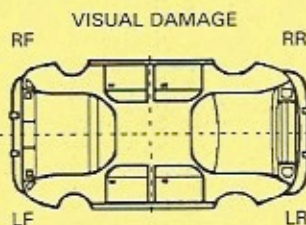

TEARDOWN ESTIMATE: I understand that my vehicle will be reassembled within _____ days of the date shown above if I choose not to authorize the services recommended.

I hereby authorize the repair work herein set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delay caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

HAZARDOUS WASTE DISPOSAL	\$
TEARDOWN ESTIMATE	\$
PRELIMINARY ESTIMATE	\$

REVISED ESTIMATE #	DATE	TIME	BY	CONTACTED VIA	PERSON CONTACTED
				<input type="checkbox"/> PHONE <input type="checkbox"/> IN PERSON	
				<input type="checkbox"/> PHONE <input type="checkbox"/> IN PERSON	

CUSTOMER SIGNATURE **X**

"DESIGNATION OF PERSON TO AUTHORIZE ADDITIONAL WORK OR PARTS"
 I hereby designate the individual named below to authorize any additional work not specified or parts not included in the original written estimated price for parts and labor:

Name of Designee: _____ Phone Number: _____
 Fax Number: _____ E-Mail Address: _____
 Date: _____ Customer's Signature: _____

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Printed in accordance with Proposition 65 in Cal. Health & Safety Code § 25249.5, et seq.) For further information about Proposition 65, <http://www.oakley.com/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211

(866) 311-6819

Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
22MAR13	25MAR13	C000813	SBM11AAA7CW000813	C000813	T813		25MAR13	10603
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:50	17:27	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
3307	3312							

TECH	TYPE	HOURS	LIST AMT	NET UNIT	TOTAL
A Perform 1 year/10k service					
CAUSE: 1 year service, Service Booking #9820, Work Package #37024.					
MC2 MAINTENANCE					
	573 CMC	5.00		800.00	800.00
6	M040 MOBIL ONE 0/40		13.44	13.44	80.64
1	1211F0107CP				
	OIL-FILTER		38.31	38.31	38.31
1	1200RC042				
	WASHER-ALUMINIUM				
	CRUSH-14X18X1.35		4.36	4.36	4.36
1	1211F1276CP INTAKE				
	SOUND GENERATOR		179.12	179.12	179.12
1	1211A3694CP WIPER				
	BLADE - LHD - FED		32.65	32.65	32.65
1	1211F0799CP				
	ENGINE-BED PLATE				
	PLUG-INCL WASHER		18.76	18.76	18.76
MISC VEHICLE VERY LOW ON FUEL, ADDED \$20.00 IN FUEL					
	CMC			20.00	20.00
Performed 1 year service per McLaren service sheet specifications. Service Booking #9820, Work Package #37024.					

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			


I acknowledge notice and oral approval of an increase in the original estimated price.

CUSTOMER SIGNATURE

NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.

CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.



BEVERLY HILLS
 9022 WILSHIRE BLVD.
 BEVERLY HILLS, CA 90211
 (866) 311-6819
 Email: McLarenService@TheAutoGallery
 www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
22MAR13	25MAR13	C000813	SBM11AAA7CW000813	C000813	T813		25MAR13	10603
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:50	17:27	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
3307	3312							

TECH.	TYPE	HOURS	LIST AMT	NET UNIT	TOTAL
B Replace left front tire due to sidewall damage. CAUSE: Right front tire damaged on sidewall MCT1 MOUNT AND BALANCE 1 TIRE, AND RESET TIRE PSI					
	573 CMC	0.00		0.00	0.00
	1 335YR9P0XLV7				
	235/35R19 PI P-ZERO		375.00	375.00	375.00
SUBL Sublet tire mount and balance Vin CW000813, Inv #272395, 03/25/2013 PO#147232					
	CMC		50.00	50.00	50.00
Removed right front wheel, sent out for tire replacement and re balancing.					
C Perform open service campaign #01N, Document #11 B 005, Replacement of the displacement sensor brackets and drop link rods. CAUSE: Campaign #01N- Replacement of the displacement sensor brackets and drop link rods, Service Booking #9820, Work Package #23771. 01N REPLACEMENT OF THE DISPLACEMENT SENSOR BRACKETS AND DROP LINK RODS					

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.

CUSTOMER SIGNATURE

NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.

CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.



McLaren
BEVERLY HILLS
 9022 WILSHIRE BLVD.
 BEVERLY HILLS, CA 90211
 (866) 311-6819
 Email: McLarenService@TheAutoGallery
 www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

DATE WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
22MAR13	25MAR13	C000813	SBM11AAA7CW000813	C000813	T813		25MAR13	10603
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:50	17:27	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
3307	3312							

TECH.	TYPE	HOURS	LIST AMT	NET AMT	TOTAL
573	WMC	2.50			(N/C)
1 1211B1167CP SOP					(N/C)
DISPLACEMENT SENSOR KIT					
Performed campaign #01N, Document #11 B 005 per McLaren specifications, removed and replaced the front and rear suspension displacement sensor brackets and drop link rods with updated type. Adjusted all sensor positioning to correct tolerances. The purpose of the updated components is to prevent potential seizing of the displacement sensor drop link rods. Vehicle now up to McLaren specifications. Service Booking #9820, Work Package #23771.					

** PRE-INVOICE **		DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
		LABOR AMOUNT	800.00	\$	\$
		PARTS AMOUNT	728.84		
		GAS,OIL, LUBE	0.00	I acknowledge notice and oral approval of an increase in the original estimated price.	
		SUBLET AMOUNT	50.00	X	
		MISC. CHARGES	20.00	CUSTOMER SIGNATURE	
		TOTAL CHARGES	1598.84	NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE	
		LESS INS./ADJ.	0.00	NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.	
		SALES TAX	65.60	CUSTOMER SIGNATURE	
		PLEASE PAY THIS AMOUNT	1664.44	X	

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

Service sheet : 1st year or 15,000 km (10,000 miles)


check vehicle odometer reading against mileage dependant task service sheet before carrying out service

Vehicle registration :	VIN: <u>SBW11AA7CW000813</u>	km / miles: <u>3307</u>
Colour: <u>McLaren Orange</u>		Date: <u>03/22/2013</u>
Address :		Service Time: 5.85 units
		Invoice / Job no: <u>RA# 10603</u> <u>SB# 9820</u> <u>WP# 37024</u>

Vehicle acceptance (customer present from 1.1 to 1.4)

1.0 - Vehicle pre-checks	Completed	Not Completed	Comments
1.1 Check for wheel locking key (if supplied)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	N/A
1.2 Check tyre orientation, damage, and crack formations	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
1.3 Inspect wheel rim condition	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
1.4 Check bodywork	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
1.5 Check McLaren Retailer Portal for any outstanding campaigns on vehicle	<input checked="" type="checkbox"/>	<input type="checkbox"/>	

Check paint and panels for defects - please mark the picture as following: (D dent - S scratch - X damage)

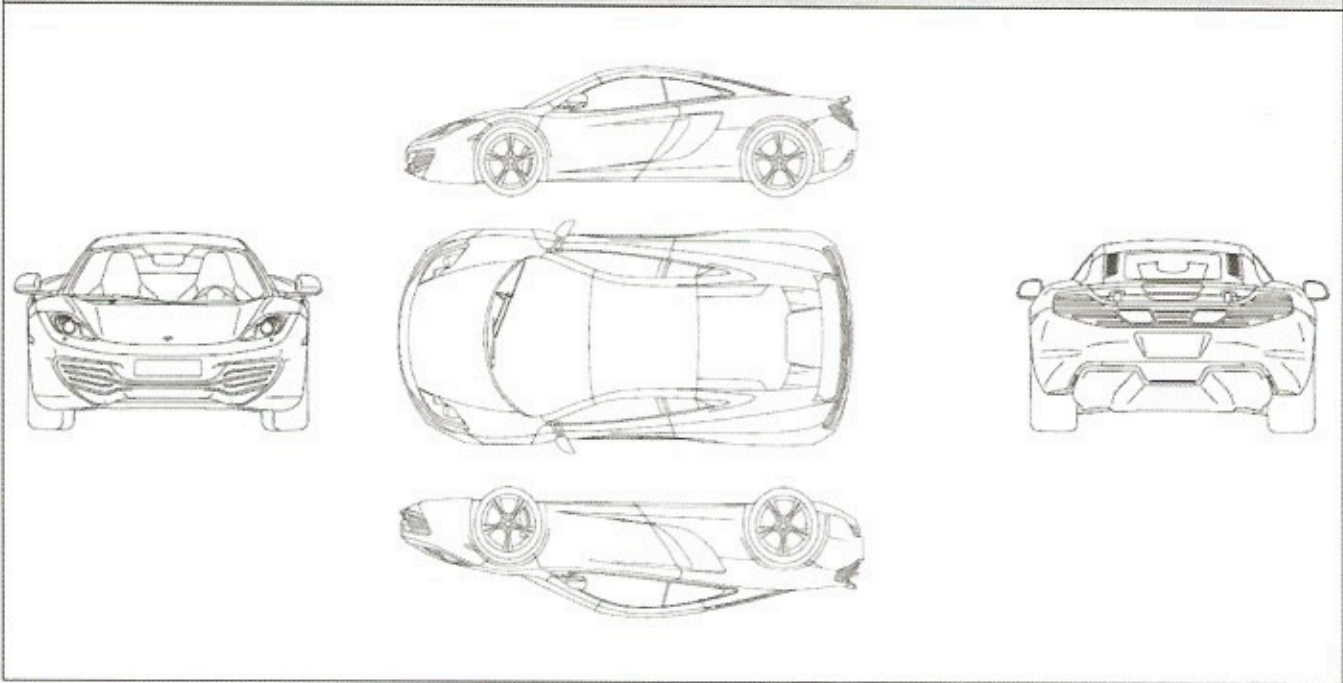

Vehicle exterior/fluid and battery checks - (ensure battery charger and body protection are fitted)

2.0 - Two technicians will be required for steps 2.1 and 2.2	Completed	Not Completed	Comments
2.1 Check exterior lighting function	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.2 Check headlamp/windscreen washer system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.3 Check headlamp adjustment - Ref. AA-RM-02A02-04-003	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.4 Replace wiper blade	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.5 Check window glazing	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.6 Check exterior light glazing	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.7 Check gaps and seals of doors, engine cover, and luggage compartment lid	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.8 Check fuel filler flap manual opening	<input checked="" type="checkbox"/>	<input type="checkbox"/>	

	Completed	Not Completed	Comments
2.9 Check controls and adjusters in general (hinges, doors, luggage lid and engine cover)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.10 Check battery connections and charge (physical check) - Ref. AA-RM-02A02-03-004	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.11 Check cabin filter (replace as required) - Ref. AA-RM-02A02-03-004	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.12 Check/adjust fluid level of brake system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.13 Check/adjust fluid level of power steering - Ref. AA-RM-03D01-01-008	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
2.14 Check/adjust fluid level of windshield washer system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	

Interior function checks

3.0 - Carry out cluster checks				Completed	Not Completed	Comments
3.1 Check battery condition				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
3.2 Check engine oil level - Ref. AA-RM-04F02-01-007				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
3.3 Check TPMS (Tyre Pressure Monitoring System)				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
3.4 Check indicator lamps and warning lamps				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
4.0 - Carry out IRIS checks				Completed	Not Completed	Comments
4.1 Check operation of IRIS system (audio/phone/sat nav/pc/cameras)				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.0 - Carry out interior functional checks				Completed	Not Completed	Comments
5.1 Check central locking and alarm system				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.2 Check interior controls (switches, lights, windows) and parking sensors (if fitted)				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.3 Check heated rear window function				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.4 Check operation of heating, ventilation and air conditioning system				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.5 Check condition of interior trim (seats, door casings, centre console, fascia, carpets)				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.6 Check exterior door mirrors function and powerfold, rear view mirror, and sun visors				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.7 Check condition and operation of seat belts/buckles (ensure belts are not twisted)				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.8 Check brake pedal free play				<input checked="" type="checkbox"/>	<input type="checkbox"/>	
5.9 Check operation of EPB (Electronic Parking Brake)				<input checked="" type="checkbox"/>	<input type="checkbox"/>	

Mechanical checks

6.0 - Secure/lift vehicle on lifting platform - Ref. AA-RM-02A04-04-005					Completed	Not Completed	Comments
6.1 Check/enter tyre pressure	FL:	FR:	RL:	RR:	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
	29	29	32	32			
6.2 Measure tread depth (mm)	FL:	FR:	RL:	RR:	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
	Outside	5.0	4.2	4.8	4.2	Replaced LF Tire	
	Center	6.5	7.1	5.9	6.0		
	Inside	5.0	4.0	3.9	4.3		
6.3 Check front/rear axle wheel bearing play					<input checked="" type="checkbox"/>	<input type="checkbox"/>	
6.4 Check front/rear ball joints for play					<input checked="" type="checkbox"/>	<input type="checkbox"/>	
6.5 Check front/rear track rods for play					<input checked="" type="checkbox"/>	<input type="checkbox"/>	

7.0 - Remove wheels - Ref. AA-RM-03B03-01-001	Completed	Not Completed	Comments
7.1 Check brake pads (replace if necessary)	✓	<input type="radio"/>	
7.2 Check condition of brake discs (weigh all of them if CCM) - Ref. AA-RM-03C01-01-006	✓	<input type="radio"/>	
7.3 Check EPB (Electronic Parking Brake) pads (replace if required)	✓	<input type="radio"/>	
7.4 Check brake system for routing, leaks, and damage (bleed brakes if required)	✓	<input type="radio"/>	
7.5 Check/clean air ducts of brake system	✓	<input type="radio"/>	
8.0 - Remove all under floors - Ref. AA-RM-02A04-04-001/002/003/005/006/008	Completed	Not Completed	Comments
8.1 Check all visible parts for routing, leaks, and damage (cooling system)	✓	<input type="radio"/>	
8.2 Check powertrain system for leaks (engine, transmission, and exhaust)	✓	<input type="radio"/>	
8.3 Check all visible steering components for leaks and damage	✓	<input type="radio"/>	
8.4 Check engine mounts	✓	<input type="radio"/>	
8.5 Tighten screws, nuts, and bolts (including exhaust system, clips and strips in general)	✓	<input type="radio"/>	
8.6 Check torques on suspension - Ref. AA-RM-03B01-02-002/003, 03B02-01-001/002	✓	<input type="radio"/>	
8.7 Check condition of drive shafts	✓	<input type="radio"/>	
9.0 - Remove rear wheel arch liners (carry out steps 9.2 to 9.6 while oil is draining)	Completed	Not Completed	Comments
9.1 Drain engine oil - Ref. AA-RM-04F02-01-011	✓	<input type="radio"/>	
9.2 Check Z-bar drop links for play	✓	<input type="radio"/>	
9.3 Check/clean air filter elements (replace as required) - Ref. AA-RM-04F01-02-002	✓	<input type="radio"/>	
9.4 Check transmission and clutch fluids are not overfilled	✓	<input type="radio"/>	
9.5 Check front lower exhaust manifold nuts/studs and exhaust manifold	✓	<input type="radio"/>	
9.6 Check radiator/low temp cooler condition, check for any damage (clean as necessary)	✓	<input type="radio"/>	
10.0 - Lower vehicle	Completed	Not Completed	Comments
10.1 Replace engine oil filter - Ref. AA-RM-04F02-01-003	✓	<input type="radio"/>	
10.2 Fill engine oil (5 litres to start) - Ref. AA-RM-04F02-01-011	✓	<input type="radio"/>	
10.3 Check engine oil level - Ref. AA-RM-04F02-01-007	✓	<input type="radio"/>	
10.4 Top up and recheck level as required	✓	<input type="radio"/>	
11.0 - Lift vehicle	Completed	Not Completed	Comments
11.1 Visual inspection for general leaks	✓	<input type="radio"/>	

underside of vehicle

12.0 - Install all under floors - Ref. AA-RM-02A04-04-001/002/003/005/006/008	Completed	Not Completed	Comments
12.1 Check tyre orientation, damage, and crack formations	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
12.2 Install wheels - Ref. AA-RM-03B03-01-001	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.0 - Lower vehicle to ground	Completed	Not Completed	Comments
13.1 Check wheel bolt torque values (130 Nm)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.2 Replace engine ISG (Intake Sound Generator) - Ref. AA-RM-04F01-01-037	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.3 Check corrosion/antifreeze protection and enter here: <i>-35C</i>	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.4 Check exhaust emission label (market specific)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.5 Check injection/ignition system connections and harness	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.6 Check/adjust fluid level of cooling system	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
13.7 Check vehicle steering alignment (adjust as required)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
14.0 - Road test (carry out 14.1 and 14.2 whilst on test. Max 30 min / 6 miles)	Completed	Not Completed	Comments
14.1 Check airbrake function	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
14.2 Check navigation system (if fitted)	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.0 - Finish road test and carry out documents/safety device/final checks	Completed	Not Completed	Comments
15.1 Clean battery contacts with Electrolube CCS (only if key battery is being replaced)	<input type="checkbox"/>	<input type="checkbox"/>	<i>N/A</i>
15.2 Check function of all keys, locks, and fobs	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.3 Check for towing eye	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.4 Read out fault memory, clear errors, and zero service interval counter via MDS	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.5 Report and rectify all recorded defects	<input checked="" type="checkbox"/>	<input type="checkbox"/>	
15.6 Check/stamp service and warranty guide	<input checked="" type="checkbox"/>	<input type="checkbox"/>	

Associated Documents

Step Reference	Document Number	Document Title
2.3	AA-RM-02A02-04-003	Adjust headlamp
2.10 and 2.11	AA-RM-02A02-03-004	Remove/install luggage bin - Rear
2.13	AA-RM-03D01-01-008	Fill/bleed fluid - Steering system
6.0	AA-RM-02A04-04-005	Secure/lift vehicle on lifting platform
7.0 and 12.2	AA-RM-03B03-01-001	Remove/install Wheel
7.2	AA-RM-03C01-01-006	Cleaning/checking CCM brake discs
8.0 and 12.0	AA-RM-02A04-04-001	Remove/install floor panel - Engine/fuel tank
8.0 and 12.0	AA-RM-02A04-04-002	Remove/install floor panel - Front
8.0 and 12.0	AA-RM-02A04-04-003	Remove/install floor panel - Tunnel
8.0 and 12.0	AA-RM-02A04-04-005	Remove/install floor panel - Rear lower extension
8.0 and 12.0	AA-RM-02A04-04-006	Remove/install guide vane
8.0 and 12.0	AA-RM-02A04-04-008	Remove/install transmission floor panel
8.6	AA-RM-03B01-02-002	Remove/install lower wishbone - front
8.6	AA-RM-03B01-02-003	Remove/install upper wishbone - front
8.6	AA-RM-03B02-01-001	Remove/install upper wishbone - rear
8.6	AA-RM-03B02-01-002	Remove/install lower wishbone - rear
9.1 and 10.2	AA-RM-04F02-01-011	Drain and refill engine oil
9.3	AA-RM-04F01-02-002	Remove/install air filter
10.1	AA-RM-04F02-01-003	Remove/install Oil Filter
10.3	AA-RM-04F02-01-007	Check engine oil level
13.2	AA-RM-04F01-01-037	Remove/install intake sound generator

Consumables / Sundries

6q engine oil 2 copper washers topped off all fluids

Comments


AP and engine air filters ok

Technician Name:

Bryan Bates

**McLAREN BEVERLY HILLS
9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211**

Technician Signature:

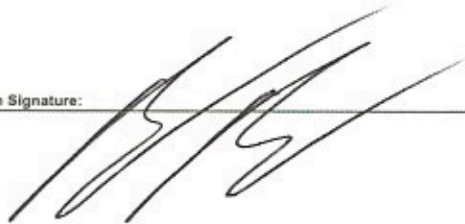

Dealer Stamp:

Printed copy is not controlled



BEVERLY HILLS
 9022 WILSHIRE BLVD.
 BEVERLY HILLS, CA 90211
 (866) 311-6819

Email: McLarenService@TheAutoGallery
 www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR **TRAVIS CHAVEZ**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
22MAR13	25MAR13	C000813	SBM11AAA7CW000813	C000813	T813		25MAR13	10603
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABEL RATE	DELIVERY DATE	PREPARED BY	S/A
10:50	17:27	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
3307	3312							

TECH.	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL
B Replace left front tire due to sidewall damage. CAUSE: Right front tire damaged on sidewall MCT1 MOUNT AND BALANCE 1 TIRE, AND RESET TIRE PSI					
	573 CMC	0.00		0.00	0.00
	1 335YR9P0XLV7				
	235/35R19 PI P-ZERO	375.00	375.00		375.00
SUBL Sublet tire mount and balance Vin CW000813, Inv #272395, 03/25/2013 PO#147232					
	CMC		50.00		50.00
Removed right front wheel, sent out for tire replacement and re balancing.					
C Perform open service campaign #01N, Document #11 B 005, Replacement of the displacement sensor brackets and drop link rods. CAUSE: Campaign #01N- Replacement of the displacement sensor brackets and drop link rods, Service Booking #9820, Work Package #23771. 01N REPLACEMENT OF THE DISPLACEMENT SENSOR BRACKETS AND DROP LINK RODS					

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			
		I acknowledge notice and oral approval of an increase in the original estimated price.	
		X CUSTOMER SIGNATURE	
		NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.	
		CUSTOMER SIGNATURE	
		X	

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>



BEVERLY HILLS
 9022 WILSHIRE BLVD.
 BEVERLY HILLS, CA 90211
 (866) 311-6819

Email: McLarenService@TheAutoGallery
 www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR **TRAVIS CHAVEZ**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
22MAR13	25MAR13	C000813	SBM11AAA7CW000813	C000813	T813		25MAR13	10603
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST PAY LABOR RATE	DELIVERY DATE	PREPARED BY	SA
10:50	17:27	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
3307	3312							

TECH.	TYPE	HOURS	LSTANT	NETANT	TOTAL
573	WMC	2.50			(N/C)
1	1211B1167CP SOP				(N/C)
DISPLACEMENT SENSOR KIT					
Performed campaign #01N, Document #11 B 005 per McLaren specifications, removed and replaced the front and rear suspension displacement sensor brackets and drop link rods with updated type. Adjusted all sensor positioning to correct tolerances. The purpose of the updated components is to prevent potential seizing of the displacement sensor drop link rods. Vehicle now up to McLaren specifications. Service Booking #9820, Work Package #23771.					

** PRE-INVOICE **

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT	800.00	\$	\$
PARTS AMOUNT	728.84		
GAS, OIL, LUBE	0.00		
SUBLET AMOUNT	50.00		
MISC. CHARGES	20.00		
TOTAL CHARGES	1598.84		
LESS INS./ADJ.	0.00		
SALES TAX	65.60		
PLEASE PAY THIS AMOUNT	1664.44		

I acknowledge notice and oral approval of an increase in the original estimated price.

CUSTOMER SIGNATURE

NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.

CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>



BEVERLY HILLS
 9022 WILSHIRE BLVD.
 BEVERLY HILLS, CA 90211
 (866) 311-6819

Email: McLarenService@TheAutoGallery
 www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR **TRAVIS CHAVEZ**

REPAIR ORDER WORKSLIP NO.	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
06MAR13	19MAR13	C000813	SBM11AAA7CW000813	C000813	T0813		19MAR13	10588
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
18:36	15:52	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
3083	3091							

A Tow vehicle in from clients office
 TOW TOW VEHICLE
 573 WMC 0.00 (N/C)

SUBL Sublet tow in from client office in
 PasedenaVin Cw000813, Inv #196512,
 03/04/2013 PO#146757
 WMC (N/C)

B Client states when starting the vehicle an
 error message stating ESC Fault Limp Home
 Mode Take to McLaren service center had
 came on, check and advise.
 CAUSE: Hard reset of vehicle electronics,
 Service Booking #9425, Work Package
 #36415.
 05M0101001 DISCONNECT/CONNECT BATTERY
 GROUND LINE
 573 WMC 0.40 (N/C)
 1 DIAGNOSTICS REQUIRED
 573 WMC 0.40 (N/C)
 2 VEHICLE IN WORKSHOP
 573 WMC 0.20 (N/C)

Started vehicle, verified the ESC fault
 warning light is on as well as numerous others
 if you cycle through the error messages.


DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS, OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.
 CUSTOMER SIGNATURE

NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.
 CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, gms, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS
 9022 WILSHIRE BLVD.
 BEVERLY HILLS, CA 90211
 (866) 311-6819

Email: McLarenService@TheAutoGallery
 www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR **TRAVIS CHAVEZ**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
06MAR13	19MAR13	C000813	SBM11AAA7CW000813	C000813	T0813		19MAR13	10588
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LAID/RATE	DELIVERY DATE	PREPARED BY	S/A
18:36	15:52	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
3083	3091							

Performed MDS, quick test, found no communication could be established with numerous electronic control units related to body systems and also numerous active communication faults in numerous ecus's. Removed trunk paneling for access to main fuses. Checked all fuses, all okay. As a next step in diagnosis, performed a hard reset of vehicle electronics, disconnected/reconnected negative battery terminal, rechecked MDS communication with ecus, now all ecus communicate and fault codes changed to inactive. Cleared all faults, resynchronized vehicle electronics, road tested vehicle, no error messages and vehicle now operating as designed. Service Booking #9425, Work Package #36415.
 C Unable to retrieve vehicle mileage due to warning messages.
 CAUSE: Mileage unknown due to communication errors with numerous ecu's
 MC6 ELECTRICAL
 573 WMC 0.00
 Mileage can now be retrieved, correct mileage

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS, OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.
 CUSTOMER SIGNATURE
 NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.
 CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS
 9022 WILSHIRE BLVD.
 BEVERLY HILLS, CA 90211
 (866) 311-6819

Email: McLarenService@TheAutoGallery
 www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR **TRAVIS CHAVEZ**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
06MAR13	19MAR13	C000813	SBM11AAA7CW000813	C000813	T0813		19MAR13	10588
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
18:36	15:52	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
3083	3091							

is 3083

THE AUTO GALLERY

** PRE-INVOICE **

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT	0.00	\$	\$
PARTS AMOUNT	0.00		
GAS,OIL, LUBE	0.00		
SUBLET AMOUNT	0.00		
MISC. CHARGES	0.00		
TOTAL CHARGES	0.00		
LESS INS./ADJ.	0.00		
SALES TAX	0.00		
PLEASE PAY THIS AMOUNT	0.00		

I acknowledge notice and oral approval of an increase in the original estimated price.

CUSTOMER SIGNATURE

NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.

CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code 25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR TRAVIS CHAVEZ

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
18SEP12	21NOV12	C000813	SBM11AAA7CW000813	C000813	T813		21NOV12	10390
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
11:17	13:30	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
1657	1657							

A Client requests to leave vehicle here while He is out of country and have the new software installed when released in October.
MC3 PERFORMANCE
573 CMC 0.00 0.00 0.00

THE AUTO GALLERY

** PRE-INVOICE **

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT	0.00	\$	\$
PARTS AMOUNT	0.00		
GAS,OIL, LUBE	0.00		
SUBLET AMOUNT	0.00		
MISC. CHARGES	0.00		
TOTAL CHARGES	0.00		
LESS INS./ADJ.	0.00		
SALES TAX	0.00		
PLEASE PAY THIS AMOUNT	0.00		

I acknowledge notice and oral approval of an increase in the original estimated price.
X
CUSTOMER SIGNATURE
NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.
CUSTOMER SIGNATURE
X

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819

Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR TRAVIS CHAVEZ

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
20NOV12	21NOV12	C000813	SBM11AAA7CW000813	C000813	T813		21NOV12	10467
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	SIA
10:32	13:29	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
1657	1664							

TECH.	TYPE	HOURS	LIST/UNIT	NET/AMT	TOTAL
<p>A Client states the tpms fault message comes on when starting the vehicle, check and advise. CAUSE: No Fault Found No Repair Performed. Corrected all tire pressures, system operating normal. MC6 ELECTRICAL 573 WMC 0.00 (N/C)</p>					
<p>B Install front skid plates and tyre spoiler inserts, replace torn tyre spoiler. CAUSE: Skid Plate and Tyre Spoiler Insert Installation SKIDS Install front skid plates and tyre spoiler inserts 573 CMC 1.50 240.46 240.46 1 12C-SKID MP4-12C FRONT BUMPER SKID PLATE KIT 450.00 225.00 225.00 1 1211A1816CP TYRE SPOILER-FRNT-RH 48.86 36.65 36.65</p>					
<p>Installed front skid plates and tyre spoiler inserts. Replaced right tyre spoiler as it was torn off.</p>					
<p>C Perform open service campaign 01D, Document</p>					

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.
 CUSTOMER SIGNATURE
 NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.
 CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code 1/25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819

Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR **TRAVIS CHAVEZ**

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
20NOV12	21NOV12	C000813	SBM11AAA7CW000813	C000813	T813		21NOV12	10467
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:32	13:29	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
1657	1664							

TECH TYPE HOURS LST/UNIT NET/UNIT TOTAL

#11 E 001, Retrofit noise insulation to the cooling fan relays.
 CAUSE: Campaign #01D, Retrofit noise insulation to cooling fan relays. Service Booking #7053, Work Package #13361.
 01D Campaign #01D, Doc #11 E 001, Insulate cooling fan relays
 573 WMC 1.50 (N/C)
 1 1211M2360CP NVH COVER-COOLING FAN RELAYS (N/C)

Performed open service campaign #01D per McLaren specifications. Removed cooling fan relay unit, retrofitted noise insulation to prevent excessive noise from relays when switching on/off. Vehicle now up to McLaren specifications. Service Booking #7053, Work Package #13361.

D Perform open service campaign #01H, Document #11 A 030, HVAC Drain tube modification.
 CAUSE: Campaign #01H- HVAC Drain tube modification, Service Booking #7053, Work Package #21361.

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.
 CUSTOMER SIGNATURE
 NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
 NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.
 CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. **To minimize your exposure when servicing, maintaining or cleaning your vehicle:** 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code 1/25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

SERVICE ADVISOR TRAVIS CHAVEZ

BAR # ARD267177 EPA# CAL000368341

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
20NOV12	21NOV12	C000813	SBM11AAA7CW000813	C000813	T813		21NOV12	10467
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:32	13:29	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
1657	1664							

TICKET	TYPE	HOURS	LIST/UNIT	NET/UNIT	TOTAL
01H	HVAC DRAIN TUBE MODIFICATION	573	WMC	0.10	(N/C)
<p>Performed campaign #01H, Document #11 A 030 per McLaren specifications, modified HVAC drain tube to create a constant drain path preventing clogging and possible water leaking inside the cabin footwell areas. Vehicle now up to McLaren specifications. Service Booking #7053, Work Package #21361.</p> <p>E Perform open service campaign #01N, Document #11 B 005, Replacement of the displacement sensor brackets and drop link rods.</p> <p>CAUSE: No Repairs Performed at this time. Client to return when parts are available. Vehicle is safe to drive.</p>					
01N	REPLACEMENT OF THE DISPLACEMENT SENSOR BRACKETS AND DROP LINK RODS	573	WMC	0.00	(N/C)
<p>F Perform open service campaign #01P, Document #11 M 041, Vehicle software update to platform 10.2.</p> <p>CAUSE: Campaign #01P- Vehicle software update to platform 10.2. Service booking #7053.</p>					

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.

CUSTOMER SIGNATURE

NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.

CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

SERVICE ADVISOR TRAVIS CHAVEZ

BAR # ARD267177 EPA# CAL000368341

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.D. NO.	INVOICE PRINTED	INVOICE NO.
20NOV12	21NOV12	C000813	SBM11AAA7CW000813	C000813	T813		21NOV12	10467
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:32	13:29	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
1657	1664							

TECH	TYPE	HOURS	LISTUNIT	NETAMT	TOTAL
					(N/C)
Work Package #24953. 01P SOFTWARE UPDATE 10.2 573 WMC 0.10 Performed campaign 01P, Document #11 M 041 per McLaren specifications. Installed vehicle platform software update to 10.2 which includes new software for the following electronic control units, Switch Control Unit Gateway, Instrument Cluster, Electronic Parking Brake (only if required), Body Controller, Security Body Controller, Heating Ventilation and Air-Conditioning Door Module Left and Right, Seat Control Module Left and Right (if applicable), IRIS Head Unit, Steering Angle Sensor (only if required), Powertrain Chassis Control Unit, Engine Control Module and Satellite Navigation. The most noticeable customer benefits of this software are: <ul style="list-style-type: none"> o Increase in engine power to 625PS o Programmable Intake Sound Generator (ISG) o Headlights linked to rain sensor (automatic) o Easy-exit seat return via the instrument cluster (electric seats only) o Meridian sound system equaliser settings 					

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			
		I acknowledge notice and oral approval of an increase in the original estimated price. <input checked="" type="checkbox"/> CUSTOMER SIGNATURE NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.	
		CUSTOMER SIGNATURE <input checked="" type="checkbox"/>	

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

SERVICE ADVISOR TRAVIS CHAVEZ

BAR # ARD267177 EPA# CAL000368341

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
20NOV12	21NOV12	C000813	SBM11AAA7CW000813	C000813	T813		21NOV12	10467
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:32	13:29	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
1657	1664							

(Meridian Surround Sound) Overall improved software updates throughout the vehicle Bluetooth connectivity and satellite navigation functionality All programming was successful. Cleared all created faults in systems, rechecked vehicle functions, all operating as designed. Vehicle now up to McLaren specifications. Service booking #7053, Work Package #24953.

G Perform open service campaign #01J, Document #11 A 032 Replacement of both door latches.

CAUSE: Campaign #01J- Replacement of both door latches, Service Booking #7053, Work Package #30497.

01J REPLACEMENT OF BOTH DOOR LATCHES
573 WMC 3.00

1 1211A6407CP DOOR LATCH-LH (N/C)
1 1211A6408CP DOOR LATCH-RH (N/C)

Performed campaign #01J, Document #11 A 032 per McLaren specifications. Removed and replaced left and right door latches with the

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			
		I acknowledge notice and oral approval of an increase in the original estimated price.	
		X CUSTOMER SIGNATURE	
		NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.	
		CUSTOMER SIGNATURE	
		X	

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code 25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

SERVICE ADVISOR TRAVIS CHAVEZ

BAR # ARD267177 EPA# CAL000368341

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
20NOV12	21NOV12	C000813	SBM11AAA7CW000813	C000813	T813		21NOV12	10467
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:32	13:29	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
1657	1664							

updated type to improve the durability of both the door latches. Vehicle now up to McLaren specifications. Service Booking #7053, Work Package #30497.

H Perform open service campaign #01S, Document #11 M 045, Diversity Tuner Retrofit (Including Bumper Antenna).

CAUSE: Campaign #01S- Diversity Tuner Retrofit (Including Bumper Antenna), Service Booking #7053, Work Package #31877.

01S DIVERSITY TUNER RETROFIT (INCLUDING BUMPER ANTENNA)

573 WMC 2.90

1 1211M2561CP BUMPER ANTENNA TUNER KIT

Performed campaign #01S, Document #11 M 045 per McLaren specifications. Installed the diversity tuner kit which includes the FM/AM antenna amplifier module and antenna that is routed behind the front bumper. The diversity tuner kit will improve radio reception quality. Roadtested vehicle, tested fm/am radio reception, reception normal. Vehicle now up to McLaren specifications. Service Booking

TOTAL

(N/C)

(N/C)

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS, OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.

CUSTOMER SIGNATURE

NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.

CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code 25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR TRAVIS CHAVEZ

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
20NOV12	21NOV12	C000813	SBM11AAA7CW000813	C000813	T813		21NOV12	10467
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:32	13:29	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
1657	1664							


TECH	TYPE	HOURS	UNIT	NET UNIT	TOTAL
#7053, Work Package #31877.					
I** Tow vehicle in from clients office					
TOW TOW VEHICLE					
	573	CMC	0.00	0.00	0.00
SUBL Sublet tow in from clients office, Vin					
CW000813, 09/14/2012, Inv #186071.					
PO#144042					
		CMC	150.00	150.00	150.00

THE AUTO GALLERY

** PRE-INVOICE **		DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
		LABOR AMOUNT	240.46	\$	\$
		PARTS AMOUNT	261.65		
		GAS,OIL, LUBE	0.00		
		SUBLET AMOUNT	150.00		
		MISC. CHARGES	0.00		
		TOTAL CHARGES	652.11		
		LESS INS./ADJ.	0.00		
		SALES TAX	22.89		
		PLEASE PAY THIS AMOUNT	675.00		
		I acknowledge notice and oral approval of an increase in the original estimated price.			
		X CUSTOMER SIGNATURE			
		NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.			
		X CUSTOMER SIGNATURE			

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

SERVICE ADVISOR TRAVIS CHAVEZ

BAR # ARD267177 EPA# CAL000368341

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
01JUN12	26JUL12	C000813	SBM11AAA7CW000813	C000813	T813		26JUL12	10227
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:24	14:54	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
49	49							

TECH.	TYPE	HOURS	START	END/UNIT	TOTAL
A	Sublet Matte black wrapping installation to rear bumper, side panels and vanes, smoke out side marker lights, and Windshield skin CB SUBLET INSTALL OF PROTECTIVE CLEAR BRA	573	IMCNC	0.00	(N/C)
SUBL	Sublet side marker smoke color installation and windshield skin PO#139681		IMCNC		(N/C)
B**	Tow vehicle to clients residence TOW TOW VEHICLE	573	IMCNC	0.00	(N/C)
SUBL	Tow vehicle to clients residence, Vin #CW000813, Inv #14286, 05/28/2012 PO#139683		IMCNC		(N/C)
C**	Client will be paying for the added matte black wrapping to the rear bumper side vanes and turning vanes. CB SUBLET INSTALL OF PROTECTIVE CLEAR BRA	573	CMC	0.00	0.00
SUBL	Sublet matte black wrapping installation to the rear bumper, side vanes and				

DESCRIPTION	TOTALS	ORIG. EST.	AUTHORIZED ADDITIONS
LABOR AMOUNT		\$	\$
PARTS AMOUNT			
GAS,OIL, LUBE			
SUBLET AMOUNT			
MISC. CHARGES			
TOTAL CHARGES			
LESS INS./ADJ.			
SALES TAX			
PLEASE PAY THIS AMOUNT			

I acknowledge notice and oral approval of an increase in the original estimated price.

CUSTOMER SIGNATURE

NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE
NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.

CUSTOMER SIGNATURE

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY



BEVERLY HILLS

9022 WILSHIRE BLVD.
BEVERLY HILLS, CA 90211
(866) 311-6819Email: McLarenService@TheAutoGallery
www.McLarenBeverlyHills.com

BAR # ARD267177 EPA# CAL000368341

SERVICE ADVISOR TRAVIS CHAVEZ

REPAIR ORDER WRITTEN	DATE READY	STOCK NO.	VEHICLE IDENTIFICATION	CUST. NO.	TAG NO.	P.O. NO.	INVOICE PRINTED	INVOICE NO.
01JUN12	26JUL12	C000813	SBM11AAA7CW000813	C000813	T813		26JUL12	10227
TIME IN	TIME READY	YEAR	MAKE & MODEL	TELEPHONE NO.	CUST. PAY LABOR RATE	DELIVERY DATE	PREPARED BY	S/A
10:24	14:54	12	MCLAREN MP4-12C			17MAY12	388	388
MILEAGE IN	MILEAGE OUT	LICENSE NO.						
49	49							

TECH.	TYPE	HOURS	UNIT/UNIT	NET/AMT	TOTAL
turning vanes	CMC			675.00	675.00

THE AUTO GALLERY

** PRE-INVOICE **

DESCRIPTION	TOTALS
LABOR AMOUNT	0.00
PARTS AMOUNT	0.00
GAS,OIL, LUBE	0.00
SUBLET AMOUNT	675.00
MISC. CHARGES	0.00
TOTAL CHARGES	675.00
LESS INS./ADJ.	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	675.00

ORIG. EST. \$	AUTHORIZED ADDITIONS \$
I acknowledge notice and oral approval of an increase in the original estimated price.	
X CUSTOMER SIGNATURE	
NOT RESPONSIBLE FOR LOOSE ARTICLES LEFT IN VEHICLE NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON REVERSE SIDE.	
CUSTOMER SIGNATURE	
X	

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER COPY