



**Hammond Autowerks**

4349 B Montgomery Dr.  
Santa Rosa, CA. 95405  
Phone: 707-538-4325

**INVOICE**


**27607**

Org. Est. # 067345  
BAR #ARD00258579  
EPA #CAL000405349

**INVOICE**

Printed Date: 11/03/2021

Work Completed: 11/02/2021

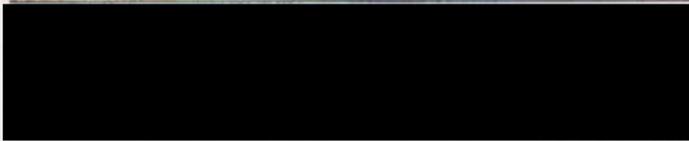

2012 Mercedes-Benz - SLS - 6.3L, V8 (379CI) VIN(Not Available)  
Lic # : 8XNT329 Odometer In : 13072

VIN # : WDDRK7HA2 CA008192

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
fuel filter 221 470 20 90	1.00	132.00	132.00	Per customer, smells fuel - worse when filling tank - no leaks under car; Check and advise;	135.00
seal ring 211 471 01 79	1.00	33.50	33.50	Inspect car confirm complaint, suspect fuel tank filter/pump leaking, suggest remove in what ever necessary to confirm and repair	
ring 211 471 01 10	1.00	3.40	3.40	Set Tire Pressures to specifications Tire pressures have been set to specifications:	n/c
Battery MTX-48/H6	1.00	219.95	219.95	31 psi Front, 35 psi Rear Per customer, when something comes in front on the car - command center says check all surroundings; check and advise; Check for software for command system, found no newer software available, no updates available, found some after market radar detector equipment may have some adverse affect on system, no suggested repairs at this time	n/c
				Per customer, idle seems way too high; Check and advise; re set cold idle settings found only about 50-75 rpm lower, no other adjustments available and no engine or transmission updates at this time	n/c
				Check for software updates Check entire car for updates, tel aid update available , down load and install, no other updates available at this time	n/c
				Fuel	35.46
				FUEL FILTER - REMOVE AND REPLACE INCLUDES REMOVING ROLL OVER PROTECTION Remove both front seats, remove rear carpeting, remove plastic around head roll over bars, remove rear SAM and fuse box, remove tel aid unit, remove top and front protective shields, unbolt and raise up roll over support and hoops, remove and replace leaking fuel filter, install new , add fuel and run car , fuel leak is no longer present, some fuel smell does persist due to fuel soaked padding ( replacements un obtainable ) fuel smell should dissipate over time, re assemble car in reverse order During repairs found incorrect battery and not properly installed, suggest replacing battery and properly installing	1,755.00
				Install battery	67.50
				[ Discount ] \$135.00 off labor	



**INVOICE**

**Hammond Autowerks**  
4349 B Montgomery Dr.  
Santa Rosa, CA. 95405  
Phone: 707-538-4325

**INVOICE**

**27607**

Org. Est. # 0673  
BAR #ARD002585  
EPA #CAL0004053

Printed Date: 11/03/2021

Work Completed: 11/02/20:

2012 Mercedes-Benz - SLS - 6.3L, V8 (379CI) VIN(Not Availab  
Lic #: 8XNT329 Odometer In : 1307

VIN #: WDDRK7HA2 CA008192

Part Description / Number	Qty	Sal	Ext	Labor Description	E
---------------------------	-----	-----	-----	-------------------	---

Org. Estimate 170.46 Revisions 2,112.32 Current Estimate 2,282.78

Revision # 1, Previous Estimate Amount: 170.46, Additional Cost: 1904.52, Revised Estimate: 1974.98, Parts: \$168.90 Labor: \$1620.00 Sublet: \$0.00  
Taxes & Fees: \$15.62 Authorized by: Matthews, Pat. Date: 11/2/2021, Time: 9:22 AM, Initiated By: Shop, Written By: Hammond, Craig Reason:  
fuel leak. Phone Number - Cellular: 925-676-4543xcell

Revision # 2, Previous Estimate Amount: 2109.98, Additional Cost: 307.80, Revised Estimate: 2417.78, Parts: \$219.95 Labor: \$67.50 Sublet: \$0.00  
Taxes & Fees: \$20.35 Authorized by: Matthews, Pat. Date: 11/2/2021, Time: 9:55 AM, Initiated By: Shop, Written By: Hammond, Craig Reason:  
correct battery. Phone Number - Cellular: 925-676-4543xcell

Labor:	1,957.50
Parts:	388.85
Sublet:	35.46
Discount:	-135.00
SubTotal:	2,246.81
Tax:	35.97
Total:	2,282.78
Bal Due:	\$0.00

[ Payments - Check - \$2,282.78 ]

Vehicle Received: 11/2/2021

Customer Number : 1712

Thank you for allowing us to service your vehicle. We appreciate your patronage.  
Warranty on parts and labor is one years or 12,000 miles whichever comes first, unless noted otherwise. Warranty work has to be performed in our shop & cannot exceed the original  
cost of repair. Incidental costs incurred (hotel, towing, rental, etc. will not be covered.

Signature \_\_\_\_\_ Date \_\_\_\_\_

Visit us on the web: [www.hammondautowerks.com](http://www.hammondautowerks.com)

Email Address: [hammondautowerks@att.net](mailto:hammondautowerks@att.net)

Service Advisor: Hammond, Craig Tech: Please Select, Technician: Hammond, i

**Hammond Autowerks**  
 4349 B Montgomery Drive  
 Santa Rosa, CA. 95405  
 Phone: 707-538-4325


**INVOICE**

**28724**

BAR #ARD00258579  
 EPA #CAL000405349

**INVOICE**

Printed Date: 05/04/2022 Work Completed: 04/12/2022

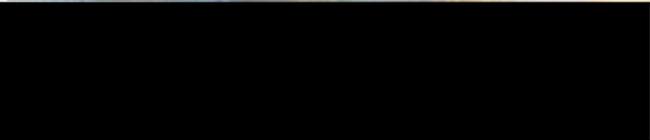

2012 Mercedes-Benz - SLS - 6.3L, V8 (379CI) VIN(Not Available)  
 Lic # : 8XNT329 Odometer In : 13147

VIN # : WDDRK7HA2 CA008192

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
Oil Filter Kit - w/ O-Ring 000 180 30 09	1.00	14.50	14.50	Perform Basic Service *	72.50
M5W40 Engine Oil M5W40	8.00	8.99	71.92	Brake fluid <1%. Engine air filters ok. Battery tested 889/760CCA. Front tires 7mm with 6.5mm edges. Rear tires 6mm with 5.5mm edges. Front brakes 9mm and rear brakes 8mm	
Michelin Pilot Super Sport 275/35ZR19 MICH-10300	2.00	442.78	885.56	* Includes: Oil and filter change, basic brake inspection and fluid testing (rotor measuring may be extra), lamp inspection and bulb replacement (most vehicles), suspension inspection, basic battery inspection and testing, top off washer fluid, check all fluids (if applicable), check wiper blades, check tire wear, check and adjust spare tire pressure, check engine air and cabin filters (on most vehicles), check for leaks, check drive belt.	
CA Tire tax	2.00	1.75	3.50		
Tire disposal fee	2.00	4.00	8.00		
Michelin Pilot Super Sport 305/30ZR20 MICH-48442	2.00	600.72	1,201.44	Set Tire Pressures to specifications	n/c
CA Tire tax	2.00	1.75	3.50	Tire pressures have been set to specifications:	
Tire disposal fee	2.00	4.00	8.00	31psi Front, 35psi Rear	
				Scan car for codes	n/c
				Scanned vehicle and saved report.	
				If possible - check spare tire	n/c
				Car does not have a spare	
				Mount and balance 4 tires	108.00
				Set Tire Pressures to specifications	n/c
				Tire pressures have been set to specifications:	
				psi Front, psi Rear	
				Hazardous Materials	5.00

Org. Estimate 191.56 Revisions 0.00 Current Estimate 191.56

Labor:	180.50
Parts:	2,173.42
Fee(s):	28.00
SubTotal:	2,381.92
Tax:	201.04
Total:	2,582.96
Bal Due:	\$0.00

[ Payments - Check (#2530) - \$2,582.96 ]

Vehicle Received: 4/12/2022

Customer Number : 1712

Thank you for allowing us to service your vehicle. We appreciate your patronage.  
 Warranty on parts and labor is one years or 12,000 miles whichever comes first, unless noted otherwise. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Incidental costs incurred (hotel, towing, rental, etc. will not be covered.

Signature \_\_\_\_\_ Date \_\_\_\_\_

Visit us on the web: [www.hammondautowerks.com](http://www.hammondautowerks.com)

Email Address: [hammondautowerks@sonic.net](mailto:hammondautowerks@sonic.net)

**Hammond Autowerks**

4349 B Montgomery Drive  
 Santa Rosa, CA. 95405  
 Phone: 707-538-4325 Fax: - -


Sub Estimate For Or

028724

BAR #ARD00258579  
 EPA #CAL000405349

Estimate Date : 5/4/2022

**Estimate for Services**

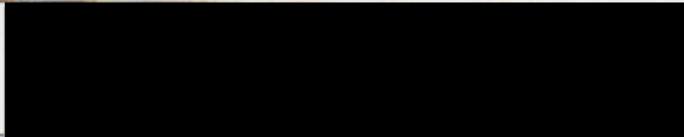

2012 Mercedes-Benz - SLS - 6.3L,V8 (379CI) VIN(Not Availab  
 Lic #: 8XNT329 - CA Odom. In: 13147

VIN #: WDDRK7HA2 CA008192

Part Description / Number	Qty	Sale	Ext	Labor Description	Hours	Extended
speaker 197 820 04 02	2.00	154.41	308.82	Hazardous Materials		5.00
floor 197 680 06 40 9G07	1.00	723.53	723.53			
int lamp 207 820 02 01 9051	1.00	432.35	432.35			
support 197 684 00 37	1.00	347.65	347.65			
floor 197 686 01 79 9G07	1.00	166.76	166.76			
197 690 00 07 COVER FRONT LOUDSPEAKER 197 690 00 07	2.00	264.71	529.42			
197 690 00 06 MOUNTING FRAME FRONT LOUDSPEAKER 197 690 00 06	2.00	29.84	59.68			
221 820 02 02 SPEAKER 221 820 02 02	2.00	43.67	87.34			
197 820 05 56 LICENSE PLATE LAMP 197 820 05 56	1.00	22.94	22.94			
171 820 99 10 SWITCH SEAT ADJUSTMENT, RIGHT 171 820 99 10	1.00	247.06	247.06			

*Total: 5,184.12*

Parts/Supplies: 2,925.55 Labor: 0.00 HazMat/Fees: 5.00 Tax: 270.61 Total: \$ 3,201.16

Thank you for allowing us to service your vehicle. We appreciate your patronage.  
 Warranty on parts and labor is one years or 12,000 miles whichever comes first, unless noted otherwise. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Incidental costs incurred (hotel, towing, rental, etc. will not be covered.

Signature \_\_\_\_\_ Date \_\_\_\_\_ Time \_\_\_\_\_



**Hammond Autowerks**  
 4349 B Montgomery Drive  
 Santa Rosa, CA. 95405  
 Phone: 707-538-4325

**INVOICE**

**29056**

Org. Est. # 069028  
 BAR #ARD00258579  
 EPA #CAL000405349

**INVOICE**

Printed Date: 06/08/2022    Work Completed: 06/08/2022

2012 Mercedes-Benz - SLS - 6.3L, V8 (379CI) VIN(Not Available)  
 Lic # : 8XNT329    Odometer In : 13517

VIN # : WDDRK7HA2 CA008192

Part Description / Number	Qty	Sale	Ext	Labor Description	Ext
D/F PLUG 001 990 87 17	1.00	8.80	8.80	<b>DCT TRANSMISSION SERVICE - DIFF SERVICE</b> Raised vehicle. Removed rear under panel. Removed protective engine brace. Disconnected electrical connector for electronic parking brake, removed mounting nuts for electronic parking brake assembly, and set aside. Removed transmission protective brace. Using graduated cylinder, removed both drain plugs, and measured quantity of oil drained(about 3qts). Re-installed drain plugs and torqued to specification. Filled assembly with gear oil and set level. Using graduated cylinder, removed transmission drain, removed fill plug, and measured oil quantity(about 6qts). Installed new drain plug and torqued to specification. Filled transmission fluid, turned vehicle on, let vehicle get to operating temperature, and set oil level. Re-assembled in reverse order. Test drove vehicle.  Set Tire Pressures to specifications Tire pressures have been set to specifications:  31 psi Front, 35 psi Rear  Hazardous Materials	270.00
D/F PLUG 002 990 08 17	1.00	9.90	9.90		n/c
CRC Brakleen Size: 14 OZ. 05050	1.00	9.12	9.12		
ATF 001 989 86 03 09	7.00	28.05	196.35		
gear oil 001 989 87 03 09	3.00	32.10	96.30		

Org. Estimate 620.69    Revisions 0.00    Current Estimate 620.69

Labor:	270.00
Parts:	320.47
HazMat:	5.00
SubTotal:	595.47
Tax:	29.64
Total:	625.11
Bal Due:	\$0.00

[ Payments - Check (#2534) - \$625.11 ]

Vehicle Received: 6/6/2022

Customer Number : 1712

Thank you for allowing us to service your vehicle. We appreciate your patronage.  
 Warranty on parts and labor is one years or 12,000 miles whichever comes first, unless noted otherwise. Warranty work has to be performed in our shop & cannot exceed the original cost of repair. Incidental costs incurred (hotel, towing, rental, etc. will not be covered.

Signature \_\_\_\_\_ Date \_\_\_\_\_

Visit us on the web: [www.hammondautowerks.com](http://www.hammondautowerks.com)

Email Address: [hammondautowerks@sonic.net](mailto:hammondautowerks@sonic.net)



# Hammond Autowerks

4349 B Montgomery Drive  
 Santa Rosa, CA. 95405  
 Phone: (707)-538-4325  
 hammondautowerks.com | hammondautowerks@sonic.net

Invoice # 036098  
 Original Est # 77297  
 BAR #ARD00258579  
 EPA #CAL000405349

## Invoice

Balance Due: \$217.66

### 2012 Mercedes-Benz - SLS

6.3L V8 (379CI) VIN(Not Available)  
 License Plate: 8XNT329 CA  
 Odometer: In 15,912  
 Engine Hr: In 0.0

VIN: WDDRK 2CA008192  
 Color: White

Work Complete: 06/12/2025  
 Service Advisor: Marc Brady  
 Customer ID: 1712

Type	Description	Qty/Hr	Sale/Rate	Total
<b>Perform Basic Service *</b>				<b>\$206.17</b>
Labor	Perform Basic Service * All lights work properly. Wipers ok. Battery tested 'Good Battery'(941/760CCA). Drive Belt has marginal wear on flat side. Brake Fluid moisture tested 1.6%. Air Filters are marginal. Brake Pad wear Front 9mm Rear 8mm. Tire wear Front 6.5mm Rear Left 6.5mm(with 6mm inner tread) Rear Right 6.5mm(with 5.5mm inner tread).	0.50 hr		\$100.00
Note	* Includes: Oil and filter change, basic brake inspection and fluid testing (rotor measuring may be extra), lamp inspection and bulb replacement (most vehicles), suspension inspection, basic battery inspection and testing, top off washer fluid, check all fluids (if applicable), check wiper blades, check tire wear, check and adjust spare tire pressure, check engine air and cabin filters (on most vehicles), check for leaks, check drive belt.			
Part	Oil Filter Kit	1.00	\$21.00	\$21.00
Part	Engine Oil	8.40	\$8.99	\$75.52
Labor	Set Tire Pressures to specifications Tire pressures have been set to specifications:  31 psi Front, 35 psi Rear	0.00 hr	\$175.00	\$0.00
Labor	Scan car for codes (Note any current faults and if CEL indicator is on) No CEL indicator on at this time. Using XENTRY,scanned vehicle for faults. Found no codes in engine or transmission.	0.00 hr	\$175.00	\$0.00
Labor	If possible - check spare tire Vehicle is not equipped with spare tire.	0.00 hr	\$175.00	\$0.00
Parts: \$96.52      Labor: \$100.00      Tax: \$9.65      Total: \$206.17				
<b>Order</b>				<b>\$11.49</b>
Misc	Haz Mat.			\$5.00
Misc	CC Charges			\$5.90
Total: \$11.49      Tax: \$0.59				

217.66