

Labor Rate: 50.00
Parts Charge: 10%

Date Started:

Customer Name:

Address:

Phone:

Email:

Vehicle:

1966 230SL

VIN:

11304212016064

Repair wood, recover dash pads, fix slop in
Concerns: shifter.

Work Performed:	Description	Labor Hours	Cost
	Remove glove box, under-dash pads,		
4-May	radio, clock, right wood trim	1.25	62.50
	Remove steering wheel, speedo. Remove		
	left wood, remove dash pads, clean out		
8-May	urethane adhesive.	1.50	75.00
	Package & send dash pads and wood for re-		
9-May	finishing	1.00	50.00
23-May	Replace shifter bushings	2.50	125.00
23-May	Clean dash chrome	1.00	50.00
	Work on installing instruments, dash pads		
9-Jul	and wood	3.00	150.00
10-Jul	Work on installing dash pads and wood	4.00	200.00
	Re-glue glove box covering, install trim on		
	glove box door, install & align glove box &		
1-Aug	door, install lower dash pads for alignment	3.00	150.00

Install radio (needed shims to fit), install lower dash trim permanently, install			
2-Aug	wooden tray	3.00	150.00
Install tach, fasten glove box in place with			
3-Aug	correct screws and cup washers	1.00	50.00
3-Aug	Install and adjust new hood buffers	NC	0.00
Remove soft top hatch cover, take to Sure			
6-Aug	Fit Arlington, pick up, re-install	1.00	50.00
Troubleshoot instrument pod light not			
6-Aug	working.	NC	0.00
Install new "Emergency" washer, replace			
6-Aug	instrument light bulb	0.50	25.00
6-Aug	Engine health check	NC	0.00
Labor Total		22.75	1,137.50

Parts:	Description	Price	Quantity	Cost
ASC 832717	Shifter bushings & boots	103.27	1	103.27
ASC 836004	Gaskets, speedo, tach, instruments	64.21	1	64.21
	WRD thermo housing, air filter, shipping			
Pacific fuel injection	(not installed, in trunk)	325.00	1	325.00
ASC 838117	Washers for lower dash pads	3.19	6	19.17
ASC 838117	Washers for upper & pillar pads	2.33	10	23.25
ASC 838117	Hood buffers	4.62	2	9.24
ASC 838117	Escutcheon - hazard switch	13.74	1	13.74
ASC 838117	Escutcheon - light switch	22.00	1	22.00
	Misc screws, washers, instrument light			
FSG	bulb, knurled nut for clock.	5.00	1	5.00
ASC 840676	Glove box screws	8.76	1	8.76
eBay	"Emergency" washer + shipping	40.00	1	40.00
Benz Restorer	Firewall pad (not installed, in trunk)	156.32	1	156.32
				0.00
	Total			789.96
	Parts Charge			79.00
	Parts Total			868.96

Other:	Description	Cost
UPS	Shipping - pads	17.19
UPS	Shipping - wood	22.57
Oldtimer	Dash pad recover + material	825.55
Heritage	Refinish dash wood	492.50
Sure Fit	Re-cover soft top hatch lid	150.00

Other Total		1,507.81
-------------	--	----------

Invoice Total		3,514.27
---------------	--	----------

since 1979

autohausAZ

Your Online Warehouse Source for Discount Auto Parts

3341 East Corona Ave | Phoenix, AZ 85040

Sales (800) 240-4620 | Fax (602) 276-6716

www.AutohausAZ.com

Shipping Info:

Customer Info:

Order Number	Order Placed	Order Shipped
494102	11/02/2010 11:23 AM	11/03/2010
Invoice	Shipped Via	Payment
516199	UPS Ground	American Express

Comments					
Qty	Part Number	Description	List Price	Your Price	Total
2	000 180 00 09	Mann Oil Filter Kit; Cartridge Filter; 115 x 68mm (approx. 4.5 inch x 2.7 inch)	\$13.50	\$4.57	\$9.14
1	000 428 31 35	ATE/Pex Brake Hose/Line; Rear Right;; 26.5cm Length with 2 Female Connections	\$40.00	\$13.25	\$13.25
1	000 428 93 35	Meyle Brake Hose/Line; Rear Left; 25cm(9 3/4 inch) Length with 1 Male + 1 Female End	\$80.00	\$10.41	\$10.41
2	123 428 05 35	Pex Brake Hose/Line; Front; 44.5cm (17.5 inch) Length with 1 Male + 1 Female End	\$19.50	\$9.44	\$18.88

Parts Total - Including Core Deposits \$51.68
 Sales Tax (AZ Residents Only) \$0.00
 Shipping/Handling Charges \$0.00

Invoice Total \$51.68

Thank You For Your Order - Have a Really Great Day!

AutohausAZ strives to be both customer and environment friendly.
 We make every effort to use recyclable packing materials whenever possible.

Packed By: _____

Checked By: _____

Please carefully verify the accuracy of your ordered parts immediately upon receipt and prior to installation.

since 1979


autohausAZ

Your Online Warehouse Source for Discount Auto Parts

3341 East Corona Ave | Phoenix, AZ 85040

Sales (800) 240-4620 | Fax (602) 276-6716

www.AutohausAZ.com

Shipping Info: 

Customer Info:

Order Number	Order Placed	Order Shipped
499152	11/16/2010 09:39 AM	11/17/2010
Invoice	Shipped Via	Payment
521485	UPS Ground	American Express

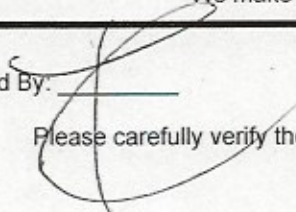
Comments					
Qty	Part Number	Description	List Price	Your Price	Total
1	001 430 63 01	ATE Brake Master Cylinder; 23.81mm Diameter	\$330.00	\$170.99	\$170.99

Parts Total - Including Core Deposits \$170.99
Sales Tax (AZ Residents Only) \$0.00
Shipping/Handling Charges \$0.00

Invoice Total \$170.99

Thank You For Your Order - Have a Really Great Day!

AutohausAZ strives to be both customer and environment friendly.
We make every effort to use recyclable packing materials whenever possible.

Packed By: Checked By: 

Please carefully verify the accuracy of your ordered parts immediately upon receipt and prior to installation.

WHITE POST RESTORATIONS

ONE OLD CAR DRIVE

P.O. DRAWER D

WHITE POST, VA 22663

(540) 837-1140

INVOICE

19298

DATE 11-17-10

Lele oferedis.

4-Shoes Belined 60- 240.⁰⁰2-wheel cylis complete 80- 160.⁰⁰WPS 20.⁰⁰420.⁰⁰THIS SLIP MUST ACCOMPANY
ALL CLAIMS AND RETURNED GOODS

PARTS INVOICE

CUST NO.	TAX EXEMPT NUMBER	CUST. P. O. NO.	SHIP VIA	PAY	SOLD BY	INVOICE DATE	INVOICE NO.
1007829			WILL CALL	PENDING	ROY A. CARTER	11/17/10	771662
B				S			MRR

B
I
L
L

SHIT

SHIP QTY	B. O. QTY	PART NUMBER / DESCRIPTION	BIN	LIST	NET	AMOUNT
1	0	000-431-45-02	EXPANSION TA	SP-ORD	116.09	92.87
1	0	004-997-32-45	SEAL RING, VL	SP-ORD	4.94	3.95
1	0	000-428-03-73	HOSE CLAMP	SP-ORD	3.33	2.66
					SUBTOTAL	99.48
					TAX	4.98
					FREIGHT	0.00
					PAY THIS AMOUNT	104.46

ORIGINAL MB PARTS HAVE A 12MTH UNLIMITED MIL
WARRANTY-TRANSMISSIONS 24/24 ENGINES 48/50
VISIT OUR WEBSITE-www.justmercedes.com

SPECIAL ORDER OR FACTORY
ORDERED ITEMS NOT RETURN-
ABLE. ELECTRICAL PARTS NOT
RETURNABLE. 20% HANDLING
CHARGE ON ALL MERCHANDISE
RETURNED FOR CREDIT. NO
REFUNDS OR EXCHANGES
WITHOUT THIS INVOICE. NO
REFUNDS AFTER 30 DAYS.

PARTS DEPT. HOURS MON. TO
FRIDAY 7:30 AM TO 6:00 PM

GENUINE MERCEDES-BENZ SPARE PARTS AND ACCESSORIES ARE COVERED BY A LIMITED WARRANTY OF 12 MONTHS, UNLIMITED MILEAGE. BE SURE TO ASK US FOR DETAILS.

ORIGINAL MB PARTS HAVE A 12MTH UNLIMITED MILE
WARRANTY-TRANSMISSIONS 24/24 ENGINES 48/50
VISIT OUR WEBSITE-www.justmercedes.com

CLIENT COPY

DIRECT PART LINE: 703-284-2450
WHOLESALE PARTS LINE 703-284-2420
FAX NO. 703-527-8359



Mercedes-Benz

American Service Center

585 NORTH GLEBE ROAD
ARLINGTON, VIRGINIA 22203
(703) 525-2100
www.justmercedes.com

10:43:04 PAGE 1 OF 1
NET503



TIRES!

*We handle most major brands...
and offer very competitive pricing*

All our tires include 2 years of road hazard insurance at no additional charge.



American Service Center

R.O. / Invoice No.

Coupon Expires 12/17/2010

T-12

CHARLES ARNOLD TAYLOR

Thank you for choosing our
Parts Department at
American Service Center

If at any time you have questions regarding available parts, don't hesitate to give me a call.

ROY A. CARTER
Parts Advisor
703-284-2540

CSAT-9

CHARLES ARNOLD TAYLOR

**American Service
Center
Wholesale Parts
Department**

*Our Parts Department gives
you over 100 years of
combined experience.*

866-559-5649

American Service Center

R.O. / Invoice No.

P. 7



PARTS INVOICE

CUST NO.	TAX EXEMPT NUMBER	CUST. P. O. NO.	SHIP VIA	PAY	SOLD BY	INVOICE DATE	INVOICE NO.
1007829				PENDING	ROY A. CARTER	11/23/10	772227 MBR

B
I
L
L
T
O

S
H
I
P
T
O

©2008 The Reynolds and Reynolds Company. All Rights Reserved. EPRINTFD-4E C0559032 Q (06/08)

SHIP QTY	B. O. QTY	PART NUMBER / DESCRIPTION	BIN	LIST	NET	AMOUNT
1	0	000-586-01-43 BRAKE MASTER <i>Repair kit</i>	SP-ORD	79.04	71.14	71.14
SUBTOTAL						71.14
TAX						3.56
FREIGHT						0.00
PAY THIS AMOUNT						74.70

SPECIAL ORDER OR FACTORY ORDERED ITEMS NOT RETURNABLE. ELECTRICAL PARTS NOT RETURNABLE. 20% HANDLING CHARGE ON ALL MERCHANDISE RETURNED FOR CREDIT. NO REFUNDS OR EXCHANGES WITHOUT THIS INVOICE. NO REFUNDS AFTER 30 DAYS.

PARTS DEPT. HOURS MON. TO FRIDAY 7:30 AM TO 6:00 PM

GENUINE MERCEDES-BENZ SPARE PARTS AND ACCESSORIES ARE COVERED BY A LIMITED WARRANTY OF 12 MONTHS, UNLIMITED MILEAGE. BE SURE TO ASK US FOR DETAILS.

ORIGINAL MB PARTS HAVE A 12MTH UNLIMITED MIL WARRANTY-TRANSMISSIONS 24/24 ENGINES 48/50
**VISIT OUR WEBSITE-www.justmercedes.com **

CLIENT COPY

DIRECT PART LINE: 703-284-2450
WHOLESALE PARTS LINE 703-284-2420
FAX NO. 703-527-8359



Mercedes-Benz

American Service Center

585 NORTH GLEBE ROAD
ARLINGTON, VIRGINIA 22203
(703) 525-2100
www.justmercedes.com

11:36:56 PAGE 1 OF 1
NET503

Bill to:

Vehicle: 1966 230SL

VIN: 113 042 10 016064

Complaint: Noise and rough ride, vague steering, incorrect hoses and clamps

Action Taken: Inspected car, rear bottom spring pads completely worn through, shocks weak, bushings unknown. Steering generally worn, front shocks weak. Incorrect hoses and clamps, incorrect battery hold-down and J-hooks.

Recommendations: New shocks, steering components, alignment, new bushings in rear. Install correct hoses, clamps, and battery hold-down pieces.

Parts & Sub-Let

Description	Vendor	Status	Quantity	Price	Amount
Norma clamp kit for 230SL	PL	R	1	115.50	115.50
Hose (coolant reservoir, heater return)	ASC	R	1	32.60	32.60
Hose (injection coolant)	ASC	R	1	9.52	9.52
Hose (upper radiator)	ASC	R	1	86.94	86.94
Hose (lower radiator)	ASC	R	1	57.61	57.61
Hose (heater feed)	ASC	R	1	44.56	44.56
Hose (Y-pipe - water pump)	ASC	R	1	18.48	18.48
Battery J-bolts	ASC	R	2	16.84	33.68
Drag Link	ASC	R	1	176.07	176.07
Tie rods	AZ	R	2	54.98	109.96
Spring shim, top (returned)	AZ	R	2	0.00	0.00
Spring shim, bottom	AZ	R	2	15.16	30.32
Front trailing arm bushings	AZ	R	2	16.67	33.33
Rear trailing arm bushings	AZ	R	4	7.30	29.22
Steering damper	AZ	R	1	30.80	30.80
Front shocks	AZ	R	2	109.80	219.60
Rear shocks	AZ	R	2	110.72	221.43
Battery hold-down bracket	CAT	R	1	25.00	25.00
Alignment - Hogan & Sons	HS	D	1	173.43	173.43
Boot for valve cover vent	ASC	R	1	8.66	8.66
Parts Total					1,456.70

Labor

Rate/hr: 50.00

Description	Hours	Amount
Pick up and return car	0.5	25.00
Raise car, evaluate rear susp. & steering	0.5	25.00
Remove trailing arms, replace bushings	2.0	100.00
R/R rear shocks, re-install trailing arms	2.0	100.00
Remove hose clamps and hoses	1.0	50.00
Install new hoses and clamps	1.0	50.00
R/R steering components	3.0	150.00
R/R front shocks	1.0	50.00
R/R battery hold-down and J-bolts	0.5	25.00
Drive car to/from alignment shop	0.5	25.00
R/R "cotter key" clamps on brake line	1.0	50.00
		0.00
		0.00
		0.00
Labor Total	13.0	650.00

Invoice Total	2,106.70
----------------------	-----------------

Clamp kit for 230SL

- 2 EA 46mm Large diameter rad hose ends
- 4 ea 41mm for small end of rad hose and bypass hose
- 1 ea 26mm breather hose at valve cover
- 1 ea 27mm expansion tank lower hose at Y fitting
- 14 24mm for heater and water hoses
- 2 ea 21mm for power steering low pressure return
- 22ea 19mm for water and air
- 2 ea 13mm for overflow from expansion tank to radiator
- 6 5 mm beru for vacuum line

Thanks,
and Good Luck

Order Number	Order Placed	Order Shipped
551047	04/12/2011 06:35 PM	04/14/2011
Invoice	Shipped Via	Payment
575900	UPS 3 Day	American Express

Comments
BRING TO PL FOR INSPECTION SHIP 4/14 We regret to inform you that our stock for center link part number 110 460 02 05 has been depleted. We have checked with several of our direct importers and found that this part is now on back order with no expected delivery date. We are certainly sorry for this inaccuracy in our catalog and any inconvenience this may cause you. The remainder of your order is available and currently scheduled to ship tomorrow. However, if you would like to make any changes to your order due to the stock outage of part number 110 460 02 05, please let us know by tomorrow morning. Otherwise, we will ship the remainder of your order so as not to delay the delivery of the other parts you selected.

Qty	Part Number	Description	List Price	Your Price	Total
2	107 330 01 03LEM	Lemfoerder Tie Rod Assembly; Left/Right	\$85.00	\$49.98	\$99.96
2	108 325 01 85	Genuine Mercedes Coil Spring Shim; Rear Left/Right (Top); 30mm	\$49.85	\$37.76	\$75.52
2	110 325 01 85	CRP Coil Spring Shim; Rear Left/Right (Bottom)	\$14.98	\$13.78	\$27.56
2	110 352 10 65	Genuine Mercedes Trailing Arm Mount Bushing; Rear Left/Right - Front of Trailing Arm to Chassis	\$18.50	\$15.15	\$30.30
4	110 352 18 65	Genuine Mercedes Trailing Arm Mount Bushing; Cone-Shaped Bushing to Rear Axle Housing	\$8.00	\$6.64	\$26.56
0	110 460 02 05	Febi Drag Link/Center Link	\$147.00	\$53.95	\$0.00
1	363952	Stabilus-Boge Steering Damper	\$52.39	\$28.00	\$28.00
2	B360529	Bilstein Shock Absorber; Front Left/Right; Heavy Duty 4 Stripe	\$272.00	\$99.82	\$199.64
2	B460539	Bilstein Shock Absorber; Rear Left/Right; Heavy Duty 4 Stripe	\$272.00	\$100.65	\$201.30

Parts Total - Including Core Deposits \$688.84
 Sales Tax (AZ Residents Only) \$0.00
 Shipping/Handling Charges \$54.73

Invoice Total **\$743.57**

Thank You For Your Order - Have a Really Great Day!

AutohausAZ strives to be both customer and environment friendly.
 We make every effort to use recyclable packing materials whenever possible.

Packed By: 10

Checked By: 82

Please carefully verify the accuracy of your ordered parts immediately upon receipt and prior to installation.



PARTS INVOICE

CUST NO.	TAX EXEMPT NUMBER	CUST. P. O. NO.	SHIP VIA	PAY	SOLD BY	INVOICE DATE	INVOICE NO.
1007829				CHARGE	ROY A. CARTER	04/25/11	789066 MBR

B
I
L
L

S
H
I
P
T
O

SHIP QTY	B. O. QTY	PART NUMBER / DESCRIPTION	BIN	LIST	NET	AMOUNT
1	0	900271-012018	SP-ORD	37.05	29.64	29.64
1	0	127-203-00-82	SP-ORD	10.81	8.65	8.65
1	0	113-501-06-82	SP-ORD	98.80	79.04	79.04
1	0	113-501-04-82	SP-ORD	65.46	52.37	52.37
1	0	113-831-08-94	SP-ORD	50.64	40.51	40.51
1	0	900271-018038	2B1	10.71	7.20	7.20
1	0	111-831-00-94	SP-ORD	21.00	16.80	16.80
2	0	186-541-01-24	SP-ORD	19.14	15.31	30.62
1	0	110-460-02-05	SP-ORD	200.07	160.06	160.06
SUBTOTAL						424.89
TAX						21.25
FREIGHT						0.00
PAY THIS AMOUNT						446.14

ORIGINAL MB PARTS HAVE A 12MTH UNLIMITED MIL
WARRANTY-TRANSMISSIONS 24/24 ENGINES 48/50
**VISIT OUR WEBSITE-www.justmercedes.com **

*Not used
- not charged*

SPECIAL ORDER OR FACTORY
ORDERED ITEMS NOT RETURN-
ABLE. ELECTRICAL PARTS NOT
RETURNABLE. 20% HANDLING
CHARGE ON ALL MERCHANDISE
RETURNED FOR CREDIT. NO
REFUNDS OR EXCHANGES
WITHOUT THIS INVOICE. NO
REFUNDS AFTER 30 DAYS.

PARTS DEPT. HOURS MON. TO
FRIDAY 7:30 AM TO 6:00 PM

GENUINE MERCEDES-BENZ SPARE
PARTS AND ACCESSORIES ARE
COVERED BY A LIMITED WAR-
RANTY OF 12 MONTHS, UNLIMITED
MILEAGE. BE SURE TO ASK US FOR
DETAILS.

CLIENT COPY

DIRECT PART LINE: 703-284-2450
WHOLESALE PARTS LINE 703-284-2420
FAX NO. 703-527-8359



Mercedes-Benz

American Service Center

585 NORTH GLEBE ROAD
ARLINGTON, VIRGINIA 22203
(703) 525-2100
www.justmercedes.com

11:43:22 PAGE 1 OF 1
NET503

HOGAN & SONS INC

OWNED & OPERATED BY A PROUD GOODYEAR INDEPENDENT DEALER
7451 LEE HIGHWAY, WWW.HOGANANDSONSINC.COM
FALLS CHURCH, VA 22042
(703)289-9660
FEDERAL TAX ID# 541252393
FALLSCHURCH@HOGANANDSONSINC.COM



INVOICE
076782

05/06/11 05/06/11
02:04 PM 03:30 PM
TERR: 1752
NONSIG: 184878

PAGE: 01

BILL TO:

PHONE 1
PHONE 2.....
DATE REQUESTED 05/06/11
TIME REQUESTED
RETURN PARTS.. NO
SALESMAN..... 008 / 010
PRIOR INVOICE. 66705

VEH YEAR/MAKE. 66 MERCEDES BENZ
VEHICLE MODEL. 230 SERIES
VEHICLE COLOR. RED
LICENSE/STATE. GET TAG / VA
ODOMETR IN/OUT 97875 / 97875
ENG. SIZE..... 6-2292 2.3L SOHC

ACCOUNT # COB TC CUST# TYPE/STATE AUTHORIZATION CREDIT CARD NO.
175200052 A 01 14180 0 VA 126461 HDC 5004

SLSM	TECH	PRODUCT CODE	BC	QTY	DESCRIPTION	PARTS	LBR/EXCISE	LINE TOTAL
008	066	078-147	R	1	WHEEL ALIGNMENT SPECIALTY VEHICLE	.00	159.99	159.99

PLEASE VISIT OUR WEBSITE: WWW.HOGANANDSONSINC.COM
FOLLOW US ON FACEBOOK: FACEBOOK.COM/HOGANANDSONSINC

X-----
CUSTOMER AUTHORIZATION FOR TOTAL

INVOICE TOTAL

PARTS TOTAL..... .00
LABOR TOTAL..... 159.99
MISC SHOP SUPPLIES: 12.80
SUB TOTAL..... 172.79
SALES TAX..... .64

CHARGED AMOUNT 173.43
TAXABLE AMOUNT 12.80

\$173.43

TREAD L/F..... 9/32 TREAD R/F..... 9/32 TREAD R/R..... 9/32 TREAD L/R..... 9/32

SEE REVERSE SIDE FOR IMPORTANT SAFETY WARNING AND WARRANTY INFORMATION

HAVE A QUESTION OR PROBLEM?

Please tell our store manager. We value your opinion as much as your business. Should you need additional assistance, call our
CUSTOMER ASSISTANCE LINE 1-800-321-2136



Farland
CLASSIC RESTORATION

3800 S. Kalamath Street
Englewood, Colorado 80110
303-761-1245

Invoice

Date	Invoice #
8/13/2018	8541

Bill To

JOB	TERMS	DUE DATE	VIN #
1967 Mercedes 230 ...	Due on Receipt	8/13/2018	...

Description	Qty	Rate	Amount
*Monday 07/30/18 THROUGH *Friday 08/10/18: PAINTLESS DENT REPAIR : LEFT FRONT FENDER LEFT FRONT DOOR LEFT REAR QUARTER DECK RIGHT REAR QUARTER RIGHT FRONT DOOR RIGHT FRONT FENDER HOOD		875.00	875.00
*Monday: 08/06/18: Jim : Place car on lift, steam clean & pressure wash under side of car, air dry engine & compartment, clean & remove grease & rust as needed, remove from lift	4.5	95.00	427.50
*Wednesday: 08/08/18: Aaron : Remove driver side & passenger side door panels, remove both taillights	2	95.00	190.00
Labor Subtotal			1,492.50

Thank You For Your Business! Jack Farland

Sales Tax (7.75%) \$0.00

Total \$1,492.50



farland
CLASSIC RESTORATION

3800 S. Kalamath Street
Englewood, Colorado 80110
303-761-1245

Invoice

Date	Invoice #
8/24/2018	8585

Bill To

JOB	TERMS	DUE DATE	VIN #
1967 Mercedes 230 ...	Due on Receipt	8/24/2018	...

Description	Qty	Rate	Amount
*Monday 08/13/18 THROUGH *Friday 08/24/18:			
*Tuesday: 08/14/18: Jim : Clean, scrub & remove rust from the bottom side of trunk mat, clean, prep & paint black, cover & tape all rocker panels, prep & apply under-coat, reinstall tail lights, remove hard-top, wash & clean soft top, hand wash exterior, hand polish soft top window, scrub & clean tires, clean hardtop	6.5	95.00	617.50
*Wednesday: 08/15/18: Jim : Clean hard top head liner, sand paint to remove scratches on hardtop, buff & polish hard top, buff & polish clam shell as needed, reinstall hard top, wet sand paint bubbles on hood & trunk with 3000 grit sand paper, begin buffing & polishing with compound & yellow wool pad	7	95.00	665.00
*Thursday: 08/16/18: Jim : Wet sand hood - 2000, 3000 grit sand paper, buff & polish with compound & yellow wool pad, buff & polish with yellow foam pad & polish, buff & polish with black foam pad & finishing polish	6.5	95.00	617.50
*Wednesday: 08/22/18: Aaron : Reinstall door panels	2	95.00	190.00
Labor Subtotal			2,090.00
UNDER-COATING		45.00	45.00T
BLACK SATIN TRIM COATING		35.00	35.00T
2000, 3000 GRIT SANDING DISCS		9.65	9.65T
WOOL PAD		18.00	18.00T
FOAM PAD	2	14.00	28.00T
BUFFING & POLISHING MATERIALS		35.00	35.00T
Material Subtotal			170.65
Thank You For Your Business! Jack Farland			
Sales Tax (7.75%)			\$13.23
Total			\$2,273.88



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #1212

Page 1 of 8
11/07/2022

1967 MERCEDES BENZ 230SL

1967 MERCEDES BENZ
230SL

Engine: 2.3L L6
Plate: 699HLQ
Odometer In: 98784
Odometer Out: 98784

Advisor: Peter Schiavoni
Technician: Bill Darling

GRAND TOTAL: \$880.91

✓ PAID

SERVICES

1 DIAGNOSTIC - FIRST HOUR OF TESTING

CLIENT STATES THERE IS A FUEL LEAK WHILE THE VEHICLE IS RUNNING, ADVISE. YOU CAN SEE THE FUEL LEAK, AND THERE APPEARS TO BE AN OIL LEAK AS WELL

LABOR

DIAGNOSTIC LABOR - FIRST HOUR OF TESTING

SUBTOTAL: \$69.50

Labor: \$69.50
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

2 *LUBE AND OIL CHANGE - UP TO 8 QUARTS EURO 6/8 CYL 5W30

LABOR

DRAIN AND FILL ENGINE OIL
REPLACE ENGINE OIL FILTER
REPLACE DRAIN PLUG GASKET
LUBRICATE SUSPENSION COMPONENTS AS NEEDED
SET TIRE PRESSURES TO SPECIFICATION
PERFORM MULTIPOINT VEHICLE HEALTH CHECK

PARTS

	QTY	EACH	TOTAL
OIL FILTER, DRAIN PLUG GASKET, AND MOTOR OIL	1.0	\$109.99	\$109.99
8100 X-CLEAN EFE 5W30 FULL SYNTHETIC ENGINE OIL	8.0	\$0.00	\$0.00
OIL FILTER KIT - G4	1.0	\$0.00	\$0.00

SUBTOTAL: \$179.99

Labor: \$70.00
Parts: \$109.99
Fees: \$0.00
Sublet: \$0.00

3 STANDARD VEHICLE HEALTH CHECK

LABOR

PERFORM MULTIPOINT VEHICLE HEALTH CHECK

SUBTOTAL: \$0.00

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

4 REAR DIFFERENTIAL SERVICE

LABOR

REAR DIFFERENTIAL SERVICE

PARTS

QTY	EACH	TOTAL
-----	------	-------

SUBTOTAL: \$162.78

Labor: \$94.80
Parts: \$67.98
Fees: \$0.00
Sublet: \$0.00



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #1212

Page 2 of 8
11/07/2022

1967 MERCEDES BENZ 230SL

Gear Oil GEARBOX 80W90 1L	2.0	\$33.99	\$67.98
---------------------------	-----	---------	---------

5 BRAKE FLUID EXCHANGE

SUBTOTAL: \$149.99

LABOR

PERFORM BRAKE FLUID EXCHANGE

Labor: \$125.00
Parts: \$24.99
Fees: \$0.00
Sublet: \$0.00

PARTS

DOT 4 BRAKE - 1 LITRE

QTY	EACH	TOTAL
1.0	\$24.99	\$24.99

6 ENGINE COOLANT SYSTEM FLUSH

SUBTOTAL: \$262.60

LABOR

PERFORM ENGINE COOLING SYSTEM FLUSH

Labor: \$187.50
Parts: \$75.10
Fees: \$0.00
Sublet: \$0.00

PARTS

COOLANT FLUSH AGENT -
G20

QTY	EACH	TOTAL
1.0	\$17.50	\$17.50

COOLANT - CONCENTRATE
CONVENTIONAL

QTY	EACH	TOTAL
2.0	\$28.80	\$57.60



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #1212

Page 3 of 8
11/07/2022

1967 MERCEDES BENZ 230SL

Terms of Service:

1. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

The Import Mechanics staff may operate my vehicle for the purpose of testing, inspection, and delivery.

3. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

4. "ABANDONED VEHICLES"

Vehicles left more than 72 hours after repairs are completed will incur a \$25 per day storage fee until the vehicle is picked up. Vehicles left in possession of The Import Mechanics for more than 30 consecutive days will be considered abandoned & will be subject to impound and sale.

5. "TEXT MESSAGE/ONLINE COMMUNICATION OK"

I welcome text message/email from The Import Mechanics as a means of receiving copies of my estimate, work order, and invoice.

6. "ESTIMATES ARE ESTIMATES"

We strive for perfection, however, often times finding and fixing one issue may reveal another. Therefore, all estimates shall be treated as "initial" repair steps, until a specific job is complete.

7. "CUSTOMER SUPPLIED PARTS"

We do not install customer supplied parts.

8. "REQUESTING A REFUND"

We only issue refunds under specific circumstances, such as for a prepaid part when a job is aborted or cancelled. We do not issue refunds, whether partial or full, on completed jobs.

9. "WARRANTY"

We warranty our workmanship for 12 months or 12,000 miles, whichever comes first. We do not warranty used parts, under any circumstance. All warranties are immediately rendered null and void if the vehicle is used in a manner inconsistent with its design and intended purpose, any repair shop or individual outside of The Import Mechanics performs any repairs on the vehicle after said repairs are performed. All warranty coverage is at the discretion of The Import Mechanics management.

10. "HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these ten terms.

GRAND TOTAL: \$880.91

Total Labor: \$546.80

Total Parts: \$278.06

Total Fees: \$0.00

Total Sublets: \$0.00

Shop Supplies: \$29.00

Sales Tax: \$27.05

✓ PAID

11-08-2022 1:45 PM

Paid by Credit Card: \$880.91

Authorization:

10/28/2022



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #1212

Page 4 of 8
11/07/2022

1967 MERCEDES BENZ 230SL

INSPECTION REPORT

DIAGNOSTIC - FIRST HOUR OF TESTING

☒ FINDINGS

THERE ARE OIL LEAKS FROM TRANSMISSION AND VARIOUS ENGINE OIL LEAKS. THERE IS COOLANT SEEPING FROM LOWER RAD HOSE AT RADIATOR AND WATER PUMP HOUSING HOSE CONNECTIONS BUT BOTH OF THESE ARE VERY MINOR. THE TECHNICIAN FOUND NO GAS LEAKING FROM ANYWHERE AT THIS TIME. FROM WHAT THE CLIENT DESCRIBED, PERHAPS THE FUEL PUMP HAD LEAKED, BUT NOT NOW. THE TECHNICIAN FOUND A MINOR GEAR OIL LEAK AT REAR AXLE.

OUT OF ALL OF THE LEAKS, THE TRANSMISSION LEAK IS THE LARGEST ONE. THE TECHNICIAN DOES NOT WANT TO PURSUE ANY OF THESE LEAKS BECAUSE OF HOW MINOR THEY ARE. DUE TO THE AGE OF THE VEHICLE AND THE TECHNICIAN'S EXPERIENCE, THESE VEHICLES WILL LEAK JUST AS MUCH AFTER THE REPAIR AS THEY DID BEFORE. PARTS AVAILABILITY IS ALSO A MAJOR CONCERN AT THIS TIME.

THE TECHNICIAN TOPPED UP TRANSMISSION FLUID AND RECOMMENDS MONITORING

*LUBE AND OIL CHANGE - UP TO 8 QUARTS EURO 6/8 CYL 5W30

☒ OTHER MAINTENANCE SERVICES DUE?

EXISTING FLUIDS ARE IN ROUGH SHAPE. THE REAR DIFFERENTIAL FLUID WAS EXPOSED TO MOISTURE WHICH TURNED THE OIL RED AND FOAMY. COOLANT HAS A HAZY COLOR TO IT AND IS TESTING BAD. BRAKE FLUID IS DARK IN COLOR AND SHOULD BE SERVICED FOR THE LONGEST LIFE OF THE BRAKING SYSTEM

- ☒ CHECK AIR FILTER (IF ACCESSIBLE)
- ☒ UNDER VEHICLE: PERFORM VISUAL INSPECTION OF HOSES, RADIATOR, SUSPENSION, AXLES, FUEL SUPPLY SYSTEM, BRAKE LINES, EXHAUST
- ☒ RIGHT FRONT (R/F) TIRE - PRESSURE: 32 PSI | DATE CODE YEAR: 10
- ☒ LEFT FRONT (L/F) TIRE - PRESSURE: 32PSI | DATE CODE YEAR: __10__
- ☒ LEFT REAR (L/R) TIRE - PRESSURE: 32 PSI | DATE CODE YEAR: __10__
- ☒ RIGHT REAR (R/R) TIRE - PRESSURE: 32PSI | DATE CODE YEAR: __10__

STANDARD VEHICLE HEALTH CHECK

- ☒ OVAL CIRCLE CLUB? PUBLISH "OVAL CIRCLE CLUB" IN NOTES IF YES.
- ☒ INSTRUMENT WARNING INDICATORS / SERVICE STICKER
- ☒ NOISES, VIBRATIONS, DRIVEABILITY
- ☒ CHECK WINDSHIELD AND WIPERS
- ☒ CHECK EXTERIOR LIGHTS
- ☒ PERFORM COMPLETE VISUAL INSPECTION OF ENGINE COMPARTMENT: BELTS, HOSES, WIRING, 12V BATTERY TERMINALS



The Import Mechanics

235 N Broadway, Denver, CO 80203

3039979998

service@importmechanics.com

Invoice #1212

Page 5 of 8

11/07/2022

1967 MERCEDES BENZ 230SL

☒ CHECK ACCESSIBLE FLUID LEVELS AND CONDITION

EXISTING FLUIDS ARE IN ROUGH SHAPE. THE REAR DIFFERENTIAL FLUID WAS EXPOSED TO MOISTURE WHICH TURNED THE OIL RED AND FOAMY. COOLANT HAS A HAZY COLOR TO IT AND IS TESTING BAD. BRAKE FLUID IS DARK IN COLOR AND SHOULD BE SERVICED FOR THE LONGEST LIFE OF THE BRAKING SYSTEM

☒ CHECK TIRES FOR PROPER WEAR

TIRES ARE FROM 2010. DRIVE WITH CAUTION

- ☒ RIGHT FRONT (R/F) TIRE - DEPTH: 9/32"
- ☒ LEFT FRONT (R/F) TIRE - DEPTH: 9/32"
- ☒ RIGHT REAR (R/F) TIRE - DEPTH: 9/32"
- ☒ LEFT REAR (R/F) TIRE - DEPTH: 9/32"
- ☒ FRONT OUTER BRAKE PAD THICKNESS: 8
- ☒ REAR OUTER BRAKE PAD CONDITION: __ DRUM __ MM
- ☒ ADDITIONAL FINDINGS



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #1212

Page 6 of 8
11/07/2022


1967 MERCEDES BENZ 230SL


NOTES


*LUBE AND OIL CHANGE - UP TO 8 QUARTS EURO 6/8
CYL 5W30 \$144.99 +tax


Approved in person, 2:12pm 10/28/22


Written by Peter Schiavoni | The Import Mechanics at 10/28/2022 02:12 PM


 969712F8-5C82-4A54-
B565-B0B1371784BA.jpeg

 5899F3A5-A434-44D3-
ADC7-27F9325016F5.jpeg

 39BE38EA-2A00-4084-
B953-8CA094AF11B7.jpeg

 29C7C8EB-E26A-42D3-
8E18-E75F76F7C860.jpeg

 B6E8FD29-EA07-469A-
8739-9BE9C169584E.jpeg

 A91509BD-00C7-499E-
AB04-AC24267F271F.jpeg

 458B0EB6-CF06-4B58-
9CB4-2E7F599AC983.jpeg

Written by Remy Savi | The Import Mechanics at 10/28/2022 02:22 PM

EXISTING FLUIDS ARE IN ROUGH SHAPE. THE REAR DIFFERENTIAL FLUID WAS EXPOSED TO MOISTURE WHICH TURNED THE OIL RED AND FOAMY. COOLANT HAS A HAZY COLOR TO IT AND IS TESTING BAD. BRAKE FLUID IS DARK IN COLOR AND SHOULD BE SERVICED FOR THE LONGEST LIFE OF THE BRAKING SYSTEM

ENGINE COOLANT SYSTEM FLUSH \$262.60 +tax

Approved by phone, 11:05am 11/1/22

BRAKE FLUID EXCHANGE \$149.99 +tax

Approved by phone, 11:05am 11/1/22

REAR DIFFERENTIAL SERVICE \$162.78 +tax

Approved by phone, 11:05am 11/1/22

Written by Peter Schiavoni | The Import Mechanics at 11/01/2022 09:32 AM

CALLED TO UPDATE, LEFT A VOICEMAIL

Written by Peter Schiavoni | The Import Mechanics at 11/01/2022 10:29 AM



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #1212

Page 7 of 8
11/07/2022

1967 MERCEDES BENZ 230SL

Attached Images:





The Import Mechanics

235 N Broadway, Denver, CO 80203

3039979998

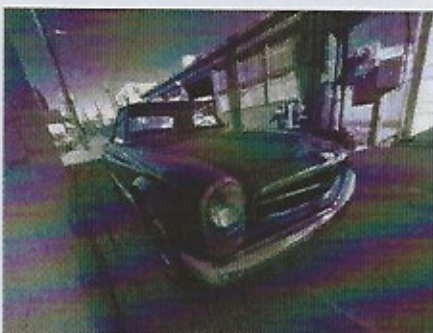
service@importmechanics.com

Invoice #1212

Page 8 of 8

11/07/2022

1967 MERCEDES BENZ 230SL



**The Import Mechanics**

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #4202

Page 1 of 5
10/19/2023

**1967 MERCEDES BENZ
230SL**

Engine: 2.3L L6
Plate: 699HLQ
Odometer In: 98767
Odometer Out: 98772

Advisor: Peter Schiavoni
Technician: Bill Darling

GRAND TOTAL: \$337.36**✓ PAID****SERVICES****1 FUEL PUMP CONCERN**

THE CLIENT REQUESTED US TO LOOK INTO A FUEL LEAK AROUND THE FUEL PUMP AREA (DRIVERS SIDE JUST BEHIND THE REAR AXLE). THE CLIENT NOTICED THAT FUEL WOULD DRIP OUT AFTER SITTING A FEW MONTHS.

LABOR

DIAGNOSE FUEL LEAK

SUBTOTAL: \$165.00

Labor: \$165.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

2 SERVICE ADVISOR VEHICLE CHECK IN**SUBTOTAL: \$0.00**

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

3 TECHNICIAN STANDARD VEHICLE HEALTH CHECK**SUBTOTAL: \$0.00**

Labor: \$0.00
Parts: \$0.00
Fees: \$0.00
Sublet: \$0.00

4 LUBE AND OIL CHANGE - SPECIALTY**SUBTOTAL: \$127.00****LABOR**

DRAIN AND FILL ENGINE OIL
REPLACE ENGINE OIL FILTER
REPLACE DRAIN PLUG GASKET
LUBRICATE SUSPENSION COMPONENTS AS NEEDED
SET TIRE PRESSURES TO SPECIFICATION
PERFORM MULTIPOINT VEHICLE HEALTH CHECK

Labor: \$70.00
Parts: \$57.00
Fees: \$0.00
Sublet: \$0.00

PARTS

5W30 GTX ULTRACLEAN MOTOR
OIL - 1 QUART
OIL FILTER KIT - G4

QTY	EACH	TOTAL
6.0	\$7.00	\$42.00
1.0	\$15.00	\$15.00



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #4202

Page 2 of 5
10/19/2023

5 FUEL CHARGE

SUBLETS

FUEL CHARGE

TOTAL

\$25.00

SUBTOTAL: \$25.00

Labor: \$0.00

Parts: \$0.00

Fees: \$0.00

Sublet: \$25.00

Terms of Service:

1. "YES, DO THIS WORK"

I hereby authorize the corresponding service to be done along with the necessary materials.

2. "YOU MAY DRIVE MY CAR ON PUBLIC ROADS"

The Import Mechanics staff may operate my vehicle for the purpose of testing, inspection, and delivery.

3. "NO PAYMENT, NO KEYS"

An express lien is acknowledged on my vehicle to secure the amount of services thereto.

4. "ABANDONED VEHICLES"

Vehicles left more than 72 hours after repairs are completed will incur a \$25 per day storage fee until the vehicle is picked up. Vehicles left in possession of The Import Mechanics for more than 30 consecutive days will be considered abandoned & will be subject to impound and sale.

5. "TEXT MESSAGE/ONLINE COMMUNICATION OK"

I welcome text message/email from The Import Mechanics as a means of receiving copies of my estimate, work order, and invoice.

6. "ESTIMATES ARE ESTIMATES"

We strive for perfection, however, often times finding and fixing one issue may reveal another. Therefore, all estimates shall be treated as "initial" repair steps, until a specific job is complete.

7. "CUSTOMER SUPPLIED PARTS"

We do not install customer supplied parts.

8. "REQUESTING A REFUND"

We only issue refunds under specific circumstances, such as for a prepaid part when a job is aborted or cancelled. We do not issue refunds, whether partial or full, on completed jobs.

9. "WARRANTY"

We warranty our workmanship for 12 months or 12,000 miles, whichever comes first. We do not warranty used parts, under any circumstance. All warranties are immediately rendered null and void if the vehicle is used in a manner inconsistent with its design and intended purpose, any repair shop or individual outside of The Import Mechanics performs any repairs on the vehicle after said repairs are performed. All warranty coverage is at the discretion of The Import Mechanics management.

10. "HERE'S MY SIGNATURE"

I endorse the attached digital image of my signature as equivalent to my written signature and as proof of my agreement to these ten terms.

GRAND TOTAL: \$337.36

Total Labor: \$235.00

Total Parts: \$57.00

Total Fees: \$0.00

Total Sublets: \$25.00

Shop Supplies: \$14.10

Sales Tax: \$6.26

✓ PAID

10/23/2023 09:49 AM

Paid by Credit Card: \$337.36

Authorization:

10/02/2023



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #4202

Page 3 of 5
10/19/2023

INSPECTION REPORT

FUEL PUMP CONCERN

☒ FINDINGS

SERVICE ADVISOR VEHICLE CHECK IN

- ☒ CHECK IN PHOTOS: BODY, VIN PLATE, TIRE PLATE, GAUGE CLUSTER & INTERIOR
- ☒ VEHICLE BODY CONDITION: WINDSHIELD, MISSING COMPONENTS, OR MAJOR DAMAGE?
- ☒ DOCUMENT ODOMETER MILEAGE AND VEHICLE COLOR
- ☒ INSTRUMENT WARNING INDICATORS
- ☒ OIL CHANGE REMINDER STICKER: DUE FOR AN OIL CHANGE?
- ☒ OVAL CIRCLE CLUB: STICKER OR LICENSE PLATE FRAME?
- ☒ **WIPER AND WASHER FUNCTION: DO THEY WORK FRONT & REAR? DO THE WIPERS STREAK?**
- ☒ HORN FUNCTION
- ☒ ANY APPLICABLE PREVIOUS RECOMMENDATIONS?
- ☒ ANY MILEAGE BASED SERVICES COMING UP OR ARE CURRENTLY DUE?
- ☒ CHECK FOR OPEN NHTSA RECALLS

TECHNICIAN STANDARD VEHICLE HEALTH CHECK

- ☒ SHORT TEST DRIVE AROUND THE BLOCK: NOISES, VIBRATIONS, DRIVEABILITY CONCERNS?
- ☒ CHECK EXTERIOR LIGHTS
- ☒ PERFORM COMPLETE VISUAL INSPECTION OF ENGINE COMPARTMENT: BELTS, HOSES, WIRING, 12V BATTERY TERMINALS
- ☒ **CHECK ACCESSIBLE FLUID LEVELS AND CONDITION**
- ☒ **ANY VISIBLE FLUID LEAKS?**
- ☒ VEHICLE SUSPENSION CONDITION
- ☒ UNDERBODY VEHICLE CONDITION: UNDERBODY SHIELD STILL THERE? RUST? EXHAUST SYSTEM? MISSING PIECES? DAMAGE?
- ☒ TIRE CONDITION: DRY ROT? UNEVEN WEAR?
- ☒ RIGHT FRONT (R/F) TIRE - DEPTH: 9/32"
- ☒ LEFT FRONT (L/F) TIRE - DEPTH: 9/32"
- ☒ RIGHT REAR (R/R) TIRE - DEPTH: 8/32"
- ☒ LEFT REAR (L/R) TIRE - DEPTH: 8/32"
- ☒ FRONT OUTER BRAKE PAD THICKNESS: 7MM



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #4202

Page 4 of 5
10/19/2023

- | | |
|-------------------------------------|---|
| <input checked="" type="checkbox"/> | REAR OUTER BRAKE PAD CONDITION: DRUM |
| <input checked="" type="checkbox"/> | FAULT CODES / COMPUTER DATA ***IF APPLICABLE*** |
| <input checked="" type="checkbox"/> | ADDITIONAL FINDINGS |

LUBE AND OIL CHANGE - SPECIALTY

- | | |
|-------------------------------------|---|
| <input checked="" type="checkbox"/> | OTHER MAINTENANCE SERVICES DUE? |
| <input checked="" type="checkbox"/> | CHECK AIR FILTER (IF ACCESSIBLE) |
| <input checked="" type="checkbox"/> | RIGHT FRONT (R/F) TIRE - PRESSURE: 30PSI DATE CODE YEAR: 10 |
| <input checked="" type="checkbox"/> | LEFT FRONT (L/F) TIRE - PRESSURE: 30PSI DATE CODE YEAR: 10 |
| <input checked="" type="checkbox"/> | LEFT REAR (L/R) TIRE - PRESSURE: 30PSI DATE CODE YEAR: 10 |
| <input checked="" type="checkbox"/> | RIGHT REAR (R/R) TIRE - PRESSURE: 30PSI DATE CODE YEAR: 10 |



The Import Mechanics

235 N Broadway, Denver, CO 80203
3039979998
service@importmechanics.com

Invoice #4202

Page 5 of 5
10/19/2023

FINDINGS

☒ VEHICLE BODY CONDITION: WINDSHIELD, MISSING COMPONENTS, OR MAJOR DAMAGE?

DENT IN DRIVERS SIDE REAR BUMPER

Written by Peter Schiavoni at 10/02/2023 12:35 PM

☒ WIPER AND WASHER FUNCTION: DO THEY WORK FRONT & REAR? DO THE WIPERS STREAK?

WASHERS DO NOT WORK

Written by Peter Schiavoni at 10/02/2023 12:36 PM

☒ ANY VISIBLE FLUID LEAKS?

NO UNUSUAL LEAKS FOUND. MINOR ENGINE OIL LEAKS AND THE REAR DIFFERENTIAL IS ALSO LEAKING.
NORMAL FOR A CAR OF THIS AGE

Written by Bill Darling at 10/03/2023 08:29 AM

☒ CHECK ACCESSIBLE FLUID LEVELS AND CONDITION

THE ENGINE OIL IS OLD AND SHOULD BE CHANGED. THE FUEL LEVEL IS LOW AND SMELLS OLD. THE
TECHNICIAN PUT \$25 OF GAS IN THE CAR

LUBE AND OIL CHANGE - SPECIALTY

\$127.00 +tax

Approved by phone, 4:44pm 10/3/23

Written by Peter Schiavoni at 10/03/2023 04:39 PM

☒ FINDINGS

UPON THE ORIGINAL INSPECTION, NO EVIDENCE OF A FUEL LEAK WAS FOUND. THE TECHNICIAN TOOK THE
CAR ON A THOROUGH TEST DRIVE AND THEN INSPECTED THE FUEL PUMP AREA TO FIND NO FUEL LEAKS.

THE TECHNICIAN WAS ABLE TO RUN THE FUEL PUMP INDIVIDUALLY FOR OVER AN HOUR AND A HALF WITH NO
LEAKS

THE CAR HAS SAT IN OUR SHOWROOM FROM OCTOBER 4TH TO OCTOBER 19TH WITH NO FUEL LEAKS. THE
TECHNICIAN DROVE THE VEHICLE AGAIN AND NO LEAKS WERE FOUND.

Written by Peter Schiavoni at 10/19/2023 10:45 AM