



Unit 4 Cuckoo Oak Workshops  
Halesfield 18  
Madeley  
Telford  
TF7 4PP  
01952 587672

## Commercial Invoice

**Invoice Number** INV2528 - Dino Seats  
**Invoice Date** 27 Sep 2019

Description	Amount
2 x Dino Seats in black leather with black stitching	1,300.00
2 x matching Dino headrests	300.00
Shipping to Tampa Florida USA	245.00

---

Tax Breakdown	Net	VAT	Incl. VAT
Exempt	1,845.00	0.00	1,845.00
	<b>Total Invoice</b>		<b>1,845.00</b>

*Please be aware that until payment is received we are unable to order materials or begin works.*

*Delivery Approx 8-10 wks from date of payment*

*We will not be responsible for any possible additional costs imposed by governmental agencies upon our goods.*

*It is the customers responsibly to check all measurements as mistakes will not be rectified*

*Many thanks*



**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

## INVOICE

### BILL TO

1972 Ferrari Dino

INVOICE # 18526

DATE 04/09/2020

TERMS Due on receipt

### JOB #

#2024

### CAR DESCRIPTION

1972 Ferrari Dino

DESCRIPTION	AMOUNT
black silicone hose	37.15T
shipping	11.69T
shorten belt and add label	104.00T
	Subtotal: 152.84

This invoice is for the period beginning 03/27/2020 to 04/09/2020 2,008.50T

### Labor

Inspect engine plus tried to tighten leaking hose. Still leaks. Research for hoses and exhaust system. Search and ordered 2 bend hoses. Remove radio and try and fit customer supplied radio. Too large and designed to be mounted under dash. Reinstall radio. Install new boot plastic liner. Remove driver's seat, new seat is slightly different and making a plan for install. Remove passenger seat belt to replace with customer supplied unit. Transfer emblem from release button to try and preserve factory look. Cut and drill metal tube as needed to fabricate 2 seat track frames. Clean driver side carpet. Paint and form replacement seat belt brackets. Bought materials in person for seat modification. Research A/C compressor parts. Design the seat modification. Mount passenger seat belt after modification and label added. Make pattern for seat headrest in case they have to be modified to fit. Finish passenger seat bracket. Remove coolant tubes that run the length of the car to check condition-need replacement of metal pipes and rubber hoses for longevity.

Remove muffler assembly and brackets. Took seats to upholstery.

NOTE: Did not charge for seat modification materials.

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	2,161.34
TAX (8.5%)	183.71
TOTAL	2,345.05
BALANCE DUE	<b>\$2,345.05</b>



## Old Wheel Restorations

12820 Gibson Lane  
Odessa, FL 33556-2210  
(813) 917-9205  
Info@OldWheel.com  
www.OldWheel.com

# INVOICE

### BILL TO

1972 Ferrari Dino

INVOICE # 18531

DATE 04/16/2020

TERMS Due on receipt

### JOB #

2024

### CAR DESCRIPTION

1972 Ferrari Dino

DESCRIPTION	AMOUNT
1.31 in x 10.5 ft 17 ga acetylene	15.77T
1 1/4 water hoses	44.20T
Shipping	290.46T
18 gauge x 48 x 96 CR sheet	29.54T
compressed gas	42.24T
seat repair and redye	90.06T
3/4 hydraulic hose	390.00T
1/2 hydraulic hose	76.91T
coolant and fuel hose	12.12T
	19.86T
	Subtotal: 1,011.16
	3,198.00T

This invoice is for the period beginning 04/10/2020 to 04/16/2020

### Labor

Paint seat track for passenger side. Inspect upper engine compartment for cooling hose condition. Remove 6 heat shields from muffler assembly, grind and clean spots to weld on mufflers. Welded all cracks of mufflers. Cut 1 tail pipe off. Set up tubing bender to duplicate. Obtained pipe for exhaust.

Make a list of parts and sent request to supplier.

Remove upper coolant hoses and inspect. Measure parts. Remove thermostat and inspect. Appears to be stuck open. Finish patching mufflers. Make brackets and weld heat shields on top of mufflers. Cut and bend pipe to fit right side of mufflers (work on bending pipe in pipe bender 2 1/2 hrs) but could not achieve proper bending. Obtained materials for exhaust. Inspect and make list of needed parts. Remove parts to measure as needed.

Make exhaust pipes. Weld and grind. Insulate and install heat shields around pipes. Obtained seats. Ordered parts. Remove 2 water outlets from tops of engine. Repair pitting on one with epoxy. Fabricate 2 new gaskets. Obtained parts in person.

NOTE: Worked 2 1/2 hours at NO CHARGE

---

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	4,209.16
TAX (8.5%)	357.78
TOTAL	4,566.94
BALANCE DUE	<b>\$4,566.94</b>



### Old Wheel Restorations

12820 Gibson Lane  
Odessa, FL 33556-2210  
(813) 917-9205  
Info@OldWheel.com  
www.OldWheel.com

# INVOICE

## BILL TO

1972 Ferrari Dino

INVOICE # 18532

DATE 04/23/2020

TERMS Due on receipt

## JOB #

2024

## CAR DESCRIPTION

1972 Ferrari Dino

### DESCRIPTION

### AMOUNT

gasket exhaust pipe seal ring	34.01T
shipping for exhaust pipe seal ring	16.71T
2- 1 1/4" hose elbows	71.42T
seat upholstery	606.93T
4 chrome exhaust tips	210.14T
shipping for exhaust tips	44.18T
	Subtotal: 983.39

This invoice is for the period beginning 04/17/2020 to 04/22/2020

2,437.50T

### Labor

Cut sheet metal to make shields for mufflers. Bend, bead roll and bend edges. Mount seat tracks to repaired seats and put seats in car. Restore eleven factory hose clamps. Assisted with rolling plates. Took seats back to repair problems. NO CHARGE on delivery of seats. Mount seat tracks to seats. Install seats in car.

Replace engine vent hoses, remove left rear inner fender to gain access. Polish all clamps. Clean and paint 2 fittings as needed.

Finish making muffler heat shields, weld them in place and grind. Make heat shield for pipe to manifold in front of engine and weld in place. Weld muffler tag back in place. Spot weld exhaust tip baffles. Grind heat shield on pipe to manifold.

Install 2) 8' water pipes down center of vehicle. Took 2 people to do that. Replace 10 rivets in under car splash shield. Drill 4 new holes to mount on splash guard that had 4 broken bolts. Finish grinding heat shields and paint. Clean pipe flanges and hardener. Search and order tail pipe resonators.

Note: worked 1 hour at no charge

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service,

**SUBTOTAL**

**3,420.89**

easier name! Please recommend us to your car friends!

TAX (8.5%)	290.78
TOTAL	3,711.67
BALANCE DUE	<b>\$3,711.67</b>



**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

## INVOICE

### BILL TO

1972 Ferrari Dino

**INVOICE #** 18536

**DATE** 04/30/2020

**TERMS** Due on receipt

DESCRIPTION	AMOUNT
5" clamp hose	5.19T
hose	71.51T
single outlet	101.37T
shipping single outlet	24.12T
A/C bracket used	585.00T
A/C drier	155.87T
kit for fitting A/C drier	9.31T
thermostat	167.95T
sealing ring thermostat	18.32T
water pipe t piece	111.77T
40.07 coolant pipe	162.50T
14-24 pipe coolant from T-Stat	468.34T
shipping	33.06T
Flat black flame paint	13.64T
10 quick changing disk	17.60T
welding materials	85.00T
2 part epoxy	25.98T
1 grinding wheel	3.00T
3 cut off wheels	9.00T
	<b>Subtotal: 2,068.53</b>

This invoice is for period beginning 04.18.20 through 04.30.20

1,560.00T

### LABOR

Sort parts that were sent by vendor. Cut old exhaust tips off and weld new ones on, mask ad paint inside edge. Cut bad ends off 2 coolant tube which we couldn't find a replacement and weld new pipe on ends. Grind and water test. Weld pin holes and water test. Skim pipe at ends. Sand and skim again. Move car to lift. Install exhaust

## DESCRIPTION

## AMOUNT

system. Remove batter cable at battery end. Inspect cable.  
Route battery cables up to battery. Wrap positive cable with orange tape,  
clean positive cable clamp and paint red. Wrap ground cable with black  
tape. Solder positive wires at clamp. Install battery cover and spare tire.  
Cut used coolant pipe, received from supplier, but was slightly different in  
layout and turn to correct angle, weld, grind and skim, sand and paint.


Note: All the steel pipes are ready for installation.

---

We are re-branding our company name from "Pistorius Collectible  
Autos" to "Old Wheel Restorations" Same owners, same great service,  
easier name! Please recommend us to your car friends!

SUBTOTAL	3,628.53
TAX (8.5%)	308.43
TOTAL	3,936.96
BALANCE DUE	<b>\$3,936.96</b>



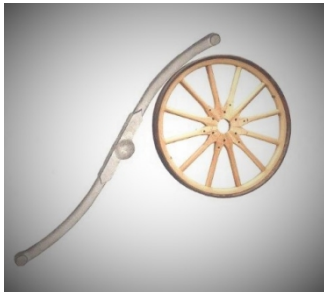

**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

# INVOICE

**BILL TO**

1972 Ferrari Dino

**INVOICE #** 18546

**DATE** 05/18/2020

**TERMS** Due on receipt

**JOB #**

2024

**CAR DESCRIPTION**

1972 Ferrari Dino

DESCRIPTION	AMOUNT
hoses	13.13T
epoxy	25.99T
shipping of returned water pipe	12.87T
heater hose	34.91T
heater hoses	32.58T
radiator hose	15.59T
molded heater hose	15.59T
<b>Subtotal:</b>	<b>150.66</b>

This invoice is for period beginning 05.01.20 to 05.14.20

2,320.50T

**Labor**

Fill defects in water jacket with epoxy, sand and reapply epoxy where defects showed through. Start to fit metal water tube. Disassemble front storage area and remove spare tire. Start removal of heater hoses going to 2 heater cables. Remove 18 feet of heater hose. Run new hose from engine to front heater cores. Remove both right side inner fender to access hoses. Start to install fresh air tubes and repair as needed, Install 3 blower tubes. Install wiper motor which was disconnected. install 3 metal coolant tubes by engine and 2) 90\* rubber hoses. Sand coolant transfer tube flat for good seal on intake. Remove one carburetor to make it possible to mount transfer tube correctly. Obtained parts in person. Sanded scratches and chips out of air cleaner, taped off stickers and fittings. Made a structure to hold it and keep paint off gaskets. Painted both lid and air box. Install coolant outlet and thermostat housing, cut coolant hose to fit. Install carburetor. Wire brush and buff hose clamps for intake tube to air cleaner. Install one engine breather hose. Install new thermostat. Hook up loose wire at throttle switch. Replace 2 missing bolts on engine oil filler to block housing. Put 2 tires back on. Install intake air filter housing. Paint and install intake tube to housing.

**NOTE:** Previous invoice #18536 reflected an incorrect time period of 4/18-4/30/20 when it should have said 4/23-4/30/20.

---

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	2,471.16
TAX (8.5%)	210.05
TOTAL	2,681.21
BALANCE DUE	<b>\$2,681.21</b>



**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

# INVOICE

## BILL TO

1972 Ferrari Dino

**INVOICE #** 18555

**DATE** 05/21/2020

**TERMS** Due on receipt

## JOB #

2024

## CAR DESCRIPTION

1972 Ferrari Dino

DESCRIPTION	AMOUNT
hex nuts	7.77T
sender oil pressure	184.15T
shipping for sender oil pressure	16.63T
<b>Subtotal:</b>	<b>208.55</b>

This invoice is for period beginning 05.15.20 to 05.21.20 897.00T

### Labor

Lower steering column to be able to access instrument cluster. Remove amp gauge and test. Needs new gauge or repaired. Remove speedometer and disassemble to clean lens. Clean 6 connectors behind cluster.

Checked and found oil sending unit faulty. Obtained a new unit. Work on dash. Make bracket to fix broken mounting. Work on clutch. Fit A/C clutch to compressor. Test clutch-okay. Find proper bolts for A/C compressor to bracket.

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

<b>SUBTOTAL</b>	<b>1,105.55</b>
<b>TAX (8.5%)</b>	<b>93.97</b>
<b>TOTAL</b>	<b>1,199.52</b>
<b>BALANCE DUE</b>	<b>\$1,199.52</b>



### Old Wheel Restorations

12820 Gibson Lane  
Odessa, FL 33556-2210  
(813) 917-9205  
Info@OldWheel.com  
www.OldWheel.com

## INVOICE

### BILL TO

1972 Ferrari Dino

INVOICE # 18561

DATE 05/31/2020

TERMS Due on receipt

### JOB #

2024

### CAR DESCRIPTION

1972 Ferrari Dino

DESCRIPTION	AMOUNT
#8 O ring service valve	33.80T
#10 O ring service valve	33.80T
O-ring assortment	11.05T
v belt	11.69T
weatherhead assembly hose-oil	80.73T
HYD assembly hose-oil	105.56T
weld black plastic bonder	11.04T
#10 female O ring	16.90T
#8 female O ring	4.03T
	Subtotal: 308.60

This invoice is for period beginning 05.22.20 to 05.31.20

1,911.00T

### Labor

Mount A/C bracket to engine. Remove 2 high pressure hoses for oil cooler to be replaced. They were leaking due to age. Remove oil cooler. Mount compressor. Took oil hoses to be replaced in person. Check fit of A/C hoses to hoses to be replaced. Check fit of A/C hoses to new compressor. Determine sizes of adapters needed. Measure for belt needed. Took several belts to get correct one. Disassemble all gauges. Diagnose and repair internal connections. Reassemble. Search for missing hardware to attach power wires. During install face plate popped off gauges. Remove gauges to repair. Remove loose exhaust shield to repair mounting. Obtained parts for A/C hose to compressor fittings. Mount exhaust heat shield with new hardware where needed. Replace electrical connectors in dash for amp gauge. Solder and heat shrink epoxy new mount for broken area of dash for front face of gauge cluster. Install oil pressure sensor. Install amp meter into gauge cluster.

Make a plan for replacement of connections at A/C compressor. Size hoses, Cut original hose connections off and crimped new connectors on. Modify two 90\* adapters to get tension on belt of A/C compressor. Start

## DESCRIPTION

## AMOUNT

reassembly of dash and column. Take battery hold down hardware off to remove battery to gain access to A/C drier. Soak connections in penetrating oil.

## NOTE:

- 1) 1.75 hours worked at NO CHARGE
- 2) Outstanding work is:
  - a) Dash instruments
  - b) A/C reticulation
  - c) Assembling of car.

---

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	2,219.60
TAX (8.5%)	188.67
TOTAL	2,408.27
BALANCE DUE	<b>\$2,408.27</b>



**Old Wheel Restorations**

12820 Gibson Lane  
Odessa, FL 33556-2210  
(813) 917-9205  
Info@OldWheel.com  
www.OldWheel.com

# INVOICE

**BILL TO**

1972 Ferrari Dino

**INVOICE #** 18564

**DATE** 06/08/2020

**TERMS** Due on receipt

**JOB #**

2024

**CAR DESCRIPTION**

1972 Ferrari Dino

DESCRIPTION	AMOUNT
refrigerant	31.16T
	Subtotal: 31.16

This invoice is for period beginning 06.01.20 to 06.4.20 1,833.00T

**Labor**

Remove A/C drier. Install gauge cluster. install A/C bolt and alternator bolt. Install hoses to A/C compressor. Install oil cooler and 2 hoses from engine to oil cooler. Remove A/C hoses to drier to have modified if needed to fit more modern drier. Reassemble dash cluster and control.

Obtained A/C part.

Reposition air conditioning low side hose at compressor so it doesn't rub.

Insulate air duct from A/C hose. Remove steering wheel and complete instrument cluster again and replaced at NO CHARGE. Remove and clean 3 grounds. Clean connections at ignition switch with file. Found voltage regulator loose and tightened as needed. Install A/C drier, one hose and fittings as needed. Repair speedometer face that keeps coming off.

Fill cooling system with water for test. Tighten holding clamp for A/C drier.

Reposition where thermal couple attaches at drier. Remove charge fitting at drier since we found it will not work and cap fitting. Install instrument cluster. Found clock not working. Remove clock and disassemble for repair. Fabricated axle to replace broken one for a gear to rise on.

Vacuum test A/C system. Lubricate turn signal switch to repair bad connection causing signals not to work. Service electrical connections at emergency flasher switch. Clean battery tray and paint it.

Note: 4 hours worked at NO CHARGE.

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

<b>SUBTOTAL</b>	1,864.16
<b>TAX (8.5%)</b>	158.45

TOTAL  
BALANCE DUE

2,022.61  
**\$2,022.61**



**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

# INVOICE

**BILL TO**

1972 Ferrari Dino

**INVOICE #** 18569

**DATE** 06/11/2020

**TERMS** Due on receipt

**JOB #**

2024

**CAR DESCRIPTION**

1972 Ferrari Dino


DESCRIPTION	AMOUNT
clutch	751.63T
compressor	233.23T
	Subtotal: 984.86

This invoice is for period beginning 06.05.20 to 06.11.20 546.00T  
 Labor  
 Finish assembly of clock. Test run clock-okay. Install clock back in cluster.  
 Install cluster into car. A/C leak check, found condenser leaking. Drain  
 cooling system. Remove hood. Remove radiator and condenser as a unit.  
 Separate condenser radiator to send out for repair.

-----  
 We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

<b>SUBTOTAL</b>	1,530.86
<b>TAX (8.5%)</b>	130.12
<b>TOTAL</b>	1,660.98
<b>BALANCE DUE</b>	<b>\$1,660.98</b>



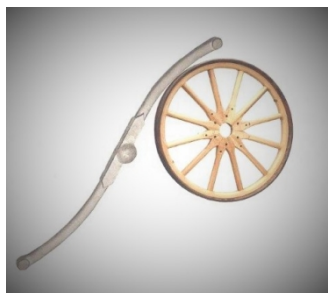

**Old Wheel Restorations**  
12820 Gibson Lane  
Odessa, FL 33556-2210  
(813) 917-9205  
Info@OldWheel.com  
www.OldWheel.com

## INVOICE

### BILL TO

1972 Ferrari Dino

INVOICE # 18571

DATE 06/22/2020

TERMS Due on receipt

### JOB #

2024

### CAR DESCRIPTION

1972 Ferrari Dino

DESCRIPTION	AMOUNT
clean and repair A/C condensor	169.00T
134a oil	26.00T
freon 134a	38.00T
dye shots	18.50T
antifreeze	16.89T
25in dual speaker cone	38.97T

Subtotal: 307.36

This invoice is for period beginning 06.11.20 to 06.19.20

1,891.50T

### Labor

Loosen A/C compressor and remove belt. Remove suction hose to allow for addition of compressor oil. Flush A/C evaporator and hoses. Collect and install A/C condenser and radiator. Fill compressor with oil. Attach low side hose and adapter to compressor. leak test system with vacuum. Did not pass test. Check for leaks. Found a pressure switch in front that was a little loose. Service every A/C connector on car. Wire brush and clean all. Vacuum test A/C system. Vacuum was holding.

Install battery hold down and battery cover. Install plastic trim in front storage compartment. Install right front inner fender. Install right rear inner fender and tire. Raise idle speed. Charge A/C system. Test run and charge A/C system.

Repair passenger wiper arm. Install front splash shield under car. Fill cooling system with coolant. Remove center console to repair loose parts. Tape cracked fuel filter cap, this is a temporary fix.

## DESCRIPTION

## AMOUNT

Diagnose inoperative radio and replace inline fuse behind radio. Remove right and left door panels and found there were no speakers. Install speakers for radio.

Clean car at NO CHARGE

---

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	2,198.86
TAX	186.90
TOTAL	2,385.76
BALANCE DUE	<b>\$2,385.76</b>



**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

## INVOICE

### BILL TO

1972 Ferrari Dino

INVOICE # 18586

DATE 07/01/2020

TERMS Due on receipt

### JOB #

2035

### CAR DESCRIPTION

1972 Ferrari

DESCRIPTION	AMOUNT
sender oil/water temp	21.91T
shipping	16.63T
alternator	214.50T
brake fluid	8.44T
Subtotal:	261.48

This invoice is for period beginning 06.25.20 to 07.03.2020

### LABOR:

Load and unload car at no charge . Check brake system for leak. Service leaking connections at brake master cylinder. Remove all 4 tires flush and bleed complete brake system. Test run engine, found alternator was not charging. Removal of alternator by removing A/C belt and harmonic balancer. Took alternator to repair shop. Fabricated wire harness for alternator, Reassembly of alt into car, finish alternator install. Install both belts and crank pulley install oil temperature sensor. Check all fluids and cleaned the car. Test drove the car

1,657.50T

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	1,918.98
TAX (8.5%)	163.11
TOTAL	2,082.09
BALANCE DUE	<b>\$2,082.09</b>



**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

## INVOICE

### BILL TO

1972 Ferrari Dino

INVOICE # 18627

DATE 09/10/2020

TERMS Due on receipt

### JOB #

2035

### CAR DESCRIPTION

1972 Ferrari Dino

### DESCRIPTION

### AMOUNT

Battery on/off selector	38.99T
Battery cables	20.78T
Fastners	13.60T
Paint and Primer	3.00T
1/2 sq. foot Sheet Metal	1.00T
Cable Push/Pull Univ.	10.65T
Kit Brakes Mast. Cyn. 22mm	153.14T
Shipping	12.87T
Steel TUBE ASSY BUNDY STICK	30.45T
(5) 1/8" POP RIVETS	0.75T
Black Silicone	2.25T
Kit rear brake caliper	146.30T
Kit front brake caliper	127.40T
Kit rear caliper park brake	103.87T
Shipping	13.73T

Subtotal: 678.78

This invoice is for period beginning 07-04-2020 to 09-10-2020:

LABOR: Picked up car with trailer. Start removing brake rear brake proportions valve. Remove wall between trunk and engine to get all the brake lines. Remove rear brake proportions valve. Open and inspect. Remove center console to check choke cable. Remove bad choke cable. Remove air breather to check choke. Remove Htr. blower and remove brake master cylinder. Make a bracket for battery. Cut out switch. Prime and paint bracket. Install new battery, cables on cut out switch. Installed cut out switch and connected battery. Lift car and remove wheels. Inspect brakes at all 4 wheels. Installed new choke cable. Remove seals from rear Brake valve. Clean parts and replace seal in brake valve and master. Disassemble master cylinder . Assemble master cylinder after honing, start assembling rear brake valve, clean booster and install master

1,150.50T

## DESCRIPTION

## AMOUNT

cylinder. Drain and clean brake reservoirs. Blow out rear brakes install brake line and compensator valve. Place reservoirs.  
 Blow out front brakes. Connect lines at master. Bleed, cleanup. Make bracket for choke cable at engine. Install choke cable, console and breather, seat belts.  
 Bled brakes. Put on stands and checked brake adjusted and inspected. Test drove car for 20 miles. Brake held. Engine and rear calipers are leaking. Install board between engine and trunk. Remove air breather and tighten valve bolts, to stop leaks, one stud was stripped. Install engine cover latch and adjusted.  
 NOTE: BRAKE REPAIRS NO CHARGE  
 BRAKE WORK NOT COMPLETED YET  
 \*\*18.5 HOURS worked at NO CHARGE

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	1,829.28
TAX	155.49
TOTAL	1,984.77
BALANCE DUE	<b>\$1,984.77</b>



## Old Wheel Restorations

12820 Gibson Lane  
Odessa, FL 33556-2210  
(813) 917-9205  
Info@OldWheel.com  
www.OldWheel.com

# INVOICE

## BILL TO

1972 Ferrari Dino

INVOICE # 18646

DATE 09/22/2020

TERMS Due on receipt

## JOB #

2035

## CAR DESCRIPTION

1972 Ferrari Dino

DESCRIPTION	AMOUNT
SEAL CALIPER JOINT	115.23T
Machine Rotors	40.00T
Shipping	25.77T
Brake Pad set	58.67T
Fuel	20.00T
Brake Fluid	10.00T

Subtotal: 269.67

This invoice is for the period beginning 09-11-2020 to 09-22-2020: 448.50T

LABOR: Cut bolt to fit valve cover and install. Spray engine with degreaser pressure wash and clean up. remove wheels and all 4 brake calipers, open inspect and clean calipers, replace seals and start assembly.

Open, inspect and clean right rear caliper. Replace seals in right rear caliper and park brake assembly. Disassemble left rear caliper and park brake. Clean and inspect. Start assembly with new seal. Finish assembling calipers. Install all 4 calipers and lines, adjusted rear calipers. Bleed, road test adjust rear more, Test drove.

Remove front lower cover. Remove proportion valve . open clean and service proportion valve. Reassemble and install. Remove front flex hose and check. Reinstall hose. Bleed brakes, install front bottom cover, check brake pedal travel.

Check front caliper operation. Add Teflon washers to 5 bolts on engine to slow leak. Clean fluid off intake. Remove front wheels, calipers and rotors. Machine rotor's to .825 min.+ .787. Installed back on car with new pads. Put spare tire, blower, washer bag, air filter canister and plastic cover in

## DESCRIPTION

## AMOUNT

front by spare.

Check leaks. Add gas . Detail car in and out.

NOTE: NO CHARGE 23.25 hours TOTAL VALUE FOR BRAKE REPAIRS  
(\$3256.50)

---

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	718.17
TAX	61.04
TOTAL	779.21
<b>BALANCE DUE</b>	<b>\$779.21</b>



**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

## INVOICE

**BILL TO**

**INVOICE #** 19025  
**DATE** 11/29/2021

**TERMS** Due on receipt

<b>JOB #</b>	<b>CAR DESCRIPTION</b>
2180	1972 Ferrari

DESCRIPTION	AMOUNT
oil pressure sensor	162.50T
shipping	19.50T
	Subtotal: 182.00

This invoice is from 11/23/21 to 11/24/21	273.00T
---	---------

LABOR: Check clearance on radiator to fans. Make, paint, install bracket to hold top of radiator.  
 Inspect engine oil leak.  
 Remove air filter canister, clean oil from intake, remove oil sensor which was leaking and replace copper washer. Clean surface and install. Test oil pressure - 40 at idle, 65 at fast idle. Install air filter.  
 Test drive.  
 Second chassis cover slipped out of first one. Position correctly and add fender washers.  
 Test drive - good.

ending milage 31053.0	0.00
-----------------------	------

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

<b>SUBTOTAL</b>	455.00
<b>TAX</b>	34.13
<b>TOTAL</b>	489.13
<b>BALANCE DUE</b>	<b>\$489.13</b>





**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

## INVOICE

**BILL TO**

**INVOICE # 19030**

**DATE 01/10/2022**

**TERMS** Due on receipt

**JOB #**

2180

**CAR DESCRIPTION**

1972 Ferrari

DESCRIPTION	AMOUNT
rebuild starter (\$225.50 value)	0.00T
heat shrink	1.20T
electric connectors	0.72T
ignition coil	30.67T
new starter	553.74T
	<b>Subtotal: 586.33</b>

This invoice is from 11/25/21 to 1/6/22

2,515.50T

**LABOR:** Could not get starter to engage. Push car on hoist. Remove rear exhaust manifold.

Remove radiator tank and misc other items to access starter. Remove starter for repair.

Repair choke rod for carbs. Lubricate choke cable.

Remove air filter and intake tubes to replace oil pressure sending unit.

Replace oil pressure sending unit and hook up wires. Clean around sending unit. Clean gasket area for exhaust manifold.

Install starter.

Went in person to try and find gaskets. Make gaskets, clean flanges and install exhaust manifold.

Install: water bottle, heater tube and evaporator canister.

Connect exhaust pipe to manifold. Crank car - no spark. Adjust choke cable.

Take right door skin off to adjust interior handle.

Adjust right door handle, install door skin.

Work on conv ignition. Get car to start. Add gas. Starts but fails to stay running. Starter still has an issue - unbolt starter and slide back to inspect fly wheel. Install starter with one bolt, connect jump wires to starter and test for voltage drop.

## DESCRIPTION

## AMOUNT

Diagnose no start of ignition system. Replace one bad coil. Found some questionable wiring and replaced as needed.  
 Check choke cable operation.  
 Finish installing coil and test system. Still not working on electronic ignition. Check wiring.  
 Check oil pressure circuit to gauge. Remove oil pressure sending unit and test. The new sending unit is faulty. Remove electronic ignition module and test circuits. Needs module.  
 Remove console and remove choke lever. Adjust cable hold at lever.  
 Make calls to find ignition box.  
 Call for parts - send pics of old parts.  
 Remove console from car. Make steel plate to hold choke lever and center of console. Add plastic to glue vinyl to. Paint plate. Glue vinyl and install plate and choke lever.  
 Call about parts, Call MSD to verify MSD box will work and check dimensions to see how to fit it..  
 Obtained another oil sending unit and fit.

NOTE: 1. Worked 2.25 hours AT NO CHARGE removing and reinstalling starter.  
 2. A new smaller starter was ordered so that engine does not have to be stripped to install it  
 3. An MSD box was decided on because it will save a minimum of \$700 versus installing and original electronic box.

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	3,101.83
TAX	232.64
TOTAL	3,334.47
BALANCE DUE	<b>\$3,334.47</b>



**Old Wheel Restorations**  
 12820 Gibson Lane  
 Odessa, FL 33556-2210 US  
 (813) 917-9205  
 Info@OldWheel.com  
 www.OldWheel.com

## INVOICE

### BILL TO

**INVOICE #** 19053  
**DATE** 01/21/2022  
**DUE DATE** 01/21/2022  
**TERMS** Due on receipt

<b>JOB #</b>	<b>CAR DESCRIPTION</b>
2180	1972 Ferrari

DESCRIPTION	AMOUNT
oil pressure sending unit	163.80T
freight	19.50T
ignition control (MSD)	361.39T
cable choke	32.50T
freight	12.55T
thermostat body	51.80T
	<b>Subtotal: 641.54</b>
*choke cable credit	-17.00T

This invoice is from 1/7/22 to 1/20/22 1,072.50T

**LABOR:** Call for MSD box, move wires and make mounting plate for MSD box. Change oil sensor.  
 Try to remove starter in parts - not working. Remove exhaust manifold again and starter AT NO CHARGE.  
 Install new starter. Make gaskets for exhaust manifold AT NO CHARGE.  
 Reroute starter wires to fit new starter, insulate cable end. Install exhaust manifold spacers. Remove bulkhead to trunk to install exhaust manifold. Put bulkhead back. Connect tail pipe to manifold.  
 Remove rear section of console to change choke cable. Change cable, install rear section of console and seat belts. Route cable and cut to size.  
 Trace AC temperature broken capillary line from switch forward. Remove toe board carpet and cover. Drill rivet holding capillary line clip. Remove line. Remove plate for MSD box and mark and drill holes for new box.  
 Search for a new temp controller.  
 Weld nuts, glue spacers on MSD plate. Route new temp sensor temporarily, rivet bulkhead in trunk and install carpet. Put cover back behind spare. Connect battery, install battery cover and place spare tire.

## DESCRIPTION

## AMOUNT

Start and run. Test new switch to see if it will work.  
Prep and paint MSD plate AT NO CHARGE.  
Obtained a temp control switch in person.

NOTE: Worked for 9.5 hours AT NO CHARGE

---

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	1,697.04
TAX	127.28
TOTAL	1,824.32
BALANCE DUE	<b>\$1,824.32</b>



## Old Wheel Restorations

12820 Gibson Lane  
Odessa, FL 33556-2210  
(813) 917-9205  
Info@OldWheel.com  
www.OldWheel.com

# INVOICE

**BILL TO**

**INVOICE # 19065**

**DATE 02/08/2022**

**TERMS Due on receipt**

**JOB #**

2180

**CAR DESCRIPTION**

1972 Ferrari

DESCRIPTION	AMOUNT
ignition coil	88.19T
fuel line	8.27T
freon	47.04T
ignition coil credit (inv 19030)	-30.67T
oil pressure sending unit credit (inv 19053)	-163.80T
	Subtotal: -50.97

This invoice is from 1/21/22 to 2/7/22

1,365.00T

LABOR: Route new AC control switch. Test. Pull wire from A/C clutch to test. Trace wires.

Removed old coils. Modified bracket for new coil. Installed both coils.

Finish mounting perch for MSD box bracket mount by welding nut to it.

Mounted bracket to car then MSD box to bracket. Checked for harness clearance. Had to remove and install coils multiple times to measure for modifications.

Worked on the oil pressure sending unit that is not working.

Install choke cable in console, install window switches, fan switch and cigar lighter in console. Install console, shifter plate, front console. Install toe board. Glue carpet and clean up.

Wire in ignition module. Solder and heat shrink all connections. Check A/C electrical operation. Remove right rear tire and inner fender to check A/C pressure. Perform leak test of A/C. Found connections on dryer leaking.

Make bolt extension for ignition cover in trunk and install cover.

Install air intake hoses and intake canister.

Finish filling A/C. Put inner fender back on and right rear tire.

Remove air filter, adjust idle, adjust carbs, install air filter.

Test windshield washer, remove washer pump and bench test - bad - no discharge - tape up pump wires.

## DESCRIPTION

## AMOUNT

Install trunk panel in trunk.  
Clean car AT NO CHARGE.

NOTE: 1. Worked .75 hours AT NO CHARGE  
2. Needs new windshield washer  
3. Drivers safety belt is not working!

---

We are re-branding our company name from "Pistorius Collectible Autos" to "Old Wheel Restorations" Same owners, same great service, easier name! Please recommend us to your car friends!

SUBTOTAL	1,314.03
TAX	98.55
TOTAL	1,412.58
BALANCE DUE	<b>\$1,412.58</b>

Begin forwarded message:

**From:** AutoZone <orders@em.autozone.com>

**Date:** June 17, 2022 at 4:41:31 PM EDT

**To:**

**Subject:** Here's your receipt. Thanks for shopping!

**Reply-To:** "orders@em.autozone.com" <orders-HP2v610000018173663419b3206b434b5c3ae8121@em.autozone.com>



Here's your 06/17/22 receipt

[Auto Parts](#)

[Tools & Equipment](#)

[Repair Help](#)

[Hot Deals](#)



**THANKS FOR  
STOPPING IN!**



3263861624061722

You purchased these items in-store

CORE TRADE-IN \$22.00-P 1  
-1 @ 1/22.00  
\*000959692 CORE TRADE-IN 34-DL  
**34-DL**  
**Duralast Battery**  
EA

1 @ 1/179.99 \$179.99 P 1  
000959692 34-DL  
**34-DL**  
**Duralast Battery**  
EA

000959692 CORE CHARGE \$22.00 P

1 @ 1/4.99 \$4.99 P 1  
000001943 75130  
**Scott**  
**Blue Shop Towels Roll**  
55 CT

1 @ 1/10.99 \$10.99 P 1  
000142483 874900  
**AutoZone**  
**Red Shop Towels**  
25 CT

1 @ 1/3.49 \$3.49 P 1  
000554868 BT-1K  
**AGS**  
**Battery Installation Kit**  
EA

1 @ 1/4.99 \$4.99 P 1  
000401968 25108  
**Fast Orange**  
**Pumice Hand Cleaner**  
7.5 OZ

**Total Items Sold: 5**

**Subtotal:** \$204.45  
**Discount:** \$4 Dirty Job Bundle ~~\$5.98-~~  
**New Subtotal:** \$198.47

Environmental Tax:



STATE BATTERY SALES FEE	
Environmental Tax Amount:	<b>\$1.50</b>
Total Tax %: 7.500%	
Total Tax Amount:	<b>\$15.00</b>
Total Tax @ 7.500%:	<b>\$15.00</b>

<b>Transaction Total:</b>	<b>\$214.97</b>
---------------------------	-----------------



\$214.97
032511
CHIP
VISA CREDIT / CHASE VISA
A0000000031010

<b>Total Paid:</b>	<b>\$214.97</b>
--------------------	-----------------



## WARRANTY

Your purchase includes the following warranties. We can also look up warranty information for you in-store based on the name and phone number associated with these warranties.