

RESTORATION & PERFORMANCE MOTOR CARS

RD 2 Box 16 Mountain Road
VERGENNES, VERMONT 05491
(802) 877-2645

No 0023

QTY.	PART NO. AND DESCRIPTION	PRICE	
3	9TS. SIKKENS. BLACK URETHANE ENAMEL	12	36
1	9TS. SIKKENS. Grey 1A	12	12
2	gals. WASH & SOLV.	18	36

NAME 		CUSTOMER'S ORDER NO.	DATE May 88
ADDRESS 		PHONE	PROMISED
CITY		ORDER WRITTEN BY	A.M. P.M.
YEAR, MAKE AND MODEL 67 FERRARI 365-2+2		SERIAL NUMBER 12939	LICENSE NUMBER
		MOTOR NUMBER	ODOMETER

DESCRIPTION OF WORK	AMOUNT
LUBRICATION ☐ CHANGE OIL ☐ OIL FILTER ☐ TUNE UP ☐	
TRANSMISSION ☐ DIFFERENTIAL ☐ WASH ☐ POLISH ☐	
FINISH UNDERSIDE of Car - 26 hrs.	780
2 Brake Cylinders, leaking R & L - 6 hrs.	180
Remove all Fuel & Brake lines - 2 hrs.	60
RE PRESS ALL NEW Suspension Pieces for Rear & Front Sway Bars - 12 hrs.	360
SHOCKS - BUSHINGS. Rear Axle SEALS	1380
Trans. SYNCRON TURN ARROW - SEAL & Gasket RST.	

(MAY BE CONTINUED ON OTHER SIDE)	TOTAL PARTS	84 -
----------------------------------	-------------	------

ACCESSORIES		
Shop SUPPLIES - TOWELS	25 -	25.00
UPS - Brakes	35 -	35.00
TOTAL ACCESSORIES		60

LITERS/GALS. OF GAS @				0	TOTAL LABOR	1380	
LITERS/QTS. OF OIL @					TOTAL PARTS	84	
kg/LBS. OF GREASE @					ACCESSORIES	60	
					GAS, OIL AND GREASE		
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.					OUTSIDE REPAIRS		
SIGNATURE					TAX	3	36
					Thank You TOTAL	1527	56

RESTORATION & PERFORMANCE MOTOR CARS

RD 2 Box 16 Mountain Road
VERGENNES, VERMONT 05491
(802) 877-2645

No 0029

NAME 		CUSTOMER'S ORDER NO.	DATE <i>June 88</i>
ADDRESS		PHONE	PROMISED
CITY		ORDER WRITTEN BY	A.M. P.M.
YEAR, MAKE AND MODEL	SERIAL NUMBER	LICENSE NUMBER	TERMS
<i>79 365 2F2</i>	<i>12939</i>		
	MOTOR NUMBER	ODOMETER	

DESCRIPTION OF WORK	AMOUNT
LUBRICATION ☐ CHANGE OIL ☐ OIL FILTER ☐ TUNE UP ☐	
TRANSMISSION ☐ DIFFERENTIAL ☐ WASH ☐ POLISH ☐	
<i>RE INSTALL ALL SUSPENSION</i>	
<i>Parts. Remove Bushings. Same</i>	
<i>LIGHT BOXES. RE INSTALL</i>	
<i>HEADERS,</i>	<i>9hrs. 270-</i>
<i>No Rent. Spare. charge -</i>	<i>0-</i>
TOTAL PARTS	

(MAY BE CONTINUED ON OTHER SIDE)

ACCESSORIES	LITERS/GALS. OF GAS @	TOTAL LABOR	<i>270</i>
	LITERS/QTS. OF OIL @	TOTAL PARTS	
	kg/LBS. OF GREASE @	ACCESSORIES	
		GAS, OIL AND GREASE	
	I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.	OUTSIDE REPAIRS	
	SIGNATURE	TAX	<i>0-</i>
TOTAL ACCESSORIES		Thank You	
		TOTAL	<i>270-</i>



STATEMENT.

[REDACTED]
365 GT 2+2 SN 12939

WORK ORDER # 15 FOR APRIL 1988

LABOR + PRIMER TO CLEAN UNDERSIDE

OF CAR, STRIP SUSPENSION

R&R VALVE STEM SEALS. 749.⁰⁰

WORK ORDER # 23 FOR MAY 1988

MANY HOURS TO FINISH UNDERSIDE OF CAR.

DISCOVERED FRONT & REAR CALIPERS LEAKING.

CONSULT. - FINALLY DECIDED ON SS PISTONS
& REBUILD - 850.⁰⁰ 950.⁰⁰ EST.

FIT BUSHINGS TO SHOCKS & SUSPENSION.

CHANGED 2ND Gear SYNCHRO 180°

NEW GASKETS & SEALS IN TRANSMISSION &

AND REAR AXLE. - STRIPPED BRAKE & FUEL LINES 1527.⁵⁰

WORK ORDER # 29 JUNE 1988

RE-INSTALL ALL SUSPENSION PIECES & SHOCKS

RE-MOUNT BUMPER & LIGHT CHROME DOORS. RE-INSTALL
HEADERS.

270

Peter Markowski

\$2,546.⁵⁰



365 GT 12939



Statement

Repair to drivers door electric window motor (Sublet 24⁰⁰)
adjust outside mirror
oil and filter change
air filter change
locate and tighten 4 oil leaks
check transaxle oil level
tighten all shock bushings
repair R.H. front swaybar bushing
grease front suspension (found 4 fittings that were not accepting grease for a long time)
1/2" O-ring for dipstick
remove electric antenna (built body plug)
front end alignment (Sublet \$40⁰⁰)
repair L.H. Vent window
clean sediment bowl
flush radiator
remove L.H. door speaker labor 6 hrs. @ \$30. per hr \$180
keys (Sublet 10.50)
General mechanical check over Total \$254⁵⁰



STATEMENT

365 GT 2+2

2-29-88

VEHICLE STORAGE 11-87 - 2-88 @ 65⁰⁰ mo 260.⁰⁰

REMOVE EXHAUST SYSTEM INSPECT UNDERSIDE of CAR, REMOVE SHOCKS SCARY BARS, REMOVE VALVE COVERS, OIL SEALS at FRONT AND VALVE STEM SEALS WORKING... COMPRESSION CHECK LOWEST READING 124# - HIGHEST 151 PROPER VALVE ADJUSTMENT WILL IMPROVE, FLYWHEEL WAS REINSTALLED 180° OUT EMERGENCY BRAKE CABLE FRAYED - REMOVED REAR AXLE - TORQUE TUBE - TRANSMISSION, CLUTCH.

11 HOURS LABOR @ 30.⁰⁰ hr 330.⁰⁰

EXHAUST SYSTEM WITH HANGARS & FREIGHT. \$1237.⁴⁵ x .80 989.⁹⁶
CREDIT .800.⁰⁰ FOR PARTS ADVANCE (800.⁰⁰)

VT. STATE TAX on PARTS ONLY 39.⁵⁶

IN PROCESS

\$ 819.⁵²

ROCKER ARM PILLOW BLOCKS RE FIT.
SHOCK ABSORBERS ARE ORDERED.
ALL REAR SUSPENSION BOWTS TO BE REPLACED
VALVE STEM SEALS TO BE RENEWED WITH NEW TEFLON UNITS
REAR AXLE OIL SEAL TO BE REPLACED
REPLACE EMERGENCY BRAKE CABLE
ALL BRAKE RUBBER PIECES REPLACED.
NICKLE PLATE AND REPAIR EXHAUST HEADERS
REPAIR FIBERGLASS AROUND REAR FUEL TANK DAMN
REBUILD SYNCRO - 2ND GEAR
CLEAN, PAINT, DETAIL UNDERSIDE.

Peter Markowski

RD #2 Box 16 Monkton Road, Vergennes, Vermont 05491

(802) 877-2645

WILL CALL FOR PARTS ADVANCE TO COVER COST.
TO KEEP DISCOUNT. 11.1 - Peter

QTY.	PART NO. AND DESCRIPTION	PRICE
1	PARTSOURCE 5737	929 50
1	" 5944	119 33
	5941	33 45
	5942	358 93
	5943	2018 29
	5953	226 91
	6029	920 -
	6458	106 -
	6507	92 50

Photo Box

24	CHAMPION N64E	1 95	42 -
50	55 6mm NUTS BOLTS WASHERS.		65 00
12	NYLON TIES.		1 50
1	RADIO SHACK ANTENNA-		89 95
1	55 BRAKES		972 81
1	COUNTRY TIRE. TWIN-TUBE ALUMINUM		67 55
2	Brake HOSES - TANNER	95 28	95 88
18	Brake FITTINGS. FUBING	50	9 -
40	FUEL BRAKE LINE		24 -
25	FUEL COPPER LINE FUEL		36 00
2	BLOWN FILTERS	16 -	32 -
2	QTS CASROL FLUID. q.	6 95	13 90

24	COPPER NUTS - EXHAUST.	25	6 00
50	WAVE WASHERS 6mm NUTS/WASHERS.	5 00	
	WELD. FUEL LINE & EXHAUST		
	BRAKETS HEAT SHIELDS.		
	HOOD LATCH BRACKET.	25 00	
	AC Repair - New FANP.	166 00	
	10' AIRCRAFT CABLE - E. Duff.	25 00	
	BATTERY BOX	18 00	
	TOTAL ACCESSORIES		6548 90

RESTORATION & PERFORMANCE MOTOR CARS
RD 2 Box 16 Mountain Road
VERGENNES, VERMONT 05491
(802) 877-2645

No 0034

NAME	CUSTOMER'S ORDER NO.	DATE
ADDRESS	PHONE	PROMISED
CITY	ORDER WRITTEN BY	A.M. P.M.
YEAR, MAKE AND MODEL	SERIAL NUMBER	LICENSE NUMBER
	MOTOR NUMBER	ODOMETER

DESCRIPTION OF WORK	AMOUNT
LUBRICATION ☒ CHANGE OIL ☒ OIL FILTER ☒ TUNE UP ☐	
TRANSMISSION ☒ DIFFERENTIAL ☒ WASH ☐ POLISH ☐	
21 Inches - NC for ADAM	
12 Hours	360 -
JUNE Storage.	65 -

LITERS/GALS. OF GAS @		TOTAL LABOR	360 -
LITERS/QTS. OF OIL @	1.75	TOTAL PARTS	6548 90
g/LBS. OF GREASE @	4.90	ACCESSORIES	
		GAS, OIL AND GREASE	60 20
		OUTSIDE REPAIRS	
		Storage	65
		TAX	261 25
		Thank You	
		TOTAL	7296 05

I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.

SIGNATURE

QTY.	PART NO. AND DESCRIPTION	PRICE		
1	USED VALVE SPRING		31	-
12	NGVC - N.C			
2	USED DIST. COPS N.C.			
3	Valve Seats.	16 50	49	50
6	Valve ADJ STELLITE	11 00	66	-
4	POINTS - SETS.	21 -	84	
1	WIRE & END KIT		97	50
1	FUEL FILTER		10	-

RESTORATION & PERFORMANCE MOTOR CARS

RD 2 Box 16 Mountain Road
VERGENNES, VERMONT 05491
(802) 877-2645

No 0036

NAME	CUSTOMER'S ORDER NO.	DATE
[REDACTED]		9-15-88
ADDRESS	PHONE	PROMISED
[REDACTED]		
CITY	ORDER WRITTEN BY	A.M. P.M.
[REDACTED]		
YEAR, MAKE AND MODEL	LICENSE NUMBER	TERMS
69 365 242	12939	
	MOTOR NUMBER	ODOMETER

TEST. IGNITION - BRING UP TO 10,000 VOLTS RESISTANCE AT PLUG -	
Compression TEST	
#1 - Not OILED	39#
OILED	67#
Valve Springs Broken.	
LEAKS AT INTAKE #1 CYL	
Remove Head - RINGS BROKEN.	

DESCRIPTION OF WORK	AMOUNT
LUBRICATION ☐ CHANGE OIL ☐ OIL FILTER ☐ TUNE UP ☐	
TRANSMISSION ☐ DIFFERENTIAL ☐ WASH ☐ POLISH ☐	
RE LOCATE FLYWHEEL -	
DIAGNOSE IRRADIK RUNNING -	
LOW-MID RANGE SKIP.	
Carb. R&R - NEW SEAT & NEEDLES	
RADIATOR TOP SEAM LEAK	
Compression TEST Phone Calls.	
NEW IGNITION WIRES - ENDS. POINTS.	
CORRECT L.H TIMING TO CORRECT.	
Compression AS ATTACHED.	

(MAY BE CONTINUED ON OTHER SIDE)

TOTAL PARTS	338 00
ACCESSORIES	
UPS. SPRING.	4 -
TOTAL ACCESSORIES	4

LITERS/GALS. OF GAS @		TOTAL LABOR	450
LITERS/QTS. OF OIL @		TOTAL PARTS	338
kg/LBS. OF GREASE @		ACCESSORIES	4 -
		GAS, OIL AND GREASE	
		OUTSIDE REPAIRS	
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.		TAX	13 52
SIGNATURE		Thank You TOTAL	805 52

RESTORATION & PERFORMANCE MOTOR CARS

RD 2 Box 16 Mountain Road
VERGENNES, VERMONT 05491
(802) 877-2645

No 0053

QTY.	PART NO. AND DESCRIPTION	PRICE
	PARTS WORK UP ORDER	
	FOR ENGINE OVERHAUL	
	- RINGS, BEARINGS, GASKETS	
	ACCESSORY DRIVE BEARINGS	1656 - 1656 -
	SEALS - TIMING CHAIN	
	CRANK & HORN CYLINDERS	165 - 165 -
	at NOACO MACHINE SER.	
	NEW RING GEAR FOR STARTER	357 - 357 -

NAME 	CUSTOMER'S ORDER NO.	DATE 12-28-88
ADDRESS 	PHONE	PROMISED A.M. P.M.
YEAR, MAKE AND MODEL 69 365 2+2	SERIAL NUMBER 12939	LICENSE NUMBER
	MOTOR NUMBER	ODOMETER

DESCRIPTION OF WORK	AMOUNT
LUBRICATION ☐ CHANGE OIL ☐ OIL FILTER ☐ TUNE UP ☐	
TRANSMISSION ☐ DIFFERENTIAL ☐ WASH ☐ POLISH ☐	
BALANCE & POLISH & MACHINE	
365 CRANKSHAFT, RODS, PINS CLUTCH	
DRIVES & HARMONIC BALANCE HUB.	
- ALSO UP - RACE SHOP	
OUTSIDE REPAIR	200 -
3 hours - mostly by RETS	90 -
R & R - Phone.	

(MAY BE CONTINUED ON OTHER SIDE)	TOTAL PARTS	2178 -	NOVEMBER - DECEMBER STORAGE	130 -
----------------------------------	-------------	--------	-----------------------------	-------

ACCESSORIES	LITERS/GALS. OF GAS @	TOTAL LABOR	90 -
UPS	LITERS/QTS. OF OIL @	TOTAL PARTS	2178 -
12	kg/LBS. OF GREASE @	ACCESSORIES	12
12		GAS, OIL AND GREASE	
	I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.	OUTSIDE REPAIRS	200 -
	SIGNATURE		130
TOTAL ACCESSORIES		TAX	87 12
12 -		Thank You	
		TOTAL	2697 12

RESTORATION & PERFORMANCE MOTOR CARS

RD 2 Box 16 Mountain Road
VERGENNES, VERMONT 05491
(802) 877-2645

No 0089

NAME [REDACTED]	CUSTOMER'S ORDER NO.	DATE 4-15-89
ADDRESS [REDACTED]	PHONE [REDACTED]	PROMISED A.M. P.M.
CITY [REDACTED]	ORDER WRITTEN BY	
YEAR, MAKE AND MODEL 69 365212	SERIAL NUMBER 12939	LICENSE NUMBER
	MOTOR NUMBER 12939	ODOMETER
		TERMS

DESCRIPTION OF WORK	AMOUNT
LUBRICATION ☐ CHANGE OIL ☐ OIL FILTER ☐ TUNE UP ☐	
TRANSMISSION ☐ DIFFERENTIAL ☐ WASH ☐ POLISH ☐	
2 MONTHS STORAGE @ 65	130 -
MOTIVE POWER - LASOR INV. 101549	
GALLEY PLUG FIX	307.50
MACHINE SHOP - BUSHINGS FOR OIL PUMP	842.50
CYLINDER HEAD PLANE TO REMOVE PITTING - MUST BE WELDED & REMED. BOTH HEADS TO MATCH - 2 1/2	75 -
R&R CRANKSHAFT TROP PLUGS	
BUILD NEW BUSHINGS FOR OIL PUMP.	
NEW NOT AVAILABLE LOCATE Brg SIDE 2	60
REFIT CRANKSHAFT & BEARINGS TO BLOCK & RODS - 8 1/2	255
REFIT CAM WHEELS & ADJ. SCREW 3	90

(MAY BE CONTINUED ON OTHER SIDE)

TOTAL PARTS

ACCESSORIES

LITERS/GALS. OF GAS @

LITERS/QTS. OF OIL @

kg/LBS. OF GREASE @

TOTAL LABOR

TOTAL PARTS

ACCESSORIES

GAS, OIL
AND GREASE

OUTSIDE REPAIRS

RENT.

TAX

Thank You

TOTAL

TOTAL ACCESSORIES

I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.

SIGNATURE

555 -

130 -

0 -

1165 -

QTY.	PART NO. AND DESCRIPTION	PRICE	
2	205 MICHELIN VINTAGE	248 50	497 00
10	955. KENDALL 15-40	2	20 -
2	16 22 FILTERS	17 10	24 -



RESTORATION & PERFORMANCE
MOTOR CARS
RD #2 Box 2029 Monkton Rd
VERGENNES, VERMONT 05491
(802) 877-2645

No 0266

NAME	CUSTOMER'S ORDER NO.	DATE
[REDACTED]		430.91
ADDRESS	PHONE	PROMISED
[REDACTED]		
CITY	ORDER WRITTEN BY	A.M.
[REDACTED]		P.M.
YEAR, MAKE AND MODEL	LICENSE NUMBER	TERMS
69 365 2+2		
MOTOR NUMBER	ODOMETER	

DESCRIPTION OF WORK	AMOUNT
LUBRICATION ☐ CHANGE OIL ☐ OIL FILTER ☐ TUNE UP ☐	
TRANSMISSION ☐ DIFFERENTIAL ☐ WASH ☐ POLISH ☐	
RETORQUE HEADS. CHECK VALVE ②-①③	
IGNITION Timing - DISTRIBUTORS ①②	
TAKE OUT RATTLE WHEN STARTED ①	
COLD	
IN STALL; BALANCE NEW TIRES ①	
SUBLOTS 28 -	
TOTAL PARTS 541 00	
4 mos Rental Storage 260 -	

LITERS/GALS. OF GAS @ 1/2 CAROLAN 20-10	TOTAL LABOR 400 -
LITERS/QTS. OF OIL @ 1 in Auto.	TOTAL PARTS 541 00
kg/LBS. OF GREASE @	ACCESSORIES 16 50
	GAS, OIL AND GREASE 20
	OUTSIDE REPAIRS 28
	Storage 260 -
	TAX 21 64
	Thank You TOTAL 1287 14

I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.

SIGNATURE

(MAY BE CONTINUED ON OTHER SIDE)

ACCESSORIES	
FREIGHT - TIRES. 16 50	
INSTALL - SUBLOT.	
TOTAL ACCESSORIES 16 50	

QTY.	PART NO. AND DESCRIPTION	PRICE
8	2050 Renault	2 43 16
2	manuel oil	5 65 8
2	PH 2804-1	16 10 28
1	WFI FINE FILTER	22 60 18
1	manuel ELECTRIC Regd	20 10 148 90
1	THROTTLE Ventro Bally	98 10 76
1	TRAIL OIL Bally 23	25
1	Alternator Brush Set	62 50 30
2	gas CONDITONERS	8 10 14



RESTORATION & PERFORMANCE
MOTOR CARS
RD #2 Box 2029 Monkton Rd
VERGENNES, VERMONT 05491
(802) 877-2645

No 0476

NAME	CUSTOMER'S ORDER NO.	DATE
ADDRESS	PHONE	PROMISED
CITY	ORDER WRITTEN BY	A.M. P.M.
YEAR MAKE AND MODEL	LICENSE NUMBER	TERMS
SERIAL NUMBER	ODOMETER	

365GT242 32365

DESCRIPTION OF WORK	AMOUNT
LUBRICATION ☐ CHANGE OIL ☐ OIL FILTER ☐ TUNE UP ☐	
TRANSMISSION ☐ DIFFERENTIAL ☐ WASH ☐ POLISH ☐	
SEAT TRACK - 2015 4.5	
BATTERY REGULATOR - 8	
HOOT PARTS 100132	
WHEEL WELLS FOR RUST. 225	
CHECK OIL LEAKS. VALVE ADJUST. RETORQUE. 25	
PATCH HOLE IN FLOOR. DRIVERS SIDE. 25	
Rental 6 mos at 80 (14 hrs) 480 - dwd	

(MAY BE CONTINUED ON OTHER SIDE)

TOTAL PARTS	333
ACCESSORIES	
TOTAL ACCESSORIES	

LITERS/GALS. OF GAS @ 12 hr at 10/12	TOTAL LABOR 480 - ✓
LITERS/QTS. OF OIL @	TOTAL PARTS 333 - ✓
kg/LBS. OF GREASE @	ACCESSORIES
	GAS, OIL AND GREASE 12 - ✓
	OUTSIDE REPAIRS 92 - ✓
	TAX 16 65 ✓
	Thank You TOTAL 933 65

I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.

SIGNATURE

480.00 Bal due

AD. 1K # 2927 6/11/03

Repair 917 x TAX
Storage 480
1413.65
943.65

[illegible]

(MAY BE CONTINUED ON OTHER SIDE)

43 -

ACCESSORIES



QTY.	PART NO. AND DESCRIPTION	PRICE	
13	QTS TURBO	2 95	26 -
2	FILTERS - B253 TECH	16 18	24 -
12	PLUGS - N9YC	3 35	30 -
1	COOLANT ADDITIVE	6 85	5 -
6QT	Redline HTL Redline	8 40	48 -
1	Castrol LMA	7 15	6 -
4	P5 PIRELLI 205/70VR-15	15	
		15470	(124) -
			496 00

1	Power Steering Pump Seal	21 15	18 -
1	QT. P.S. FLUID	3 79	3 -
Left front TRAVE out of TRAVE WHEEL 1 1/8" - might need to be Re Done - watch OIL LEVEL			
			656 -

ACCESSORIES			
	FILTER DIS P	2.5	5 -
	(FREIGHT. Tires In.)		
	FREIGHT.		36
	TIRE DISPOSAL FEE	x4	20 -
	Balance & mount tires		44 -
	COOLANT TEST & Re con		15
	TOTAL ACCESSORIES		120 -



RESTORATION & PERFORMANCE
MOTOR CARS
RD #2 Box 2029 Monkton Rd.
VERGENNES, VERMONT 05491
(802) 877-2645

0663

NAME	CUSTOMER'S ORDER NO	DATE
ADDRESS	ORDER WRITTEN BY	PROMISED
CITY, STATE, ZIP		A.M. P.M.
HOME PHONE	BUS PHONE	EXT
YEAR, MAKE AND MODEL		ODOMETER
SERIAL NUMBER	MOTOR NUMBER	LICENSE NUMBER

DESCRIPTION OF WORK	AMOUNT
☐ LUBE ☒ CHG. OIL ☒ OIL FILTER ☒ TUNE UP ☐ TRANS. ☐ DIFF.	
Test Coolant	
PLUGS - Balance CARB #3	1.5
mount wheels - CUT off OLD X	2.5
change transmission oil	
check levels BLEED BRAKE	3.5
R/R Power Steering Pump. X	2.5
	14 - 10 -
3.1 mos. - 365 Storage	80 -
6.1 mos. - 356 Storage	80 -
	240 -
	480
LITERS/GALS. OF GAS @	10 @ 40
LITERS/QTS. OF OIL @	
kg/LBS. OF GREASE @	5 @ 12
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.	
SIGNATURE	
	TOTAL LABOR
	TOTAL PARTS
	ACCESSORIES
	GAS, OIL AND GREASE
	SUBLET REPAIRS
	Sub Rental
	TAX
	Thank You
	TOTAL

QTY.	PART NO. AND DESCRIPTION	PRICE	90	
3	LH TIEROD END. FIA 202	141 10	270	
3	RH TIEROD END. 200	130 15	A/C	
1	DIN CAP-0023.	24 15	20 -	



RESTORATION & PERFORMANCE MOTOR CARS

RD #2 Box 2029 Monkton Rd.
VERGENNES, VERMONT 05491
(802) 877-2645

0712

NAME	CUSTOMER'S ORDER NO.	DATE
ADDRESS	ORDER WRITTEN BY	PROMISED
CITY STATE ZIP		A.M. P.M.
HOME PHONE	BUS PHONE	EXT
YEAR, MAKE AND MODEL		ODOMETER
SERIAL NUMBER	MOTOR NUMBER	TERMS
		LICENSE NUMBER

DESCRIPTION OF WORK	AMOUNT
☐ LUBE ☐ CHG. OIL ☐ OIL FILTER ☐ TUNE UP ☐ TRANS. ☐ DIFF.	
Wheel Alignment	48 -
INSTALL 6 TIEROD ENDS. 3 hrs.	
Cap. V. Leaks	

(MAY BE CONTINUED ON OTHER SIDE)

TOTAL PARTS	295 -
ACCESSORIES	
TOTAL ACCESSORIES	

LITERS/GALS. OF GAS @		TOTAL LABOR	120 -
LITERS/QTS. OF OIL @		TOTAL PARTS	295 -
kg/LBS. OF GREASE @		ACCESSORIES	
		GAS, OIL AND GREASE	
		SUBLET REPAIRS	48 -
		TAX	14 50
		Thank You TOTAL	472 50

I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. An express mechanics lien is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to cars or articles left in cars in case of fire, theft or any other cause beyond your control.

SIGNATURE

QTY.	PART NO. AND DESCRIPTION	PRICE			
1	Cig. Lighter assy	26 80	20	00	
1	Eclipse CD Player/Receiver	440 20	350	00	
2	Eclipse 80w Speakers	260 00	240	00	
1	Paralell Flow Condenser	180 20	165	00	
1	A/c compressor SD-508	260 70	220	00	
1	Binary Switch Kit	65 40	40	00	
1	Hose kit	116 20	108	00	
1	Drier	36 20	30	00	
1	Bulkhead Fitting #10	10 60	10	00	
1	#6 Bulkhead fitting	10 60	10	00	
2	16" Fans - Pusher	107 25	220	00	
2	45° Flare - 90° fitting	10 70	20	00	
84	Feet #8 hose Barrier	2 50	10	00	
1	At-Exide orbital Battery	158 00	120	00	
2	gallons Gm. Antifreeze	7 20	12	00	
4	feet Power Steer Hose	2 00	8	00	
2	Quarts Power Steer Fluid	4 00	4	00	
1	Mirror Round	10 80			
2	Headlight - halogen Bulbs	25 60	40	00	

(MAY BE CONTINUED ON OTHER SIDE)

TOTAL PARTS		1627 00		
ACCESSORIES				
-	Sublet			
1	Clock Conversion To Quartz		280 00	
+	Misc. crimping, Adapting at Don Clark's		60 00	
-	Charge A/c at Bonister		65 00	
	1 1/4 Pound Arcon Dic 10'			
TOTAL ACCESSORIES				

1627

RPM

RESTORATION & PERFORMANCE MOTOR CARS

RD #2 Box 2029 Monkton Rd.
VERGENNES, VERMONT 05491
Ph/Fax (802) 877-2645

NAME: [REDACTED]

ADDRESS: [REDACTED]

CITY, STATE, ZIP: Essex Vt

HOME PHONE: [REDACTED] BUS PHONE: [REDACTED] EXT: [REDACTED]

YEAR, MAKE AND MODEL: 1969 Ferrari 365 GT 2+2

SERIAL NUMBER: [REDACTED] MOTOR NUMBER: [REDACTED] TERMS: [REDACTED]

CUSTOMER'S ORDER NO: [REDACTED]

DATE: 9-9-01

PROMISED: A.M. P.M.

ODOMETER: 54972

LICENSE NUMBER: [REDACTED]

DESCRIPTION OF WORK	AMOUNT
☐ LUBE ☐ CHANGE OIL ☐ OIL FILTER ☐ TUNE-UP ☐ TRANS ☐ DIFF.	
Work to Install Stereo - Open up Panel, Drilling For Door Speakers - Remove old Speakers in Rear	4.
Work to Tighten Door Prop Mechanism	3. N/c
Work Necessary For A/c System Compressor Bracket, Fan Brackets, Remove. Boil out Condenser, Wiring For Cooling Fans, Relocate Horns, Dissassemble, Reassemble Center Dash Panel.	20 hr

LITERS/GALS. OF GAS @		TOTAL LABOR	1200 00
LITERS/QTS. OF OIL @		TOTAL PARTS	1627 00
KG/LBS. OF GREASE @		ACCESSORIES	
		GAS, OIL AND GREASE	
		SUBLET REPAIRS	405 00
		EPA / WASTE DISPOSAL	
		TAX	81 35
		TOTAL	3313 35
		Balance	813 35

Deposit 2500

THANK YOU



SERVICE REPAIR ORDER

596 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335

DATE	R.O. NO.
7/11/2003	3911

CUSTOMER NAME & ADDRESS



TEL-(Bus)

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1969	Red	12939	58,533	
ITEM	QTY.	DESCRIPTION		PRICE	CLASS	TOTAL
Ferrari Labor	8.75	Perform Fluid service. Place car on lift and remove 4 wheels. Drain engine oil and gearbox oil and replenish. Flush braking system.		92.50	Service	809.38
<i>Paul M. Kent</i> 7/11/03		Trace wiper wiring and rewire so as to set. There is an internal motor issue preventing park. A manual shut down will be required. Check left turn signal for shut off and it does. Rewire fans so as to avoid blowing fuses. Driver's side door lock plunger needs to be sourced. Remove and replace door panel to access plunger shaft.				
		Detail car.				
		the car will need tail sections for the exhaust.				
		Pennzoil GT Perf. Mtr. Oil 20W50		3.45	Parts	37.95T
		Agip Rotra SX 75W90 Gear Oil		9.21	Parts	46.05T
EngOil20W50	11	Windshield Washer Solvent		2.10	Parts	2.10T
Agip RotraSX	5	Sealing Ring		1.29	Parts	2.58T
W/Wash. Solv.	1	Oil Filter Fram		21.71	Parts	43.42T
Sealing Ring	2					
2804-1	2					

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

X _____

Total



SERVICE REPAIR ORDER

596 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335

DATE	R.O. NO.
7/11/2003	3911

CUSTOMER NAME & ADDRESS						
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1969	Red	12939	58,533	
ITEM	QTY.	DESCRIPTION		PRICE	CLASS	TOTAL
Ferrari Labor	2.5	Complete detail car in and out. Wax exterior, leather clean and treat interior, Deoxidize wheel outers, clean glass, vacuum.		92.50	Service	231.25
		Sales Tax		5.00%		6.61

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total \$1,179.34

X _____



SERVICE REPAIR ORDER

500 Post Road
West Mass. 02493
Phone (617) 647-7300
Fax (617) 647-7335

DATE	R.O. NO.
7/20/2003	3917

CUSTOMER NAME & ADDRESS



CUSTOMER COPY

TEL-(Bus)

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1969	Red	12939	58,533	
ITEM	QTY.	DESCRIPTION		PRICE	CLASS	TOTAL
Ferrari Labor	1.4	WIRED IN FUSE CONNECTION RADIATOR FANS AND THERMOSTAT CIRCUIT.		92.50	Service	129.50
		Sales Tax		5.00%		0.00

CUSTOMER COPY

800-44-7171
7/17/03

I authorize you to perform the above repairs and furnish necessary parts. Your employees may operate the vehicle for inspection, testing and delivery at my risk. I am not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose. Neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total \$129.50

X _____



SERVICE REPAIR ORDER

596 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335

DATE	R.O. NO.
1/1/2004	4115

CUSTOMER NAME & ADDRESS



TEL-(Bus)

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
	365 GT 2...	1969	Red	12939	59,712	FERRARI

ITEM	QTY.	DESCRIPTION	PRICE	CLASS	TOTAL
Ferrari Labor	0	REPLACE BOTH REAR EXHAUST MUFFLERS:	92.50	Service	0.00
101497	0	Exhaust Strap Hanger	10.77	Parts	0.00T
Ferrari Labor	1	REPLACE BRAKE AND CLUTCH PEDAL PADS	92.50	Service	92.50
101307	1	CLUTCH PEDAL PAD	22.13	Parts	22.13T
100976	1	BRAKE PEDAL PAD	22.13	Parts	22.13T
Ferrari Labor	3	CHECK HORN INTERMITENT:	92.50	Service	277.50
Ferrari Labor	1.5	CHECK TURN SIGNALS CANCEL INOP ON LEFT SIDE:	92.50	Service	138.75
Ferrari Labor	0	CUSTOMER DISCOUNT OF \$536.42.	92.50	Service	0.00
		EQUALS BALANCE OF \$5,000.00.			
		Sales Tax	5.00%		210.90

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

X

Total \$8,036.42

2500 - 96



SERVICE REPAIR ORDER

596 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335

DATE	R.O. NO.
1/8/2004	4119

CUSTOMER NAME & ADDRESS



CUSTOMER COPY

90.
1/12/04

TEL-(Bus)

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
	365 GT 2...	1969	Red	12939	59,712	FERRARI
ITEM	QTY.	DESCRIPTION		PRICE	CLASS	TOTAL
Ferrari Labor	10	REPLACE SYNCROS IN TRANSMISSION, 2ND IS GRINDING: Remove exhaust system, cross over supports, rear differential and torque tube. Remove transmission and clutch assembly.		92.50		925.00
Ferrari Labor	10	Dissassemble gearbox. Remove gears, bearings and syncro sleeves from primary and secondary shafts. Clean and inspect gears, syncro hubs, sleeves, bearings and shafts for wear. Order syncro rings bearings, etc.		92.50		925.00
520622	1	GASKET GEARBOX-BELL HOUSING		15.11		15.11T
53047	1	Gearbox top cover gasket 330 gt		22.57		22.57T
522905	1	GASKET GEARBOX REAR		17.45		17.45T
93330	1	RING NUT		57.88		57.88T
53517	1	RING NUT		83.85		83.85T
93325	1	RING NUT		52.29		52.29T
93327	1	RING NUT		57.30		57.30T
521315	1	SHIFTER GASKET		24.16		24.16T
100858	1	Rubber Clutch Cable Boot		18.83		18.83T
101633	28	Half Shaft Bolt Nut		6.29679		176.31T
95860024	1	O-RING		7.03		7.03T
95850222	1	Oil Seal 330 GT		18.14		18.14T
93747	1	LOCK TAB		24.06		24.06T
522047	2	Synchronizer Sleeve 53511		456.895		913.79T

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total



SERVICE REPAIR ORDER

596 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335

DATE	R.O. NO.
1/8/2004	4119

CUSTOMER NAME & ADDRESS



CUSTOMER COPY

				TEL-(Bus)	TEL-(Home)	
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
	365 GT 2...	1969	Red	12939	59,712	FERRARI
ITEM	QTY.	DESCRIPTION		PRICE	CLASS	TOTAL
521767	3	Synchro Ring		222.69333		668.08T
521768	1	Synchro Ring 2nd gear		133.84		133.84T
521769	1	Synchro Ring 3rd gear		156.46		156.46T
94239	1	LOCK TAPS		24.06		24.06T
93305	1	LOCK TAB		13.54		13.54T
93306	1	LOCK TAB		13.54		13.54T
131251	2	Motor Mount		96.415		192.83T
100317	1	O-RING		4.83		4.83T
103877	1	Clutch Pilot Bearing		31.19		31.19T
138391	1	Flywheel Seal		64.89		64.89T
95890501	2	ball bearing		147.61		295.22T
95893006	1	needle bearing		38.83		38.83T
100187	4	flywheel lock tab		29.31		117.24T
99101615	1	Kit Clutch Pac V12 B&B 275 365		650.00		650.00T
Ferrari Labor	8	INSTALL NEW CLUTCH ASSEMBLY, GEARBOX, CROSSOVER BRACKETS, DRIVE SHAFT AND DIFFERENTIAL. INSTALL EXHAUST SYSTEM.		92.50		740.00
Ferrari Labor	5.5	REPLACE FRONT AND REAR BRAKE HOSES: install		92.50		508.75
64047362	2	Brake Hose 330 GTC/365 GT		58.64		117.28T
64047358	2	BRAKE HOSE, 365 REAR		81.58		163.16T

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total

X _____



SERVICE REPAIR ORDER

596 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335

DATE	R.O. NO.
1/8/2004	4119

CUSTOMER NAME & ADDRESS



CUSTOMER COPY

TEL-(Bus)

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
	365 GT 2...	1969	Red	12939	59,712	FERRARI
ITEM	QTY.	DESCRIPTION	PRICE	CLASS	TOTAL	
Ferrari Labor	0	REPLACE BOTH REAR EXHAUST MUFFLERS:	92.50		0.00	
101497	0	Exhaust Strap Hanger	10.77		0.00T	
Ferrari Labor	1	REPLACE BRAKE AND CLUTCH PEDAL PADS	92.50		92.50	
101307	1	CLUTCH PEDAL PAD	22.13		22.13T	
100976	1	BRAKE PEDAL PAD	22.13		22.13T	
Ferrari Labor	3	CHECK HORN INTERMITENT:	92.50		277.50	
Ferrari Labor	1.5	CHECK TURN SIGNALS CANCEL INOP ON LEFT SIDE:	92.50		138.75	
		Sales Tax	5.00%		210.90	

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total \$8,036.42

X _____

(SEE ATTACHED)
ROBERTS 6/1/04
DEPOSIT
536.42
2500.00

WJA
PO. 1/12/04

5,100.00



SERVICE REPAIR ORDER

596 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335

DATE	R.O. NO.
4/29/2004	4245

CUSTOMER NAME & ADDRESS



CUSTOMER COPY

TEL-(Bus)

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
	365 GT 2...	1969	Red	12939	59,712	FERRARI

ITEM	QTY.	DESCRIPTION	PRICE	CLASS	TOTAL
Ferrari Labor	10	CHECK IGN DISTRIBUTOR POINTS, NEED TO BE REPLACED. Remove both distributors from motor. Check advance weights on distributor machine for full advance and return. Left distributor has sticking weights. remove plate and service weights and return springs in both distributors. Install new points in each distributor and set dwell. Install distributors back in motor and index slots for timing. Set ignition timing and base idle.	97.50	Service	975.00
95300083	2	Ignition Points - Short - R1	64.475	Parts	128.95T
95300084	2	Ignition Points - Long - R2	64.475	Parts	128.95T
Ferrari Labor	5	DRIVERS WINDOW SLOW. Remove drivers inner door panel. Remove window/trans assembly. Remove old hardened grease and repack. Motor is a bit more noisier than passenger door. Reinstall motor/trans assembly, adjust and reinstall door panel.	97.50	Service	487.50
Ferrari Labor	0.5	Check CAR FOR N.E. 1000 RALLY.	97.50	Service	48.75

CUSTOMER COPY

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total

X _____



SERVICE REPAIR ORDER

596 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335


DATE	R.O. NO.
4/29/2004	4245

CUSTOMER NAME & ADDRESS						
[REDACTED]				TEL-(Bus)	TEL-(Home)	
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
	365 GT 2...	1969	Red	12939	59,712	FERRARI
ITEM	QTY.	DESCRIPTION		PRICE	CLASS	TOTAL
Ferrari Labor	2	REPLACE FRONT AND REAR BRAKE PADS.		97.50	Service	195.00
6432611900	1	Rear pads		82.91	Parts	82.91T
64320574	1	Brake Pads Front		181.50	Parts	181.50T
Ferrari Labor	3	DRIVE DOOR HINGE PINS BACK DOWN ON DRIVERS DOOR AND SECURE WITH COTTER PINS. TIGHTEN AND LUBED DOOR CHECK.		97.50	Service	292.50
Ferrari Labor	0.75	REPLACE BOTH POWER STEERING BELTS DUE TO WEAR.		97.50	Service	73.13
95840036	2	Drive Belt 365 GT 2+2 power steering		38.28	Parts	76.56T
Ferrari Labor	1.5	REPAIR WIRING FOR BRAKE LITES, SWITCH INSTALLED FOR HAZZARD LIGHTS CAUSED AN INTERRUPTION IN BRAKE CIRCUIT.		97.50	Service	146.25
Ferrari Labor	1	CUT REAR EXHAUST HANGER BRACKET TO MATCH OTHER SIDE. HAD TO ROUND OFF CORNER.		97.50	Service	97.50

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

X _____

Total

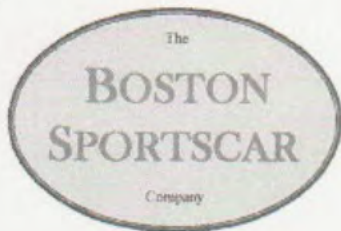

SERVICE REPAIR ORDER

396 Boston Post Road
Weston, Mass. 02493
Phone: (781) 647-7300
Fax: (781) 647-7335

DATE	R.O. NO.
4/29/2004	4245

CUSTOMER NAME & ADDRESS						
[REDACTED]						
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
	365 GT 2...	1969	Red	12939	59,712	FERRARI
ITEM	QTY.	DESCRIPTION		PRICE	CLASS	TOTAL
Ferrari Labor	1.5	WELD TWO BROKEN EXHAUST PIPE HANGERS ON LEFT SIDE UNDER DRIVERS DOOR.		97.50	Service	146.25
		Sales Tax		5.00%		29.94

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

X _____

Total \$3,090.69

2838029

12118

INVOICE

PAGE 1

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123

www.ferrarine.com

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	62675/62680		
DEL DATE	PROD DATE	WARR EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969			17:00 15JUN04		102.00	CASH	28JUN2004

13:51 15JUN04 13:22 28JUN04

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A	CHANGE OIL & FILTER,CK SUSPENSION,CK & ADJUST TIRE PRESSURES,LUBE AS NECESSARY						
	LOF CHANGE OIL & FILTER,CK SUSPENSION,CK & ADJUST TIRE PRESSURES,LUBE AS NECESSARY						
	1007 KEVIN TAYLOR LIC#: 08231955						
	C					140.00	140.00
2	PH2804 OIL FILTER 308/GTO/MOND/328/365/330				22.00	22.00	44.00
12	CASTROL1040 MOTOR OIL				3.99	3.99	47.88
PARTS:	91.88	LABOR:	140.00	OTHER:	0.00	TOTAL LINE A:	231.88

B OVERALL SAFETY CHECKOVER

SS FOUND LOWER RADIATOR HOSE FOULING ON STEERING DRAGLINK-DRAINED COOLING SYSTEM-REPLACED LOWER HOSE AND REPOSITIONED FOR CLEARANCE							
1007 KEVIN TAYLOR LIC#: 08231955							
C						275.00	275.00
1 26693 COOLANT HOSE					169.26	152.00	152.00
1 CLAMP2638 CLAMP BLUE					2.83	2.83	2.83
1 CLAMP3244 CLAMP BLUE					2.92	2.92	2.92
SS NOTE:RADIATOR FAN SWITCH HAS BEEN BYPASSED-CUSTOMER IS AWARE. REVERSE LIGHTS ARE INOP, SLIGHT VIBRATION FELT IN FRT END @ HIGH SPEED							
1007 KEVIN TAYLOR LIC#: 08231955							
C						0.00	0.00
PARTS:	157.75	LABOR:	275.00	OTHER:	0.00	TOTAL LINE B:	432.75

C REPAIR HORN-TEMP REPAIR-SWITCH

SS TRACED FAULTY HORN WIRING TO POOR CARBON BRUSH CONTACT INSIDE STEERING COLUMN-R&R STEERING WHEEL-REPL BRUSH AND WIRE.							
1007 KEVIN TAYLOR LIC#: 08231955							

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

2838029

12118

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123
www.ferrarine.com

INVOICE

PAGE 2

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	62675/62680		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969			17:00 15JUN04		102.00	CASH	28JUN2004
R.O. OPENED		READY	OPTIONS:				
13:51 15JUN04		13:22 28JUN04					
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
			C			175.00	175.00

SS REMOVED TEMP. HORN SWITCH FROM CONSOLE AND
REFIT ANTENNA SWITCH

1007 KEVIN TAYLOR LIC#: 08231955

PARTS: 0.00 LABOR: 175.00 OTHER: 0.00 TOTAL LINE C: 175.00

D DRIVER'S WINDOW INOPERATIVE

SS TESTED ELECTRICAL CIRCUITS TO MOTOR-OK.
INTERNAL MOTOR FAULT. R&R LH WINDOW
MOTOR-SENT FOR OVERHAUL-REINST AND
LUBRICATED CABLE/PULLIES.

1007 KEVIN TAYLOR LIC#: 08231955

C
1 WMTR REBLT WINDOW MOTOR

SS PAINTED INSIDE OF DRIVER'S DOOR WITH RUST
INHIBITOR-SUPPLIED BY CUSTOMER

1007 KEVIN TAYLOR LIC#: 08231955

PARTS: 310.00 LABOR: 315.00 OTHER: 0.00 TOTAL LINE D: 625.00

E HEADLAMPS INOPERATIVE

SS SEE DESCRIPTION BELOW

1007 KEVIN TAYLOR LIC#: 08231955

C
1 RELAY 6RA RELAY

PARTS: 143.20 LABOR: 400.00 OTHER: 0.00 TOTAL LINE E: 543.20

INITIAL DIAGNOSIS OF HEADLAMP CIRCUIT-TRACED FAU LT TO INOPERATIVE
RELAY-R&R RELAY BOARD AND SID E CONSOLE PANEL-REPLACED CONTROL RELAY.
RELAY IS NOW OPERATIONAL, BUT HEADLAMPS STILL INOP-TRACED WIRING FROM
RELAY TO STEERING COLUMN SWITCH, AND CONSOLE SWITCH. FOUND CONSOLE

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

2838029

1 2 1 1 8

INVOICE

PAGE 3

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123
www.ferrarine.com

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

SERVICE ADVISOR: 1002 STEPHEN OLDFORD								
COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
RED	69	FERRARI 365 GT 2+2		12939	28YC05	62675/62680		
DEL DATE	PROD DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969			17:00 15JUN04			102.00	CASH	28JUN2004

13:51 15JUN04 13:22 28JUN04

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
SWITCH-GROUNDING RELAY-SENDING POWER THROUGH BLACK WIRE TO COLUMN SWITCH.-NO POWER FROM STEE RING COLUMN TO RED AND YELLOW WIRES TO HEADLAMP S-INTERNAL COLUMN SWITCH FAULT. BRIDGED/BYPASSE D WIRING AT COLUMN SWITCH PER CUSTOMER'S REQUEST-REASSEMBLED RELAY BOARD AND TRIM PANELS -NOTE:NON-ORIGINAL STEERING COLUMN SWITCH HAS BEEN INSTALLED AND DASH "E" SWITCH HAS BEEN WIRED TO ACTIVATE LIGHTS.							

F CIG. LIGHTER INOP

SS DETACHED GRD WIRE TO CIG. LIGHTER-TOO SHORT. EXTENDED GRD WIRE-INCLUDING R&R CONSOLE PANEL. ADJUSTED TABS TO RETAIN ELEMENT 1007 KEVIN TAYLOR LIC#: 08231955							
						65.00	65.00

PARTS: 0.00 LABOR: 65.00 OTHER: 0.00 TOTAL LINE F: 65.00

G FABRICATE ENGINE BONNET CABLE

SS FABRICATED AND FIT ENGINE LID CABLE TO LIMIT FORWARD MOVEMENT 1007 KEVIN TAYLOR LIC#: 08231955							
						65.00	65.00

PARTS: 0.00 LABOR: 65.00 OTHER: 0.00 TOTAL LINE G: 65.00

H INSPECT CLUTCH CABLE

SS CABLE YOKES ARE WORN-OK AT THIS TIME-INSPECT NEXT SERVICE 1007 KEVIN TAYLOR LIC#: 08231955							
						0.00	0.00

SS INSTALLED BATTERY CUT-OFF SWITCH TO NEG. POST
AND REROUTED/SECURED POSITIVE CABLE TO
BATTERY

1007 KEVIN TAYLOR LIC#: 08231955
C 45.00 45.00

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

2838029

12118

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123

www.ferrarine.com

INVOICE

PAGE 4

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	62675/62680		
DEL DATE	PROD. DATE	WARR EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969			17:00 15JUN04		102.00	CASH	28JUN2004

R.O. OPENED	READY	OPTIONS:	
13:51 15JUN04	13:22 28JUN04		
LINE	OPCODE	TECH	TYPE HOURS
PARTS:	0.00	LABOR:	45.00 OTHER: 0.00
TOTAL LINE H:		45.00	

I MOUNT FIRE EXTINGUISHER BEHIND RH SEAT-FABRICATE BRACKET

SS FABRICATED BRACKET AND MOUNTED FIRE
EXTINGUISHER BEHIND PASSENGER'S SEAT
1007 KEVIN TAYLOR LIC#: 08231955

C 45.00 45.00
PARTS: 0.00 LABOR: 45.00 OTHER: 0.00 TOTAL LINE I: 45.00

J MODIFY-DRILL WATER DRAIN HOLES IN EXH TAILPIPER

SS DRILLED DRAIN HOLES IN TAILPIPER-NO CHARGE
1007 KEVIN TAYLOR LIC#: 08231955

C 0.00 0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE J: 0.00

K GLUE-SECURE CLUTCH PEDAL RUBBER COVER

SS APPLIED GLUE AND SECURED CLUTCH PEDAL COVER-NO
CHARGE
1007 KEVIN TAYLOR LIC#: 08231955

C 0.00 0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE K: 0.00

L NOTE: ESTIMATE/RECOMMENDATION TO ADDRESS RUST ON LOWER DOORS AROUND
DRAIN HOLES

WIP WORK IN PROGRESS

99 C 0.00 0.00
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE L: 0.00

M WASH EXTERIOR AND VACUUM

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

1 2 1 1 8

INVOICE

PAGE 5

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123

www.ferrarine.com

SERVICE ADVISOR:				1002 STEPHEN OLDFORD			
COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	62675/62680		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969			17:00 15JUN04		102.00	CASH	28JUN2004

R.O. OPENED		READY		OPTIONS:	
13:51 15JUN04		13:22 28JUN04			
LINE	OPCODE	TECH	TYPE	HOURS	
CLEAN WASH EXTERIOR AND VACUUM					
	1020	C			
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00
				TOTAL LINE M:	0.00

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusa.
com



Thank you,
Steve

THANK YOU
EXCLUSIONS OF WARRANTIES

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

DESCRIPTION	TOTALS
LABOR AMOUNT	1525.00
PARTS AMOUNT	702.83
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	44.56
TOTAL CHARGES	2272.39
LESS INSURANCE	0.00
SALES TAX	37.37
PLEASE PAY THIS AMOUNT	2309.76

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

CUSTOMER COPY

2838029

1 2 2 6 5

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123
www.ferrarinne.com

INVOICE

PAGE 1

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

SERVICE ADVISOR: 1002 STEPHEN OLDFORD							
COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT	TAG
RED	69	FERRARI 365 GT 2+2		12939	28YC05	63175/63180	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969			17:00 08SEP04		102.00	CASH	13OCT2004

R.O. OPENED

READY

OPTIONS:

11:03 08SEP04 16:18 13OCT04

LINE OPCODE TECH TYPE HOURS

LIST

NET

TOTAL

A REPLACE ENGINE MOUNTS

SS SEE DESCRIPTION BELOW

1007 KEVIN TAYLOR LIC#: 08231955

C

2 131251 PLUG MTS	109.34	850.00	850.00
4 102015 EXHAUST GASKET SINGLE	10.00	9.00	190.00
4 102017 EXHAUST GASKET DOUBLE	14.90	13.50	36.00
18 104339 SPACER	3.16	2.75	54.00
19 104339 SPACER	3.16	2.75	49.50
4 CLAMP178 1 7/8 CLAMP	4.18	3.50	52.25
PARTS: 395.75	LABOR: 850.00	OTHER: 0.00	TOTAL LINE A: 1245.75

REMOVED ENTIRE EXHAUST SYSTEM INCLUDING MANIFOLD DS-FOR ACCESS TO MOTOR MOUNTS. SUPPORTED ENGINE AND REPLACED BOTH RUBBER MOUNTS. REPAIRED LH EXH MANIFOLD-WELDED EXTENSION DUE TO RUST/CRACK. REFIT MANIFOLDS W/NEW GASKETS AND HARDWARE. REFIT ENTIRE EXH. SYSTEM WITH NEW HANGER SPACERS AND ADJUSTED FOR PROPER ALIGNMENT.

B FUEL ODOR-CARB UNIONS

SS SEE DESCRIPTION BELOW

1007 KEVIN TAYLOR LIC#: 08231955

C

SS REPLACED ENGINE AIR FILTERS		300.00	300.00
1007 KEVIN TAYLOR LIC#: 08231955			
C		0.00	0.00
3 95182025 AIR FILTER 365	52.50	42.50	127.50
PARTS: 127.50	LABOR: 300.00	OTHER: 0.00	TOTAL LINE B: 427.50

REPLACED LEAKING CARB FUEL BANJO UNION GASKETS. RESET CARB LINKAGE TO CORRECT POSITION AND RETUNED CARB MIXTURE/IDLE SETTINGS.

C REPLACE ALTERNATOR BELTS

SS ADJUSTED TENSION FOR POWER STEERING BELTS-ALT.
BELT IS OK

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

2838029

1 2 2 6 5

INVOICE

PAGE 2

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123
www.ferrarine.com

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR		YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
RED		69	FERRARI 365 GT 2+2		12939	28YC05	63175/63180		
DEL DATE		PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
01JAN1969				17:00 08SEP04		102.00	CASH	13OCT2004	

R.O. OPENED	READY	OPTIONS:
11:03 08SEP04	16:18 13OCT04	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1007		KEVIN TAYLOR	LIC#:	08231955			
		C				60.00	60.00
PARTS:	0.00	LABOR:	60.00	OTHER:	0.00	TOTAL LINE C:	60.00

D C/S RATTLE FROM LH DOOR WHEN DRIVING ON ROUGH SURFACE
SS R&R LH DOOR TRIM PANEL-INSULATED WINDOW CABLES
AND LOCK RODS-BOTH DOORS

1007	KEVIN TAYLOR	LIC#:	08231955				
		C				0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE D:	0.00

E REPLACE LH DOOR WINDOW CHANNEL GASKET
SS REPLACED BOTH WINDOW CHANNEL FELT
GASKETS-INCLUDING RELEASE FRAME MOUNTS TO
GAIN ACCESS-CLEANED OLD SEALER/GLUE FROM
CHANNELS

1007	KEVIN TAYLOR	LIC#:	08231955				
		C				750.00	750.00
14	990086	U	CHANNEL		6.24	5.50	77.00
PARTS:	77.00	LABOR:	750.00	OTHER:	0.00	TOTAL LINE E:	827.00

F C/S NOISE PRESENT WHEN TURNING-HARD RIGHT TURNS
SS NO ABNORMAL NOISES HEARD AFTER ENGINE MOUNT
REPL. AND P/S BELT ADJ.-OK

1007	KEVIN TAYLOR	LIC#:	08231955				
		C				0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE F:	0.00

G REWIRE RADIO POWER TO KEY-ON POWER SOURCE
SS RADIO ALREADY WIRED TO KEY ON SOURCE-CHECKED

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

2838029

12265

INVOICE

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123

www.ferrarin.com

PAGE 3

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR		YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
RED		69	FERRARI 365 GT 2+2		12939	28YC05	63175/63180		
DEL DATE		PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969				17:00 08SEP04			102.00	CASH	13OCT2004

R.O. OPENED	READY	OPTIONS:
11:03 08SEP04	16:18 13OCT04	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

BATTERY DRAW-9MA.

1007 KEVIN TAYLOR LIC#: 08231955

C

0.00 0.00

SS R&R RH DOOR SPEAKER-(SWAPPED SPEAKER FROM LH
DOOR TO TEST)-TRACED FAULT TO DAMAGED WIRING
TO RH SPEAKER-REPAIRED AND RECONNECTED.

1007 KEVIN TAYLOR LIC#: 08231955

C

187.00 187.00

SS PAINT ANTI-RUST "ENRUST" INSIDE RH DOOR-AND
MAKE/FIT RH WEATHER SHIELD.

1007 KEVIN TAYLOR LIC#: 08231955

C

0.00 0.00

PARTS: 0.00 LABOR: 187.00 OTHER: 0.00 TOTAL LINE G: 187.00

H PRELIM. WORK FOR NEW SEATBELT POSITIONING

WIP WORK IN PROGRESS

1007 KEVIN TAYLOR LIC#: 08231955

C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE H: 0.00

I COURTESY INSP-OIL LEVEL, WHEEL TORQUE/TIRE PRESS, & LIGHTS

CHECK COURTESY INSP-OIL LEVEL, WHEEL TORQUE/TIRE
PRESS, & LIGHTS

1007 KEVIN TAYLOR LIC#: 08231955

C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE I: 0.00

J WASH EXTERIOR AND VACUUM

CLEAN WASH EXTERIOR AND VACUUM

1020 C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE J: 0.00

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

2838029

1 2 2 6 5

INVOICE

PAGE 4

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123

www.ferrariusa.com

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

SERVICE ADVISOR: 1002 STEPHEN OLDFORD							
COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	63175/63180		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969			17:00 08SEP04		102.00	CASH	13OCT2004

R.O. OPENED READY OPTIONS:

11:03 08SEP04 16:18 13OCT04

LINE OPCODE TECH TYPE HOURS

LIST NET TOTAL

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusa.
com



THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	2147.00
PARTS AMOUNT	600.25
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	30.00
TOTAL CHARGES	2777.25
LESS INSURANCE	0.00
SALES TAX	31.51
PLEASE PAY THIS AMOUNT	2808.76

CUSTOMER COPY

2838029

1 2 3 2 7

INVOICE

PAGE 1

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123
www.ferrarine.com

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	63465/63466		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN1969			17:00 13OCT04		102.00	CASH	13OCT2004

R.D. OPENED READY OPTIONS:

08:24 13OCT04 16:34 13OCT04

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A SLIGHT FUEL LEAK FROM CARB FUEL DELIVERY PIPE UNIONS.

SS REMOVED AIRBOX AND FUEL DELIVERY

RAIL-RESURFACED ALL BANJO UNION FACES AND

REFIT W/NEW WASHERS TO RESEAL. RUN UP AND

RECHECK FOR LEAK-OK

1007 KEVIN TAYLOR LIC#: 08231955

C

1 BREEZE3504 CLAMP

PARTS:	2.48	LABOR:	60.00	OTHER:	0.00	TOTAL LINE A:	62.48
--------	------	--------	-------	--------	------	---------------	-------

B REPLACE TORN WEATHERSTRIP GASKETS FOR DOOR OPENING

SS REPLACEMENT TO BE COMPLETED WITH NEW SEATBELT

INSTALL-RESCHEDULE FOR COMPLETION.

1007 KEVIN TAYLOR LIC#: 08231955

C

28 990021 DR SEAL

PARTS:	175.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE B:	175.00
--------	--------	--------	------	--------	------	---------------	--------

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrarius.com

\$3055.11

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	60.00
PARTS AMOUNT	177.48
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	237.48
LESS INSURANCE	0.00
SALES TAX	8.87
PLEASE PAY THIS AMOUNT	246.35

CUSTOMER COPY

2838029

1 2 3 7 4

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123

www.ferrarine.com

INVOICE

PAGE 1

SERVICE ADVISOR: 1017 RYAN BROOKS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	63749/63752		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PD NO.	RATE	PAYMENT	INV. DATE
01JAN69 IS			17:00 08NOV04		102.00	CASH	29NOV2004

R.O. OPENED	READY	OPTIONS:
10:13 08NOV04	10:59 29NOV04	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A INSTALL SEATBELTS PROVIDED BY CUST.

SS SEE FULL DESCRIPTION BELOW

1007 KEVIN TAYLOR LIC#: 08231955

C		500.00	500.00
1 ARCPipe WELD PIPE	46.80	32.50	32.50

SUBL FLATBED TRANSPORT TO/FROM BODYSHOP

C		150.00	150.00
---	--	--------	--------

SUBL WELD MOUNTING PLATES FOR S/BELT RETRACTORS AND FIT W/FLUSH MOUNTED

ALLEN-HEAD SCREWS		285.00	285.00
-------------------	--	--------	--------

PARTS:	32.50	LABOR:	500.00	OTHER:	435.00	TOTAL LINE A:	967.50
--------	-------	--------	--------	--------	--------	---------------	--------

REMOVED INTERIOR TRIM AND FRONT SEATS-AFTER REMOVING SILL PLATE TRIM
PANELS-CUT AWAY FIBER GLASS TO EXPOSE BODY SILL TO MOUNT S/BELT
RETRACTORS-MODIFIED NEW MOUNTING PLATES AND CUT SILL TO FLUSH MOUNT
BRACKETS-SENT VEHICLE TO BODYSHOP FOR WELDING. RE-FIBERGLASS SILLS
AFTER WELDING TO STRENGTHEN FLOOR SECTION. MODIFIED SILL TRIM PANELS TO
FIT NEW S/BELT RETRACTORS-HAD TO FABRICATE SPACERS AND ADJUST TRIM
PANELS TO PROPERLY FIT NEW RETRACTORS. AFTER PREP-PAINTED SPACERS BLACK
AND FINAL FIT TRIM PANELS AND MOUNTED S/BELT RETRACTORS.- REINSTALLED
CARPET/TRIM, AND SEATS-INCLUDING MAKE NEW SEAT MOUNTING BOLT.

B INSTALL ALUM./PLASTIC CARB. WASHER KIT

SS SEE DESCRIPTION BELOW

1007 KEVIN TAYLOR LIC#: 08231955

C		175.00	175.00
1 40DFI WEBER CARB	2000.00	1600.00	1600.00
6 A12X18 ALUM WASHER	3.00	2.50	15.00

PARTS:	1615.00	LABOR:	175.00	OTHER:	0.00	TOTAL LINE B:	1790.00
--------	---------	--------	--------	--------	------	---------------	---------

ATTEMPT TO FIT NEW SEALING WASHERS FOR CARB FUEL DELIVERY
BANJO-FITTINGS. FOUND #3 CARB FITTING THREADS STRIPPED-TOP OF CARB IS
UNREPAIRABLE. REPLACED #3 CARB-REMOVED TOP PLATE TO CLEAN AND VERIFY
FUEL JET SIZES-OK. REFIT CARB AND FUEL DELIVERY RAIL W/NEW ALUMINUM

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

2838029

1 2 3 7 4

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123
www.ferrarine.com

INVOICE

PAGE 2

SERVICE ADVISOR: 1017 RYAN BROOKS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	63749/63752		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 IS			17:00 08NOV04		102.00	CASH	29NOV2004

R.O. OPENED READY OPTIONS:

10:13 08NOV04 10:59 29NOV04

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
SEALING	WASHERS	RETUNE	NEW CARB	AND REFIT AIRBO X ASSY.			

C THERMO SWITCH WIRED TO "A" SWITCH ON INT.
SS SEE FULL DESCRIPTION BELOW
1007 KEVIN TAYLOR LIC#: 08231955

	C					200.00	200.00
1	20068904	SWITCH			113.68	96.50	96.50
1	101507	SWITCH/THERMAL			78.05	66.35	66.35
1	101508	GASKET			1.40	1.20	1.20
PARTS:	164.05	LABOR:	200.00	OTHER:	0.00	TOTAL LINE C:	364.05

R&R CENTER CONSOLE TRIM PANEL-REMOVED "A" SWITCH H AND FIT NEW SWITCH
FOR MANUAL CONTROL OF RAD COOLING FANS-RUN NEW WIRING FOR FANS AND
REPLACED RADIATOR THERMO SWITCH AND GROUND WIRE REFILLED COOLING SYSTEM
AND RUN UP TO TEST-OK FOUND RADIATOR CAP LEAKING-MODIFIED CAP AND
REFACED NECK TO SEAL. ORDERED NEW RAD CAP

D INSTALL BOTTOM WINDOW TRIM FELTS
SS R&R BOTH DOOR TRIM PANELS-DRILL OUT
RIVETS-TRIM NEW FELT STRIPS TO FIT AND RIVET
NEW FELT STRIPS TO DOORS
1007 KEVIN TAYLOR LIC#: 08231955

	C					250.00	250.00
7	990026	FELT SCRUB			7.00	5.95	41.65
PARTS:	41.65	LABOR:	250.00	OTHER:	0.00	TOTAL LINE D:	291.65

E INSTALL RUBBER DOOR TRIM PIECE
SS W/SILL PLATE TRIM REMOVED-REMOVED DOOR
WEATHERSTRIP GASKETS-CUT NEW GASKETS TO FIT
AND INSTALLED NEW DOOR GASKETS
1007 KEVIN TAYLOR LIC#: 08231955

	C					0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE E:	0.00

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

2838029

1 2 3 7 4

INVOICE

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123

www.ferrariusa.com

PAGE 3

SERVICE ADVISOR: 1017 RYAN BROOKS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	63749/63752		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 IS			17:00 08NOV04		102.00	CASH	29NOV2004
R.O. OPENED		READY	OPTIONS:				
10:13 08NOV04		10:59 29NOV04					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
F	DUPLICATE KEY						
	SS KEY BLANK NOT AVAILABLE FROM FERRARI-AWAITING						
	NEW KEY FROM LOCKSMITH						
	99 C					0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE F:	0.00

G	WASH EXTERIOR AND VACUUM						
	CLEAN WASH EXTERIOR AND VACUUM						
	1020 C					0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE G:	0.00

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusa.
com



THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	1125.00
PARTS AMOUNT	1853.20
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	435.00
MISC. CHARGES	20.00
TOTAL CHARGES	3433.20
LESS INSURANCE	0.00
SALES TAX	93.66
PLEASE PAY THIS AMOUNT	3526.86

CUSTOMER COPY

2838029

1 2 4 1 7

INVOICE

PAGE 1

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123
www.ferrarine.com

SERVICE ADVISOR: 1017 RYAN BROOKS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
RED	69	FERRARI 365 GT 2+2	12939	28YC05	63956/63956	
DEL DATE	PROD DATE	WARR EXP	PROMISED	PO NO	RATE	PAYMENT
01JAN69 IS			17:00 20DEC04		102.00	CASH

R.O. OPENED	READY	OPTIONS:
-------------	-------	----------

16:47 20DEC04 08:37 23DEC04

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A REPLACE RADIATOR CAP

SS FIT NEW RADIATOR CAP

1007 KEVIN TAYLOR LIC#: 08231955

C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

B ADJUST WINDOW CHANNEL-GAP IN THE BACK OF THE WINDOW

SS SEE FULL DESCRIPTION BELOW

1007 KEVIN TAYLOR LIC#: 08231955

C

350.00 350.00

PARTS: 0.00 LABOR: 350.00 OTHER: 0.00 TOTAL LINE B: 350.00

R&R RH DOOR TRIM PANEL-ATTEMPT TO ADJUST WINDOW FRAME-NOT ENOUGH. FOUND WINDOW FRAME BENT-TOO HIGH. STRAIGHTENED WINDOW FRAME-REAR CORNER SEPERATED IN PROCESS. REPAIRED REAR CORNER OF FRAME-INCLUDING FABRICATE AND FIT INTERNAL BRACKET-REASSEMBLED AND ADJUSTED. FILLED GAP IN CORNER W/EPOXY. ADJUSTED DOOR LATCH AND STRIKER FOR PROPER ALIGNMENT.

NOTE:SMALL GAP STILL IN CORNER WEATHERSTRIP AREA-NO MORE ADJUSTMENT AVAILABLE.

C RATTLE IN THE PASS SIDE DOOR

SS R&R LH DOOR PANEL-ADJUSTED INTERIOR HANDLE

ROD-INSULATED RIVET HEADS ON UPPER DOOR

FRAME

1007 KEVIN TAYLOR LIC#: 08231955

C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrarius.com

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	350.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	7.00
TOTAL CHARGES	357.00
LESS INSURANCE	0.00
SALES TAX	0.35
PLEASE PAY THIS AMOUNT	357.35

CUSTOMER COPY

Coker Tire

Fine Tires for Collector Vehicles

International Headquarters • All Mail • East Coast Warehouse
1317 Chestnut Street, Chattanooga, TN 37402 USA
Local & International 423-265-6368 • Fax 423-756-5607

West Coast Retail Store & Warehouse
5468 East Lamona Avenue, Fresno, CA 93727 USA
Local & International 559-453-3278 • Fax 559-453-0085




Nationwide Toll Free

1-800-251-6336

www.coker.com

SOLD TO:

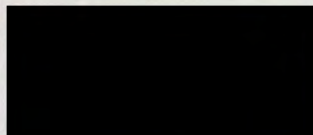

11/02

SHIP TO:

MARK MINA
FERRARI OF NEW ENGLAND
1203 WASHINGTON ST

INVOICE# 078367

Pick Batch# 15346

WEST NEWTON MA 02465

CUST P.O. #	MAKE-MODEL	TAG	MILEAGE	TELEPHONE	ROUTE	SLM	SHIP VIA	ORDER #	PAGE	REMARKS	
		*ARBABCF			0	15	Shipping & Handling	175647	1		
INVOICE DATE	INVOICE NUMBER	PREVIOUS SHIPPED INVOICE NUMBER	TERMS								
04/26/2005	078367		CASH SALE				Opened by Operator # 73 04/26/05 16:39:13 17				
STOCK NUMBER	SIZE	DESCRIPTION			QUANTITY			UNIT PRICE	T	F.E.T.	EXTENSION
					ORDERS	SHIPPED	PREV SHP				
57977	21570VR15	MICHELIN XWXT BLK			4	4		346.21	00	.00	1384.84
85364	15F13	185/195R15 MICH. TUBE TR-13			4	4		17.00	00	.00	68.00
EXTENDED	PROTECTION SVC	FOR VINTAGE TIRES (0) (0) (0) (0)			12	12		10.00	00	.00	120.00
1	DECLARED	VALUE PER ITEM PER \$100.00			12	12		1.00	00	.00	12.00
	ferrari 1969 confirmed order sure about size										
FEDEX	C-Ship&HandlIFC	Zone 5	31 lbs per package		4	4		13.41	00	.00	53.64
	043527181 tax id 6172441112										
FEDEX	C-Ship&HandlIFC	Zone 5	12 lbs per package		1	1		8.06	00	.00	8.06
METHOD OF PAYMENT:											
VISA 1,646.54 EXP: 8/2006 AUTHORIZATION CODE: 091911											
CHANGE: .00											
Freight Tracking #: 074783140981655 074783140981662 074783140981679 074783140981693											

FEDEX TRACKING www.fedex.com or 800-762-3725

PARTS	FREIGHT	TAX %	TAXABLE AMOUNT	TAX	F.E.T.	MISC. AMOUNT	INVOICE TOTAL
1452.84	120.00						PAID IN FULL
	73.70						1646.54

U.S. DOLLARS

PLEASE SEE BACK FOR EXTENDED TIRE PROTECTION WARRANTY & RETURN POLICY

2838029

1 2 5 6 5

INVOICE

Ferrari

OF
NEW ENGLAND

1203 WASHINGTON STREET
WEST NEWTON, MA 02465
617-559-0123

www.ferrarine.com

PAGE 1

SERVICE ADVISOR: 1017 RYAN BROOKS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	64340/64345		
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 IS			17:00 16MAY05		102.00	CASH	17MAY05
R.O. OPENED		READY	OPTIONS:				

10:59 16MAY05 12:22 17MAY05

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A INSTALL NEW TIRES

SS MOUNTED AND BALANCED FRONT AND REAR TIRES

W/TUBES

1014

C

320.00

320.00

2 192934 CONTRAPPESO RUOTE CPL (50GR 5-

3.99

3.99

7.98

PARTS:

7.98

LABOR:

320.00

OTHER:

0.00

TOTAL LINE A:

327.98

B** INSTALL NEW IGNITION LOCK CYLINDER

SS LOWERED STEERING COLUMN, REMOVED OLD IGNITION

LOCK CYLINDER AND REPLACED WITH NEW CYLINDER

AND KEYS-TESTED OK

1014

C

270.00

270.00

1 168785 SWITCH/ING

1327.49

875.00

875.00

PARTS:

875.00

LABOR:

270.00

OTHER:

0.00

TOTAL LINE B:

1145.00

C** COURTESY INSP-OIL LEVEL, WHEEL TORQUE/TIRE PRESS, & LIGHTS

CHECK COURTESY INSP-OIL LEVEL, WHEEL TORQUE/TIRE

PRESS, & LIGHTS

1014

C

0.00

0.00

PARTS:

0.00

LABOR:

0.00

OTHER:

0.00

TOTAL LINE C:

0.00

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusa.
com

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	590.00
PARTS AMOUNT	882.98
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	29.46
TOTAL CHARGES	1502.44
LESS INSURANCE	0.00
SALES TAX	45.62
PLEASE PAY THIS AMOUNT	1548.06

CUSTOMER COPY

KTR European Motorsports, Inc.

99 Fitchburg Road
 Ayer, MA 01432
 978-772-7800

Invoice

66,300
 MINOR
 TUNE-UP

Date	Invoice #
10/6/2005	3945

Bill To

10/11/05
 per.
 \$ 3,320.78

Terms	Project
Net 15	1969 Ferrari 365


Item	Serviced	Qty	Description	Rate	Amount
Labor Service	9/20/2005	2.5	Diagnose wiper switch problem- replace switch, no movement of wipers.	75.00	187.50
Labor Service	9/21/2005	4.5	Remove left and right inner wheel panels and remove glove box. Remove battery to access wiper motor, remove and inspect. Note rust and debris inside.	75.00	337.50
Labor Service	9/22/2005	4.5	Connect wiper motor to car and test. Sort out connections at wiper switch. Check wiring for shorts in harness. Reinstall glove box and foot well side panels. Install and safety wire drain plug and fill engine with oil. Remove air box and remove distributor caps. Check ignition wire, remove and inspect spark plugs.	75.00	337.50
Labor Service	9/23/2005	4.5	Do compression test cold. Clean, lube and reinstall wiper motor. Install steering wheel assembly and switch assembly. Fit wiper arms and adjust position on windshield. Reinstall battery and hold down.	75.00	337.50
Labor Service	9/26/2005	5.75	Clean and adjust point gap in distributor. Run on distributor machine to check internal timing and advance. Cover screw for better driver fit and install both distributors. Prime engine and run briefly. Remove fuel rail and carb tops to have air box stud threads repaired. Install four heli coils and with fuel rail removed, note odd spacing of carbs for rail to fit well, mount top in milling machine and face cut sealing surface. Install cover to carb.	75.00	431.25
Labor Service	9/27/2005	6.5	Gap and install spark plugs, remove fluid from brake reservoir and fill with new oil. Bleed brakes, check brake pads, lube tapers of hubs and fit wheels. Check carb sync, run engine to warm up and check and set ignition setting to full advance. Remove throttle links and set to standard lengths and reinstall. Set carb sync at idle, off idle and adjust volume bypass screws at each throttle bore.	75.00	487.50
Labor Service	9/28/2005	4.25	Check ignition wire firing order. Remove small fuel return hose to tank and check for flow while pump is running. Flush out fit hose to fuel rail. Remove carb top and begin to repair threads. Mount cover in milling machine and indicate center of threaded boss. Drill tap for heli coil and install. Cut to length and face cut sealing surface of carb top for sealing washer.	75.00	318.75
Labor Service	9/29/2005	4.75	Complete carb repair and install cover and banjo fitting safety wire. Install air box and fit heli coil to front carb air box stud. Check lights and connect wire in trunk for back up light. Move front throttle links to clear breather hoses to air box.	75.00	356.25
Total					

KTR European Motorsports, Inc.

99 Fitchburg Road
Ayer, MA 01432
978-772-7800

Invoice

Date	Invoice #
10/6/2005	3945

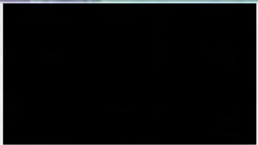Bill To


Terms	Project
Net 15	1969 Ferrari 365

Item	Serviced	Qty	Description	Rate	Amount
Helper/Detail/Delivery	9/30/2005	5.5	Wash, clean, polish and detail car.	35.00	192.50
Labor Service	9/30/2005	1.25	Center wheel and do final adjustments to carb/idle mixture screws.	75.00	93.75
Parts	9/30/2005	12	Spark plug	2.41	28.92T
Parts	9/30/2005	12	20W50 oil	2.89	34.68T
Miscellaneous - Other	9/30/2005		Fuel	20.00	20.00
Shop Supplies			Shop Supplies	154.00	154.00
			Sales Tax	5.00%	3.18
				Total	\$3,320.78

KTR European Motorsports, Inc.

99 Fitchburg Road
Ayer, MA 01432
978-772-7800

Invoice

Date	Invoice #
11/16/2006	5484

Bill To

12/1/06
PETER M.
- WHEN DID HE GET SET OF POINTS?
- DID THEY GET SHOWN IN?

* ATTORNEY EVOL
- WORK ON VALVE GUIDES

PAID RECEIPT

HOUSEHOLD CASH

11/21/06

Terms	Project
Net 15	1969 Ferrari 365

Item	Serviced	Qty	Description	Rate	Amount
Labor Service	10/11/2006	3.5	Test drive and note poor running condition. Remove spark plugs and inspect, check compression and check ignition wire continuity and plug ends. Note cracked distributor cap on 1-6 bank and replace with used cap from stock. Clean corrosion from 1-6 coil wire at coil and install drain hose from hood area to keep water off top of coil. Test drive with new spark plugs and note still poor running condition. Continue to diagnose poor ignition wires and check idle jets. Note problems with #8 spark hole.	75.00	262.50
Labor Service	10/17/2006	1.25	Remove carb tops and check float bowls for debris. Clean #8 spark plug threads and install spark plug. Check spark plug wires and plug ends.	75.00	93.75
Labor Service	10/18/2006	4.25	Note number 7-9 cylinders not running, remove 7-12 distributor and run on machine. One set points not working, fit new set points and adjust phasing. Reinstall distributor and plug wire set. Warm up engine and test drive car in lot. Check carb sync and note out of adjustment. Test 7-12 coil-ok.	75.00	318.75
Labor Service	10/19/2006	4.25	Install #70 low speed jets and check ignition setting. Remove 1-6 distributor and adjust phasing. Set idle ignition setting, test drive. Install air box and air filters/covers. Sync carbs at idle and off.	75.00	318.75
Helper/Detail/Delivery	11/1/2006	0.5	Clean interior.	35.00	17.50
Miscellaneous - Other	10/26/2006	10.04	Fuel	2.599	26.09
Miscellaneous - Other	11/1/2006	1	Fuel	10.00	10.00
Parts	11/8/2006	1	Fuel filter- large	22.26	22.26T
Parts	11/8/2006	1	Fuel filter- small	10.80	10.80T
Shipping Charges	11/8/2006	1	UPS Shipping- Partsource	6.00	6.00
Parts	11/9/2006	2	Fuel pump	97.55	195.10T
Parts	11/15/2006	4	Bushing	2.76	11.04T
Shop Supplies			Shop Supplies	50.56	50.56
			Sales Tax	5.00%	11.96

- 1ST EXHAUST MUFFLER (12.06)
- FUEL AND TANK GUN
- KV TEST (PAINTS)
- COMPRESSION TEST

- POINTS AND P.T.

- FULL RAMP ON RPM'S (NOT 0,000)

Total**\$1,355.00**

- RAN DIST. ON MACHINE? DID YOU GET FULL ADVANCE
DID THE ADVANCE WEIGHTS (CLEANED) DID THEY CRACK THEM

KTR European Motorsports, Inc.**Invoice**

99 Fitchburg Road
Ayer, MA 01432
978-772-7800

Date	Invoice #
11/24/2006	5505

Bill To


12/24/06

Terms	Project
Net 15	1969 Ferrari 365


Item	Serviced	Qty	Description	Rate	Amount
Labor Service	11/15/2006	4.25	Run fuel pump- failed after overheating. Check for power to pump and tap pump to try to get working. Pump out fuel from tank and remove pump and both filters. Test fit fuel pumps to check for fit, plumb inlet and outlet of pumps on bench. Install to car, degrease fuel filter canisters and fit new filters. Install to car and complete plumbing with new fuel line. Fuel system to check pump operation briefly.	75.00	318.75
Labor Service	11/16/2006	2.5	Shrink wrap electrical connections at fuel pumps and safety wire banjo bolts to main fuel filter. Fill tank with fuel and fit pressure gauge to carburetor. Fuel inlet port, run pumps to check operation. Run engine to warm up and check fuel pressure. Remove gauge, fit air box cover and refit fuse box covers. Test drive car and adjust idle speed and mixture.	75.00	187.50
Shop Supplies			Shop Supplies	25.31	25.31
			Sales Tax	5.00%	0.00
Total					\$531.56

KTR European Motorsports, Inc.

99 Fitchburg Road
Ayer, MA 01432
978-772-7800

Invoice

Date	Invoice #
12/21/2006	5587

Bill To


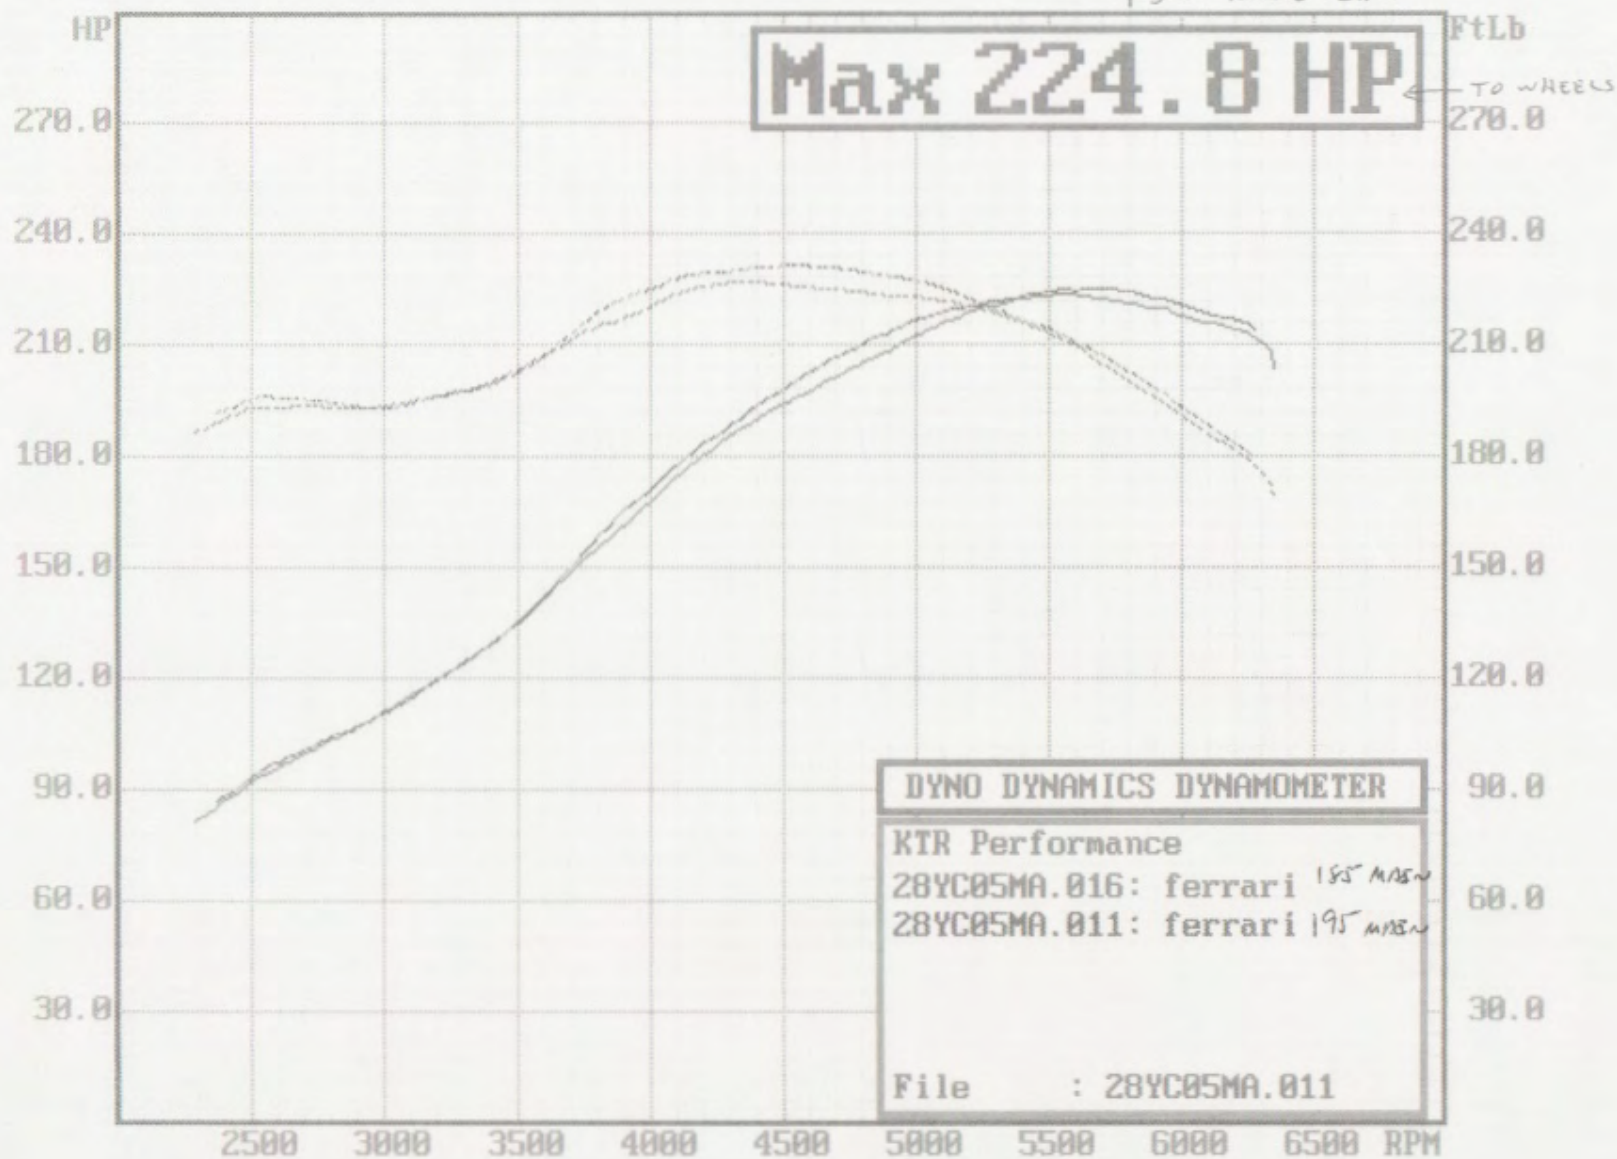
pp. 2/27/07


Terms	Project
Net 15	1969 Ferrari 365


Item	Serviced	Qty	Description	Rate	Amount
Labor Service	12/7/2006	1.75	Do compression test and note spark plug color. Refit plugs and remove header heat shields. Run car to warm up and measure each header pipe, note even temperature.	75.00	131.25
Labor Service	12/8/2006	2	Fit O2 sensor unit to car and warm up engine, test drive and note rich mixture at low end and cruising speed. Lean from midrange on up.	75.00	150.00
Dyno Advanced	12/12/2006	1	Run car on dyno to do base line performance.	110.00	110.00
Labor Service	12/12/2006	3.25	Do one main jet change and one idle jet change. Check spark plugs after power runs.	75.00	243.75
Labor Service	12/13/2006	2.5	Remove car from dyno. Install heat shields and air box assembly. Warm up and test drive car. Adjust idle mixture screws and add fuel.	75.00	187.50
Parts	12/14/2006	6	Jets	12.00	72.00T
Parts	12/14/2006	6	Jets	12.00	72.00T
Miscellaneous - Other	12/14/2006	*****	Fuel	2.559	26.00
Sublet	12/20/2006	1	Run car on dyno	75.00	75.00
Shop Supplies			Shop Supplies	41.12	41.12
			Sales Tax	5.00%	7.20
Total					\$1,115.82


12/15/06

+30% Torque = 292.5



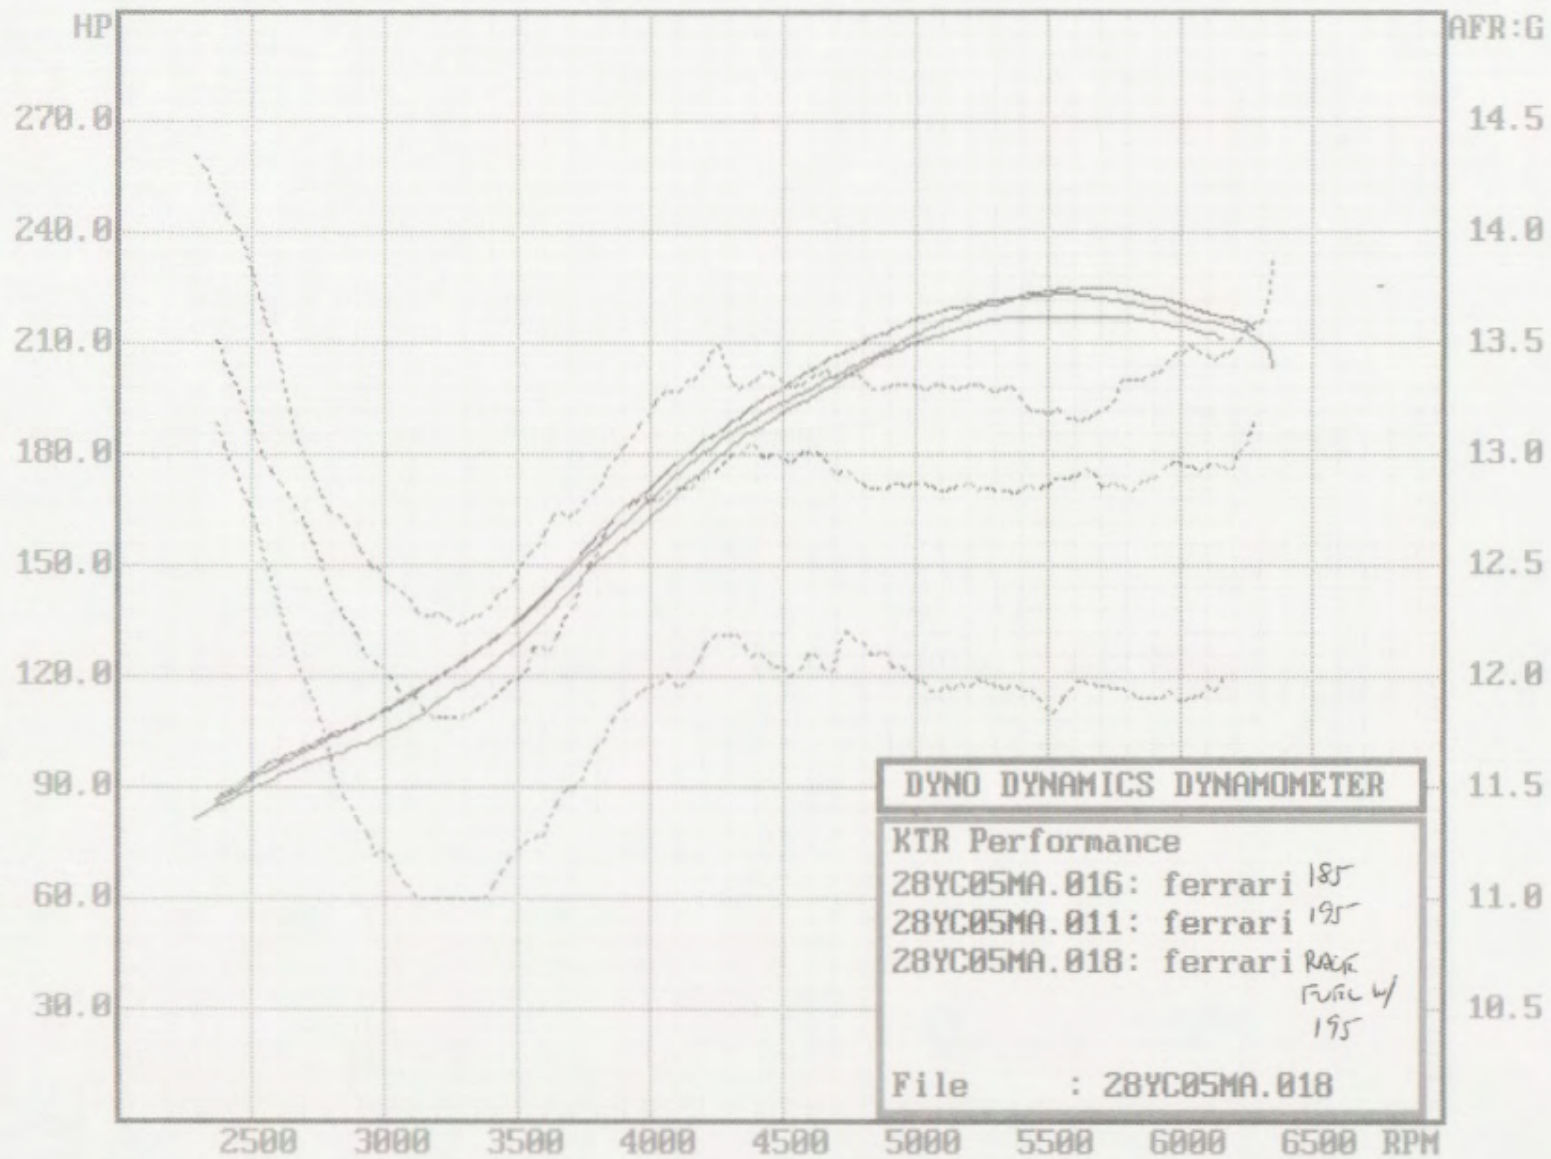

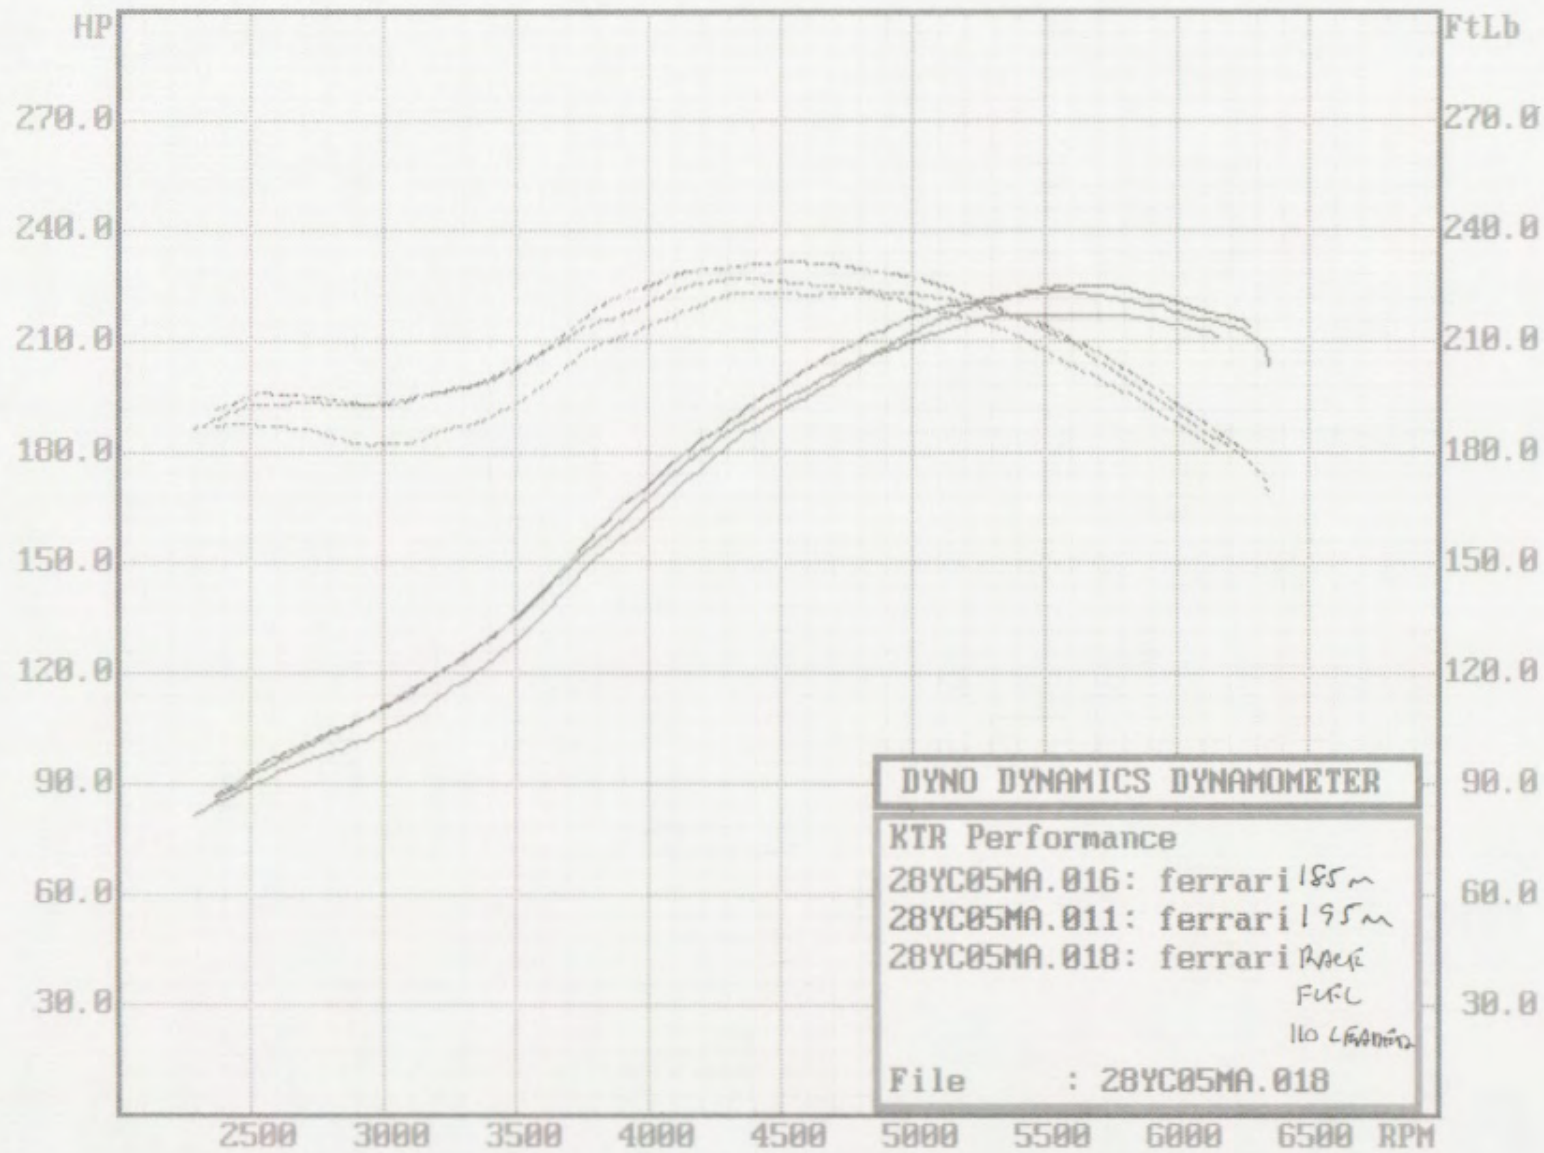

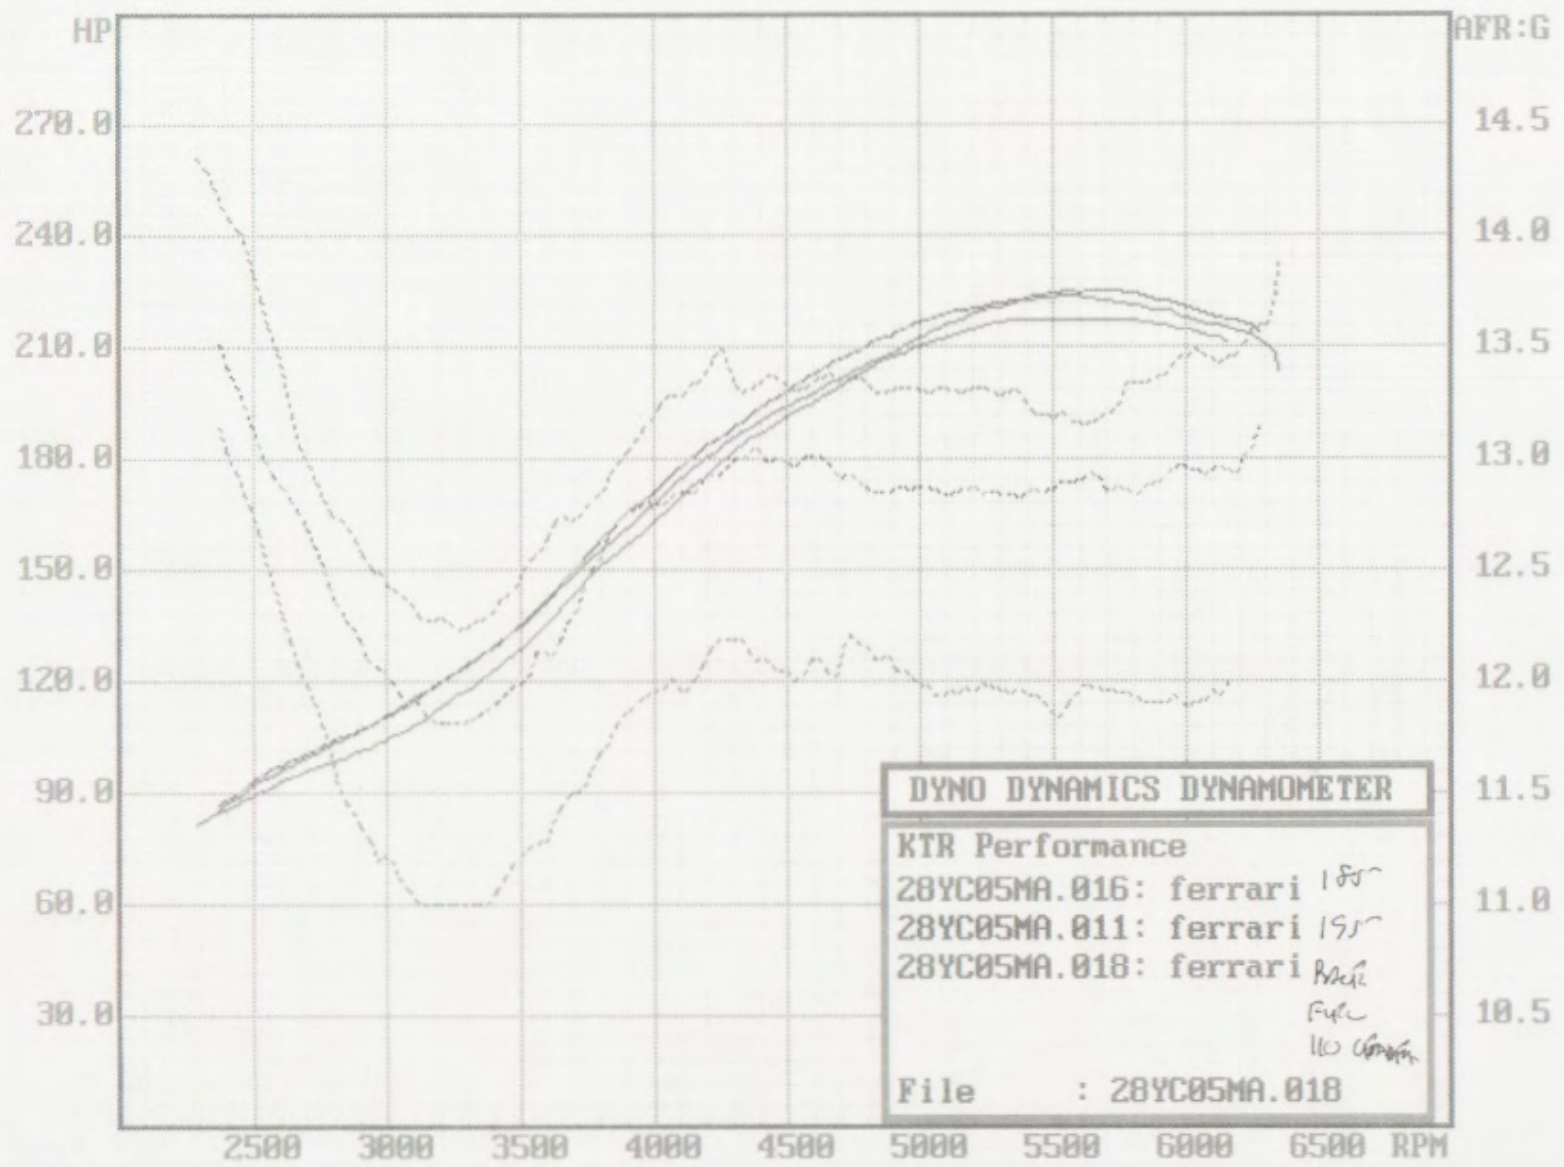

Invoice

Date	Invoice #
9/19/2007	6344

Bill To



9/24/07

Terms	Project
Net 15	1969 Ferrari 365

Item	Serviced	Qty	Description	Rate	Amount
Labor Service	7/25/2007	1.5	Change oil and filters. Check gear box and diff fluid levels. Safety wire plugs. Check belts and hoses. Check coolant.	75.00	112.50
Labor Service	7/25/2007	6	Check rear suspension for noise over bumps. Check tightness on nuts and bolts. Pull rear wheels and check brake calipers, reinstall wheels.	75.00	450.00
Labor Service	7/26/2007	2	Pull left rear wheel off, visually inspect shock. Remove shock and disassemble.	75.00	150.00
Labor Body-Work	7/30/2007	6	Cut out rot and bondo on lower sections of quarter panels. Fabricate patches and bond to panels. Begin to fill and sand repairs.	48.00	288.00
Labor Body-Work	7/31/2007	4	Finish filling and smoothing repairs. Sand out chips. Mask and prime lower rear sections of quarter panels. Apply seam sealer behind patch panels.	48.00	192.00
Labor Body-Work	8/1/2007	4	Sand left and right rear repairs. Set up, mask and paint. Unmask, mount wheels.	48.00	192.00
Labor Body-Work	8/2/2007	1.5	Apply clear guard to quarter panels. Mask and undercoat where needed.	48.00	72.00
Labor Service	8/9/2007	0.5	Assemble new struts/shocks.	75.00	37.50
Labor Service	8/9/2007	2.25	Finish assembling shocks. Install right side on car.	75.00	168.75
Labor Service	8/10/2007	3	Install left side shock assembly	75.00	225.00
Helper/Detail/Delivery	8/14/2007	1	Degrease car.	35.00	35.00
Labor Service	8/15/2007	1	Clean out old gasket from left vent window and urethane in glass.	75.00	75.00
Helper/Detail/Delivery	8/15/2007	1	Wash and clean car.	35.00	35.00
Parts	7/25/2007	12	20W50 oil	5.02	60.24T
Shipping Charges	8/9/2007	1	UPS Shipping- TrueChoice	25.30	25.30
Parts	7/31/2007	0.5	Primer	16.35	8.18T
Sublet	8/9/2007	1	Rebuild shocks	403.32	403.32
Shop Supplies			Shop Supplies	101.64	101.64
			Sales Tax	5.00%	3.42
Total					\$2,634.85

CUSTOMER #: 2838029

16637

Ferrari

OF
NEW ENGLAND

101 WASHINGTON STREET
FOXBORO, MA 02035
617-559-0123
www.ferrari.com

INVOICE

PAGE 1

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	72493/72498	T39	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 16JUN10		139.00	CASH	17JUN10

R.O. OPENED READY OPTIONS:

10:34 16JUN10 18:16 17JUN10

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A							

A PERFORM ANNUAL ENGINE OIL/FILTER SERVICE AND INSPECTION

LOF PERFORM ANNUAL ENGINE OIL/FILTER SERVICE AND INSPECTION

1001 DAVIDANGELONI LIC#: 031403140

C

9 BP20W50 BRAD PENN 20W50 OIL

11.50 125.00 125.00

2 PH2804-1 FRAM OIL FILTER

33.60 11.50 103.50

1 8909107 BRAKE/PARTS CLEANER

4.25 22.34 44.68

1 10257060 WASHER/COPPER D. 16-22X1.5

0.76 3.85 3.85

SS ENGINE OIL LEAKS...SEE NOTES BELOW

1001 DAVIDANGELONI LIC#: 031403140

C

125.00 125.00

PARTS: 152.79 LABOR: 250.00 OTHER: 0.00 TOTAL LINE A: 402.79

72498 PERFORMED ANNUAL OIL SERVICE. FOUND EXTENSIVE OIL LEAKS FROM ENGINE. RETORQUED FRONT COVER, OIL PAN, SUMP PLATE, AND CAM COVERS. MOST BOLTS SIGNIFICANTLY LOOSE. CLEANED RESIDUAL OIL (MONITOR LEAKS IN FUTURE). INSTALLED NEW FILTERS, SAFETY WIRED DRAIN PLUG, REFILLED TO CORRECT LEVEL WITH HIGH ANTI-WEAR ADDITIVE OIL, AND PERFORMED ALL RELATED CHECKS AND ADJUSTMENTS PER SERVICE INCLUDING LUBE CHASSIS. TIRE PRESSURES SET TO 27 PSI FRONT 33 PSI REAR.

B COURTESY INSPECTION OF ALL FLUID LEVELS, WHEEL TORQUE/TIRE PRESSURES AND LIGHTS

CHECK COURTESY INSPECTION OF ALL FLUID LEVELS, WHEEL TORQUE/TIRE PRESSURES AND LIGHTS

1001 DAVIDANGELONI LIC#: 031403140

C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

C REPAIR LH FRONT LIGHT IN BUMPER...CONTACTS NOT SECURE

SS REPAIRED LH FRONT DIRECTIONAL LIGHT...SEE

NOTES BELOW

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

CUSTOMER #: 2838029

16637

Ferrari

OF
NEW ENGLAND

101 WASHINGTON STREET
FOXBORO, MA 02035
617-559-0123
www.ferrariusa.com

INVOICE

PAGE 2

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

RED	69	FERRARI 365 GT 2+2	12939	28YC05	72493/72498	T39	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 16JUN10		139.00	CASH	17JUN10
R.O. OPENED		READY		OPTIONS:			
10:34 16JUN10		18:16 17JUN10					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1001	DAVIDANGELONI	LIC#:	031403140			500.00	500.00
1	LS6232	SOCKET	TERMINAL		4.87	4.87	4.87
PARTS:	4.87	LABOR:	500.00	OTHER:	0.00	TOTAL LINE C:	504.87

72493 PARTIALLY R&R LS FRONT BUMPER. R&R LS DIRECTIONAL HOUSING. DISASSEMBLED LAMP SOCKET. FOUND SOCKET BODY SEPARATING WHEN BULB TURNED TO LOCK AND CONTACT PLATE ROTATING IN SOCKET. REMOVED CONTACT PLATE. TACK WELDED SOCKET BODY DOVETAIL LOCKS TO PREVENT SEPARATION. RESHAPED CONTACT PLATE LOCK TABS FOR MORE POSITIVE ENGAGEMENT. CUT OFF FRAYED WIRE AT TERMINAL ENDS AND RECRIMPED TERMINALS WITH ADDED HEATSHRINK. SEALED BACKSIDE OF SOCKET. INSTALLED NEW CORRECT 18W BULBS AND CHECKED OPERATION-OK. REUSED ORIGINAL GASKET AND ALIGNED LENS WITH BUMPER AS GOOD AS POSSIBLE. NOTE: 1 SCREW MISSING FOR LENS AND SIDE MARKERS INOP (CHECKED BULB-OK WILL NEED FURTHER DIAGNOSIS.)

D	WASH EXTERIOR AND VACUUM						
	CLEAN WASH EXTERIOR AND VACUUM						
99	C					0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE D:	0.00

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusa.
com

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	750.00
PARTS AMOUNT	157.66
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	10.30
TOTAL CHARGES	917.96
LESS INSURANCE	0.00
SALES TAX	10.49
PLEASE PAY THIS AMOUNT	928.45

CUSTOMER COPY

CUSTOMER #: 2838029

18117

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarinne.com

INVOICE

PAGE 1

SERVICE ADVISOR: 1024 JASON SIREEN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	74146/74146	T939	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 29NOV11		139.00	CASH	29NOV11

R.O. OPENED

READY

OPTIONS:

09:35 28NOV11 08:33 29NOV11

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CLIENT STATES WHEN TURN ON LEFT BLINKER IT JUST STAYS ON SOLID LIKE
THERE IS A BULB OUT AND LEFT FRONT BULB DOES NOT WORK

SS REPAIRED DRIVERS FRONT BLINKER OPERATION

1021 NICOLA MAFFEO LIC#: 0

C

1 552 FLASHER RELAY

375.00 375.00

6.98 6.98 6.98

1 1156 BULB

9.54 9.54 9.54

PARTS: 16.52 LABOR: 375.00 OTHER: 0.00 TOTAL LINE A: 391.52

74146 FOUND DRS FRONT BLINKER BULB STUCK IN SOCKET, NECESSARY TO
CLEAN SOCKET AND REPLACE BULB. CHECK FUSE, OK. REMOVED FUSED BOX TO
INSPECT FLASHERS AND CONNECTIONS, CHECK FOR FLASHER OPERATION FOUND
STOCK FLASHER BYPASSED AND AFTER MARKET FLASHER INSTALLED. REPLACED
FLASHER AND INSPECT WIRES / CONNECTIONS AND FOUND ADD ON HARNESS FROM
AFTER MARKET FLASHER TO INSTRUMENT CLUSTER FOR THE DIRECTIONAL. CLEANED
LIGHT SOCKET AND WIRE CONNECTION FOR LEFT BLINKER BULB IN THE
INSTRUMENT CLUSTER AND CLEAN AND SECURED GROUND WIRE. LEFT BLINKER NOW
WORKS. TEST WIRE HARNESS AND CONNECTIONS BY MOVING ALL WIRES AND WIGGLE
CONNECTIONS AND BLINKER STILL WORKS AT THIS TIME. REASSEMBLE DRS FRONT
LENS WITH ORIGINAL GASKET. NOTE ONE SCREW MISSING FOR LENS.

B COURTESY INSPECTION OF ALL FLUID LEVELS, WHEEL TORQUE/TIRE PRESSURES
AND LIGHTS

CHECK COURTESY INSPECTION OF ALL FLUID LEVELS,

WHEEL TORQUE/TIRE PRESSURES AND LIGHTS

1021 NICOLA MAFFEO LIC#: 0

C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

C WASH EXTERIOR AND VACUUM

CLEAN WASH EXTERIOR AND VACUUM

99 C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00

THANK YOU**EXCLUSIONS OF WARRANTIES**

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

CUSTOMER #: 2838029

18117

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarine.com

INVOICE

PAGE 2

SERVICE ADVISOR: 1024 JASON SIREEN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	74146/74146	T939	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 29NOV11		139.00	CASH	29NOV11

S.O. OPENED READY OPTIONS:

09:35 28NOV11 08:33 29NOV11

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
for all your service needs contact the							
ferrari experts at 617-559-0123 or e mail							
the service dept at f6305srv@ferrariusi.							
com							



THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	375.00
PARTS AMOUNT	16.52
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	391.52
LESS INSURANCE	0.00
SALES TAX	1.03
PLEASE PAY THIS AMOUNT	392.55

CUSTOMER COPY

CUSTOMER #: 2838029

18908

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarinne.com

INVOICE

PAGE 1

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	74690/74694	T2939	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DE			19:00 29AUG12		139.00	CASH	28SEP12
R.O. OPENED	READY	OPTIONS:					

08:38 22AUG12 08:56 28SEP12

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CLIENT STATES TOW TO SHOP; CLUTCH PEDAL WENT TO FLOOR

CAUSE: BROKEN CLUTCH PEDAL RETURN SPRING

SS REPLACED CLUTCH PEDAL RETURN SPRING

1026 FERNANDES, TONY LIC#: 0

C

1 660346 PEDAL SPRING

139.00 139.00

95.00 56.73 56.73

PARTS: 56.73 LABOR: 139.00 OTHER: 0.00 TOTAL LINE A: 195.73

74690 BROKEN CLUTCH PEDAL RETURN SPRING DIAGNOSED COMPLAINT-FOUND

BROKEN RETURN SPRING-REPLACED RETURN SPRING-TESTED CLUTCH PEDAL-PEDAL

WAS VERY LOW AND CHECKED ADJUSTMENT-CABLE WAS AT END OF

ADJUSTMENT-ADVISE REPLACE CLUTCH CABLE-TEST DROVE-CLUTCH DOESNT FULLY

DISENGAGE DUE TO STRECHED CABLE SO REVERSE GRINDS GOING INTO GEAR

B COURTESY INSPECTION OF ALL FLUID LEVELS, WHEEL TORQUE/TIRE PRESSURES

AND LIGHTS

CHECK COURTESY INSPECTION OF ALL FLUID LEVELS,

WHEEL TORQUE/TIRE PRESSURES AND LIGHTS

1026 FERNANDES, TONY LIC#: 0

C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE B: 0.00

C WASH EXTERIOR AND VACUUM

CLEAN WASH EXTERIOR AND VACUUM

99 C

0.00 0.00

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE C: 0.00

D** CLIENT STATES REPLACE POWER STEERING SEALS PER ESTIMATE

CAUSE: INTERNAL LEAK FROM POWER STEERING SIDE OF BOX INTO MECHANICAL

SIDE CAUSING LEAK

SS REMOVED STEERING BOX SEALS FOR MEASURE RECORDS

AND CLIENT WILL RETURN ONCE SEALS ARE

OBTAINED

1027 C

0.00 0.00

6 8909107 BRAKE/PARTS CLEANER-55 GALLON DRUM 4.25 4.25 25.50

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

CUSTOMER #: 2838029

18908

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarine.com

INVOICE

PAGE 2

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
RED	69	FERRARI 365 GT 2+2		12939	28YC05	74690/74694		T2939
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
01JAN69 DE			19:00 29AUG12		139.00	CASH	28SEP12	
R.O. OPENED		READY	OPTIONS:					

08:38 22AUG12 08:56 28SEP12

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
5	100015	O	RING D. 11,11X (MAR)		5.50	5.50	27.50
4	103039	O	RING D. 7,66X		2.36	2.36	9.44
1	136140	O	RING		5.76	5.76	5.76
2	104613	P/S	BOX OUTER SEALS		9.99	9.99	19.98
1	740557K	ZF	SEALS FOR BOX		38.25	38.25	38.25
2	RG17	PBR	RUBBER GREASE		8.99	8.99	17.98
1	14461381	GASKET D. 101.27X2			14.68	14.68	14.68
2	10257060	WASHER/COPPER D. 16-22X1.5			0.79	0.79	1.58
2	10280060	WASHER/COPPER D. 14-20X1.5			1.02	1.02	2.04
PARTS:	162.71	LABOR:	0.00	OTHER:	0.00	TOTAL LINE D:	162.71

74690 INTERNAL LEAK FROM POWER STEERING SIDE OF BOX INTO MECHANICAL SIDE CAUSING LEAK REMOVED BOX FROM VEHICLE TORE BOX DOWN, CLEANED AND PROCEEDED TO LOCATE SEALS NEEDED-AFTER MANY CALLS FOUND SEALS HAD TO BE REPRODUCED-REASSEMBLED BOX USING OLD SEALS AS CLIENT REQUESTED-REINSTALLED BOX BUT LEFT POWER STEERING BELTS DISCONNECTED DUE TO LEAKAGE THAT WOULD OCCUR-TEST DROVE-FOUND MULTIPLE MULTIPLE DRIVABILITY ISSUES DURING DRIVE-STEERING BOX IS NOW A MANUAL BOX AND IS HARDER TO TURN THAN WITH POWER STEERING

E** CLIENT STATES R4PLACE DR'S SIDE CV BOOT KIT PER ESTIMATE

CAUSE: CLAMPS NONEXISTANT ON BOOT

SS REPLACED CV BOOT AND CLAMPS ON DRS SIDE AXLE

1027	C				375.00	375.00	
1	95860404K	CV BOOT KIT			24.95	24.95	24.95
2	8909107	BRAKE/PARTS CLEANER-55 GALLON DRUM			4.25	4.25	8.50
PARTS:	33.45	LABOR:	375.00	OTHER:	0.00	TOTAL LINE E:	408.45

74690 CLAMPS NONEXISTANT ON BOOT REMOVED DR SIDE CV AXLE-REBUILT AXLE WITH NEW BOOT AND CLAMPS-REINSTALLED AXLE

F** CLIENT STATES REMOVE ZIP TIES, INSTALL CLAMPS PER ESTIMATE

SS REPLACE ZIP TIES WITH PROPER CLAMPS

1027	C				125.00	125.00	
1	15327510	CV BOOT CLAMP 8MMX14			8.99	8.99	8.99
1	15327520	CV BOOT CLAMP 8MM X 20			12.99	12.99	12.99

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

CUSTOMER #: 2838029

18908

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarinna.com

INVOICE

PAGE 3

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/OUT		TAG
RED	69	FERRARI 365 GT 2+2		12939	28YC05	74690/74694		T2939
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DE			19:00 29AUG12			139.00	CASH	28SEP12

08:38 22AUG12 08:56 28SEP12

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
PARTS:	21.98	LABOR:	125.00	OTHER:	0.00	TOTAL LINE F:	146.98
74690 REMOVED ZIP TIES AND INSTALLED METAL CLAMPS IN PLACE							

G** CLIENT STATES REPLACE SPARK PLUGS PER ESTIMATE

SS REPLACED SPARK PLUGS

1027 C

250.00 250.00

12	BP6ES	NGK	SPARK PLUGS-330	3.75	3.75	45.00	
PARTS:	45.00	LABOR:	250.00	OTHER:	0.00	TOTAL LINE G:	295.00
74690 REMOVED AND REPLACED SPARK PLUGS AFTER GAPING THEM TO SPEC-FOUND CARBORATION ISSUES AFTER LOOKING AT OLD SPARK PLUGS							

H** PERFORM ANNUAL ENGINE OIL/FILTER SERVICE AND INSPECTION

LOF PERFORM ANNUAL ENGINE OIL/FILTER SERVICE AND INSPECTION

1027 C

125.00 125.00

2	10257060	WASHER/COPPER D.	16-22X1.5	0.79	0.79	1.58	
14	6147	CASTROL	20W50 1QT	9.78	7.95	111.30	
2	8909107	BRAKE/PARTS	CLEANER-55 GALLON DRUM	4.25	4.25	8.50	
2	191993K	OIL FILTER		49.99	39.93	79.86	
PARTS:	201.24	LABOR:	125.00	OTHER:	0.00	TOTAL LINE H:	326.24
74690 PERFORMED ANNUAL ENGINE OIL/FILTER SERVICE							

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusa.
com

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	1014.00
PARTS AMOUNT	521.11
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	23.31
TOTAL CHARGES	1558.42
LESS INSURANCE	0.00
SALES TAX	34.03
PLEASE PAY THIS AMOUNT	1592.45

CUSTOMER COPY

CUSTOMER #: 2838029

19058

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarine.com

INVOICE

PAGE 1

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	74694/74694	T1017	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 05OCT12		139.00	CASH	08OCT12

10:16 05OCT12 12:50 08OCT12

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A REPLACE CLUTCH CABLE PER CLIENTS REQUEST

SS REPLACED CLUTCH CABLE AND ADJUSTED CABLE AND

LINKAGE

1026 FERNANDES, TONY LIC#: 0

C

1 500573 365 CLUTCH CABLE

PARTS: 224.75 LABOR: 250.00 OTHER: 0.00 TOTAL LINE A: 474.75

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusu.
com



(\$2100)

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	250.00
PARTS AMOUNT	224.75
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	474.75
LESS INSURANCE	0.00
SALES TAX	14.05
PLEASE PAY THIS AMOUNT	488.80

CUSTOMER COPY

[REDACTED]

From: Sean McGuire <smcguire@ferrarine.com>
Sent: Friday, October 26, 2012 2:12 PM
To: [REDACTED]
Subject: Greetings from Maserati/Ferrari service

[REDACTED]

Michael is out of town but checking his e-mail and asked me to drop you a line. The pricing below is before he applies any discounting

CLUTCH KIT	\$ 999.00
REAR MAIN SEAL	\$ 78.12
S/R BEARING BALL	\$19.60
Labor	\$2502

Total before tax/supplies \$3598.72

\$ 2,948 - PANTS

Ryan said tho' the power steering seals are being made, they're still a few weeks out

Regards,
Sean in service

1850 - FLY WINDMILL

5,448

Sean McGuire
Service Consultant

Ferrari -Maserati of New England
441 Providence Hwy
Norwood, MA 02062
781-619-6970
www.ferrarine.com



[REDACTED]

From: Michael Shalhoub <mshalhoub@ferrarine.com>
Sent: Friday, November 23, 2012 8:02 AM
To: [REDACTED]
Cc: [REDACTED]
Subject: 365

Good morning [REDACTED]

I have the paperwork ready for you. The original retail on this job was over \$6200.00 and after I adjusted the entire job I have it down to \$4953.90. I did not charge you at all for the tow, I cover that fully and basically marked everything down as much as possible. The flywheel not only cost another \$1850.00 but we also had to send it out to be stamped with timing marks at a machine shop, that was \$300.00 dollars. That is another factor with vintage parts, they are not always available for immediate installation.

I have both invoices so you can see the difference if you wish, otherwise you can come today or next week.

Have a great day,

Michael Shalhoub
Service and Parts Director

Ferrari -Maserati of New England
441 Providence Hwy
Norwood, MA 02062
781-619-6956
www.ferrarine.com



MUTUALLY ACCORDABLE

SOLUTION

- (1) ^{INSTALL} PURCHASE AN A NEW BUX YW REFERENCED
- (2) \$3200 IN PARTS
- (3)

CUSTOMER #: 2838029

19064

Ferrari
OFNEW ENGLAND
441 BOSTON PROVIDENCE TURNPIKE
NORWOOD, MA 02062
781-769-8800DIRECT SERVICE LINE: 781-619-6979
SERVICE FAX: 781-619-6954
www.ferrarine.com

INVOICE

PAGE 1

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	74715/74720	T2939	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 08OCT12		139.00	CASH	21NOV12
R.O. OPENED		READY	OPTIONS:				
16:28 08OCT12		10:49 21NOV12					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CLIENT STATES TOW TO SHOP DUE TO CLUTCH INOP
SS REPLACED CLUTCH ASSEMBLY WITH FLYWHEEL.
FLYWHEEL WAS CRACKED AND HEAT STAMPED
1026 FERNANDES, TONY LIC#: 0

1	99101615K	275-365-412	CLUTCH KIT	1158.84	2502.00	2502.00
1	138391	REAR MAIN SEAL		78.12	78.12	78.12
1	101297	S/R BEARING BALL ALN15		19.60	19.60	19.60
1	12600R	365 GT 2+2	FLYWHEEL	1850.00	1850.00	1850.00

SUBL TOW TO SHOP PO#16583

C					167.00	167.00
---	--	--	--	--	--------	--------

SUBL STAMP FLYWHEEL PO#16675

C					384.00	384.00
---	--	--	--	--	--------	--------

PARTS: 2946.72 LABOR: 2502.00 OTHER: 551.00 TOTAL LINE A: 5999.72

74715

R&R GEAR/BOX INSPECT CLUTCH.FOUND FAULTY CLUTCH PRESSURE PLATE AND
CLUTCH

RELEASE BEARING.REPLACED CLUTCH KIT REAR MAIN OIL SEAL PILOT

BEARING AND

ENGINE FLYWHEEL.PERFORMED CLUTCH ADJUSTMENT AND LUBE CLUTCH PEDAL

LINKAGE

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariususa.
com

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	2502.00
PARTS AMOUNT	2946.72
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	551.00
MISC. CHARGES	49.31
TOTAL CHARGES	6049.03
LESS INSURANCE	0.00
SALES TAX	187.25
PLEASE PAY THIS AMOUNT	6236.28

CUSTOMER COPY

CUSTOMER #: 2838029

19064

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-789-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarine.com

INVOICE

DUPLICATE 1

PAGE 1

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	74715/74720	T2939	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 08OCT12		139.00	CASH	21NOV12

R.O. OPENED	READY	OPTIONS:
16:28 08OCT12	10:57 21NOV12	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CLIENT STATES TOW TO SHOP DUE TO CLUTCH INOP
 SS REPLACED CLUTCH ASSEMBLY WITH FLYWHEEL.
 FLYWHEEL WAS CRACKED AND HEAT STAMPED
 1026 FERNANDES, TONY LIC#: 0

	C					1800.00	1800.00
1	99101615K	275-365-412	CLUTCH KIT		1158.84	864.50	864.50
1	138391	REAR MAIN SEAL			78.12	78.12	78.12
1	101297	S/R BEARING BALL ALN15			19.60	19.60	19.60
1	12600R	365 GT 2+2 FLYWHEEL			1850.00	1723.80	1723.80

SUBL TOW TO SHOP PO#16583

ISP

SUBL STAMP FLYWHEEL PO#16675

C

PARTS: 2686.02 LABOR: 1800.00 OTHER: 300.00 TOTAL LINE A: 4786.02

74715

R&R GEAR/BOX INSPECT CLUTCH.FOUND FAULTY CLUTCH PRESSURE PLATE AND
 CLUTCH
 RELEASE BEARING.REPLACED CLUTCH KIT REAR MAIN OIL SEAL PILOT
 BEARING AND
 ENGINE FLYWHEEL.PERFORMED CLUTCH ADJUSTMENT AND LUBE CLUTCH PEDAL
 LINKAGE

for all your service needs contact the
 ferrari experts at 617-559-0123 or e mail
 the service dept at f6305srv@ferrariusi.com

THANK YOU**EXCLUSIONS OF WARRANTIES**

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased, and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	1800.00
PARTS AMOUNT	2686.02
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	300.00
MISC. CHARGES	0.00
TOTAL CHARGES	4786.02
LESS INSURANCE	0.00
SALES TAX	167.88
PLEASE PAY THIS AMOUNT	4953.90

CUSTOMER COPY

CUSTOMER #: 2838029

19064

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarine.com

INVOICE

DUPLICATE 2

PAGE 1

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/ OUT		TAG
RED	69	FERRARI 365 GT 2+2		12939	28YC05	74715/74720		T2939
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
01JAN69 DE			17:00 08OCT12		139.00	CASH	29NOV12	

16:28 08OCT12 08:51 29NOV12

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CLIENT STATES TOW TO SHOP DUE TO CLUTCH INOP

SS REPLACED CLUTCH ASSEMBLY WITH FLYWHEEL.

FLYWHEEL WAS CRACKED AND HEAT STAPMED

1026 FERNANDES, TONY LIC#: 0

C

1 99101615K 275-365-412 CLUTCH KIT

1300.00 1300.00

1 138391 REAR MAIN SEAL

1158.84 715.00 715.00

1 101297 S/R BEARING BALL ALN15

78.12 66.00 66.00

1 12600R 365 GT 2+2 FLYWHEEL

19.60 16.50 16.50

SS GOODWILL ADJUSTMENT

1850.00 1459.70 1459.70

1026 FERNANDES, TONY LIC#: 0

ISP

(N/C)

SUHL TOW TO SHOP PO#16583

ISP

(N/C)

SUHL STAMP FLYWHEEL PO#16675

C

300.00 300.00

PARTS: 2257.20 LABOR: 1300.00 OTHER: 300.00 TOTAL LINE A: 3857.20

74715

R&R GEAR/BOX INSPECT CLUTCH FOUND FAULTY CLUTCH PRESSURE PLATE AND CLUTCH

RELEASE BEARING REPLACED CLUTCH KIT REAR MAIN OIL SEAL PILOT BEARING AND

ENGINE FLYWHEEL PERFORMED CLUTCH ADJUSTMENT AND LUBE CLUTCH PEDAL LINKAGE

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusa.
com

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	1300.00
PARTS AMOUNT	2257.20
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	300.00
MISC. CHARGES	1.62
TOTAL CHARGES	3858.82
LESS INSURANCE	0.00
SALES TAX	141.18
PLEASE PAY THIS AMOUNT	4000.00

CUSTOMER COPY

CUSTOMER #: 2838029

19211

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarinema.com

INVOICE

PAGE 1

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	74720/74728	T12939	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 30NOV12		139.00	CASH	05DEC12

R.O. OPENED: READY: OPTIONS:

15:23 30NOV12 15:35 05DEC12

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A INSTALL ORDERED STEERING BOX

SS REPLACED STEERING BOX GOODWILL DUE TO WE

DISASSEMBLED BOX TO REPLACE SEALS AND SEALS

WERE NO LONGER AVAILABLE

1027 ISP

(N/C)

1027 IPP

(N/C)

2 100516 365 P/S BELT

ISP

(N/C)

IPP

(N/C)

1 95740004 365 GT 2+2 POWER STEERING BOX

ISP

(N/C)

IPP

(N/C)

PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE A: 0.00

74728 R&R STEERING BOX-BLEED POWER STEERING SYSTEM-PERFORM FRONT

END ALIGNMENT

SPLIT FOR REPAIR ORDER 50/50 LABOR AND PARTS

GOODWILL PER GM

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariusa.
com

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	0.00
PARTS AMOUNT	0.00
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	0.00
LESS INSURANCE	0.00
SALES TAX	0.00
PLEASE PAY THIS AMOUNT	0.00

CUSTOMER COPY

CUSTOMER #: 2838029

19761

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE
NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarine.com

INVOICE

PAGE 1

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL	VIN		LICENSE	MILEAGE IN/ OUT		TAG
RED	69	FERRARI 365 GT 2+2	12939		28YC05	74962/75038		T939
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE	
01JAN69 DD			17:00 04JUN13		139.00	CASH	24SEP13	
R.O. OPENED		READY	OPTIONS:					
13:00 04JUN13		10:22 24SEP13						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL	

A CLIENT STATES RIGHT AND LEFT BLINKERS ARE INOP
SS REPAIRED SHORT CIRCUIT FOR TURN SIGNALS AND
RADIO

1026 FERNANDES, TONY LIC#: 0

C

1 552 FLASHER THERMAL

PARTS:	9.99	LABOR:	353.77	OTHER:	0.00	TOTAL LINE A:	363.76
--------	------	--------	--------	--------	------	---------------	--------

74962 DIAGNOSE ELECTRICAL PROBLEM FOUND WIRE FOR AFTER MARKET RADIO
SHORTED IN THE FUSE BOX CAUSING SHORT CIRCUIT AT THE TURN SIGNALS AND
RADIO. OFLASHER RELAY FOR TURN SIGNALS SHORTED AS A RESULT. REPAIRED
SHORTED WIRES AND REPLACED BLOWN RELAY AND FUNCTION TEST, NO BLINKERS
AND RADIO OK.

B CLIENT STATES RADIO AND OR CD WILL CUT OUT WHILE DRIVING...SEEMS TO
HAVE STARTED SAME TIME AS BLINKER PROBLEM

SS SEE STORY ON LINE A

1026 FERNANDES, TONY LIC#: 0

C

PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE B:	0.00
--------	------	--------	------	--------	------	---------------	------

C CLIENT STATES ONCE VEHICLE IS HOT IT IS HARD TO GET SHIFT INTO 2ND
GEAR AND REVERSE

SS SEE LINE D FOR REPAIR

1026 FERNANDES, TONY LIC#: 0

C

PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE C:	0.00
--------	------	--------	------	--------	------	---------------	------

D CLEINT STATES ONCE VEHICLE IS HOT AND WHEN DEPRESS CLUTCH PEDAL IT
BECOMES HARD FOR THE LAST 25% OF TRAVEL

SS OVERHAUL PDEAL ASSEMBLY, SEE NOTES FOR DETAILS

1026 FERNANDES, TONY LIC#: 0

C

						1596.23	1596.23
3 PAP1825P10 BUSHING FOR PEDAL SHAFT-365 GT							
2+2						9.99	9.99
							29.97

THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

CUSTOMER #: 2838029

19761

Ferrari
OFNEW ENGLAND
441 BOSTON PROVIDENCE TURNPIKE
NORWOOD, MA 02062
781-769-8800
DIRECT SERVICE LINE: 781-619-6979
SERVICE FAX: 781-619-6954
www.ferrarine.com

INVOICE

PAGE 2

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	74962/75038	T939	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DE			17:00 04JUN13		139.00	CASH	24SEP13

R.O. OPENED	READY	OPTIONS:
13:00 04JUN13	10:22 24SEP13	

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
2	101305	SPRING			17.51	17.51	35.02
1	112466	GUIDING BUSHING (MAR)			51.78	51.78	51.78
1	660410	PEDAL BOX GASKET-365 GT 2+2			65.99	65.99	65.99
4	8909107	BRAKE/PARTS CLEANER-55 GALLON DRUM			4.25	4.25	17.00

SUBL OVERHAUL PEDAL ASSEMBLY PO#17501

C 435.00 435.00
 PARTS: 199.76 LABOR: 1596.23 OTHER: 435.00 TOTAL LINE D: 2230.99

74962 ROAD TEST AND INSPECT CLUTCH OPERATION FOUND CLUTCH PEDAL HARD TO PUSH / BINDING AT THE LAST 25% OF TRAVEL ONCE VEHICLE IS HOT. ALSO FOUND WHEN LETTING UP ON CLUTCH PEDAL MOVEMENT WOULD CHATTER ON THE WAY UP. RECHECK ADJUSTMENT, DISCONNECT CLUTCH CABLE FROM THE PEDAL SIDE AND FUNCTION CLUTCH ASSEMBLY MANUALLY AS WELL AS INSPECT PRESSURE PLATE TENSION DURING THROW, FOUND TO BE SMOOTH IN THAT TEST. RECONNECT CABLE TO INSPECT PEDAL ASSEMBLY SIDE AND FOUND MOVEMENT / INTERFERENCE IN THE PEDAL ASSEMBLY SHAFT. REMOVE PEDAL BOX ASSEMBLY AND DISASSEMBLE FOR OVERHAUL. SENT UNIT TO MACHINE SHOP FOR BEARING REPLACEMENT AND LINE HONE FITMENT. NECESSARY TO FABRICATE NEW END BUSHING AS IT WAS NO LONGER AVAILABLE. REASSEMBLE PEDAL UNIT AND REINSTALL. MAKE MULTIPLE ADJUSTMENTS AND TESTS TO SET CABLE AND CLUTCH ADJUSTMENT. NOW DURING MULTIPLE ROAD TESTS WITH TECH AND SERVICE DIRECTOR CLUTCH PEDAL MOVES SMOOTH DOWN TO FLOOR AND BACK UP AND ALL GEARS SHIFT WELL.

E CLEINT STATES ON SOME OCCASIONS ONCE CAR IS HOT AND HARD SHIFTING IS OCCURRING HE COULD SMELL CLUTCH TYPE SMELL
 SS SEE LINE D FOR REPAIR

1026 FERNANDES, TONY LIC#: 0

C 0.00 0.00
 PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE E: 0.00

F COURTESY INSPECTION OF ALL FLUID LEVELS, WHEEL TORQUE/TIRE PRESSURES AND LIGHTS

CHECK COURTESY INSPECTION OF ALL FLUID LEVELS,
 WHEEL TORQUE/TIRE PRESSURES AND LIGHTS

1026 FERNANDES, TONY LIC#: 0

THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

CUSTOMER COPY

CUSTOMER #: 2838029

19761

Ferrari
OFNEW ENGLAND
441 BOSTON PROVIDENCE TURNPIKE
NORWOOD, MA 02062
781-769-8800
DIRECT SERVICE LINE: 781-619-6979
SERVICE FAX: 781-619-6954
www.ferrarine.com

INVOICE

PAGE 3

SERVICE ADVISOR: 5449 SEAN MCGUIRE

COLOR	YEAR	MAKE/MODEL		VIN	LICENSE	MILEAGE IN/OUT		TAG
RED	69	FERRARI 365 GT 2+2		12939	28YC05	74962/75038		T939
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED		PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 04JUN13			139.00	CASH	24SEP13

R.O. OPENED	READY	OPTIONS:					
13:00 04JUN13	10:22 24SEP13						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL

C
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE F: 0.00

G WASH EXTERIOR AND VACUUM

CLEAN WASH EXTERIOR AND VACUUM

1026 FERNANDES, TONY LIC#: 0

C
PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE G: 0.00

for all your service needs contact the
ferrari experts at 617-559-0123 or e mail
the service dept at f6305srv@ferrariususa.
com



THANK YOU

EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	1950.00
PARTS AMOUNT	209.75
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	435.00
MISC. CHARGES	49.31
TOTAL CHARGES	2644.06
LESS INSURANCE	0.00
SALES TAX	16.19
PLEASE PAY THIS AMOUNT	2660.25

CUSTOMER COPY

CUSTOMER #: 2838029

23101

Ferrari

OF

NEW ENGLAND

441 BOSTON PROVIDENCE TURNPIKE

NORWOOD, MA 02062

781-769-8800

DIRECT SERVICE LINE: 781-619-6979

SERVICE FAX: 781-619-6954

www.ferrarine.com

INVOICE

DUPLICATE 1

PAGE 1

SERVICE ADVISOR: 8250 MICHELLE PETRARCA

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
RED	69	FERRARI 365 GT 2+2	12939	28YC05	76599/76599	T939	
DEL DATE	PROD DATE	WARR EXP	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN69 DD			17:00 29AUG16		149.00	CASH	03SEP16
R.O. OPENED	READY	OPTIONS:					

15:34 29AUG16 12:26 03SEP16

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A	PERFORM ANNUAL ENGINE OIL/FILTER SERVICE AND INSPECTION						
	LOF PERFORM ANNUAL ENGINE OIL/FILTER SERVICE AND						
	INSPECTION						

8196 ADAO, PEDRO LIC#: 0

	C					125.00	125.00
12	SINT-2000 AGIP OIL 10W-40-1LTR.				9.95	9.95	119.40
2	191993 OIL FILTER				24.71	24.71	49.42
1	8909107 BRAKE/PARTS CLEANER-55 GALLON DRUM				4.25	4.25	4.25
1	10257060 WASHER/COPPER D 16-22X1.5				1.82	1.82	1.82
PARTS:	174.89	LABOR:	125.00	OTHER:	0.00	TOTAL LINE A:	299.89

76599 PERFORM ANNUAL OIL SERVICE. FOUND BIGGEST ENGINE OIL LEAK
 COMING FROM FRONT ENGINE COVER BUT VALVE COVERS, REAR MAIN SEAL ARE
 LEAKING AS WELL. SUSPENSION BUSHINGS ARE WORN OUT AND LEAKING GREASE.
 REAR TIRES ARE WEARING ON INNER EDGES NEED REPLACEMENT SOON. CHECKED
 ALL OTHER FLUID LEVELS, LIGHTS, AND TIRE PRESSURES.

 B COURTESY INSPECTION OF ALL FLUID LEVELS, WHEEL TORQUE/TIRE PRESSURES
 AND LIGHTS

CHECK COURTESY INSPECTION OF ALL FLUID LEVELS,
 WHEEL TORQUE/TIRE PRESSURES AND LIGHTS

8196 ADAO, PEDRO LIC#: 0

	C					0.00	0.00
6	SINT-2000 AGIP OIL 10W-40-1LTR.				9.95	9.95	59.70
PARTS:	59.70	LABOR:	0.00	OTHER:	0.00	TOTAL LINE B:	59.70

C WASH EXTERIOR AND VACUUM
 CLEAN WASH EXTERIOR AND VACUUM

	99	C				0.00	0.00
PARTS:	0.00	LABOR:	0.00	OTHER:	0.00	TOTAL LINE C:	0.00

 for all your service needs contact the
 ferrari experts at 617-559-0123 or e mail
 the service dept at f6305srv@ferrariusa.
 com

THANK YOU**EXCLUSIONS OF WARRANTIES**

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agrees that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	125.00
PARTS AMOUNT	234.59
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	6.25
TOTAL CHARGES	365.84
LESS INSURANCE	0.00
SALES TAX	15.05
PLEASE PAY THIS AMOUNT	380.89

CUSTOMER COPY

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452
www.astonmartin-lotus.com
Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959
Service x-223, Parts x-226
Fax 781-547-5960

Invoice # 57694

1969 Ferrari 365 GT

VIN: 12939

Engine: V12 4.4L, 4390cc, Gas, Ca

Trans:

License # 28YC05

ODO In: 76653 Out: 76655

Color: Red

Mfg. Date:

Unit # 12939

Inv Date: 6/27/2017

Promised: 6/27/2017 @ 6:00pm

Service Writer: Steve Oldford

Status: Posted

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
Client requests: Check Over Vehicle, Road Test and Evaluation					699.43
Labor Service - Performed visual inspection of vehicle systems for safety, and reliability (see list). Checked for causes of significant oil leak at front of engine. Found majority of oil leak most likely from LS oil filter (loose). Cam covers exhibit typical leaks (RS worse). Unable to distinguish specific leaks at front of engine due to amount of oil present. Replaced oil filters and cleaned residual oil from engine with brake clean and targeted pressure washing. Replaced O-ring on engine oil dipstick. Fabricated and replaced melted and degraded Negative battery cable (non original ends used. Can source original style cable ends in future). Monitor oil leaks and reschedule for Cam covers and further repairs.					594.50
Note: Rear tires significantly worn on edges. DA					
New	PH2804-1	Fram oil filter	2.00	27.90	55.80
New	2GAUGE	Battery Cable, Black (PHI 3-506), CS2L - 2GA (ft)	2.00	8.40	16.80
New	510.20106	1-2ga Post Type Straight Neg battery terminal	1.00	10.34	10.34
New	510.10256	2GA Lug, 5/16" HD	1.00	12.39	12.39
New	510.9803	Solder Slug, Pink 1GA	2.00	4.80	9.60

Technician Certifications:

• DA David Angeloni

Warranty

All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.
Manufacturer's vehicle Warranty expires/expired on _____. There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X

Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's

Posted 6/27/17 2:32PM

AMEX

724.94

AUTH: :525401 xx7005

Invoice Summary

Parts	104.93
Labor	594.50
Supply/Haz Wast	17.84

Sub Total	717.27
Sales Tax (DEF)	7.67

General inspection

1969 365 GT 2+2

6-27-2017

76653 Miles

Ignition wires – oil soaked and age?

Coolant hoses from rear block Y to heater cores cracking. LS worse and kinked under fender.

✓ Oil leaking onto alternator belts and exhaust. Replaced loose LS oil filter.

✓ Negative battery cable clamp loose and corroded. Replaced cable with functional equivalent terminals.

Cam cover gaskets leaking

Oil pressure gauge hose – age? OK now - monitor.

✗ Rear tires worn on outer edges – appears to have run on low pressure for extended periods. Need to be replaced.

Slight play in LF wheel bearing.

Wiring and routing at electric cooling fans sloppy.

✓ Autoflux wiring operation? Electric pump seems to run regardless of switch position -OK now - may have been rewired with pump replacement.

LS motor mount sagging

Lower coolant hose oil soaked.

Front coolant tank overflow hose missing.

Stant style coolant cap installed. Operating correctly at this time but may want to check for proper blanking and pressure cap location.

AC compressor appears to be leaking from front seal however too much residual oil present to determine.

Heater hoses at front T fitting cracking.

Speedo drive - typical leak – monitor.

Shifter loose and rotates.

LF sway bar bushing crushed.

Recommend compression test.

✓ Cleaned and targeted pressure washed oil from front of engine to determine location of further leaks.

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452

www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959

Service x-223, Parts x-226

Fax 781-547-5960

Invoice # 57841

1969 Ferrari 365 GT

VIN: 12939

Engine: V12 4.4L, 4390cc, Gas, Ca

Trans:

License # 28YC05

ODO In: 76743 Out: 76744

Color: Red

Mfg. Date:

Unit # 12939

Inv Date: 8/10/2017

Promised: 8/10/2017 @ 5:00pm

Service Writer: Kirk McNeil

Status: Posted

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Disc.	Ext
Client requests: All the tires on the vehicle need replacement.						2,349.38
Labor Service - TIRES - Mount & Balance 4 tires DA						290.00
New	ww	Wheel weight	4.00	3.50		14.00
New	85364	Tube - 185/195 TR13 Offset Michelin 15F13	4.00	77.85	-46.72	264.68
New	57977	215/70VR15 Michelin XWX	4.00	411.18	-104.72	1,540.00
Sublet	ROADHAZ	Extended Tire Protection Program	4.00	27.00		108.00
Sublet	SHIPPING	Ship 4 tires, insured	1.00	132.70		132.70

Technician Certifications:

• DA David Angeloni

*Thank You,
Steve*

Warranty

All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.

Manufacturer's vehicle Warranty expires/expired on _____. There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X

Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's.

Posted 8/10/17 4:13PM

AMEX

2,473.83

AUTH: :532560 xx8003

Invoice Summary

Parts	1,818.68
Labor	290.00
Sublet	240.70
Supply/Haz Wast	10.15

Sub Total	2,359.53
Sales Tax (DEF)	114.00

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452
www.astonmartin-lotus.com
Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959
Service x-223, Parts x-226
Fax 781-547-5960

Repair Order # 57950

1969 Ferrari 365 GT

VIN: 12939

Engine: V12 4.4L, 4390cc, Gas, Ca

Trans:

License # 28YC05

ODO In0

Color: Red

Mfg. Date:

Unit # 12939

Inv Date: 10/02/2017

Promised: 10/02/2017 @ 6:00pm

Service Writer: Steve Oldford

Status: Appointment

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
Client requests: Repair engine oil leaks					1,907.55
Labor Service - DA					1,740.00
New	160479	Cam Cover gasket	2.00	45.55	91.10
New	220036	Gasket - End plate	3.00	6.50	19.50
New	95860076	O-ring OR3168	3.00	2.25	6.75
New	95860079	O ring seal 3167	1.00	2.35	2.35
New	95850106	Oil seal 2542/6	1.00	18.50	18.50
New	Brake cleaner	Brake & Parts cleaning solvent-(KT14282)	1.00	4.95	4.95
New	1211	Three Bond 1211 Liquid Gasket Sealant	0.50	49.00	24.50
Client states: Several cooling system hoses need to be replaced					628.98
Labor Service - DA					580.00
New	COOLANT GREEN	All Season Green A/F 1 Gal (CH-226110-486, 9401006021)	2.00	24.49	48.98
Part		Hoses...	1.00	0.00	0.00

Technician Certifications:

• DA David Angeloni

Warranty

All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.
Manufacturer's vehicle Warranty expires/expired on _____. There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs hereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorney's fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs hereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorney's fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Customer acknowledges receipt of merchandise and services.

Estimate only, do not pay.

Repair Order Summary:

Parts 216.63
Labor 2,320.00
Supply/Haz. Wast 81.20

Sub Total 2,617.83
Sales Tax (DEF) 18.61

Total 2,636.44

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452

www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959

Service x-223, Parts x-226

Fax 781-547-5960

Invoice # 57950

1969 Ferrari 365 GT

VIN: 12939

Engine: V12 4.4L, 4390cc, Gas, Ca

Trans:

License # 28YC05

ODO In: 76896 Out: 76903

Color: Red

Mfg. Date:

Unit # 12939

Inv Date: 10/02/2017

Promised: 10/02/2017 @ 6:00pm

Service Writer: Steve Oldford

Status: Posted

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Disc.	Ext
------------------	----------------------	--------------------	-----	-------	-------	-----

Client requests: Repair engine oil leaks

6,086.66

Labor Service - Found significant oil leaks from engine. Upon disassembly to reseal cam covers, chain covers and end gaskets found that the front cover to cylinder head O-rings were not present and had been replaced with large ring of silicone. Determined best course of action to forego engine out reseal to be wedge front cover and feed new o-rings into grooves. Removed auxiliary belts and brackets as necessary. Removed Oil filter housing. Disassembled front cover components and loosed front timing cover. Wedged cover forward for access. Installed new front cover o-rings, new front cover to block coolant o-rings, applied silicone to tri-joint at block, sump, front cover area and used non hardening flange sealer on existing front cover gasket gasket where separated to give best chances for resealing. Replaced distributor o-rings, front plate o-rings and seals. Replaced PS pump o-ring and seal. Found Power steering drive bearing pack loose. Installed internal c-clip to take up clearance. Replaced fuel rail seals and safety wired. Replaced missing RS cam cover alignment dowels. Replaced all auxiliary belts. Replaced hardware as necessary with correct versions. Roadtested and rechecked leaks-OK. Only leaks present after roadtest were slight leaks from bellhousing area (possible rear main) and braided oil lines (ordered).

4,720.00

Notes:

LS cam cover has been previously gouged. Applied silicone to areas.

RS distributor has been indexed wrong and cap alignment notch modified (address at later date-see below)

Lower oil line is very close to frame due to collapsing LS engine mount (to be addressed later)

Braided oil lines leaking and corroded (Scheduled for replacement)

Alternator and AC compressor have at some point been replaced with different non-original style versions. Adjusting brackets have been welded and modified to accommodate. Adjusted belts as good as possible (AC adjuster at end of travel).

Operating properly at this time but recommend exploring better alternatives in future.

DA

New	160479	Cam Cover gasket	2.00	45.55	-9.12	81.96
New	220036	Gasket - End plate	1.00	6.50	-0.98	5.52
New	95860076	O-ring OR3168	1.00	2.25	-0.23	2.02
New	95860079	O ring seal 3187	1.00	2.35	-0.24	2.11
New	95850106	Oil seal 2542/6	1.00	18.50	-2.78	15.72
New	Brake cleaner	Brake & Parts cleaning solvent-(KT14282)	2.00	4.95	-1.00	8.90
New	1211	Three Bond 1211 Liquid Gasket Sealant	0.50	49.00	-3.67	20.83
New	22108	Cam Cover o-ring	2.00	14.50	-4.36	24.64
New	22802	Gasket	1.00	13.50	-2.03	11.47
New	105557	O-ring (OR133 OR4100)	2.00	10.00	-3.00	17.00
New	240131	Gasket, filter mount	1.00	17.00	-2.55	14.45
New	10263460	Copper washer-Ferrari	1.00	2.25	-0.34	1.91
New	10265160	Washer/copper D. 35-41x1.5 (MAR)	1.00	7.25	-1.09	6.16
New	SW-C	Copper Sealing Washer	2.00	5.50	-1.66	9.34
Part		M8-1.0 x 110mm DIN 960 Class 8.8 Plain Finish Hex Cap Screw, Part No. (SKU) 11113482	1.00	34.50		34.50
New	METNUTBLACK	Metric Nut, Black Finish, each M8 x 1.0	1.00	1.96	-0.29	1.67
New	GAT 9270	Belt, Gates 9270	2.00	19.34	-5.80	32.88
New	GAT 7325	V-belt, Gates 7325	1.00	25.56	-3.83	21.73
New	101024	O-ring OR153	2.00	6.00	-1.80	10.20

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Wallham, MA 02452

www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959

Service x-223, Parts x-226

Fax 781-547-5960

Invoice # 57950

1969 Ferrari 365 GT

License # 28YC05

Inv Date: 10/02/2017

New	101030	Oring 108	2.00	5.00	-1.50	8.50
New	95910200	Ring nut 17x1.0mm	1.00	13.25	-1.99	11.26
New	11197774	Washer D.6.4x1	4.00	1.33	-0.80	4.53
New	101239	Cam Cover nut - capnut, Tall	40.00	4.10	-24.80	139.20
New	12601274	Washer	40.00	1.85	-11.20	82.80
New	15896214	Nut, 6mm	4.00	1.75	-1.04	5.96
New	FERDISTNT	Distributor nut, Ferrari, blk M6x1.0x7.5	5.00	6.75	-5.05	28.70
New	134041	Nut, 6mm	3.00	0.56	-0.24	1.44
New	238108	Washer D 6.1 - 9.9 x 1	3.00	3.12	-1.41	7.55
New	91595A438	Dowel, steel alloy 6mm x 10mm	2.00	3.85	-1.16	6.64
New	105959	Tube, Cavis	1.00	3.95	-0.59	3.36
New	CON 10X700	V-Belt, 10x700mm - Continental	2.00	35.00	-10.50	69.50
New	BPEN 20W50	Motor Oil - 20w50 Brad Penn PennGrade1 High Performance Oil (71196)	9.00	7.99	-7.20	64.71
New	169180	Nut, Nyloc	9.00	1.40	-1.89	10.71
New	102742	Nut M10x1.25x10	3.00	2.43	-1.08	6.21
New	10516670	Spring washer, 8mm black	1.00	1.05	-0.16	0.89
New	16043621	SCREW	1.00	1.47	-0.22	1.25
New	133988	Nut	2.00	3.50	-1.06	5.94
New	10902424	Screw M 6x20	5.00	0.84	-0.65	3.55
New	11197774	Washer D.6.4x1	5.00	1.33	-1.00	5.66
New	10519624	Washer	1.00	1.05	-0.16	0.89

Labor Service - Replaced breather hoses with correct Cavis hose, spring clamps and Angst style clamps as original. DA

236.00

New HOSECAVIS10/15 Hose - Cavis Green 10mm x 15mm(meter)

1.00 56.25 -5.63 50.62

New CORBINCLAMP.10.5MM Corbin Spring Clamp 10.5mm black

4.00 6.25 -2.52 22.48

Labor Service - Media blast parts and powder coated heater hose tee at rear of engine and previously modified accessory belt brackets with semi gloss black. DA, EDUARD

-67.50 295.00

Client states: Several cooling system hoses need to be replaced

2,685.99

Labor Service - Replaced hoses as needed including all heater hoses, upper radiator hose, lower radiator hoses, heater branch from ls lower pipe, and water pump hoses. R&R heater core units for access and replaced heater valve to core stub hoses. Replaced mismatched and poor quality non-original clamps with correct double wire (Angst) style clamps (current production), and Copiglia (banding) as original. Utilized visually similar Jubilee clamps instead of Cheney clamps for upper radiator hose for reliability (current repro Cheney clamps are more failure prone). Replaced heater box mounting hardware as necessary with correct hardware. Cleaned and blew out debris from heater cores. DA

625.00

New COOLANT GREEN All Season Green A/F 1 Gal (CH-285110-486, 9401006021)

2.00 24.49 -4.90 44.08

New RH32COOLANT Hose, coolant 32mm Cohlne, per meter

0.20 110.00 -3.30 18.70

New 72EP-162-36 Hose - EPDM w/2-Ply Poly 1.625" Purosil (per foot)

1.00 18.50 -1.85 16.65

New 26694 Hose

1.00 69.00 -10.35 58.65

New 26724 Coolant hose

1.00 62.00 -9.30 52.70

New BS50 Jubilee Clip, 35-50mm SS (2A)

2.00 9.85 -2.96 16.74

Labor Service - (see also coolant hose line) Replaced with closest current production matching hose and ducting. Replaced ducting from heater core to upper and lower vents and from core to blower fans on both sides secured with original style Copiglia banding. DA

1,020.00

New 048-032-0129H HOSE-2.2 mt x 1/2 ID

1.00 129.50 -12.95 116.55

New GROMMET Rubber Grommet

1.00 5.00 -0.75 4.25

New 990030 Hose, Heater 12mm by foot - Cohlne 2633-1000

25.00 12.50 -50.00 262.50

New 14054511 Nyloc nut

2.00 5.83 -1.74 9.92

New 127494 Wavy washer, 6mm zinc coated

2.00 0.70 -0.22 1.18

New AIRDUCT-CANVAS-60MM Airduct - black, wire reinforced canvas 60mm /

0.50 44.50 -3.34 18.91

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452

www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959

Service x-223, Parts x-226

Fax 781-547-5960

Invoice # 57950

1969 Ferrari 365 GT

License # 28YC05

Inv Date: 10/02/2017

New	AIRDUCT-CANVAS-100MM	2.36 inch ID Aircraft - black, wire reinforced canvas 100mm / 4 inch ID	9.00	49.00	-66.15	374.85
New	10902224	Screw	2.00	0.56	-0.16	0.96
New	12643724	Washer	4.00	0.70	-0.44	2.36
New	CLAMP-DWS	Clamp, Double wire screw, zinc steel	2.00	5.25	-1.58	8.92
New	14189071	Bracket with screw	2.00	5.11	-1.54	8.66
New	10902124	Bolt	9.00	0.70	-0.99	5.31
New	127494	Wavy washer, 6mm zinc coated	9.00	0.70	-0.99	5.31
New	12643776	Washer	9.00	1.80	-2.43	13.77

Client requests: Install correct w/washer fluid bag and re-route hoses to correct location

248.54

Labor Service - Removed incorrect tank from LS of engine bay and replaced with correct style bag attached to original mounting on battery bracket. Ran line as necessary. DA

62.50

New	V1204005	Washer bag - FORETIT 0.75L	1.00	167.50		167.50
New	030-008-0058	TUBE-OVERFLOW	0.50	22.50	-1.69	9.86
New	694041	TUBING CLEAR PLASTIC	1.00	10.56	-1.58	8.98

Client requests: Replace air filters and gaskets for airbox

244.86

Labor Service - Replaced air filters (3) and air box to carb top gaskets. Replaced nyloc nuts holding airbox to carbs. DA

0.00

New	180691	Air Box gasket	3.00	7.45	-3.36	18.99
New	95180054	Air Filter	3.00	79.25	-11.88	225.87

Client requests: refinish exhaust heatshields in engine bay

229.89

Labor Service - R&R strip and refinish exhaust heat shields as requested. reattach with new acorn nuts. DA, EDUARD

187.50

New	14054511	Nut, Acorn M6	6.00	3.25	-2.94	16.56
New	12643778	Washer	6.00	1.80	-1.62	9.18
New	KRY SP201	Paint - Black Wrinkle Finish, 11 oz aerosol	1.00	18.50	-1.85	16.65

Client requests: Replace spark plug HT leads

1,016.74

Labor Service - Replaced spark plugs, ignition wires, and standoffs. Routed, trimmed, and adjusted lengths as necessary for best fit, appearance, and function.

312.50

Note: RS distributor has been previously indexed incorrectly and cap alignment notch modified. Running OK at this time but should be rectified when distributor is out for service. DA

New	V1217005	HT Lead set: 365 GT 2+2	1.00	682.17	-102.33	579.84
New	DIST.NUMBERS	Distributor numbers - set	1.00	29.00		29.00
New	BP6ES	NGK BP6ES spark plug (7333)	12.00	7.95		95.40

Client requests: Perform complimentary service clean

0.00

Labor Service - Complimentary Wash & Valet HUGO

0.00

Technician Certifications:

- DA David Angeloni
- EDUARD Eduardo Granados
- HUGO Hugo Marquez

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452
www.astonmartin-lotus.com
Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959
Service x-223, Parts x-226
Fax 781-547-5960

Invoice # 57950

1969 Ferrari 365 GT

License # 28YC05

Inv Date: 10/02/2017

Continued from previous page

Thank You!
Steve

Warranty

All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.

Manufacturer's vehicle Warranty expires/expired on _____. There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express bill is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X

Customer acknowledges receipt of merchandise and services.

Posted 11/30/17 5:00PM

A/R Charge 10,862.06

Overdue accounts are charged 1.5% interest with a minimum finance charge of \$10.00

Invoice Summary

Parts	3,054.18
Labor	7,458.50
Supply/Haz Wast	149.17

Sub Total	10,661.85
Sales Tax (DEF)	200.21

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452
www.astonmartin-lotus.com
Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959
Service x-223, Parts x-226
Fax 781-547-5960

Invoice # 58206

1969 Ferrari 365 GT

VIN: 12939

Engine: V12 4.4L, 4390cc, Gas, Ca
Trans:

License # 28YC05

ODO In: 76931 Out: 76939

Color: Red

Mfg. Date:

Unit # 12939

Inv Date: 12/05/2017

Promised: 12/05/2017 @ 6:00pm

Service Writer: Steve Oldford

Status: Posted

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Disc.	Ext
Client states: car towed in...went dead while driving and drained battery down. Charging system issue??						5.50
Labor Service - Found terminal with poor retention had come loose at LF junction block on inner fender. Tightened terminal body creating better retention to block. DA						0.00
New	SHRINK	Shrink tubing (6" length)	1.00	5.50		5.50
Client requests: replace leaking oil hoses...special ordered parts arrived						2,013.30
Labor Service - Replaced braided Oil hoses(3) from radiator to engine left and right side and engine to sump. DA						690.00
New	9240368	Oil pipe (365)	1.00	939.27	-234.82	704.45
New	240367	Oil pipe (365GT2+2)	1.00	324.63	-81.16	243.47
New	9240265	Oil pipe (LHD) (365GT)	1.00	575.25	-143.81	431.44
New	Brake cleaner	Brake & Parts cleaning solvent-(KT14282)	1.00	4.95		4.95
Sublet	SHIPPING	Shipping/Handling Fee, DHL customs/duty fees	1.00	38.99		38.99
Client requests: replace engine mounts...special ordered parts arrived						1,479.82
Labor Service - Replaced engine mounts. Found LS mount crossthreaded in block bracket and bracket seized to engine. Necessary to cut out mount. Soaked and worked bracket until free. Drilled out threads in bracket and installed Timesert thread repair. Installed mounts with new lock washers and locking center nuts and applied antiseize to dowels and threads as necessary. DA						1,180.00
New	131251	Engine mount OD 86mm	2.00	182.00	-72.80	291.20
New	127497	Spring washer	8.00	0.53	-0.88	3.36
New	104114	Nut, Nyloc	2.00	2.73	-1.10	4.36
New	12601474	Washer	2.00	0.56	-0.22	0.80
Client requests: install new decals to power steering pump						108.00
Labor Service - Installed correct decals to power steering reservoir. DA						0.00
New	ZF-P/S.DECALS	Decal kit - ZF power steering pump (3)	1.00	180.00	-72.00	108.00
Technician Certifications:						
• DA David Angeloni						

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452

www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959

Service x-223, Parts x-226

Fax 781-547-5960

Invoice # 58206

1969 Ferrari 365 GT

License # 28YC05

Inv Date: 12/05/2017

Continued from previous page

Warranty

All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.

Manufacturer's vehicle Warranty expires/expired on _____. There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X

Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's

Posted 12/08/17 4:51PM

AMEX 3,737.78

AUTH: :503048 xx8003

Invoice Summary

Parts	1,797.63
Labor	1,770.00
Sublet	38.99
Supply/Haz Wast	17.70

Sub Total	3,624.32
Sales Tax (DEF)	113.46

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452
www.astonmartin-lotus.com
Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959
Service x-223, Parts x-226
Fax 781-547-5960

Invoice # 58725

1969 Ferrari 365 GT

VIN: 12939

Engine: V12 4.4L, 4390cc, Gas, Ca
Trans:

License # 28YC05

ODO In: 76958 Out: 76959

Color: Red

Mfg. Date:

Unit # 12939

Inv Date: 5/17/2018

Promised: 5/17/2018 @ 12:00pm

Service Writer: Kirk McNeil

Status: Posted

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
Client states: check cooling fan connectors.					818.74
Labor Service - Found cooling fans inop. Checked wiring at front of radiator and connections- ok but poor quality installation. Jumped radiator fan switch - fans operate but RS fan contacting mounting bolt. Replaced fan temp switch, cleaned up fan wiring (added connectors and new grounds. Removed unused added auxiliary lighting relay (rs engine compt) and harness. Replaced old aftermarket overflow tank cap with correct part.					580.00
Note: Cooling fans are not original and installation is poor quality (original mountings have also been modified). Recommend installing proper fans and mountings at appropriate time.					
Clearanced top of RS fan as much as possible without creating further issues.					
After running engine to temp found steam from RS top of radiator. No liquid leaks noted but radiator will need replacement/recore imminently. DA					
New 168008	Rad thermo sensor		1.00	97.52	97.52
New 10261860	Copper Washer-Ferrari		1.00	1.75	1.75
New COOLANT GREEN	All Season Green A/F 1 Gal (CH-226110-486, 9401006021)		1.00	16.95	16.95
New 101499/2	Radiator cap 0.9bar, 2 ear late		1.00	66.06	66.06
New 135254	E/Conn Eyelet		2.00	4.13	8.26
New 05551002	MLT PLG HOUSING MALE 2		2.00	2.79	5.58
New 055510021	MLT PLG HOUSING FEMALE 2		2.00	2.72	5.44
New WIRE-12GA	Wire - 12 GA Primary wire per foot (RIW)		1.00	2.18	2.18
New 558.5054	Male Spade Connector Non-Insulated with Tab 6.3MM		4.00	5.39	21.56
New 0558 6032	Female Spade Connector Non-Insulated with Tab 3MM		4.00	3.36	13.44
Client requests: Parts Only... retainers for TR door trim					19.05
Labor Service - Parts only DA					0.00
New 61568600	Fixing plug - retainer		3.00	6.35	19.05
Client requests: State Safety And Emissions Inspection					35.00
Labor Service - Acquire Ma Safety And Emissions Inspection DA					0.00
Sublet SI	State Inspection		1.00	35.00	35.00
Client requests: Perform complimentary service clean					0.00
Labor Service - Complimentary Wash & Valet HUGO					0.00
Technician Certifications:					
• DA	David Angeloni				
• HUGO	Hugo Marquez				

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452
www.astonmartin-lotus.com
Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959
Service x-223, Parts x-226
Fax 781-547-5960

Invoice # 58725

1969 Ferrari 365 GT

License # 28YC05

Inv Date: 5/17/2018

Continued from previous page

Thank You!
[Signature]

Warranty

All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.

Manufacturer's vehicle Warranty expires/expired on _____. There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purpose of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X

Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's.

Posted 5/23/18 10:35AM

AMEX

895.06

AUTH: :599719 xx8003

Invoice Summary

Parts	257.79
Labor	580.00
Sublet	35.00
Supply/Haz Wast	5.80

Sub Total	878.59
Sales Tax (DEF)	16.47

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452

www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959

Service x-223, Parts x-226

Fax 781-547-5960

Invoice # 59993

1969 Ferrari 365 GT

VIN: 12939

Engine: V12 4.4L, 4390cc, Gas, Ca

Trans:

License # 26YC05

ODO In:77421 Out:77423

Color: Red

Mfg. Date:

Unit # 12939

Inv Date: 7/31/2019

Promised: 7/31/2019 @ 6:00pm

Service Writer: Steve Oldford

Status: Posted

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Disc.	Ext
------------------	----------------------	--------------------	-----	-------	-------	-----

Client states: The Cooling System needs to be inspected for leaks... Radiator and expansion tank 3,843.63

Labor Service - Found radiator leaking on RH side. -120.00 810.00

Removed radiator and sent out for repair. Core is in rough condition and needs to be replaced. Special ordered new FIM core. Replaced core and fit original tanks.
Repaired coolant expansion tank leak as well. Refinished black.

Tested cooling fans(electric) and found on fan moving slow. Replaced both elect fans.

Refit radiator assy. Refilled coolant and replaced both caps.

Run up and retest-OK

Cooling fans operating with temp sensor and fan switch on dash ("A")

EDUARD

Sublet	RADIATOR TEST	Radiator/tank repairs. install new core	1.00	925.00		925.00
New	CS12020N	Radiator core, FIM Ferrari 365	1.00	1,056.25	-206.25	850.00
Sublet	SHIPPING	Shipping/Handling Fee	1.00	185.50		185.50
New	COOLANT GREEN	All Season Green ShellZone AVF 1 Gal (CH-226110-486, 9401006021)	2.00	16.95	-3.40	30.50
New	150238	Nut M 14x1.5x14	2.00	5.60	-1.12	10.08
New	BOLTS AE	Bolt/Screw - SAE	1.00	2.95	-0.30	2.65
New	WASHSAE	Washer - SAE	2.00	1.12	-0.22	2.02
New	A120P6015H	O-RING, 7.65 X 1.78, PIPE JOIN	1.00	8.45	-0.85	7.60
New	A120P6013H	O-RING, 10.82 X 1.78, PIPE JOIN	1.00	9.65	-0.97	8.68
New	RH9	Hose - 9mm Braided (meter)	1.00	40.83	-4.08	36.75
New	COPIGLIA.5MM	Copiglia Hose Clamp 5mm - per clamp assy	2.00	19.00	-3.80	34.20
New	101484	Radiator Cap, non pressure	1.00	88.74	-8.87	79.87
New	137644/A	Radiator cap, Oval 1.1bar	1.00	35.65	-3.57	32.08
New	SPU-DX-30102049	Hi-Performance Puller Fan	2.00	287.49	-86.24	488.74
New	SPU-DX-30130010	Fan Mounting Bracket	8.00	8.13	-9.76	55.28
New	31916	Cable tie, 262mm, Colson double	1.00	1.26	-0.19	1.07
New	62797600	Allen Bolt C/sunk 6x20	7.00	5.40	-3.78	34.02
New	102741	Nut, nyloc	7.00	1.41	-0.98	6.89

Labor Service - Replaced oil filters, drain and refill oil EDUARD 77.50

New PH2804-1 Fram oil filter, PH2804 2.00 27.90 55.80

New BPEN 20W50 Motor Oil - 20w50 Brad Penn PennGrade1 High Performance Oil (BPL71196) 12.00 8.95 107.40

Client requests: Courtesy Check - Tire pressures, wheel torque, oil level and lights 0.00

Labor Service - Courtesy inspection...Check and adjust tire pressures, torque wheels, 0.00

Check engine oil level and exterior lights. STEVE

Technician Certifications:

- EDUARD Eduardo Granados
- STEVE Steve O

Aston Martin of New England Lotus Motorsports Inc.

85 Linden Street, Waltham, MA 02452

www.astonmartin-lotus.com

Service/Parts hours: M-F 8:30AM to 5:30PM



Voice 781-547-5959

Service x-223, Parts x-226

Fax 781-547-5960

Invoice # 59993

1969 Ferrari 365 GT

License # 28YC05

Inv Date: 7/31/2019

Continued from previous page

Handwritten signature: Mark You

Warranty

All retail-priced customer paid repair work is warranted for 12 months or 12000 miles which ever comes first.

Manufacturer's vehicle Warranty expires/expired on _____. There are options available for 1 & 2 year Aston Martin Extended Service Contracts. Please inquire for your specific model.

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

X

Consumer acknowledges receipt of goods and/or services in the amount shown hereon and agrees to perform the obligations set forth by the card member's

Posted 9/13/19 4:59PM

AMEX

3,973.12

AUTH: :507630 xx1008

Invoice Summary

Parts	1,845.63
Labor	887.50
Sublet	1,110.50
Supply/Haz Wast	13.31

Sub Total	3,856.94
Sales Tax (DEF)	116.18

Tom Vail's All Ferrari Parts, Inc.
3957 Mayfield Rd.
Cleveland Heights, OH 44121
(614)855-1103
allferrariparts@gmail.com

Invoice for Manual WH-263-7458

ATT: Andy

Date: 11/30/2021

7458

Ship to:

#

Amount: \$ 1899.30

#

Paid: Yes

#

Ship Via: Manual

lots:

	Name	Code	Qty	Unit Price Options	B/O
☐	STARTER MOTOR Shipped on 11/30/2021 by FedEx-FX# Trk# 286830644001	100454	1	\$1850.00 100454	

Subtotal \$ 1850.00

Shipping \$ 49.30

Tax \$ 0.00

Total \$ 1899.30

Thank you for working with us. Below is your quote.

Tom Vail's All Ferrari Parts, Inc
3957 Mayfield Rd.
Cleveland Heights, OH 44121
(614)855-1103
allferrariparts@gmail.com

Invoice for Manual/Phone Order# WH-263-7610

Date: 01/11/2022 Order # 7610

Ship to:

Amount: \$ 899.95

Paid: Yes

Ship Via: Manual

E-Mail:

Payment:

Comments:

	Name	Code	Qty	Unit Price Options	B/O
☐	STARTER MOTOR	100454	1	\$850.00 100454	

Subtotal \$ 850.00

Shipping \$ 49.95

Tax \$ 0.00

Total \$ 899.95

Thank you for working with All Ferrari Parts. Below is your quote.

1900

900

1000 CREDIT

REPAIR ORDER



155 Kennedy Ave. Campbell, CA 95008

408.364.0881

No. 10568

MATERIAL USED

QTY	PART No.	DESCRIPTION	PRICE	WARRANTY YES NO
2	PK28041	OIL FILTERS.	82.50	
16oz/22oz		COPPER SEALS	12.75	
2	GAL. MC DEL. COOLANT	75.00		
	ATF	NOT 4 BR FLUID.	70.50	
①	12	GREASE TUBE	3.550	

DATE 4.1.25

MAKE FERRARI TYPE OR MODEL 365 2+2 Q.M. YEAR 1969

SERIAL No. 12939 ENGINE No. 669

ODOMETER 78,871 LICENSE No. AU4956 TERMS PHONE 265,564

ORDER No. INSTRUCTIONS

VEHICLE INSPECTION / ANNUAL SERVICE.

INSPECT BRAKES - OK. LUBE FRONT END SUSPENSION.

TIRES NOTS —

ADVISE CLIENT — ENGINE OIL LEAKS — CAM COVERS, TIMING CASE, REAR CRANK SEAL. / REAR HORN SHOCKS LEAKING.

INSPEE EXHAUST SYSTEM. OK. CHANGE COOLANT.

FLUSH / CHANGE BRAKE FLUID.

CENTER MUFFLERS / RUSTED & LEAKING.

AIR UP TINES - 32 PSI FOUND LOW. 22 / 20 PSI.

DEPOSIT TOWARD NEW MUFFLERS /

DSS	ISJ	LABOR CHARGE
☒	☒	Change Oil Filter Cart. 1.0
☒	☒	Change Trans. 1.5
☒	☒	Change Diff. 1.5
☐	☐	Pack Front Wheel Brgs.
☐	☐	Adjust Brakes
☐	☐	Rotate Tires
☐	☐	Wash Polish
☒	☒	General Inspection
		1.0
		1.0
		1800.00
		5.5 HR

BROUGHT FORWARD

TOTAL PARTS 276.29

You are entitled to a price estimate for the repairs you have authorized. The repair price may be less than the estimate, but will not exceed the estimate without your permission. Your signature will indicate your estimate selection. Tear down estimate - I understand that my car will be reassembled within ___ days of the date shown if I choose not to authorize the services recommended.

NOT RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE BEYOND OUR CONTROL

GAS, OIL & GREASE	PRICE
12 QTS. OIL 15W-40 S.W. 60	153.00
65 LBS. GREASE 75W-90	145.00
TOTAL GAS, OIL & GREASE	298.00

METHOD OF PAYMENT	TOTAL LABOR
☐ CASH	1257.50
☐ CHECK	276.25
☐ CHARGE	ACCESSORIES 1760.00
☐ FLAT RATE	GAS OIL & GREASE 298.00
☐ HOURLY	OUTSIDE REPAIRS
☐ BOTH	TAX
	TOTAL AMOUNT 3611.75

1800.00
4740.00
200.00
450.00
7190.30