

SERVICE REPAIR ORDER

THE
**BOSTON
SPORTSCAR**
COMPANY

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
9/5/2001	3051

PAID
9/10/2001

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	46,049	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Ferrari Labor	11	REPLACE REAR SHOCK LOAD LEVELERS: Koni load levelers no longer available. Removed original set of Koni load levelers. Modified chassis mounts to accept new set of air shock load levelers. Sourced load levelers and new suspension bushings for shocks. Installed new levelers and bushings and set ride height. Road Tested Vehicle.	92.50	1,017.50
AK-29	1	Air Shock Kit	18.85	18.85T
MA824	1	Air Shocks Load Levelers	188.25	188.25T
Ferrari Labor	4.5	AIR CONDITIONING NOT OPERATING: Freed up seized compressor fitting. Evacuated system and recharged, ran system and checked for leaks. Replaced a/c o ring at compressor fitting. Leak at bas of compressor fitting. Removed freon from system. Removed fitting assembly from compressor, resurfaced base and resealed. Recharged a/c system and tested.	92.50	416.25
R12 Freon	2.5	Freon R-12 - 1lb.	40.00	100.00T
A/C O-Ring	1	A/C O-Ring	1.89	1.89T
		Sales Tax	5.00%	27.02

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total \$3,481.25

X _____

SERVICE REPAIR ORDER

THE
**BOSTON
SPORTSCAR**
COMPANY

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
1/23/2002	3238

PAID
1/23/2002

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	46,610	
ITEM	QTY.	DESCRIPTION			PRICE	TOTAL
Ferrari Labor	6.5	Check for leaky radiator. Found that under 15 PSI the upper tank was leaking at the seam. Removed coolant, under panel fans and A/C condensor. Disconnected al hoses and removed radiator. The radiator was sent out for a reseal. All parts were reinstaled in the car, and the vehicle was road tested and presure tested. Both cooling fans came on and car temp. was normal. Tighten seat belt shoulder harness ancjor bolt.			92.50	601.25
Misc. Fast.	2	Pennzoil Antifreeze			11.65	23.30T
Hose Clamps	1	Zebra Hose Clamp			1.50	1.50T
Rad Repair	1	Radiator Repiar and Core Replacement			95.00	95.00T
		Sales Tax			5.00%	5.99

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total \$727.04

X _____

SERVICE REPAIR ORDER

THE
**BOSTON
SPORTSCAR**
COMPANY

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
8/16/2002	3533

PAID
08/22/2002

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,079	


ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Ferrari Labor	6.5	CHECK FOR OIL LEAKS: Cleaned off all oil off bottom of engine and road tested vehicle. Retightened dipstick tube and replaced o ring. Removed distributor drive housings and replaced o rings and resealed. Reinstalled in vehicle. Resealed engine oil sump pan. Road Tested vehicle and rechecked. Checked over entire vehicle for any other possible issues, everything checked out o.k. Performed state inspection.	92.50	601.25
O Rings	4	O Rings	1.99	7.96T
State Insp.	1	MA State Inspection	29.00	29.00
		Sales Tax	5.00%	0.40

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total \$638.61

X

SERVICE REPAIR ORDER

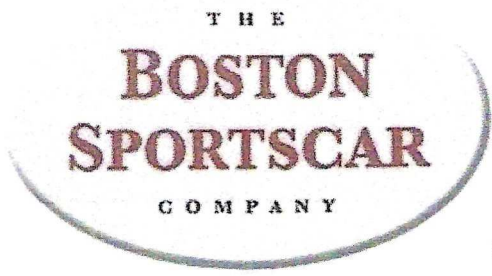

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
5/14/2003	3812

PAID
05/14/2003

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,484	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Ferrari Labor	0.75	REPAIR FLAT TIRE: Removed wheel from vehicle, replaced tire and inner tube, mounted and electronically balanced.	92.50	69.38
21570VR15	1	Michelin MXV4 215/70VR15 Tires	178.01	178.01T
Z000001080	1	ER 12/13 Tube	13.28	13.28T
Flatbed Towing L...	1	FLATBED TOWING CHARGES: Picked up vehicle with flatbed in Bolton, MA and transported to Boston Sportscar in Weston, MA..	75.00	75.00
Ferrari Labor	2.5	IGNITION KET DIFFICULT TO TURN AND VEHICLE WOULD NOT START: Faulty key ignition switch. Traced out electrical wiring for ignition switch. Sourced new late model ignition switch. Rewired switch and installed in vehicle.	92.50	231.25
70000707	1	328 Ignition Switch	383.36	383.36T

Total

SERVICE REPAIR ORDER

THE
**BOSTON
SPORTSCAR**
COMPANY

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
5/14/2003	3812


PAID
5/14/2003

CUSTOMER NAME & ADDRESS						TEL-(Home)	
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.	
Ferrari	365 GT 2...	1970	Red	13153	47,484		
ITEM	QTY.	DESCRIPTION			PRICE	TOTAL	
Ferrari Labor	4	ANNUAL SERVICE AND VEHICLE CHECKOVER: Road tested vehicle. Placed on lift. Removed wheels from vehicle, performed complete checkover. Drained engine oil and replaced oil filters. Oil drain plug was seized, extracted and cleaned up threads, reinstalled. Checked all fluid levels. <i>No major items noted with vehicle and engine is running well. Took car to body shop and had estimate on paint repairs done. Set tire pressures, reinstalled wheels, cleaned and regreased splines. Road Tested vehicle.</i>			92.50	370.00	
PH28041	2	Fram Oil Filters			21.52	43.04T	
Sealing Ring	1	Sealing Ring			0.69	0.69T	
EngOil20W50	12	Pennzoil GT Perf. Mtr. Oil 20W50			3.45	41.40T	
		Sales Tax			5.00%	32.99	

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total \$1,438.40

SERVICE REPAIR ORDER

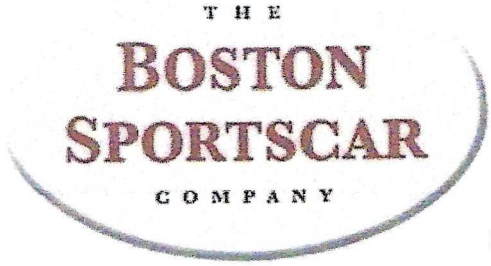

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
8/21/2003	3960

PAID
8/21/2003

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
	365 GT 2...	1970	Red	13153	47,638	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Ferrari Labor	6	VEHICLE WILL NOT START: Picked up vehicle at customer's home in Bolton, Ma with flatbed tow truck. Released hood, repaired broken cable for hood latch. Charged battery and load tested, failed, installed new MT34 Interstate battery, cleaned clamps and cable connections. Tested vehicle charging system, system charging within specifications. Road Tested vehicle. Cleaned vehicle. Flatbedded back to customer's home.	92.50	555.00
MT34	1	Interstate Battery MT-34	92.09	92.09T
		Sales Tax	5.00%	4.60

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total	\$651.69
--------------	-----------------

X _____

SERVICE REPAIR ORDER

THE
**BOSTON
SPORTSCAR**
COMPANY

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
6/18/2004	4294

PAID
6/23/2004

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
FERRARI	365 GT 2...	1970	Red	13153	47,638	


ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
TRANSPORTATI...	2	TRANSPORT VEHICLE	75.00	150.00T
Ferrari Labor	3.5	PERFORM SPRING FLUID CHANGE AND CHECK OVER FOR SUMMER. Change oil and filter, flush and bleed brakes. Check trans, coolant and washers. Set tire pressures and inspect suspension. Retorque wheels.	97.50	341.25
PH2804	2	Oil Filters	23.99	47.98T
EngOil20W50	9	Pennzoil GT Perf. Mtr. Oil 20W50	3.87	34.83T
TutelaBF	1	Tutela Brake Fluid	19.64	19.64T
State Insp.	1	MA State Inspection	29.00	29.00
		Sales Tax	5.00%	12.62

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total	\$635.32
--------------	-----------------

X _____

SERVICE REPAIR ORDER

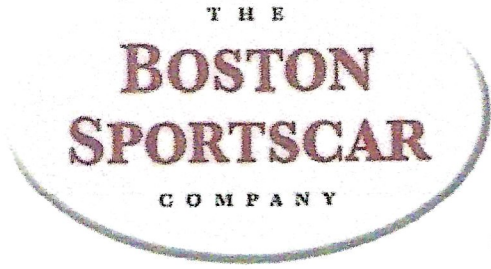

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
6/10/2009	6512

PAID
06/10/2009

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,638	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Ferrari Labor	12	REPAIRS AND SERVICE: Vehicle has not been run in a while. Following work performed. 1) Replaced battery. 2) Drained old gas out of tank, replaced both fuel filters and filled with fresh gas. 3) Drained engine oil, replaced filters and filled with Exxon 20W50 Motor oil. 4) Drained transmission oil and refilled with Agip Rotra 75W90. 5) Removed wheels from Vehicle. Replaced brake fluid, flushed system thoroughly and bled brakes at all four calipers. Brake bleeders were clogged on two calipers, removed and cleaned out. 6) Replaced one 2.5 foot fuel line that was leaking. 7) Drained Cooling system and refilled with new antifreeze. 8) Filled rear air shocks for proper ride height and set tire pressures. 9) Road Tested vehicle and performed full check over.	125.00	1,500.00
Exxon20W50 PH28041	9	Exxon Superflow 20W-50 (18B)	5.98	53.82T
	2	Oil Filter (5C)	25.88	51.76T

Total

SERVICE REPAIR ORDER



596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
6/10/2009	6512

PAID
6/10/2009

CUSTOMER NAME & ADDRESS


TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,638	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Agip RotraSX	8	Agip Rotra SX 75W90 Gear Oil (18C)	12.49	99.92T
Sealing Ring	4	Sealing Ring	1.29	5.16T
BF1200	1	Brake Fluid	17.02	17.02T
95180053	1	Fuel Filter (5E)	16.99	16.99T
95180050	1	Fuel Filter Rear	55.08	55.08T
Fuel Hose	1	Fuel Hoses	33.40	33.40T
Hose Clamps	10	Zebra Hose Clamp	1.50	15.00T
MT34	1	Interstate Battery MT-34 (9B)	131.59	131.59T
subletmartintowing	1	Towing	207.50	207.50T
Gasoline	45	Gasoline	1.00	45.00

Total

SERVICE REPAIR ORDER

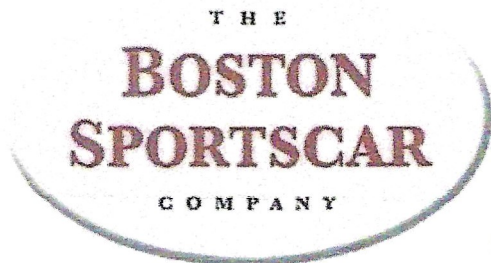

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
6/10/2009	6512

PAID
06/10/2009

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,638	


ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
		<p>FURTHER ITEMS NEEDING ATTENTION:</p> <p>1) CARBURATORS: Accelerator pump diaphragms are leaking and engine is running mediocre. Remove airbox and carburetor tops. Set float levels, clean all jets and passages, clean float balls and replace diaphragms. Reinstall on vehicle and perform carburetor set up. Set idles, airflows and mixtures. Includes replacement of spark plugs.</p> <p>2) Fuel cross over hoses between tanks should be replaced due to condition.</p> <p>3) Heater controls are frozen, remove and disassemble heater control valves, reinstall on car and adjust linkages.</p> <p>4) Grinding noise from right power window cable. Remove door panel and repair.</p> <p>5) Small exhaust leak from left front muffler. Will see if we can repair this.</p> <p>Sales Tax</p>	5.00%	34.36

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total	\$2,266.60
--------------	------------

X _____

SERVICE REPAIR ORDER

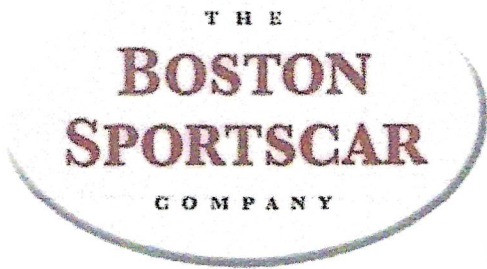

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
6/16/2009	6523

PAID
6/23/2009

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,638	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Ferrari Labor	15.5	CARBURATORS: Accelerator pump diaphragms are leaking and engine is running mediocre. Remove airbox and carburetor tops. Set float levels, clean all jets and passages, clean float balls and replace diaphragms. Reinstall on vehicle and perform carburetor set up. Set idles, airflows and mixtures. Includes replacement of spark plugs.	125.00	1,937.50
11-405	3	Carb tune up kit	146.96	440.88T
CSP332	12	Champion Spark Plugs	6.09583	73.15T
Ferrari Labor	3	FUEL CROSS OVER HOSES: Fuel cross over hoses between tanks should be replaced due to condition	125.00	375.00
114277	2	Fuel Cross-over Connection (14F)	94.745	189.49T
Ferrari Labor	2	HEATER CONTROL LEVERS: Heater controls are frozen, remove and disassemble heater control valves, reinstall on car and adjust linkages.	125.00	250.00
Ferrari Labor	2	PASSENGER WINDOW: Grinding noise from right power window cable. Remove door panel and repair.	125.00	250.00

Total

SERVICE REPAIR ORDER

THE
**BOSTON
SPORTSCAR**
COMPANY

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
6/16/2009	6523

PAID
6/22/2009

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,638	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Gasoline	70	Gasoline	1.00	70.00
Shipping		Shipping	47.13	47.13T
State Insp.	1	MA State Inspection	29.00	29.00
		Sales Tax	5.00%	37.53

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total \$3,699.68

X _____

SERVICE REPAIR ORDER

THE
**BOSTON
SPORTSCAR**
COMPANY

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
7/14/2009	6558

PAID
07/17/2009


CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,638	
ITEM	QTY.	DESCRIPTION			PRICE	TOTAL
Ferrari Labor	8	ENGINE IS CUTTING OUT AND WON'T ACCELERATE: Tested ignition system and checked over engine. Ignition system was intermittantly cutting out and three spark plug wires were arcing to the engine block. Replaced ignition wire set. Main problem was the ignition coil would stop working. Replaced ignition coils and test drove vehicle extensively.			125.00	1,000.00
109584	2	Ignition coil			248.61	497.22T
99100305a	1	Ignition Wire Set			267.00	267.00T
Ferrari Labor	6	AIR CONDITIONING SYSTEM: Repaired electrical wiring since compressor would not turn on and was not getting power. Evacuated and recharged system, system would not blow cold. High side and low side pressures were not within spec. Traced problem to faulty expansion valve. Removed passenger side dash board components, replaced expansion valve and reassembled vehicle. Evacuated and recharged air conditioning system. System blows extremely cold now.			125.00	750.00
4s38608	1	Expansion Valve			61.76	61.76T
R12 Freon	2	Freon R-12			38.00	76.00T

Total

SERVICE REPAIR ORDER

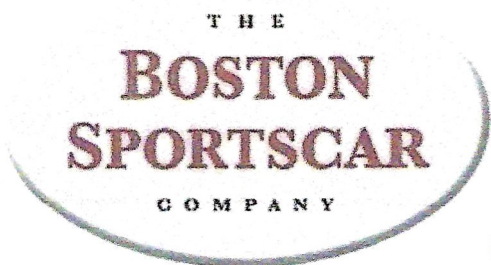

596 Boston Post Road
Weston, MA 02493
tel: (781) 647 - 7300

DATE	R.O. NO.
7/14/2009	6558

PAID
07/17/2009

CUSTOMER NAME & ADDRESS

TEL-(Home)

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Ferrari	365 GT 2...	1970	Red	13153	47,638	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Gasoline	23.37	Gasoline	1.00	23.37
subletmartintowin...	1	Towing of the C70 and the 365	207.50	207.50T
		Sales Tax	5.00%	55.47

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

Total	\$2,938.32
--------------	-------------------

X _____



W14364 Lyngen Rd
Blair, WI 54616

Invoice

Date
4/22/2012


Bill To

Ship To

Item	Description	Invoiced	Rate	Amount
	Total= \$6153.42			

Total		\$6,153.42
Payments/Credits		\$0.00
Balance Due		\$6,153.42

Phone #	Fax #	E-mail
(608) 989-2177	(608) 989-2640	info@zoomalums.com



W14364 Lyngen Rd
Blair, WI 54616

Invoice

Date
6/22/2012

Bill To

Ship To

Item	Description	Invoiced	Rate	Amount
Labor	Ferrari Rebody: - Mounting of front clip- - Fitted and finishing, riveted and welded on windshield covers. - 9 hrs. - Mounting of front clip, fitting, trimming, riveting, etc. - 27 hrs. - Fitting , trimming and finishing hood frame and skin ,started wrapping hood skin. - 19 hrs. - Mounted, heater cores and fans,duct work. Made minor repairs to fan bodies. mounted condenser cooling fans and horns. - 17 hrs. - Final fitting of door frame cladding/ opening and roof top cladding fitting windshield top. - 28 hrs. Total hours = 100 X \$60.00 = \$6,000.00 Materials and supplies. - Nuts and bolts etc. - \$3.52 - Abrasives- \$13.96 - Paint and primer. - \$5.69 - Vent clamps and hose. - \$84.52 - Rivets - \$15.00 - Epoxy primer and etching primer- \$150.00 Total Materials. -\$272.69		6,272.69	6,272.69
			Total	\$6,272.69
			Payments/Credits	\$0.00
			Balance Due	\$6,272.69

Phone #	Fax #	E-mail
(608) 989-2177	(608) 989-2640	info@zoomalums.com

Coachsmithing

W14364 Lyngen Rd
Blair, WI 54616

Invoice

Date

12/22/2015

Bill To

Ship To

Item	Description	Invoiced	Rate	Amount
Labor	<ul style="list-style-type: none"> - Final metal finish and fitting bumpers (mainly rear) and sent to platers. 40 hrs. - Cleaned prepped, painted and undercoated wheel wells etc. 8 hrs. - Final fit and adjusted tail light trim, trunk panels, painted trunk latch and cover. 10 hrs. - Trimmed fit and wrapped foot box kick panels, dash console, "A" pillar and dash surround; light pad and leather. Fit dash pods and fit gauges and new chrome rings for gauges. Cleaned chrome for interior and laid out of door panels. 40 hrs. - Vacuum formed , trimmed and fit dash gauge trim rings. 4.5 hrs. <p>Total hours = 102.5 x 60 = \$ 6150.00 Materials ,supplies and services.</p> <ul style="list-style-type: none"> - Upholstered both seats. - \$2025.00 - Misc. hardware- \$20.85 - Paint supplies, undercoat etc. - \$83.71 - Upholstery supplies.- \$82.35 <p>Materials total = \$2211.91 Total = \$8361.91</p>		8,361.91	8,361.91
			Total	\$8,361.91
			Payments/Credits	\$0.00
			Balance Due	\$8,361.91
Phone #	Fax #	E-mail		
(608) 989-2177	(608) 989-2177	builder@coachsmithing.com		

Coachsmithing

W14364 Lyngen Rd
Blair, WI 54616

Invoice

Date

7/29/2016

Bill To	Ship To

Item	Description	Invoiced	Rate	Amount
Labor	Ferrari interior and exterior - Worked on reinforcing , fitting and fastening of head liner. 16 hrs. - Installed choke cable, power steering etc. 3 hrs. - Picked up most of chrome parts and assembled seats etc. hinges and runners, and installed dash vent rings and ignition switch. installed hood latches, cable and lever. 16 hrs. - Installed head light lens tabs and final fitting of lenses , hood prop and grill. 12 hrs. - Finished tail light reflector housings and lens units, trimmed and installed. 16 hrs. - Final fit, welded, painted and installed tail pipes. 12 hrs. - Finished installing trunk carpet and panels and started to install head lights. 16 hrs - Installed gas fill lid and cables for same and trunk lid. Made leather pulls for behind driver seat and installed to fit panel. 8 hrs. - Started covering door panels and interior back panels. 12 hrs. Total hours 111 x \$60 = \$6660.00 Materials / Supplies -		7,109.68	7,109.68
			Total	
			Payments/Credits	
			Balance Due	
Phone #	Fax #	E-mail		
(608) 989-2177	(608) 989-2177	builder@coachsmithing.com		



5575 Dobbins Bridge Road
Anderson, S.C. 29626

Phone 864-225-2580

info@desmanglass.com

Invoice

Invoice # 8885

Date: 12-27-2016

To:
Coachsmithing

W14364 Lyngen Rd

Blair, WI 54616

ITEM	QTY	DESCRIPTION	PRICE
1	1	Manufacture of custom bent glass panel, 1/4" clear laminated safety glass "Rear windshield"	\$ 1345.00
2	1	Cost of tooling rear glass	\$ 1400.00
3	1	Shipping crate	\$ 150.00
4	1	Prepaid shipping	\$ 265.43

Total			\$ 3160.43

Thank you.

DESMAN

CORPORATION

5575 Dobbins Bridge Road
Anderson, S.C. 29626

Phone 864-225-2580

info@desmanglass.com

Invoice

Invoice # 8476

Date: 11-30-2016

To:
Coachsmithing

W14364 Lyngen Rd

Blair, WI 54616

ITEM	QTY	DESCRIPTION	PRICE
1	1	Manufacture of custom bent glass panel, 1/4" clear laminated safety glass "Front windshield"	\$ 1320.00
2	1	Cost of tooling front	\$ 1200.00
3	2	Side panels, left and right 2 layers of 2.5 mm glass, laminated with .040" laminate Cost side panel \$ 760.00 ea	\$ 1520.00
4	1	Cost of tooling sides	\$ 350.00
5	1	Shipping crate	\$ 200.00

Total			\$ 4590.00

Thank you.

Coachsmithing

W14364 Lyngen Rd
Blair, WI 54616

Invoice

Date

8/9/2017

Bill To

Ship To

Item	Description	Invoiced	Rate	Amount
Labor	> - New car battery \$100 > > - Payment for sizing and installation of windshield. \$350 (I would like to get that installed next week) > > - Nuts and bolts/hardware. \$23.09 > > - Spray adhesive. - \$14.29 > > - Glass shipping charge, Collect. XPOLogistics Invoice # 375-388565. \$164.58 > > - Weatherstrip Approximately. \$350 > > - My son put in 43 hrs. so far. He final assembled the trunk interior, bumper, cables and odds and ends in the passenger compartment. > > If he can get \$18 per hour we'll be happy. = \$774 > > Total = \$1775.96		1,775.96	1,775.96
			Total	\$1,775.96
			Payments/Credits	\$0.00
			Balance Due	\$1,775.96

Phone #	Fax #	E-mail
(608) 989-2177	(608) 989-2177	builder@coachsmithing.com