

2017	649.19
2016	278.66
"	321.61
"	999.10
2014	2038.20
2013	670.23
2012	791.94
"	598.08
2011	1042.02
2011	1071.49
2011	713.29
2010	903.11
2010	630.21
"	1037.75
2007	1330.09
2006	2821.88
2010	1557.69
2000	487.17
"	854.86
"	£179.52
"	794.96
"	360.93
"	891.33
2002	487.69
2005	301.88
"	2995.55
2003	7557.70
2009	825.04
?	5591.89
2008	13948.91
2009	2867.72
?	8917.22
2000	2479.66
2000	2342.31
2001	1244.76
2002	4752.09
2002	4543.53
"	4000.00
2003	650.33
2002	3132.45

BEER

924.32
5616.89
<u>6541.21</u>

UK. £

515.00
26000.00
<u>26515.00</u>

KEN  
BEER  
UK

87791.94
22
221818
87791.94
6541.21
50000.00
<u>144333.15</u>

.....

# facsimile transmittal

**To:** Geof Maycock **Fax:**  
**From:** **Date:** 09/01/99  
**Re:** Jaguar **Pages:** 1  
**CC:**

Urgent  For Review  Please Comment  Please Reply  Please Recycle

As agreed on Sunday, 29 August 1999, you will supply the following:  
One Used Jaguar MK II 3.8 Litre Saloon  
Chassis #222752  
Engine # LC6524-9

The following work has been completed:

- Body Strip, Repair and Repaint
- Engine Total Rebuilt including Balancing and Lead Free Fuel Conversion
- Gearbox Fit all Synchromesh Gearbox / Overdrive
- Brakes New Wheel Cylinders, Pads, Master Cylinder, Servo and Pipework
- Interior New Roof Lining, Carpets, Door Panels, Furflex, Restored Wood and Leather
- Electrics New Wiring, New Battery, Restored Instruments, Reconditioned Starter and Generator
- Steering Rack & Pinion Conversion with Power Assistance
- Harvey Bailey Front Coil Springs and Spax Shock Absorbers
- General Fitted with Kmh Speedometer and Complete with Tool Kit and Handbook

Additional Work To Be Completed:

- Air Conditioning with Heavy Duty Alternator and Changed Hydraulic Pump for Power Steering
- Inertia Dual Rear Seat Belts with Fixed Lap Center Belt
- Replace Carpet Underfelts on the Left Side of the car with Heat Insulating Material

Total Price for Above is £26,000, Shipping will be an Extra Charge

By now you should have received the £3,000.00 Deposit  
Could You Confirm That This Information Is in Line With Our Agreement. Thank You!

.....

AUTOCATS LIMITED  
 RAWRETH INDUSTRIAL ESTATE  
 RAWRETH LANE  
 RAYLEIGH  
 ESSEX  
 SS6 9RL  
 TEL 01268 782306 FAX 01268 782536  
 VAT No: GB 452 0471 76

# INVOICE

TO: DATE: 01.09.99  
 INVOICE NO: 01087

MAKE	MODEL	REGISTRATION NO	MILEAGE	TERMS
Jaguar	MK2 3.8	AJN 970 A		DUE ON PRESENTATION

DESCRIPTION	HOURS	PARTS	AMOUNT
Supply Jaguar MK2 3.8 Saloon			26,000.00
Registration No: AJN 970 A			
Chassis No : 222752			
Engine No : LC6524-9			

**Sellers Certificate**

I declare that I am the seller of the above vehicle at the stated price

Signed: *[Signature]*  
 .....  
 for Autocats Limited

Date: *11/9/99*  
 .....

Input Tax has not been and will not be claimed by me in respect of goods sold on this invoice

**Buyers Certificate**

I declare that I am the buyer of the above vehicle at the stated price

Signed  
 .....  
 S Walker

Date  
 .....

Less Deposit Paid 01.09.99			
	SUB	£	23,000.00
	VAT	£	-
	TOTAL	£	23,000.00

AUOCATS LIMITED  
 RAWRETH INDUSTRIAL ESTATE  
 RAWRKTU LANE  
 RAYLEIGH  
 ESSEX  
 SS6 9RL  
 TEL 01268 782306 FAX 01268 782536  
 VAT No: GB 452 0471 76

# INVOICE

TO:

DATE: 04.11.99  
 INVOICE NO: 01099

MAKE	MODEL	REGISTRATION NO	MILEAGE	TERMS
Jaguar	MK2 3.8	AJN970 A		DUE ON PRESENTATION

DESCRIPTION	HOURS	PARTS	AMOUNT
Supply:-			
Cut out and fit rubber floor mats			35.00
Supply and fit used heated rear Windscreen including original			400.00
Hazard Kit			80.00 515.00

Export Supply

SUB £ 515.00  
 VAT £ Zero Rated  
 TOTAL £ 515.00

# AUTOCATS

JAGUARS

Autocats Ltd Rawreth Industrial Estate, Rawreth Lane, Rayleigh, Essex SS6 9RL Tel 01268 782306 Fax 01268 782536

---

Our Ref: GLM.MM

24 November 1999


The car was delivered to Tilbury on Friday last and enclosed is the Bill of Lading and insurance document.

Also enclosed are:-

- 1 Spare Keys
- 2 Handbook
- 3 Copy of UK Registration Document
- 4 State of California Registration Document
- 5 Instructions and Wiring Diagram for the Air Conditioning/Heater
- 6 Invoice No: 01099 (paid)
- 7 MOT Test Certificate (UK copy)
- 8 Heritage Certificate x 2

I have driven about 250km. Please restrict the engine to 2500 RPM until 1,000 km and 3000 RPM until 2500km. Keep a close check on oil and water levels. Oil consumption can be high for up to 5,000km. Anti freeze must be kept at 50/50 concentration at all times. The steering gear is all non-standard but the fluid and method of checking are as the handbook. The air conditioning is charged with R134A refrigerant.

Best regards,

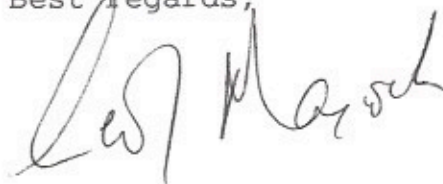

**G L Maycock**

Encs

# AUTOCATS

JAGUARS

## **Heating and Airconditioning**

A simple combined system is installed to provide a degree of cooling and the facility for rapid demist by using heat and cooling together.

The original heater box is modified to accept a smaller but more efficient heater matrix together with a purpose made A/C evaporator. An improved blower and motor are fitted. A compressor is mounted high on the left side of the engine and the condensor with its dedicated fan are mounted at the front of the left front wing and protected by a perforated shield. A dryer is fitted adjacent to the condensor which incorporates a binary switch to protect the compressor from damage due to low gas pressure. The cooling is controlled by a pre-set thermostat fitted to the left engine side panel forward of the brake fluid reservoir. The car's internal airways are modified to provide air to the space between the centre instrument panel and the top of the radio housing. An adjustable air vent is fitted.

Heating control is effected by a vacuum operated water valve controlled by a push on/push off switch on a panel to the left of the radio. A red indicator is illuminated when heating is in operation. Above this switch is another identical which controls the airconditioning function. A green indicator shows that it is operating. The two speed air fan is controlled from the appropriate switch on the instrument panel. The scuttle vent is controlled by a lever (marked vent) below the dashboard just to the left of the radio housing. Pull back to open the vent and vice-versa.

## **OPERATION**

### **Demist / Defrost**

Place car/screen slide to "screen". Push switch for heat. Close scuttle vent and switch fan to fast. If misting persists push switch for A/C (Both Red & Green lights are on).

### **Cooling**

Open scuttle vent. Press switch for A/C (only Green light on). Set Car/Screen slide to about centre position. Open Centre vents and adjust vanes as desired. Out of town sufficient airflow should be available without the fan. In town use fan as desired. In traffic close scuttle vent. Opening rear vent windows will increase air flow.

### **Heating**

As cooling but with A/C off and heat on (Red light only).

## **IMPORTANT**

Do not attempt to lower the instrument panel before removing the adjustable vent.

CODE: N = NEW U = USED RB = REBUILT RC = RECONDITIONED

**KEN BROWNE (SERVICE)**  
 Specializing in Rolls Royce, Bentley,  
 Jaguar & BMW Service  
 207 Geary Ave., Toronto, ON M6H 2C1  
 (416) 588-1996

1856

DATE IN  A.M.  P.M. DATE PROMISED  A.M.  P.M.  
 Jan. 2000  
 CUSTOMER ORDER NO. ORDER WRITTEN BY

NAME: [Redacted]  
 ADDRESS: [Redacted]  
 CITY: [Redacted]

YEAR, MAKE, MODEL: Jaguar Mk. II 1963  
 ODOMETER IN: 00546 ODOMETER OUT: 2  
 SERIAL NO./VIN: 222752 MOTOR NO. [Redacted]

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
	Radio Antenna			198.74
	Antenna Relay			14.95
	C.D. Radio			338.95
2	Speakers			110.00
	Hardware			6.50
1	Wiper Motor			295.02
1	Park Relay			67.29
2	Wiper Blades		26.75	53.50
1	Mounting Plate			18.27

SERVICES REQUESTED / DESCRIPTION OF WORK AMOUNT  
 LUBRICATION  OIL CHANGE  TUNE-UP  OIL FILTER

Fit CD Radio to Center Console. Fit Automatic Antenna. Fit 2 Rear Speakers into Rear Deck Area in trunk. Fit XJB Wiper Motor and Rocker Switch. Fit Correct Wiper Blades.

ADD MORE RADIO.

*[Handwritten signature]*

GST #R136753282

LITRES-GALS. OF GAS @ _____	TOTAL PARTS	1103.22
LITRES-QTS. OF OIL @ _____	TOTAL LABOUR	1023.00
kg/LBS. OF GREASE @ _____	OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>	<b>GAS, OIL &amp; GREASE</b>	

PAID BY  CASH  CHEQUE  DEBIT CARD  M/C  VISA  OTHER  
 # \_\_\_\_\_ EXP \_\_\_\_\_

I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.

SIGNATURE \_\_\_\_\_ SAVE OLD PARTS  YES  NO

FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING

16 1/2 HOURS AT \$ 62 (MAY BE CONTINUED ON OTHER SIDE) TOTAL LABOUR 1023.00

SUBTOTAL	2126.22
GST	148.84
Certs	34.50
PST	170.10
<b>TOTAL</b>	<b>2479.66</b>

1935

**KEN BROWNE (SERVICE)**  
 Specializing in Rolls Royce, Bentley,  
 Jaguar & BMW Service  
 207 Geary Ave., Toronto, ON M6H 2C1  
 (416) 588-1996

DATE IN	<input type="checkbox"/> A.M. <input type="checkbox"/> P.M.	DATE PROMISED	<input type="checkbox"/> A.M. <input type="checkbox"/> P.M.
CUSTOMER ORDER NO.	ORDER WRITTEN BY		

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
	Wiper Motor		No Charge	
2	Wiper Blades			29.80
8	Ltl 20-50			34.00
	Oil Filter			22.90
	Hardware & Supplies			6.35
2	Banjo Bolts			25.68
4	Washers			6.00

NA		
AD		
OR		
YEAR, MAKE, MODEL	ODOMETER IN	ODOMETER OUT
SERIAL NO. / V.I.N.	MOTOR NO.	

**SERVICES REQUESTED / DESCRIPTION OF WORK** **AMOUNT**

SERVICES REQUESTED / DESCRIPTION OF WORK	AMOUNT
<input type="checkbox"/> LUBRICATION <input type="checkbox"/> OIL CHANGE <input type="checkbox"/> TUNE-UP <input type="checkbox"/> OIL FILTER Check Operation Of Wipers. Replaced Wiper Motor and Lube Rack. Replace Wiper Blades.	No Charge
Remove Driver's Door Panel and Refit Window Rail to Increase tension on Door Seal to Reduce Wind Noise. Machine Fulcrum for Quarter Window to increase tightness.	
Change oil and Filter. Check all levels. Check Hoses & Belts.	
Check Operation of A/C and Increase Air Flow by Modifying Air Ducts in Bulkhead.	
Balance Both Front Wheels on Car. Check again for Fuel Leak. Replace two Carb Banjo Bolts and Washers. Road Test.	
(MAY BE CONTINUED ON OTHER SIDE)	
<b>TOTAL LABOUR</b>	<b>294.50</b>

GST #R136753282			
LITRES/GALS. OF GAS @ _____		TOTAL PARTS	124.73
LITRES/QTS. OF OIL @ _____		TOTAL LABOUR	294.50
KG/LBS. OF GREASE @ _____		OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>		<b>GAS, OIL &amp; GREASE</b>	
PAID BY <input type="checkbox"/> CASH <input type="checkbox"/> CHEQUE <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> M/C <input type="checkbox"/> VISA <input type="checkbox"/> OTHER		SUBTOTAL	
# _____ EXP _____		GST	
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.		PST	
SIGNATURE _____		TOTAL	
FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING		SAVE OLD PARTS <input type="checkbox"/> YES <input type="checkbox"/> NO	

434 HOURS AT \$ 62

**TOTAL 487.17**



**KEN BROWNE (SERVICE)**  
Specializing in Rolls Royce, Bentley,  
Jaguar & BMW Service

207 Gerrard Ave., Toronto, ON M5H 2G1  
(416) 588-1996

3 Falls Ave. M6G 1S4

1992

CODE: N = NEW U = USED RB = REBUILT RC = RECONDITIONED

DATE IN  A.M.  P.M. DATE PROMISED  A.M.  P.M.  
 July 20th  
 CUSTOMER ORDER NO. ORDER WRITTEN BY

YEAR MAKE MODEL ODOMETER IN ODOMETER OUT  
 Jaguar Mk II 3.8

SERIAL NO. / VIN MOTOR NO.

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
	Coat Fuel Tank			267.40
	Hardware			6.00
2	Fuel Filters		12.90	25.80
	Sending Unit Seal			3.65

*ROB*  
*PAID*

**SERVICES REQUESTED / DESCRIPTION OF WORK** **AMOUNT**

LUBRICATION  OIL CHANGE  TUNE-UP  OIL FILTER

Fuel Tank is Badly Rusted Inside. Rust is Clogging Fuel Filter and Fuel Pump. Drop Rear Exhaust and Remove Fuel Pump and Fuel tank. Send out Tank for Coating. Strip Fuel Pump and Clean Out Rust.

Also - E type  
 Reoperate Horn. Reoperate Cooling Fans. Replace Reverse lamp Bulb.

Parts - Lucas terminal 2.75  
 Bulb 3.75  
 Labour 1/2 hr. 31.00  
 37.50  
 PST 3.00  
 GST 2.63  
 Total 43.13

GST #R136753282

LITRES/GALS OF GAS @ _____	TOTAL PARTS	302.85
LITRES/QTS. OF OIL @ _____	TOTAL LABOUR	403.00
kg/LBS. OF GREASE @ _____	OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>	GAS, OIL & GREASE	
PAID BY <input type="checkbox"/> CASH <input type="checkbox"/> CHEQUE <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> M/C <input type="checkbox"/> VISA <input type="checkbox"/> OTHER	<b>SUBTOTAL</b>	705.85
# _____ EXP _____	<b>GST</b>	49.41
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.	<i>E type</i>	43.13
SIGNATURE _____	<b>PST</b>	56.47
FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING _____	<b>TOTAL</b>	854.86
SAVE OLD PARTS <input checked="" type="checkbox"/> YES <input type="checkbox"/> NO		

6 1/2 HOURS AT \$ 62 (MAY BE CONTINUED ON OTHER SIDE) **TOTAL LABOUR 403.00**

CODE: N = NEW U = USED RB = REBUILT RC = RECONDITIONED

**KEN BROWNE (SERVICE)**  
 Specializing in Rolls Royce, Bentley,  
 Jaguar & BMW Service  
 207 Geary Ave., Toronto, ON M6H 2C1  
 (416) 588-1996

1380

DATE IN  A.M.  P.M. DATE PROMISED  A.M.  P.M.  
 CUSTOMER ORDER NO. ORDER WRITTEN BY

16 Aug 00

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
8	Lt 20-50			No charge
	Oil Filter			No charge
	Hardware			1.10

REPAIR

pu

GST #R136753282

YEAR, MAKE, MODEL: Jaguar Mk II  
 ODOMETER IN: ODOMETER OUT:  
 SERIAL NO./VIN: MOTOR NO.:

**SERVICES REQUESTED / DESCRIPTION OF WORK** o **AMOUNT**

LUBRICATION  OIL CHANGE  TUNE-UP  OIL FILTER

Change Oil and Filter.  
 Lube all fittings. Torque head and  
 Cam covers. Remove Driver's Door  
 Mirror and Grind Arm to allow more  
 Adjustment of Head. Refit Mirror  
 with larger Screws. Low fuel lamp  
 Switch in Sending unit is faulty - Order  
 New Sending unit. Remove Drivers  
 Door trim and tighten Modratt  
 Window. Refit all Refit Latch for  
 LH Rear Window. Remove Distributor  
 Cap and Check Points cap & Rotor. Reset  
 Mixtures. Road test. Open Air Duct for  
 A/C a little more.

LITRES/GALS. OF GAS @ _____	TOTAL PARTS	1.10
LITRES/QTS. OF OIL @ _____	TOTAL LABOUR	155.00
kg/LBS. OF GREASE @ _____	OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>	<b>GAS, OIL &amp; GREASE</b>	
PAID BY <input type="checkbox"/> CASH <input type="checkbox"/> CHEQUE <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> M/C <input type="checkbox"/> VISA <input type="checkbox"/> OTHER		
# _____ EXP _____		
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.	<b>SUBTOTAL</b>	156.10
SIGNATURE _____	<b>GST</b>	10.93
FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING	<b>PST</b>	12.49
SAVE OLD PARTS <input type="checkbox"/> YES <input type="checkbox"/> NO	<b>TOTAL</b>	179.52

2 1/2 HOURS AT \$ \_\_\_\_\_ (MAY BE CONTINUED ON OTHER SIDE) **TOTAL LABOUR** 155.00

CODE: N = NEW U = USED RB = REBUILT RC = RECONDITIONED

**KEN BROWNE (SERVICE)**  
 Specializing in Rolls Royce, Bentley,  
 Jaguar & BMW Service  
 207 Geary Ave., Toronto, ON M6H 2C1  
 (416) 588-1996

1415

DATE BY  A.M.  P.M. DATE PROMISED  A.M.  P.M.  
 CUSTOMER ORDER NO. ORDER WRITTEN BY

NAME: [Redacted]  
 ADDRESS: [Redacted]  
 CITY: [Redacted]  
 YEAR, MAKE, MODEL: Jaguar MkII 3.8  
 ODOMETER IN: 03074 ODOMETER OUT: [Redacted]  
 SERIAL NO. / V.I.N.: [Redacted] MOTOR NO.: [Redacted]

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
	Fuel Sending Unit (used)		205.95	102.97
	Alternator Pulley			48.60
	Belt			22.71
	Hardware			2.00
	Gasket			3.50

*AS per*

**SERVICES REQUESTED / DESCRIPTION OF WORK** **AMOUNT**

LUBRICATION  OIL CHANGE  TUNE-UP  OIL FILTER

Check operation of Wipers.  
 Replace Indicator Strip for Dash Switches.  
 Check for Oil leaks.  
 Check for Fuel Smell in tank.  
 Check Fuel Mixture & Ignition.  
 Wiper motor had been again Replaced.  
 End of May. Testing Wipers now, will not stall while motor is running.  
 Indicator Strip still on Order (wrong price)  
 Tighten all Oil pan Bolts & Filter housing on sides & Block. Check ign. timing and Reset Point gap. Lower Float level on Front Carb and Reset mixture.  
 Fuel Smell in tank is due to faulty Fuel Sending Unit. Replace unit.  
 Also - A/P. Pulley is Broken and Belt is frayed. (Aluminum Pulley) Remove A/C pump etc. and Remove Alt. Replace Pulley & Belt.

- Also - Previous - Ignition Switch wiring at back of Switch has been pulled and Broken. Repair wiring at switch.

*[Signature]*  
 GST #R136753282

LITRES/GALS. OF GAS @ _____	TOTAL PARTS	179.78
LITRES/QTS. OF OIL @ _____	TOTAL LABOUR	511.50
kg/LBS. OF GREASE @ _____	OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>	<b>GAS, OIL &amp; GREASE</b>	

PAID BY  CASH  CHEQUE  DEBIT CARD  M/C  VISA  OTHER # \_\_\_\_\_ EXP \_\_\_\_\_

I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.

SIGNATURE \_\_\_\_\_ SAVE OLD PARTS  YES  NO

FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING

1/4 + 1 HOURS AT \$ 62 (MAY BE CONTINUED ON OTHER SIDE) **TOTAL LABOUR** 511.50

**SUBTOTAL** 691.28  
**GST** 48.38  
**PST** 55.30  
**TOTAL** 794.96

CODE: N = NEW U = USED RB = REBUILT RC = RECONDITIONED

**KEN BROWNE (SERVICE)**  
 Specializing in Rolls Royce, Bentley,  
 Jaguar & BMW Service  
 207 Geary Ave., Toronto, ON M6H 2C1  
 (416) 588-1996

1430

DATE IN  A.M.  P.M. DATE PROMISED  A.M.  P.M.  
 CUSTOMER ORDER NO. ORDER WRITTEN BY

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
	Fuel Pump (Rebuilt)			187.95
	Fuel Filter - Large			48.92
1	Fuel Hose			10.00
2	Clamps			5.00
2	Seals			

*ROBSON*

*Paul*

NA  
 AD  
 CIT

YEAR, MAKE, MODEL: *Jaguar Mk II 3.8* ODOMETER IN ODOMETER OUT  
 SERIAL NO./VIN. MOTOR NO.

SERVICES REQUESTED / DESCRIPTION OF WORK  LUBRICATION  OIL CHANGE  TUNE-UP  OIL FILTER

*Car towed in to shop. Fuel Pump has Failed. Replace Pump. Fit Large Fuel Filter. Road test. -OK.*

GST #R136753282

LITRES/GALS OF GAS @	TOTAL PARTS	251.87
LITRES/QTS OF OIL @	TOTAL LABOUR	62.00
kg/LBS OF GREASE @	OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>	GAS, OIL & GREASE	
PAID BY <input type="checkbox"/> CASH <input type="checkbox"/> CHEQUE <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> M/C <input type="checkbox"/> VISA <input type="checkbox"/> OTHER		
# _____ EXP _____		
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.	SUBTOTAL	313.87
SIGNATURE	GST	21.96
FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING	PST	25.10
	<b>TOTAL</b>	<b>360.93</b>

1 HOURS AT \$ *62* (MAY BE CONTINUED ON OTHER SIDE) TOTAL LABOUR *62.00*

**KEN BROWNE (SERVICE)**  
 Specializing in Rolls Royce, Bentley,  
 Jaguar & BMW Service  
 207 Geary Ave., Toronto, ON M6H 2C1  
 (416) 588-1996

1451

DATE IN  A.M.  P.M. DATE PROMISED  A.M.  P.M.  
 CUSTOMER ORDER NO. ORDER WRITTEN BY

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
	Fuel Filter (Refund) with tax.			(50.25)
	Fuel Tank			1643.95
	Hardware			12.00
2	Bushings			7.00
	Coat Tank		No Charge	
	Seal			3.50
1	Sparkplug (#6)			8.10

NA  
 AD  
 CR

YEAR, MAKE, MODEL: Jaguar Mk. II 3.8 ODOMETER IN: ODOMETER OUT:  
 SERIAL NO./VIN: MOTOR NO.:

SERVICES REQUESTED / DESCRIPTION OF WORK AMOUNT  
 LUBRICATION  OIL CHANGE  TUNE-UP  OIL FILTER

Fuel Tank has Deterioration of Pickup Pipe inside tank. Fit New tank. Remove Large Fuel Filter Fitted Before Pump. Retap threads in tank for Fitting of Sending unit. Replace #6 Sparkplug. Foul with Oil.

NEW FUEL TANK  
 Paid

GST #R136753282

LITRES/GALS. OF GAS @ _____	TOTAL PARTS	1618.30
LITRES/QTS. OF OIL @ _____	TOTAL LABOUR	418.50
kg/LBS. OF GREASE @ _____	OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>	GAS, OIL & GREASE	
PAID BY <input type="checkbox"/> CASH <input type="checkbox"/> CHEQUE <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> M/C <input type="checkbox"/> VISA <input type="checkbox"/> OTHER		
# _____ EXP. _____		
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.	SUBTOTAL	2036.80
SIGNATURE _____	GST	142.57
SAVE OLD PARTS <input type="checkbox"/> YES <input type="checkbox"/> NO		
FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING	PST	162.94
	<b>TOTAL</b>	<b>2342.31</b>

634 HOURS AT \$ 62 (MAY BE CONTINUED ON OTHER SIDE) TOTAL LABOUR 418.50

**KEN BROWNE (SERVICE)**  
 Specializing in Rolls Royce, Bentley,  
 Jaguar & BMW Service  
 207 Geary Ave., Toronto, ON M6H 2C1  
 (416) 588-1996

1465

DATE IN  A.M.  P.M. DATE PROMISED  A.M.  P.M.  
 CUSTOMER ORDER NO. ORDER WRITTEN BY

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
	Ign. Iron Coil			82.64
	Fuel Pump			187.90
2	Banjo Bolts			25.70
4	Banjo Seals			8.00
1	Banjo "T"			23.81
1	Banjo			14.95
1	"T"			18.70
	Fuel Hose			24.00
8	Hose Clamps			22.00
	Wiring			2.50

NA  
 AD  
 CIT

YEAR, MAKE, MODEL: Jaguar Mk II 3.8  
 ODOMETER IN: ODOMETER OUT:  
 SERIAL NO. / VIN: MOTOR NO.:

**SERVICES REQUESTED / DESCRIPTION OF WORK** o **AMOUNT**

LUBRICATION  OIL CHANGE  TUNE-UP  OIL FILTER

Car continues to stall. Drive car to experience failure. Ign. Iron Coil is faulty. Replace Coil, Distributor and Service. Fit Second Fuel Pump

REPAIR

GST #R136753282

LITRES/GALS. OF GAS @ _____	TOTAL PARTS	408.20
LITRES/QTS. OF OIL @ _____	TOTAL LABOUR	263.50
kg/LBS. OF GREASE @ _____	OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>	GAS, OIL & GREASE	
PAID BY <input type="checkbox"/> CASH <input type="checkbox"/> CHEQUE <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> M/C <input type="checkbox"/> VISA <input type="checkbox"/> OTHER		
# _____ EXP. _____		
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.	SUBTOTAL	671.70
SIGNATURE _____	GST	47.01
FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING	Towing	118.90
	PST	53.72
	<b>TOTAL</b>	<b>891.33</b>

4 1/4 HOURS AT \$ 62 (MAY BE CONTINUED ON OTHER SIDE) **TOTAL LABOUR 263.50**

**KEN BROWNE (SERVICE)**  
 Specializing in Rolls Royce, Bentley,  
 Jaguar & BMW Service  
 207 Geary Ave., Toronto, ON M6H 2C1  
 (416) 588-1996

1723

DATE IN	<input type="checkbox"/> A.M. <input type="checkbox"/> P.M.	DATE PROMISED	<input type="checkbox"/> A.M. <input type="checkbox"/> P.M.
CUSTOMER ORDER NO.	ORDER WRITTEN BY		

QTY.	PART NUMBER AND DESCRIPTION	CODE	UNIT PRICE	AMOUNT
	leather kit + foam kit			4710.34
	Paint + Supplies			35.00
	April Upholstery			1784.76

PRE UPHOLSTERED  
 RE-CUINING SEATS

AM: \_\_\_\_\_  
 ODF: \_\_\_\_\_  
 ITY: \_\_\_\_\_

YEAR, MAKE, MODEL Jaguar MK II 3.8	ODOMETER IN	ODOMETER OUT
SERIAL NO./VIN	MOTOR NO.	

SERVICES REQUESTED / DESCRIPTION OF WORK	AMOUNT
<input type="checkbox"/> LUBRICATION <input type="checkbox"/> OIL CHANGE <input type="checkbox"/> TUNE-UP <input type="checkbox"/> OIL FILTER	

Give Supplies Seat Frames that Recline.  
 Cleanup and Rework and Paint Frames to  
 Prepare for Reupholstery. Obtain leather  
 kit. Send Seats and Car to April Upholstery

This Bill 8917.22  
 Paid 6500.00  
 Outstanding 2417.22  
 892.88  
 2510.10

Paid  
 Visa # 3310 10  
 Second order # 1595  
 (892.88)

Paid - 4500.00  
 2000.00  
 6500.00

LITRES/GALS. OF GAS @ _____	TOTAL PARTS	6530.10
LITRES/QTS. OF OIL @ _____	TOTAL LABOUR	1224.00
kg/LBS. OF GREASE @ _____	OUTSIDE REPAIRS	
<b>TOTAL GAS, OIL &amp; GREASE</b>	<b>GAS, OIL &amp; GREASE</b>	
PAID BY <input type="checkbox"/> CASH <input type="checkbox"/> CHECK <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> M/C <input type="checkbox"/> VISA <input type="checkbox"/> OTHER	<b>SUBTOTAL</b>	7754.10
# _____ EXP. _____	<b>GST</b>	542.79
I hereby authorize the above repair work to be done along with the necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express lien under the Repair and Storage Lien Act is acknowledged on above vehicle to secure the amount of repairs thereto. It is also understood that you will not be held responsible for loss or damage to vehicles or articles left in vehicles in case of fire, theft or any other cause beyond your control.	<b>PST</b>	620.33
SIGNATURE _____	<b>TOTAL</b>	8917.22
FOR YOUR SAFETY, WE RECOMMEND THE FOLLOWING		
SAVE OLD PARTS <input type="checkbox"/> YES <input type="checkbox"/> NO		

18 HOURS AT \$ 68	(MAY BE CONTINUED ON OTHER SIDE)	TOTAL LABOUR 1224.00
-------------------	----------------------------------	----------------------

SEPT 01

# Garage Repair Order

## 224006

Ken Browne (Service)  
3 Follis Ave  
Toronto, ON

TOT 50,465  
+ ALUM RAD  
M6G 1S4 FIRE RAIN

ENGINE OVERHAUL

Date  
TOT  
City  
\$ 191539

QTY.	PART NO. AND DESCRIPTION	PRICE
12	Rod Bolts	123.88
12	Rod Nuts	39.24
	Rod Caps .040	171.78
	Rings .040 3476	<del>426.35</del>
	Complete Engine Gasket set	426.35
6	Spark Plugs	48.60
	Brake Fluid	15.00
	Power Steering Fluid	2.50
	Hardware	6.00
	Shop Supplies	17.40
6	Oil Delivery Washers	28.32
	<b>Total</b>	<b>1225.76</b>

Tax Reg. No. \_\_\_\_\_

Phone When Ready Yes  No  Res. Phone \_\_\_\_\_ Bus. Phone \_\_\_\_\_

License No. \_\_\_\_\_ Year Jaguar Make Mk.II38 Model \_\_\_\_\_ Mileage \_\_\_\_\_

Serial No. \_\_\_\_\_ Motor No. \_\_\_\_\_ Written By \_\_\_\_\_

LABOR	✓	AMOUNT
Lubricate		
Change Oil		
Change Lub.		
Trans. <input type="checkbox"/> Diff. <input type="checkbox"/>		
Replace Oil Filter		
Clean Air Filter		
Repack Front Wheels		
Adjust Brakes		
Rotate Tires		
Wash <input type="checkbox"/> Polish <input type="checkbox"/>		
Tune Motor		

Labour 38 1/2 hr. @ 68<sup>00</sup>

Remove Engine Bonnet, Manifolds, A/c Pump, Heater Fan etc. Drain all Coolant. Remove Cyl Head and Clean up Head. Remove Wheels, Steering assembly, Brake Hoses, Steering Column etc. Drop Entire Front Subframe out of Car. Remove Motor oil Pan, Remove all Con Rods & Pistons. Inspect all. Deglaze all Cyls. (Have already Been Bored to .040 oversize. Reuse Pistons & Rods. Replace Rings & Rod Brgs and Rod Bolts & Nuts. Refit all. Bleed Brakes & Top up all Fluids. A/F to 130°F.

Also-Coolmat 1018.75

**Paid** also order # 224023  
Visa 5 Jan 02 4830

**Paid 2000<sup>00</sup> Visa**  
27 Nov 01.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

\$	Total Labor	2618.00
	Total Parts	1225.76
	<b>Total</b>	<b>3843.76</b>
	Coolmat	1018.75
	Interact	486.25
	Total Gas-Oil-Grease	
	GST	340.38
	PST	389.00
<b>TOTAL</b>	<b>TOTAL</b>	<b>5591.89</b>

Authorized By \_\_\_\_\_



# Garage Repair Order

## 224023

QTY.	PART NO. AND DESCRIPTION	PRICE
	Boat	22 40
	Glue & Fasteners	16 00
	Hardware & Supplies	7 00
	<b>Total</b>	<b>45 40</b>

**Ken Browne (Service)**  
**3 Follis Ave**  
**Toronto, ON M6G 1S4**

*INSTALL INSULATION*

Tax Reg. No.

Name

Date

*20 Dec. 01*

Address

City

Phone When Ready  Yes  No

Res. Phone

Bus. Phone

Promised

License No.

Year

Make

Model

Mileage

*Jaguar Mk II, 63*

Serial No.

Motor No.

Written By

*Paid Visa 483665 Jan 5, 2002 Also Order # 224006*

*Instal Cool Mats. Remove all Seats, Carpeting and underlay and Cen. console. Replace Gear lever Boat and Fit Foam to top of Transmission lever extension. Sew Cover for transmission tunnel and Fit. Cut and Fit Cool mat to Floors & Bulkhead and under Seats. Refit Carpets, Seats etc.*

*Labour 15 1/4 hr. @ 68<sup>00</sup>*

1037 00

Accessories

Tires and Tubes

Qty.

\$

Total Labor

1037 00

Total Parts

45 40

Total Accessories

*total*

1082 40

Liters Gas

Tires and Tubes

Liters Oil

Total Subcontract

Grease

Total Gas-Oil-Grease

Subcontract

GST 75 77

PST 86 59

TOTAL 1244 76

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By

TOTAL

# Garage Repair Order

224041

**Ken Browne (Service)**  
 3 Follis Ave  
 Toronto, ON M6G 1S4

*NEW CHROME ADDRESS*

	QTY.	PART NO. AND DESCRIPTION	PRICE
↑ New		Leaping Cat	135.07
		Center Vane	249.25
	2	Turn Signals	87.90
	2	Headlamp Spears	102.80
		Backup Housing	251.90
		Outer Grill + Lenses	572.00
← Replace	2	Headlamp Rings	210.00
	2	Tail Lamp Housings	420.00
		Headlamp Kit	178.95
		Hardware	6.00
		<b>Total</b>	<b>2213.87</b>

Tax Reg. No. \_\_\_\_\_  
 Name \_\_\_\_\_ Date 14 Jun 02  
 Address \_\_\_\_\_ City \_\_\_\_\_  
 Phone When Ready Yes  No  Res. Phone \_\_\_\_\_ Bus. Phone \_\_\_\_\_ Promised \_\_\_\_\_  
 License No. \_\_\_\_\_ Year Jaguar Make Mk II Model \_\_\_\_\_ Mileage \_\_\_\_\_  
 Serial No. \_\_\_\_\_ Motg No. \_\_\_\_\_ Written By \_\_\_\_\_

LABOR	✓	AMOUNT
Lubricate		
Change Oil		
Change Lub.		
Trans. <input type="checkbox"/> Diff. <input type="checkbox"/>		
Replace Oil Filter		
Clean Air Filter		
Repack Front Wheels		
Adjust Brakes		
Rotate Tires		
Wash <input type="checkbox"/> Polish <input type="checkbox"/>		
Tune Motor		

*Remove Chrome Items to be Replaced or Rechromed.*

*Rechrome - Outer Grill + Vanes, Both tail lamp Housings, Both Headlamp Rings.*

*Replace - Leaping Cat, Grill Center Vane, Both Turn Signal Rings, Headlamp Spears, Backup Housing, Trunk Push Bezel.*

*Fit Bosch Headlamps.*

*Note - This Bill - 3132.45*  
*Overpayment - 200.00*  
*Balance 2932.45*

*Labour - 7 1/2 hr. @ 68.00*

Accessories

Tires and Tubes

Subcontract

*PAID*  
*2/5/02*

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By \_\_\_\_\_

Qty.	\$	Total Labor
		510.00
		Total Parts 2213.87
		Total <b>2723.87</b>
Liters Gas		Tires and Tubes
Liters Oil		Total Subcontract
Grease		Total Gas-Oil-Grease
		GST 190.67
		PST 217.91
		<b>TOTAL 3132.45</b>

TOTAL

TOTAL



**Garage Repair Order**  
321615

KEN BROWNE (SERVICE)  
3 FOLLIS AVE TOR.  
M66 1S4  
416-588-1996

QTY.	PART NO. AND DESCRIPTION	PRICE
------	--------------------------	-------

52.17	Clutch Master Cylinder Kit	24.90
10.00	Brake Fluid	10.00
3.00	Shop Supplies	3.00
1.00	Hardware	1.00
Total		91.07
Labor 4 1/2 hr. @ 44.00		= 333.00

Lubricate		Date		City	
Change Oil	Change Lub	Trans.	Oil Filter	Air Filter	Clean
Replace	Replace	Front Wheels	Adjust Brakes	Rotate Tires	Wash
Motor No.	Year	Make	Model	Mileage	Written By
Serial No.	Motor No.	Year	Make	Model	Mileage
License No.	Year	Make	Model	Mileage	Written By
Phone When Ready	Res. Phone	Bus. Phone	Promised		
Yes <input type="checkbox"/>					
No <input type="checkbox"/>					
Tune Motor	Wash	Polish			
<input type="checkbox"/>	<input type="checkbox"/>	<input type="checkbox"/>			

Car is not shifting properly - Clutch Hydraulics are Faulty. Remove Clutch Master Cylinder and Slaves. Rekit Bath, Bleed and Adjust. Road test. Remove Driver's Cassion and Rekit outer Bolster.

Accessories	Tires and Tubes	Qty.	Total Labor	Total Parts	Total Accessories	Tires and Tubes	Liters Gas	Liters Oil	Grease	TOTAL	GST	PST	TOTAL
			333.00	91.07	424.07						29.69	33.93	487.69

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By

**Garage Repair Order**

419220

KEN BROWNE (SERVICE)

3 FOLLIS AVE TOR.

M66 1S4

416-588-1996

*[Handwritten signature]*

*ORDER CLUTCH*

QTY, PART NO. AND DESCRIPTION PRICE

765.25	Clutch Kit
90.65	Stabalizer Mount
38.95	Trans Pin Bush
35.80	Saddle mounts
37.12	Exhaust Gaskets
16.78	In take Gaskets
13.88	Carb Seals
40.58	LT. 10-40
23.50	Oil Filter
16.00	Paint
32.00	LT Antifreeze
278.20	4 Sync Rings
239.88	Front End
218.81	Kear Bearings
54.90	Front Seal
72.10	Req Seal
67.95	Gasket Kit
187.16	Lay shaft
224.70	Roller Bearings
7.92	1/2c Plug
3.15	Fiber Washer
6.95	Spring
7.50	Trans Oil
7.00	Brake Fluid
4.00	Paint
90.00	Syase Tank
22.95	Blank cap
15.00	Hose
5.50	Clamps
48.50	2 Clutch Switch
12.00	Wiring
34.90	Relay
18.00	Flare water
7.50	Paint
12.87	A/C Hose
112.60	A/C Hose
20.00	4 Seals
8.00	Hardware
178.12	2 1/2 A/C Oil
6.00	Paint
5.00	Proselet
3216.57	Tires and Tubes Total

Labour 55 1/2 hr @ 74.00 = 4107.00  
 Paid 2,000.00 29 Nov. 02  
 Paid 2,000.00 03-12-00 Visa  
 Paid 12 March 2,000.00 Visa

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By	
City	
Total Labor	4107.00
Total Parts	3216.57
Total Accessories	7323.57
Tires and Tubes	121.42
Liters Oil	400.00
Liters Gas	512.65
Grease	585.89
Total	4543.53

LABOR	AMOUNT
Change Oil	
Change Lub	
Trans. <input type="checkbox"/> Oil <input type="checkbox"/>	
Replace Oil Filter	
Clean Air Filter	
Repack Front Wheels	
Adjust Brakes	
Rotate Tires	
Wash <input type="checkbox"/> Polish <input type="checkbox"/>	
Tune Motor	

Serial No.	Motor No.	Written By
License No.	Year	Make
Year	Model	Mileage
Res. Phone	Bus. Phone	Promised
Address	City	Date
Name		
Tax Reg. No.		

Replace Clutch, Rebuild Transmission, Rep Motor through Frame, Clean up Engine Bay while motor is out of car. Replaces stabilizer mount trans pin & seals. Bushings. Replace Exlman. fild Gasket and In take Gasket and Carb Fucils. Replace Oil Filter. Clean up Paint. Trans suspension. W/leaf Car. Fit Alluminum Rod (Owner supplied) - Paint Rod and Shroud - Fit charge tank under 6 H/Front Fender. Fit coil springs to Rad to Operate Electric Fan. FIT A/C Condenser In Fan to f Rad. 1/2 Fan in Fan to fall. Charge A/C. Road test.

**Garage Repair Order** 407819


LABOR AMOUNT

KEN BROWNE (SERVICE)

3 FOLLIS AVE TOR.

M66 154  
416-588-1998

Date 14 Feb 03  
City

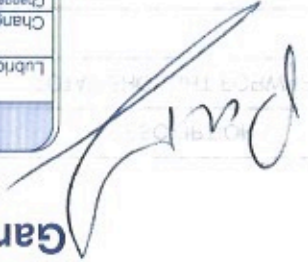

QTY, PART NO. AND DESCRIPTION PRICE

14.00	Clear Coat
6.00	Shop Supplies
10.00	Hardware
5.00	Paint
4.00	Air Filters
15.00	Freon
13.00	Sealant & Silicone
66.00	Total

Labour 6 3/4 hrs @ 74.00 = 499.50

Lubricate	
Change Oil	
Change Lub.	
Trans. <input type="checkbox"/> DIF. <input type="checkbox"/>	
Replace Oil Filter	
Clean Air Filter	
Repack Front Wheels	
Adjust Brakes	
Rotate Tires	
Wash <input type="checkbox"/> Polish <input type="checkbox"/>	
Tune Motor	

Remove Wood trim over LH Rear Door Opening.  
Reglue Broken End and Sand and Refinish.  
Heater Box has Rattle. Remove BURNET. Remove  
Heater Box and Disassemble. Air evaporator  
has been tightly fitted but heater core is loose.  
Pack Heater Core tightly into Box. Open up Vent  
Hole under Heater box over top Pedals. Fit Door  
to new opening. Ref. Fall. Topup Coolant and ALG.  
Road test.

Total Labor	499.50
Total Parts	66.00
Total Accessories	565.50
Tires and Tubes	
Liters Gas	
Liters Oil	
Total Subcontract	
Total Gas-Oil-Grease	
GST	39.59
PST	45.24
TOTAL	650.33

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By

Accessories	
Tires and Tubes	
Subcontract	

# Garage Repair Order

307528

**KEN BROWNE (SERVICE)**  
 3 FOLLIS AVE TOR.  
 M66 1S4  
 416-588-1998

QTY.	PART NO. AND DESCRIPTION	PRICE
	Wiring Harness (Front)	968 65
	Wiring Harness (Inst)	295 44
	Lucar terminals	97 30
	Brake Fluid	6 00
	Antifreeze	6 00
	Hardware Supplies	15 00
	Freon R12A	170 00
	Headlamp Switch	258 23
	Coolant Sending Unit	59 95
2	Bulbs	7 00
9	Lt. 20-50	38 25
	Oil Filter	22 50
	Fuel Solvent A/F	2 60
	<b>Total</b>	<b>1946 92</b>
	Labour 6 1/2 hrs. @ 74 <sup>00</sup>	4625 00
	Accessories	
	Tires and Tubes	
	Subcontract	

Tax Reg. No. \_\_\_\_\_  
 Name \_\_\_\_\_ Date **26 Nov. 03**  
 Address \_\_\_\_\_ City \_\_\_\_\_  
 Phone When Ready \_\_\_\_\_ Promised \_\_\_\_\_  
 License No. \_\_\_\_\_ Year \_\_\_\_\_ Make **Jaguar** Model **Mk II** Mileage **3862**  
 Motor No. \_\_\_\_\_ Written By \_\_\_\_\_

LABOR		AMOUNT
Lubricate	<input checked="" type="checkbox"/>	
Change Oil		
Change Lub.		
Trans. <input type="checkbox"/> Diff. <input type="checkbox"/>		
Replace Oil Filter		
Clean Air Filter		
Repack Front Wheels		
Adjust Brakes		
Rotate Tires		
Wash <input type="checkbox"/> Polish <input type="checkbox"/>		
Tune Motor		

Car has had electrical Fire at Dash. Open Dash and Check Wiring. - Extensive Damage to Instrument Harness and Front Harness. Order Both Harnesses. Remove Complete Dash and strip all Wiring. Remove Headlamp Switch (Original Fault) Remove Pipes at Back of Motor, Heater, Clutch Master Cyl, Fuse Block, A/C compressor, Coil, Rad etc. Remove All of Burned Harness - Route & Fit New Harness and make all connections, modifying for A/c, Alternator, Washer Bottle, 4ways, etc. Re-fit all with New Lamp Switch.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

\_\_\_\_\_  
 Authorized By

Qty.	\$	Total Labor	Total Parts	Total Accessories	Total
		4625 00			
			1946 92		
				6571 92	
Liters Gas			Tires and Tubes		
Liters Oil			Total Subcontract		
Grease			Total Gas-Oil-Grease		
			GST	460 03	
			PST	525 75	
			<b>TOTAL</b>	<b>7557 70</b>	

# Garage Repair Order

## 554107

**KEN BROWNE (SERVICE)**  
 960 BATHURST ST. TOR.  
 M5R 3G5  
 416-588-1996

QTY.	PART NO. AND DESCRIPTION	PRICE
6	Plugs	62.70
1	Air Filter	28.97
9	Lt. 20-50	38.25
	Oil Filter	26.95
	Fuel Solvent	2.60
	Top Rad Hose	24.18
	Anti freeze	12.00
	Brake Fluid	16.00
	Battery	148.90
	Paint & Shop Supplies	18.00
	Cam Cover Gasket & Seal	32.74
	Dip Stick (used)	10.00
	Wiring Supplies	3.50
	Washer Fluid	.75
	Carb Cleaner	13.95
	Bulb	3.50
	<b>Total</b>	<b>442.99</b>
	Labour 8 1/2 hr. @ 74.00	629.00
	Also Remove Heater/Ac Box and Modify for drain	
	Parts - Fuses and Tubes 14.70	Shop Supplies 35.63
	A/c Oil 8.50	Welding Sup. 15.00
	2 Seals 10.00	Brake Fluid 2.00
	Anti freeze 2.00	Paint 12.00
	Hardware 6.00	<b>Total</b> 237.83
	Labour 1 1/2 hr. @ 74.00	129.50
		PST 122.63
		GST 107.30
	<b>Total</b>	<b>1762.76</b>

Tax Reg. No. \_\_\_\_\_  
 Name \_\_\_\_\_ Date 22 March 05  
 Address \_\_\_\_\_ City \_\_\_\_\_  
 Phone When Read \_\_\_\_\_ Promised \_\_\_\_\_  
 License No. \_\_\_\_\_ Year \_\_\_\_\_ Make Jaguar Model Mk II 3.8 Odometer 06593  
 Serial No. \_\_\_\_\_ Motor No. \_\_\_\_\_ Written By \_\_\_\_\_

LABOR	✓	AMOUNT
Lubricate		
Change Oil		
Change Lub.		
Trans. <input type="checkbox"/> Diff. <input type="checkbox"/>		
Replace Oil Filter		
Clean Air Filter		
Repack Front Wheels		
Adjust Brakes		
Rotate Tires		
Wash <input type="checkbox"/> Polish <input type="checkbox"/>		
Tune Motor		

Change Oil & Filter. Lubricate & check all levels. Check Hoses & Belts. Replace top Rad Hose, top up coolant & pressure test system. Clean Carb dashpots & Bodys. Reset Jets. Service Distributor. Clean & reset Points. Check Cap Mt. lead etc. Fit New Plugs. Replace Exhaust Cam Cover Gasket. Reset mixture, Telle & timing. Check Battery & charging. Battery will not take full charge. - 4 years old. Fit New Battery. Clean up Battery tray and Bulkhead. Fit New Air Cleaner. Safety Check Steering linkages & Rack Mounts. Remove all wheels & Service Brakes. Bleed system and Fresh Fluid. Clean up Calipers. Check lights, wipers, Horn etc. Horn Not Working. Lower Steering Column and Repair Horn Pickup on Column. A/c Evaporator has no dye in it so not proceed.

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Roadtest.

Total Labor	629.00
Total Parts	442.99
Total Accessories	1071.99
Liters Gas	
Liters Oil	
Grease	
Tires and Tubes	
Also Ac drain	1762.76
Total Gas-Oil-Grease	
GST	75.04
PST	85.76
<b>TOTAL</b>	<b>1232.79</b>

2995.55



QTY.	PART NO. AND DESCRIPTION	PRICE
	Shop Supplies	4.50
1	Lt. 20-50	4.50

KEN BROWNE (SERVICE)  
 960 BATHURST ST. TOR.  
 M5R 3G5  
 416-588-1996

**Garage Repair Order**

335202

Labour 3 1/4 hr @ 78<sup>00</sup> 253.50

Tax Reg. No.		Date	
Name		10 Aug 05	
Address		City	
Phone When Ready		Promised	
License No.	Year	Make	Model
		Jaguar	Mk II
Serial No.	Motor No.	Written By	

LABOR	✓	AMOUNT
Lubricate		
Change Oil		
Change Lub.		
Trans. <input type="checkbox"/> Diff. <input type="checkbox"/>		
Replace Oil Filter		
Clean Air Filter		
Repack Front Wheels		
Adjust Brakes		
Rotate Tires		
Wash <input type="checkbox"/> Polish <input type="checkbox"/>		
Tune Motor		

Car will sometimes not crank. Load test Battery ok. Load test all Heavy Connections to Starter. Clean all terminals and Resolder 2 connections. Check Solenoid circuit, ok. Road test. Clean Plugs.

Accessories

Tires and Tubes

*Paid Visa*

Subcontract

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By

Qty.	\$	Total Labor
		253.50
		Total Parts 9.00
		Total Accessories 252.50
Liters Gas		Tires and Tubes
Liters Oil		Total Subcontract
Grease		Total Gas-Oil-Grease
		GST 18.38
		PST 21.00
<b>TOTAL</b>		<b>TOTAL 301.88</b>

# Garage Repair Order

## 353258

**KEN BROWNE (SERVICE)**  
 980 BATHURST ST. TOR.  
 M5R 3G5  
 416-588-1998

QTY.	PART NO. AND DESCRIPTION	PRICE
9	Lt. 20-50	41 40
	Oil Filter	24 95
	Brake Fluid	16 50
	Freon R12A	120 00
	Fuel Solvent	2 60
	A/c oil	4 50
	Anti freeze	25 00
2	Front shocks	420 84
	Alt Bearing	36 27
	Water Pump	285 90
	Gasket	3 75
	Hardware	60
1	Spark Plug	10 45
	Carb Cleaner	14 95
	Shop Supplies	3 50
	Hardware	10 12
	Hose Clamps	5 00
	<b>Total</b>	<b>1026 33</b>
	Labour 17 1/4 hr @ 84 <sup>00</sup>	1449 00
	Accessories	
	Tires and Tubes	
	Subcontract	

Tax Reg. No. \_\_\_\_\_

Name \_\_\_\_\_ Date **14 June 06**

Address \_\_\_\_\_ City \_\_\_\_\_

Phone When Ready \_\_\_\_\_ Promised \_\_\_\_\_

Year **2006** Make **Jaguar** Model **MK#3.8** Odometer \_\_\_\_\_

Serial No. \_\_\_\_\_ Motor No. \_\_\_\_\_ Written By \_\_\_\_\_

*Change Oil & Filter. Lubricate. check all levels. Check Hoses & Belts. Pressure test cooling system. Tighten Clamps as necessary. Blow out Air Filter. Clean Dashpots. Clean plugs. Service Distributor & Reset mixture & Idle. - Replace Rear Plug. Safety Check Brakes and Steering. Bleed all Cyls and Replace Brake Fluid. Rotate Tyres front to back. Fit New Front Shocks. Remove Rad, Breathe, Coil, shroud, Fan Pulley, Water pump, Mounting Brackets, AC pump etc. Remove Alt. and Replace Front Brg. Replace Water Pump. Ref. tall. Recharge A/c. Reoperate LH Rear Door Handle. - RH Door Handle is Broken - will need New Handle.*

LABOUR	AMOUNT
Lubricate	
Change Oil	
Change Lub.	
Trans. <input type="checkbox"/> Diff. <input type="checkbox"/>	
Replace Oil Filter	
Clean Air Filter	
Repack Front Wheels	
Adjust Brakes	
Rotate Tires	
Wash <input type="checkbox"/> Polish <input type="checkbox"/>	
Tune Motor	

Qty.	\$	Total
		Total Labour <b>1449 00</b>
		Total Parts <b>1026 33</b>
		Total Accessories <b>2475 33</b>
Liters Gas		Tires and Tubes
Liters Oil		Total Subcontract
Grease		Total Gas-Oil-Grease
		GST <b>148 52</b>
		PST <b>198 03</b>
		<b>TOTAL 2821 88</b>

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By \_\_\_\_\_

# Garage Repair Order

098451

KEN BROWNE (SERVICE)  
 960 BATHURST ST. TOR.  
 M5R 3G5  
 416-588-1996

QTY	PART NO. AND DESCRIPTION	PRICE
	Ign. Coil	92.90
	Ign. Electronic Module	228.95
6	Plugs	62.70
	Wiring & terminals	16.00
	Shop Supplies	5.00
	Welding	15.00
2	Lt 20-50	9.30
	Fuel Solvent	2.65
	<b>Total</b>	<b>432.50</b>

Tax Reg. No.

Name

Date

Address

City

Phone When Ready

Promised

Licence No.

Year

Make

Model

Odometer

Km

Serial No.

Motor No.

Written By

Labour @ 1/4 hr @ 89 = 734.25

Car towed into Shop - will not start. Ignition wiring has burned - coil is short & points burned. Replace feed wire to coil from main block. Cut and tape loom as necessary. Fit Electronic Module to distributor. Kit new coil. Replace plugs - reset timing. Reset mixture & idle - blow out air filter. Strip RH rear door and make piece to replace broken door latch plunger. Refit all. Adjust catches RH rear seat table. Lube - No Oil on filters. May need front brake rotors - reset tyre pressures. Tighten spring on door mirror.

LABOUR	✓	AMOUNT
Lubricate		
Change Oil		
Change Lub.		
Trans. <input type="checkbox"/> Diff. <input type="checkbox"/>		
Replace Oil Filter		
Clean Air Filter		
Repack Front Wheels		
Adjust Brakes		
Rotate Tires		
Wash <input type="checkbox"/> Polish <input type="checkbox"/>		
Tune Motor		

QTY	\$	Total Labour
		734.25
		Total Parts 432.50
		<b>1166.75</b>
Liters Gas		Tires and Tubes
Liters Oil		Total Subcontract
Grease		Total Gas-Oil-Grease
		GST 70.00
		PST 93.34
		<b>TOTAL 1330.09</b>

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control.

Authorized By

TOTAL

TOTAL