



CLARIDGE'S LTD.

44355 AUTOMALL CIRCLE

FREMONT, CALIFORNIA 94538

PARTS (510) 226-1120

TOLL FREE (800) 834-6051

SALES SERVICE (510) 623-1111



***** WELCOME TO CLARIDGES *****



"ONE TON OF RECYCLED PAPER SAVES 17 TREES AND 7000 GALLONS OF WATER"



Printed on recycled paper to protect the environment.

All warranties on the products sold hereby are those made by the manufacturer. The Seller, CLARIDGE'S LTD., hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. CLARIDGE'S LTD. neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of these parts and/or accessories.

NOTE: ALL PARTS LISTED ARE NEW, GENUINE OR APPROVED MERCEDES-BENZ, PORSCHE AND BMW PARTS EXCEPT AS INDICATED BY AN ASTERISK.

TOMER NO.	TAX EXEMPT NUMBER	CUST. P. O. NO.	SHIP VIA	PAY	SOLD BY	INVOICE DATE	INVOICE NO.
7885				PENDING	DENISE	06/07/97	251991 POR

B
I
L
L
T
O

S
H
I
P
T
O

QUANTITY		PART NUMBER/DESCRIPTION		BIN	LIST	NET	AMOUNT
IP	B.O.						
1	0	WKD-483-121	911 95-REP.MANUA	SP	359.07	359.07	359.07
1	0	000-000-04-00	*KLASSE WAX	A1	22.95	22.95	22.95
<p>ALL SPECIAL ORDERS PAID IN ADVANCE ELECTRICAL ITEMS AND SPECIAL ORDERS ARE NOT RETURNABLE! NO REFUNDS WITHOUT THIS INVOICE 20% HANDLING CHARGE ON ALL RETURNS</p> <p>No returns after 10 days.</p>					<p>SUB-TOTAL 382.02</p> <p>TAX 31.52</p> <p>FREIGHT 0.00</p> <p>PAY THIS AMOUNT 413.54</p>		

PAID JUN 07 1997

Visa

D X

18:15

PART502

1 OF 1

ALL PARTS STALLED ARE NEW UNLESS SPECIFIED OTHERWISE

ALL PARTS REMOVED OR BE DISCARDED UNLESS OTHERWISE INSTRUCTED DISCARD SAVE

A. BAUER, INC.

SERVICING PORSCHE ONLY
 LARS GIERSING 411 26TH STREET C. LANZATELLA
 OAKLAND, CA 94612
 (510) 834-2772

www.abauer.com

4071

DATE 12-2-99
 WRITTEN BY LC
 ORIGINAL ESTIMATE

QTY.	PART NO. OR DESCRIPTION	SALE	TIME RECEIVED
1	PRIMARY OIL FILTER	14.00	AM
1	SECONDARY OIL FILTER	7.85	PM
1	AIR FILTER	24.00	AM
1	FUEL FILTER	24.95	PM
12	SPARK PLUGS	72.00	
1	FUEL ADD	2.25	
1	W/WASH FL.	3.00	
2	POLLIN FILTERS	77.90	
2	O-RINGS	1.30	
1	TIE ROD	134.90	

YEAR MAKE MODEL NAME
 95 993 CAB
 LICENSE 3PJV628 ADDRESS
 SPEEDOMETER 35187 CITY
 MOTOR NO. BLUE BILL TO
 DELIVERY DATE ADDRESS
 VIN

I hereby authorize the repair work listed herein including necessary materials and labor work where stipulated. You and your employees may only operate the described vehicle for purposes of repair, testing, inspecting or delivering. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident, or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorney's fees in the event default is made in any payment due. Vehicle is returned to customer without warranty. Service includes performed diagnostic and handling charges (including reassembling) will be made. I have read and understand the above and acknowledge receipt of estimate.

TOTAL 369.95

TERMS: CASH UNLESS ARRANGEMENTS ARE MADE

REPAIR ORDER - LABOR INSTRUCTIONS
 CHECK FRONT WHEEL HOP IN TURNS.
 FOUND RIGHT FRONT TIE ROD BROWN.
 REPLACED RIGHT TIE ROD 202.50

TIRES

2	BRIDGESTON 502 225/45X17	490.00
2	BRIDGESTON 502 255/40X17	598.00
3	VALVE SEALS	14.00
4	WHEEL WEIGHTS	12.00
TOTAL		1114.00

ALIGNMENT - SET FRONT NEEDS
 REAR ALIGNMENT NEEDS TO BE SET
 30000 MILE SERVICE (SWERCO) 648.00

REPLACED WORN OUT TIRES - WITH BRIDGESTON 802's
 NOTE HAD WRONG FIT TIRES ON IT

PAID VIA
 12/3-99
 [Signature]

11	QTS. OIL surplus	21.50	<input type="checkbox"/> CASH
	LBS. GREASE		<input type="checkbox"/> CHARGE
	QTS. TRANS. FLUID		<input type="checkbox"/> INTERNAL
			OK'D BY

TOTAL GAS, OIL & GREASE 21.50
 WE RECOMMEND THE FOLLOWING REPAIRS:

SUBLET REPAIRS

4	TIRES MOUNT + BALANCE	64.00
---	-----------------------	-------

MECH. LABOR	850.50
PARTS	369.95
TIRES	1114.00
GAS, OIL & GREASE	21.50
SUBLET	64.00
SALES TAX	128.32
TOXIC WASTE	5.00
TOTAL	2603.27

ALL CLAIMS FOR UNSATISFACTORY LABOR OR FAULTY PARTS MUST BE MADE WITHIN 30 DAYS FROM DATE OF THIS INVOICE
 NO WARRANTY ON USED PARTS. NO WARRANTY ON CUSTOMER SUPPLIED PARTS.

BAR NO. AH 141375 • U.S. EPA ID# CAL 000168351
 THE REYNOLDS AND REYNOLDS CO. GPM-801320 (1/09) THANK YOU

A. BAUER, INC.

Invoice No.
000008237

BAR #: AH 141375
EPA # CAL 000168351
411 26th Street
Oakland, CA 94612
Phone: 510-834-2772 FAX: 510-834-2776

Order Date 07/24/02 09:11 am
Paid: 07/26/02 04:48 pm

www.abauer.com

95 PORSCHE 993 CAB BLUE
56877 Mi.
Lic: 3PJV628/CA 6Cyl 3.6
Vin: WPOCA2991SS341499 09/94
Equipment: AC PS FI
Profile:

Quotes

1 07/24/02 09:20am 1370.68
Phillip in person.

BRAKE PAD WARNING LIGHT

Labor: \$293.70

BRAKE PAD WARNING LIGHT IS ON, CHECK AND ADVISE.
INSPECTED AND FOUND THAT THE FRONT BRAKE PADS, FRONT ROTORS, AND THE REAR BRAKE PADS ARE WORN.
REPLACED THE FRONT BRAKE ROTORS, FRONT BRAKE PADS, FRONT BRAKE PAD SENSORS, REAR BRAKE PADS, AND THE REAR BRAKE PAD SENSORS. TEST DROVE, BRAKE PAD WARNING LIGHT IS NO LONGER ON.

99335193901	Brake Pads FT 993 Mintex-N	1.0 @	89.25 =\$	89.25
99335104301	Brake Disc-N	1.0 @	126.66 =\$	126.66
99335104401	Brake Disc-N	1.0 @	126.40 =\$	126.40
99361236501	BRAKE SENSOR 993-N	2.0 @	15.03 =\$	30.06
96461236301	Brake Pad Sensor `91 C4-N	2.0 @	14.30 =\$	28.60
993 MINTEX FT	BRAKE PADS REAR-N	1.0 @	78.95 =\$	78.95
				479.92

MAJOR SERV 993 C2 30-60-90K

Labor: \$881.10

30000 MILE SERVICE AS PER MANUFACTURER FILL WITH 15-50 MOBIL 1 SYNTHETIC ENGINE OIL , TRANSMISSION SERVICE
REPLACED FAN BELT, ALTERNATOR BELT, AND THE A/C BELT.
REPLACED THREE BOLTS FOR THE FAN BELT PULLEY.
REPLACED BOTH REAR BRAKE LIGHT BULBS.

99320720101	Oil Filter OC 213-N	1.0 @	11.08 =\$	11.08
99310720302	AUX OIL FILTER-N	1.0 @	9.89 =\$	9.89
040-22X27	O-RING-N	2.0 @	0.65 =\$	1.30
99311032700	AIR FILTER 993 LX459-N	1.0 @	19.83 =\$	19.83
FR5DTC	SPARKPLUGS-N	12.0 @	6.00 =\$	72.00
26634689-12OZ	TECHRON FUEL ADDITIVE-N	1.0 @	7.95 =\$	7.95
WASHER SOLVENT	WINDSHIELD WASHER FL.-N	1.0 @	3.00 =\$	3.00
99357247900	POLLEN FILTER LA15/S-N	2.0 @	39.50 =\$	79.00
ENG OIL SYNTHETI	MOBIL 1 15-50 SYNTHETI-N	11.0 @	6.00 =\$	66.00
TRANS OIL	TRANSOIL-N	7.0 @	3.00 =\$	21.00
BRAKE CLEAN	BRAKE CLEANER-N	1.0 @	3.00 =\$	3.00

----->----->----->---Continued on the next page--->----->----->----->

A. BAUER, INC.

Invoice No.
000008237

BAR #: AH 141375
EPA # CAL 000168351
411 26th Street
Oakland, CA 94612
Phone: 510-834-2772 FAX: 510-834-2776

Order Date 07/24/02 09:11 am
Paid: 07/26/02 04:48 pm

www.abauer.com

MAJOR SERV 993 C2 30-60-90K

92811025304	FUEL FILTER KL21-N	1.0 @	17.94 =\$	17.94
9.5X760	ALTERNATOR BELT-N	1.0 @	11.25 =\$	11.25
9.5-776	FAN BELT-N	1.0 @	11.25 =\$	11.25
13X1085	V-Belt 13x1085-N	1.0 @	9.00 =\$	9.00
90011902602	ALLEN BOLT FAN PULLEY-N	3.0 @	0.84 =\$	2.52
1157	Light Bulb-N	2.0 @	2.10 =\$	4.20
				350.21

CAR FAILED SMOG

Labor: \$48.95

IF SERVICE DOES NOT CURE PROBLEM, INSPECT AND ADVISE.
MEASURED EMISSIONS AFTER SERVICE. EMISSIONS OUT OF THE 1 - 3 EXHAUST BANKS ARE WITHIN SPECS. EMISSIONS OUT OF THE 4 - 6 EXHAUST BANKS ARE WITHIN SPECS. ACCORDING TO OUR 4 GAS ANALYZER THE CAR WILL PASS SMOG.

AIR BAG LIGHT

Labor: \$97.90

AIR BAG LIGHT STAYS ON, FOR TWO TO THREE MINUTES BEFORE GOING OUT, AFTER START UP, CHECK AND ADVISE.
CONNECTED BOSCH 9288 TESTER, AND DOWN LOADED FAULT CODES. HAD TWO FAULT CODES STORED FOR THE AIR BAG SYSTEM. ONE IS FOR A SHORTED WIRE FOR THE AIR BAG LIGHT, NOT PRESENT. THE OTHER ONE WAS FOR LOW BATTERY POWER, NOT PRESENT. THE LOW BATTERY POWER PROBABLY TRIGGERED THE LIGHT FOR THE SHORTED AIR BAG LIGHT. ERASED FAULT CODES AND TEST DROVE THE CAR. RECHECKED THE FAULT CODES, NO MORE FAULTS REOCCURRED, AIR BAG LIGHT IS CYCLING CORRECTLY NOW.

Recommendations: NEEDS FRONT AND REAR HOOD SHOCKS.

Payments to A. BAUER, INC.

Status: Paid Work Order

Payments: \$2,225.27

1 07/26/02 2225.27

Cost Summary

Labor	1,321.65
Parts	830.13
Haz Waste	5.00
Subtotal	2,156.78
Tax	68.49
Total	\$2,225.27
Payments	2,225.27
Bal Due	0.00

Thank you for choosing A. BAUER, INC.

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) _____


A. BAUER, INC.

Invoice No.
000009263

BAR #: AH 141375
EPA # CAL 000168351
411 26th Street
Oakland, CA 94612
Phone: 510-834-2772 FAX: 510-834-2776

Order Date 08/07/03 08:56 am
Paid: 08/15/03 05:00 pm

www.abauer.com

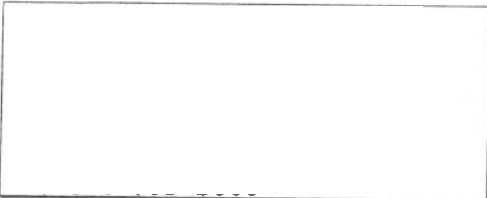

95 PORSCHE 993 CAB BLUE
57586 Mi.Last in 07/24/02
Lic: 3PJV628/CA 6Cyl 3.6
Vin: WPOCA2991SS341499 09/94
Equipment: AC PS FI
Profile:

Quotes

1 08/07/03 09:01am 209.06
Phillip in person.

NO START

Labor: \$209.06

ENGINE WOULD CRANK OVER, BUT WOULD NOT START. CAR SAT FOR FOUR MONTHS. WHEN TOW TRUNK SHOWED UP THIS MORNING, CAR STARTED, AFTER JUMPING THE BATTERY, WOULD NOT START BEFORE. STARTED THE CAR SEVERAL TIMES, COMPLAINT FINALLY REOCCURED, CHECK ENGINE LIGHT CAME ON AT THE SAME TIME.
CONNECTED BOSCH 9288 AND DOWN LOADED FAULT CODES. ONE FAULT CODE WAS STORE, DTC 21, MAF IMPLAUSIBLE SIGNAL. CHECKED CONNECTION AT THE MAF, VERY DIRTY, CLEANED CONNECTION AT THE MAF, AND PLUG. RESET FAULT CODE. STARTED THE CAR SEVERAL TIMES AGAIN, PROBLEM REOCCURED. RAN TEST PLAN, NARROWED POSSIBILITIES TO THE MAF SENSOR, OR IN THE WIRING HARNESS. PORSCHE HAS A CAMPAIGN WHICH IS REPLACING THE ENGINE WIRING HARNESSES IN THE 95 CARRERAS UNDER WARRANTY, THIS ENGINE HARNESS HAS NOT BEEN CHANGED YET. RECOMMEND HAVE THE ENGINE HARNESS REPLACED, AND SEE IF THE PROBLEM IS CURED.

CLUTCH PEDAL

Labor: \$156.79

WHEN THE CLUTCH PEDAL IS RELEASE, DOES NOT COME UP ALL THE WAY, CHECK AND ADVISE. REMOVED PEDAL BOARD, AND INSPECTED CLUTCH PEDAL MECHANISM. OPERATED AND OBSERVED CLUTCH PEDAL SEVERAL TIMES, NO PROBLEMS FOUND. REINSTALLED THE PEDAL BOARD. BLED THE CLUTCH HYDRAULIC SYSTEM, OLD FLUID WAS BLACK, AND VERY DIRTY, LIKELY THE CAUSE OF THE PEDAL STICKING.

BRK FLUID BRAKE FLUID DOT 4-N 1.0 @ 12.95 =\$ 12.95 12.95

INSPECTION

Labor: \$52.26

INSPECT THE CAR.
FILLED OUT CHECK SHEET, CAR IS IN GOOD CONDITION.
BRAKES ARE NEW, TIRES SUSPENSION ETC. OK.
NEEDS FRONT AND REAR HOOD SHOCKS.

DME RELAY

Labor: \$0.00

----->----->----->---Continued on the next page--->----->----->----->

A. BAUER, INC.

Invoice No.
000009263

BAR #: AH 141375
EPA # CAL 000168351
411 26th Street
Oakland, CA 94612
Phone: 510-834-2772 FAX: 510-834-2776

Order Date 08/07/03 08:56 am
Paid: 08/15/03 05:00 pm

www.abauer.com

DME RELAY

CUSTOMER PURCHASED DME RELAY.

99361522700	RELAY DME 993-N	1.0 @	37.87 =\$	37.87	37.87
-------------	-----------------	-------	-----------	-------	-------

Recommendations: NEEDS FRONT AND REAR HOOD SHOCKS.

Payments to A. BAUER, INC.

Cost Summary

Status: Paid Work Order

Payments: \$476.12
1 08/15/03 476.12

Labor	418.11
Parts	50.82
Haz Waste	3.00
Subtotal	471.93
Tax	4.19
Total	\$476.12
Payments	476.12
Bal Due	0.00

Thank you for choosing A. BAUER, INC.

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) _____

A. BAUER, INC.

BAR #: AH 141375
EPA # CAL 000168351
411 26th Street
Oakland, CA 94612
Phone: 510-834-2772 FAX: 510-834-2776

Work Order No.
000011433

Page 1
Order Date: 03/02/06 03:47 pm

95 Porsche 993 CAB BLUE
57758 Mi.
Lic: 3PJV628/CA 6Cyl 3.6
Vin: WP0CA2991SS341499 09/94
Equipment: AC PS FI
Profile:

SALES INSPECTION

Labor: \$225.40

CHECK CAR AS PER INSPECTION FORM
ENGINE OIL LEAKS- NONE
TRANS. OIL LEAKS- NONE
CLUTCH CONDITION- GOOD
SUSPENSION- GOOD
SHOCKS- GOOD
STEERING- GOOD
BRAKE PAD LINING REMAINING FRONT- 100%, ROTOR CONDITION- 100%
BRAKE PAD LINING REMAINING REAR- 100%, ROTOR CONDITION- 100%
BRAKE HYDRAULICS- NEEDS BRAKE MASTER CYLINDER. ESTIMATE TO REPLACE BRAKE MASTER CYLINDER,
FILL AND BLEED BRAKE HYDRAULIC SYSTEM= \$894.90
TIRES- FRONT, GOOD / REAR, FAIR
ALIGNMENT- GOOD
LIGHTS- ONE LICENCE PLATE LIGHT IS BURNT OUT
WINDSHIELD WIPERS / WASHERS- GOOD

COMPRESSION 1- 180 2- 170 3- 180 4- 170 5- 170 6- 180, COMPRESSION IS GOOD

BODY DAMAGE AND OR PAINT- GOOD

SERVICES NEEDED, COMMENTS- ENGINE OIL LEVEL IS SLIGHTLY OVER FILLED, ESTIMATE TO DRAIN
ACCESS OIL= \$52.27.
AIR BAG LIGHT WAS ON, DOWN LOADED FAULT CODES. TWO FAULT CODES STORED, LIGHT DISCONNECTED
WHILE IGNITION TURNED ON, NOT PRESENT. LOW VOLTAGE SOURCE, NOT PRESENT. CLEARED FAULT
MEMORY, TEST DROVE THE CAR, AIR BAG LIGHT DID NOT COME BACK ON.

Job Subtotal: \$225.40

Payments to A. BAUER, INC.

Cost Summary

Labor	225.40
Parts	0.00
Tax	0.00
Total	\$225.40
Payments	0.00

I hereby authorize the above repair work to be done and to be necessary repairs. I hereby grant you my permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) _____

Continued on the next page

A. BAUER, INC.

Work Order No.

Page 2

BAR #: AH 141375

000011433

Order Date: 03/02/06 03:47 pm

EPA # CAL 000168351

411 26th Street

Oakland, CA 94612

Phone: 510-834-2772 FAX: 510-834-2776

Payments to A. BAUER, INC.

Cost Summary

Bal Due

225.40

Status: New Work Order

Payments:

Thank you for choosing A. BAUER, INC.

A. BAUER, INC.

BAR #: AH 141375

EPA # CAL 000168351

411 26th Street

Oakland, CA 94612

Phone: 510-834-2772 FAX: 510-834-2776

Invoice No.
000011440

Page 1
Order Date 03/07/06 01:04 pm
Paid: 03/07/06 03:26 pm

95 Porsche 993 CAB BLUE
57777 Mi.
Lic: 3PJV628/CA 6Cyl 3.6
Vin: WPOCA2991SS341499 09/94
Equipment: AC PS FI
Profile:

Quotes
1 03/07/06 03:27pm 895.09
ANTHONY in person.

BRAKE MASTER CYLINDER

Labor: \$156.79

REPLACED FAULTY MASTER CYLINDER, FILLED AND BLED BRAKE HYDRAULICS.

99335591000	Brake Master Cyl.C2-N	1.0 @	663.19 =\$	663.19	
BRK FLUID	BRAKE FLUID DOT 4-N	1.0 @	12.95 =\$	12.95	676.14
				Job Subtotal: \$832.93	

Payments to A. BAUER, INC.

Cost Summary

Status: Paid Work Order

Labor	156.79
Parts	676.14
Haz Waste	3.00
Tax	59.16
Total	\$895.09
Payments	895.09
Bal Due	0.00

Payments: \$895.09
1 03/07/06 895.09

Thank you for choosing A. BAUER, INC.

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) _____



Mercedes-Benz
**FLETCHER JONES MOTORCARS
 OF FREMONT**

Fremont Automall
 5760 Cushing Parkway
 Fremont, CA 94538-5127



PORSCHE OF FREMONT

(510) 623-1111

RECOMMENDED SERVICES

OPERATION	OPERATION DESCRIPTION	MO/MI	TOTAL	OPERATION	OPERATION DESCRIPTION	MO/MI	TOTAL
02POA-C 06POZ-EZ 02POZ-C	C-SERVICE EZ SERVICE PO YEARLY SERVICE	MI MI MI		04POZ-E 40POZ-FEA	E-SERVICE WHEEL ALIGNMENT	MI MI	

SERVICE HISTORY

DATE	REPAIR ORDER	MILEAGE	ADVISOR	TECHNICIAN	TYPE	OPERATION	OPERATION DESCRIPTION

SALESPERSON NO.

S E R V I C E

STATE REG# P-AL242399

TERMS <input type="checkbox"/> CASH <input type="checkbox"/> CREDIT CARD <input type="checkbox"/> CHECK (PRIOR APPROVAL) <input type="checkbox"/> OTHER <input type="checkbox"/> CALL WHEN READY <input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> CUSTOMER WAITING <input type="checkbox"/> YES <input type="checkbox"/> NO <input type="checkbox"/> APPOINTMENT <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No	VEHICLE I.D. NO. WP0CA2991SS341499	YEAR/MAKE/MODEL 95 / PORSCHE / 911 / 2 DOOR CABRIOLET	PRODUCTION DATE 09/08/94	STOCK NO. 3PJV628	LICENSE NO. 301550
	CUSTOMER NO. 23051	SERVICE CONTRACT 11/14/94	DELIVERY DATE 11/14/94	DELIVERY MILES 36251	SELLING DEALER NO. 03/13/06
COLOR MIDNIGHT BLUE/	CONTRACT NO.	EXPIRATION DATE	EXPIRATION MILES	TAG NO. 9452	
TURBO POZZ	M/MC Y	AIR COND. Y	P. S. Y	TRANS M	MILEAGE 57,939
ORIGINAL ESTIMATE \$	REVISED ESTIMATE \$	2ND REVISED EST. \$	<input type="checkbox"/> BY PHONE <input type="checkbox"/> IN PERSON	ADVISOR NO. 8303	ADVISOR MARK WILLIAMS
TIME RECEIVED 07:27am	DATE/TIME PROMISED 03/13/06 05:30pm	PRIORITY 3	PERSON CONTACTED BY	SERVICE ADVISOR'S NAME	
HAZ. WASTE EST.	DATE	TIME	PHONE NO.		

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK. SUBJECT TO THE CONDITIONS ON THE REVERSE SIDE OF THIS CONTRACT, it is understood that this Company assumes no responsibility for loss or Damage by Theft or Fire to vehicle placed with them for Repair or Damage to vehicle when Called for and Delivered, or while Road Testing. The below bill for labor and material CUST. SIGN **X**

ORIGINAL CUSTOMER ESTIMATE: TOTAL X _____	FOR YOUR CONVENIENCE OUR SERVICE DEPT. HOURS: MONDAY THRU FRIDAY 7:30 A.M. TO 5:30 P.M. OUR CASHIER HOURS: MONDAY THRU FRIDAY 8:00 A.M. TO 5:30 P.M. OUR PARTS DEPARTMENT HOURS: MONDAY THRU FRIDAY 8:00 A.M. TO 5:00 P.M.
1 W 15POZ ELECTRICAL SYST/ENG PERFORM SERVICE ACTION W301 ENGINE HARNESS	FOR SMOG CERTIFICATION REPAIRS - "By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary." The station, as a matter of policy, does not repair certain types, makes or models of vehicles. NOTE: ALL PARTS LISTED ARE NEW UNLESS SPECIFIED OTHERWISE ALL PARTS REMOVED WILL BE DISCARDED UNLESS INSTRUCTED OTHERWISE PRIOR TO REPAIR VEHICLE NOT PICKED UP WITHIN 3 DAYS AFTER COMPLETION OF REPAIRS WILL BE SUBJECT TO A STORAGE CHARGE FEE OF \$50.00 PER DAY.
2 W 77POZ SUNROOF/SOFTTOP/RACK PERFORM RECALL A502 CAB TOP CLOSING MOTORS	(**HAZARDOUS MATERIAL) Removal charge for all hazardous materials removed from your automobile, that must be disposed of as a hazardous waste. Thank you for this opportunity to serve you. It is our aim to perform all the repairs requested on this repair order to your complete satisfaction. If you have any question pertaining to this work order please contact our Service Dept. Manager. THANK YOU FLETCHER JONES MOTOR CARS OF FREMONT Receipt of vehicle described hereon for repair or alteration is hereby acknowledged by dealer. Said customer is hereby notified that the said property is not insured or protected to the amount of the actual cash value thereof, or otherwise, by the dealer against loss occasioned by theft, fire or vandalism while the property remains with the dealer. Customer states no articles of personal property have been left in the vehicle and dealer is not responsible for inspection thereof. Glass replacement or repair and auto detail work may be subcontracted by us to third parties. B.A.R. # AB - 082986



Mercedes-Benz
**FLETCHER JONES MOTORCARS
 OF FREMONT**

Fremont Automall
 5760 Cushing Parkway
 Fremont, CA 94538-5127



PORSCHE OF FREMONT

(510) 623-1111

WELCOME TO FLETCHER JONES MOTORCARS

CUST. NO.	TAX EXEMPT NUMBER	CUST. P. O. NO.	SHIP VIA	PAY	SOLD BY	INVOICE DATE	INVOICE
-----------	-------------------	-----------------	----------	-----	---------	--------------	---------

99

POR-C/C SCOTT


03/14/06

489259
 POR

B
I
L
L
T
O

S
H
I
P
T
O

10% OFF COUPON

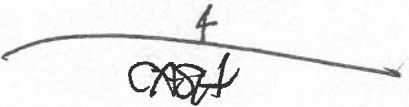QUANTITY		PART NUMBER / DESCRIPTION	BIN	LIST	NET	AMOUNT
SHIP	B. O.					
1	0	PNA-705-001-99 VALVE STEM CAP S	461D	17.58	15.82	15.82
1	0	PNA-702-009-00 POLISHED FRM - P	DISP	59.13	38.56	38.56
PAID MAR 15 2006 						
ALL SPECIAL ORDERS PAID IN ADVANCE ELECTRICAL ITEMS AND SPECIAL ORDERS ARE NOT RETURNABLE! NO REFUNDS WITHOUT THIS INVOICE 20% HANDLING CHARGE ON ALL RETURNS No returns after 10 days.					SUBTOTAL	54.38
					TAX	4.76
					FREIGHT	0.00
					PAY THIS AMOUNT	59.14

Any warranties on the products sold hereby are those made by the manufacturer. The Seller, FLETCHER JONES MOTOR CARS OF FREMONT, hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and FLETCHER JONES MOTOR CARS OF FREMONT neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of these parts and/or accessories.

NOTE: ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

REC'D BY **X**

Reynolds and Reynolds EFAINTPTCE SF629511 Q (11/06)



Mercedes-Benz
**FLETCHER JONES MOTORCARS
 OF FREMONT**

Fremont Automall
 5760 Cushing Parkway
 Fremont, CA 94538-5127



PORSCHE OF FREMONT

(510) 623-1111

CUSTOMER NO.

23051

ADVISOR MARK WILLIAMS	TAG NO. 9452	INVOICE DATE 03/14/06	INVOICE NO. POCS301550
LABOR RATE	LICENSE NO. 8303	MILEAGE 57,939	STOCK NO.
YEAR / MAKE / MODEL 95/PORSCHE/911/2 DOOR CABRIOLET	VEHICLE I.D. NO. W P O C A 2 9 9 1 S S 3 4 1 4 9 9	DELIVERY DATE 11/14/94	DELIVERY MILES 36
COMMENTS	P.O. NO.	SELLING DEALER NO. 251	PRODUCTION DATE 09/08/94
		R.O. DATE 03/13/06	

RE

JOI

LABOR
 J# 1 15POZ

ELECTRICAL SYST/ENG
 PERFORM SERVICE ACTION W301
 ENGINE HARNESS
 SERVICE ACTION COMPLETED
 ENGINE WIRING HARNESS

TECH(S): 6143

WARRANTY

MO: 57939

TO OUR CUSTOMERS:
 WE PAY FOR A RENTAL CAR FOR THE FIRST 24 HOURS, YOU ARE RESPONSIBLE FOR THE GAS, SALES TAX AND INSURANCE.

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	WARRANTY
	1	PKW301	301 HARNESS REPAIR K		
	1	000-043-204-61			
JOB# 1 TOTALS				TOTAL - PARTS	WARRANTY 0.00

JOB# 1 JOURNAL PREFIX POCS JOB# 1 TOTAL

JOB# 2 CHARGES

LABOR
 J# 2 77POZ

SUNROOF/SOFTTOP/RACK
 PERFORM RECALL A502
 CAB TOP CLOSING MOTORS
 RECALL COMPLETED
 TOP CLOSING MOTORS

TECH(S): 6143

WARRANTY

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	WARRANTY
	1	PKA502	LOCKING MOTORS		
	2	911-565-214-60	TARGA ROOF PIN		
	1	000-043-300-44-001	ELECTRICAL MOTOR		
JOB# 2 TOTALS				TOTAL - PARTS	WARRANTY 0.00

JOB# 2 JOURNAL PREFIX POCS JOB# 2 TOTAL

JOB# 3 CHARGES

OR
 3482POZ-00DIAG

DIAG ELECT COMPLNT
 (ELWYN @ 03/13/2006 14:22)
 CUSTOMER STATES REPLACE BROKEN BELT SENSOR
 BELT SENSOR BROKEN
 REPLACE BELT SENSOR

TECH(S): 6143

WARRANTY

PARTS	QTY	FP-NUMBER	DESCRIPTION	UNIT PRICE	WARRANTY
	1	993-106-035-00	BELT TENSION SEN	99.52	
JOB# 3 TOTALS				TOTAL - PARTS	99.52

JOB# 3 JOURNAL PREFIX POCS JOB# 3 TOTAL

=2

CUSTOMER COPY

[CONTINUED ON NEXT PAGE] 09:50am

TO CONSUMER: PLEASE READ ALL WARRANTY, PROP 65 AND

US EPA ID# PAL 242399

US EPA ID# MAL 242398

BAR # AB092986

Reynolds and P...



Mercedes-Benz
**FLETCHER JONES MOTORCARS
 OF FREMONT**

Fremont Automall
 5760 Cushing Parkway
 Fremont, CA 94538-5127



PORSCHE OF FREMONT

(510) 623-1111

CUSTOMER NO. 23051		ADVISOR MARK WILLIAMS	TAG NO. 8303 9452	INVOICE DATE 03/14/06	INVOICE NO. POCS301550
LABOR RATE	LICENSE NO. 3PJV628	MILEAGE 57,939	COLOR MIDNIGHT BL	STOCK NO.	
YEAR / MAKE / MODEL 95/PORSCHE/911/2 DOOR CABRIOLET			DELIVERY DATE 11/14/94	DELIVERY MILES 36	
VEHICLE I.D. NO. W P 0 C A 2 9 9 1 S S 3 4 1 4 9 9			SELLING DEALER NO. 251	PRODUCTION DATE 09/08/94	
F.T.E. NO.			P.O. NO.	R.O. DATE 03/13/06	
COMMENTS					

MO: 57939

ESTIMATE-----
 CUSTOMER HEREBY ACKNOWLEDGES RECEIVING
 ORIGINAL ESTIMATE OF \$0.00 (+TAX)
 APPROVED REVISED ESTIMATE (# 1) OF \$145.00 (+TAX) ON 03/13/06 AT 02:00pm
 BY A. FULCHER COMMENTS BELT TENSIONER
 TOTALS-----

TO OUR CUSTOMERS:
 WE PAY FOR A RENTAL CAR FOR THE FIRST 24
 HOURS, YOU ARE RESPONSIBLE FOR THE GAS,
 SALES TAX AND INSURANCE.

E.P.A.#CAD981663362
 TO OUR SERVICE CUSTOMERS:
 OUR CHARGES FOR LABOR ARE NOT BASED ON ACTUAL MECHANIC
 TIME, BUT ARE ESTABLISHED BY INDUSTRY TIME ALLOWANCES
 OR OUR OWN JUDGMENT OF THE TIME TO BE CHARGED. THIS ESTIMATE
 INCLUDES THE PRICE FOR LABOR AND PARTS NECESSARY FOR A
 SPECIFIC JOB.
 YOU WILL BE CHARGED NO MORE THAN THE ESTIMATED PRICE
 APPROVED BY YOU. IF WE DISCOVER THAT DIFFERENT OR ADDITIONAL
 REPAIRS ARE NEEDED, YOU WILL BE CONTACTED FOR YOUR ADVANCED
 APPROVAL OF A REVISED ESTIMATE.

TOTAL LABOR....	43.50
TOTAL PARTS....	99.52
TOTAL SUBLET...	0.00
TOTAL G.O.G....	0.00
TOTAL MISC CHG.	0.00
TOTAL MISC DISC	0.00
TOTAL TAX.....	8.71
TOTAL INVOICE \$	151.73

ORIGINAL ESTIMATE	REVISED ESTIMATE
\$	\$
DATE	TIME
HAZ. WASTE EST.	
2ND REVISED EST.	<input type="checkbox"/> BY PHONE
PERSON CONTACTED	<input type="checkbox"/> IN PERSON
PHONE NO.	BY

I ACKNOWLEDGE NOTICE OF AND ORALLY APPROVED THE ABOVE
 REPAIRS AND ANY INCREASE IN THE ORIGINALLY ESTIMATED
 PRICE FOR LABOR AND PARTS IF ANY

CUSTOMER SIGNATURE

694

INVOICE

Printed Date: 11/08/2022 **Work Completed: 11/08/2022**

Paul 1995 Porsche - 911 Carrera - 3.6L, H6 (220CI) VIN(A)
 Lic # : 3PJV628 Odometer In : 63232

VIN # : WPOCA2991 **SS341499**

Part Description	Qty	Sale	Ext	Labor Description	Ext
Hood Strut Front Hood	2.00	37.23	74.46	HOOD SHOCKS OR STRUTS - Remove & Replace - Both	60.00
Deck Lid Lift Support Rear, Engine Cover	2.00	50.39	100.78	HOOD SHOCKS OR STRUTS - Remove & Replace - Both	105.00
Convertible Top Motor Repair Kit	1.00	193.64	193.64	CONVERTIBLE TOP MOTOR - Remove & Replace	150.00
				Install top motor gears	180.00
				Synchronize driver seat	120.00
				Synchronize passenger seat	120.00
				Smog test	95.00
				Install engine shroud	150.00

Org. Estimate 0.00 Revisions 1,382.56 Current Estimate 1,382.56

Revision # 1, Previous Estimate Amount: 0.00, Additional Cost: 1382.56, Revised Estimate: 1382.56, Parts: \$368.88 Labor: \$885.00 Sublet: \$95.00
 Taxes & Fees: \$33.68 Authorized by - Paul, Date - 11/8/2022, Time - 3:28 PM, Initiated By - Shop, Written By - Nelson, Zac, Reason - Needed, Phone Number - Customer Called In

Labor:	885.00
Parts:	368.88
Sublet:	95.00
SubTotal:	1,348.88
Tax:	33.68
Total:	1,382.56
Bal Due:	\$0.00

[Payments - Visa - \$1,382.56]

Vehicle Received: 11/8/2022

Customer Number : 702

I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one years or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

Signature _____ Date _____