



VICTORY MOTORCARS

5829 BEVERLY HILL ST
HOUSTON, TX. 77057
Phone: 713-783-6555 Fax: 713-592-5707

INVOICE

3495

AIR-COOLED EXPERTS

INVOICE

Work Completed Date : 12/11/2014

Print Date: 12/11/2014

1997 Porsche - 911 Carrera - 3.6L, H6 (220CI)

Lic # : - TX

Odometer In : 64580

Odometer Out : 64585

VIN # : WP0DA2993 VS385464

Hat # : V-2323

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
OIL FILTER 993 207 201 02	1.00	18.36	18.36	PERFORM PPI	60.00
OIL FILTER 993 107 203 03	1.00	25.89	25.89	PERFORM PPI	
AIR FILTER 993 110 327 01	1.00	23.36	23.36	REPLACED FRONT BRAKE PADS AND SENSOR	100.00
FUEL FILTER 928 110 253 06	1.00	28.44	28.44	REPLACED OIL COOLER RESISTOR	150.00
ACC CABIN FILTER 993 572 479 00	1.00	57.96	57.96	REPLACED HOOD STRUTS	50.00
MOBIL 1 SYNTHETIC 5W-40	10.00	17.87	178.70	REPLACED HATCH STRUTS	50.00
HOOD STRUT 993 511 331 00	2.00	40.55	81.10	PERFORM 60,000 MILE SERVICE	800.00
BRAKE PAD SET 993 351 939 01	1.00	196.15	196.15	REPLACED BOTH KEY HEADS	20.00
BRAKE PAD SENSOR 964 612 363 01	2.00	18.25	36.50	REPLACED LIC. PLATE LIGHT	0.00
AUX. FAN RESISTOR 993 616 521 01	1.00	86.44	86.44	REPLACED LEFT SIDE SEAT SWITCH FRAME	50.00
LICENSE PLATE LIGHT 964 631 620 00 01C	1.00	28.06	28.06	REPLACED FENDER GASKETS	200.00
HATCH STRUT 911 512 331 01	2.00	25.38	50.76	REPLACED BOTH OUTSIDE DOOR HANDLES	300.00
SEAT SWITCH FRAME 928 521 561 03 01C	1.00	16.44	16.44	PERFORM A/C SERVICE	150.00
FENDER GASKET 993 503 393 00	2.00	23.93	47.86	MOUNT AND BALANCE TIRES	100.00
DOOR HANDLE GASKET 993 537 621 00	2.00	16.43	32.86	PERFORM 4-WHEEL ALIGNMENT	150.00
DOOR HANDLE GASKET 993 537 631 00	2.00	7.70	15.40	Hazardous Materials	15.00
A/C RELAY 999 657 018 90	1.00	59.02	59.02		
KEY HEAD 993 538 041 01	2.00	32.51	65.02		
SPARK PLUG 999 170 183 90	12.00	8.37	100.44		
MICHELIN HTR 225 40 17	2.00	250.00	500.00		
MICHELIN HTR 265 35 17	2.00	250.00	500.00		

1997 Porsche - 911 Carrera - 3.6L, H6 (220CI)

Lic #: - TX

Odometer In : 64580

Odometer Out : 64585

VIN #: WP0DA2993 VS385464

Hat #: V-2323

Part Description / Number	Qty	Sale	Ext	Labor Description	Extended
FREON	2.00	16.07	32.14		
R-134					
Shop Supplies			20.00		

Org. Estimate 4,360.97 Revisions 0.00 Current Estimate 4,360.97

Labor:	2,030.00
Parts:	2,200.90
Sublet:	150.00
Sub:	4,380.90
Tax:	181.57
HazMat:	15.00
Total:	4,577.47
Bal Due:	\$4,577.47

[Payments -]
 I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. Customer is solely responsible to maintain insurance on the vehicle at the times that is at VMC for repair work, test drives, storage, sale or otherwise. VMC has no liability of any kind to the customer for damage to the vehicle while it is at VMC.

Signature _____ Date _____ Time _____

CUSTOMER #: 73286

133069



SAN DIEGO
9020 MIRAMAR RD.
SAN DIEGO, CA 92126
(858) 695-3000
(858) 695-0496 Fax
www.porscheofsandiego.com

INVOICE PORSCHE

SERVICE AND PARTS HOURS
MON - FRI: 7:00 A.M. - 6:00 P.M.
SAT: 8:00 A.M. - 5:00 P.M.

PAGE 1

BAR# ARD267631 EPA# CAL000369215
63796 RYAN BRESHEARS

SERVICE ADVISOR:

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 1997 Porsche 993 Targa.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes entry for TIRE INFLATION SERVICE.

Table with columns: PARTS, LABOR, OTHER, TOTAL LINE. Includes entry for CUSTOMER STATES MONITORS WILL NOT SET FOR SMOG.

EST: 330.00 19JAN17 10:44 SA: 63796

Thank You for servicing with Porsche of San Diego. We appreciate your business! www.PorscheofSanDiego.com

Form containing signature lines for customer and dealership representative, and a table for HAZARDOUS WASTE DISPOSAL COSTS with columns for DESCRIPTION and TOTALS.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

Smog Check Vehicle Inspection Report (VIR)

Vehicle Information

Test Date/Time: 01/19/2017 @ 12:24

Model Year: 1997	Make: PORSCHE	Model: 911 CARRERA 2
License: 7RPJ839	State: CA	VIN: WPODA2993VS385464
Engine Size: 3.6 L	Type: Passenger	Transmission: Manual
GVWR: N/A	Test Weight: 3375	Cylinders: 6
Odometer: 71635	Certification: California	VLT Record #: 27929
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: Change of Ownership

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Smog Check Certificate Number: ZN403485
DMV ID Number: **6612N844Z464**

Your Smog Check certificate has been electronically transmitted to DMV.
Your certificate is valid for 90 days from date of issuance.
Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	N/A	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	Pass	OBD System Checks
N/A	EGR Visual	Pass	Vacuum Lines to Sensors/	Pass	Carb./Fuel Injection
N/A	EGR Functional		Switches	Pass	Other Emission Related
N/A	Fuel Cap Functional	N/A	Ignition Timing:		Components
Pass	Fuel Cap Visual	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Pass	Spark Controls	N/A	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
N/A	Fuel Evaporative Controls Functional				

ASM Emission Test Results

Test	RPM	%CO ₂		HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1509	14.7	0.0	55	9	11	0.50	0.03	0.02	437	67	351	PASS
25 mph	2484	14.8	0.0	39	6	8	0.48	0.03	0.02	724	62	107	PASS

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

Smog Check Inspection Station Information


SMOG TEST ONLY
8242-A MIRAMAR ROAD SAN DIEGO, CA 92126-4311
858-695-9053
Station Number: TC114669

Technician Name/Number: TRAN, THIEN/EO122688
Repair Tech Name/Number:
Software Version/EIS Number: 1301/ES986816

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

1/19/17

Date

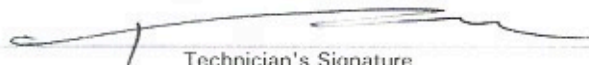

Technician's Signature

E-TECH COLLISION

2141 North Broadway
Walnut Creek, Ca 94596
925-934-1872 Fax: 925-934-7623

Repair Order

44499

Federal ID 71-0982792 EPA CAL000216805

WWW.E-TECHCOLLISION.COM On-Line Vehicle Status

BAR # ARD00243645

Estimator RON EWING

March 1, 2017 14:02:43

Customer	Vehicle	Insurance
First	Color Black	A CUSTOMER PAY
Last	Year 97	Address
Address	Make PORS	City
	Model 911 Carrera Targa 6-Speed	State
City	Prod Date 11/96	Zip
State	Style 2D CPE	Phone
Zip Code	License 7PRJ839	Claim 0
Home #	VIN WP0DA2993VS385464	Policy
Work #	Mileage In 72265.0	Loss Date / /
E-Mail #	Mileage Out 72265.0	Deductible

All Crash parts on this estimate are "new" original equipment manufacturer parts, unless otherwise specified. Parts described as rechromed, recorded, remanufactured or, reconditioned are considered rebuilt parts.

Crash parts described as quality replacement parts are non-original equipment manufacturer aftermarket new parts.

Line	Operation	Description	Qty	Price	Labor Amount
1	BODY	DOOR	1		
2	BODY REMOVE/INSTALL	RT R&I door assy	1		156.40
3	BODY REMOVE/INSTALL	RT R&I trim panel	1		92.00
4	BODY	PILLARS, ROCKER & FLOOR	1		
5	BODY REPAIR	RT Hinge pillar w/o turbo	1		414.00
5	PAINT REFINISH	RT Hinge pillar w/o turbo			92.00
6	PAINT REFINISH	Add for Clear Coat			18.40

OEM - ORIGINAL EQUIPMENT BY MANUFACTURE (NEW)

R & I - REMOVE AND INSTALL EXISTING PART

REFINISH - REPAINT ITEM LISTED COMPLETE

SPOT - TO REFINISH A PORTION OF AN ITEM

HAZARD WASTE - DISPOSAL OF WASTE PRODUCTS

LKQ - LIKE KIND IN QUALITY (USED / RECYCLED)

USED - LIKE KIND IN QUALITY (USED / RECYCLED)

A - AFTERMARKET PARTS (NON-OEM)

R & R - REMOVE AND REPLACE EXISTING PART

SECTION - TO INSTALL A PORTION OF THE SAID ITEM

M - INDICATES A MECHANICAL OPERATION PERFORMED

S - SUBLET ITEM (OPERATION NOT PERFORMED BY FACILITY)

OVERHAUL - DISMANTLE / USE ORIGINAL PART

Totals (Billing)		Repair Order	44499
Description	Amount		
Body	662.40	Taxable Sales Total (Included in sales total)	
Frame		Sales Tax	Sales Tax
Mechanical		8.25	4.46
Refinish	110.40	Tax Total 4.46	
Detail		Customer Net Total	
Glass		Billing Net Total 831.26	
Sublet		Gross Total 831.26	
Additional Sublet		Original Net Total 831.26	
Towing		Supplement Total	
Storage		TOTALS (Summary)	
Micellaneous		Customer Net Total	
Micellaneous Additional		Billing Net Total 831.26	
Parts			
Paint Materials	54.00		
Discounts			
Deductible			
Other Charges (Betterment)			
Appearance Allowance			
Related Prior Damage			
Bottom Line Adjustment			
Sales Total (Including taxable and non-taxable sales)	826.80		

I hereby authorize the repair of the above vehicle as described in the attached Estimate/Repair Order. I agree that this company is not responsible for loss or damage to this vehicle and/or loss of articles caused by fire, theft or any other cause beyond our control or for any delays caused by the unavailability of parts or shipping delays. I also hereby grant permission to this company's employees to operate the above vehicle for the purpose of testing and/or inspection. To secure payment in the amount of the repairs thereto, an expressed mechanic's lien on the above vehicle is acknowledged and I further agree to pay reasonable attorney's fee and court cost in the event legal action becomes necessary to enforce this contract. I acknowledge that the total estimate of repairs includes all parts, labor, handling, and diagnosis and agree that, if closer analysis reveals that additional repairs are necessary I will be contacted for authorization if additional repair costs are required. If NEW PARTS listed in the attached Estimate/Repair Order are NOT available, this company reserves the right to REPAIR such damaged or worn parts, where possible, the charge for which will be adjusted accordingly between the part price and the labor required.

Due to the complexity of the repair and the quality of the work required, we are unable to always guarantee a specific delivery time.

Old parts will be disposed of unless requested before work is begun. x _____ initial here. Signed: _____ Date: _____

Terms: The total amount of repair charges must be paid before the above vehicle can be released for delivery. If insurance coverage is to be applied against partial or total payment, I acknowledge that the insurance coverage is to be applied against obtained by myself or sent in advance by the insurance company prior to release of the repaired vehicle as described.

Acknowledgement of Notice and Consent

I acknowledge notice and verbal approval of an increase in the original estimated price. Signed: _____ Date: _____

I certify that repairs have been completed as indicated on the final repair estimate. Signed: _____ Date: _____

Pacific Power Motorsports Inc.

Service Invoice

2149 North Broadway
Walnut Creek: CA

Phone (925) 937-2277
Fax (925) 937-2277

PAID
03/03/2017

Account #	Date	Estimate #
	3/3/2017	2466

Make/ Model	Year / Color
PORSCHE / 993 TARGA	1997 / BLACK

Vin / License Plate
WP0DA2993VS385464 / 7PRJ839

Mileage / Date of Manuf
72,270 / 11/96

Name / Address

Item	Description	Qty	U/M	Cost	Total
Labor, A Shop	Replace Worn Clutch Disc, Pressure Plate, Pilot Bearing And Release Bearing With New Components. Replace Engine Crankshaft Rear Main Bearing Seal.	14		150.00	2,100.00
Clutch,Kit,993,C2	Porsche 993 Clutch Kit, Includes Pressure Plate, Disc And Release Bearing, New.	1		924.22	924.22T
Clutch, Bearing,...	Porsche 993 With G50 Transaxle Pilot Bearing, New.	1		76.08	76.08T
Clutch, Cap, Re...	Release Bearing Shaft Cap, New.	1		1.84	1.84T
Clutch, Bolt, Fl...	Porsche 993 Flywheel Bolt, New.	9		4.42	39.78T
Clutch,Bolt,Pre...	Porsche 993 Pressure Plate Bolt, New.	9		4.72	42.48T
Clutch,Operatin...	Porsche G50 Transaxle Operating Shaft Retainer, New.	1		1.76	1.76T
Engine,Scal,R...	Porsche 993 Rear Crankshaft Main Seal, New.	1		45.71	45.71T
Labor, A Shop	Replace Rear Spoiler Transmission With New Original Porsche Transmission. Test Function.	1		150.00	150.00
Body,SpoilerTr...	Porsche 993 Rear Spoiler Transmission, New.	1		426.04	426.04T
Labor, A Shop	Check Suspension, Estimate To Lower Suspension Ride Height	0.5		0.00	0.00
	Estimate To Lower Suspension Ride Height, Corner Balance And Align Is \$1075.00				

Bureau Of Automotive Repair License # 00239756	Sales Tax (8.25%)	\$128.53
	Total	\$3,936.44

	Payments/Credits	\$0.00
--	-------------------------	--------

Customer Signature	Balance Due	-\$3,936.44
---------------------------	--------------------	--------------------

I hereby authorize the work outlined above to be complete inclusive of all necessary parts and/or materials. Further, I acknowledge that an express mechanics lien is in force to secure the amount of the fore mentioned repairs. I hereby grant Pacific Power Motorsports and its employees permission to operate the vehicle for the purposes of testing, inspecting and/or delivery.

Most parts are warranted by their manufacturer, usually for 90 days from the date of purchase, unless otherwise specified. Used or customer supplied parts carry NO WARRANTY EXPRESS OR IMPLIED. Pacific Power Motorsports warranties their work for 3 months or 3000 miles. Parts and labor used for track or competition purposes are warranted against manufacturer's defects only. We do NOT recommend illegal modifications for street legal automobiles. PACIFIC POWER MOTORSPORTS' LIABILITY FOR LOSSES OR DAMAGES, ARISING OUT OF ANY CAUSE WHATSOEVER, IS LIMITED TO FULL REFUND OF THE PURCHASE PRICE OR AT OUR OPTION, REPAIR OR REPLACEMENT OF THE PART(S). PACIFIC POWER MOTORSPORTS SHALL NOT BE LIABLE FOR ANY CONSEQUENTIAL OR INCIDENTAL DAMAGES.

www.pacificpowermotorsports.com

Pacific Power Motorsports Inc.

Service Invoice

2149 North Broadway
Walnut Creek: CA

Phone (925) 937-2277

Fax (925) 937-2277

Account #	Date	Estimate #
	3/27/2017	2503

Make/ Model	Year / Color
PORSCHE / 993 TARGA	1997 / BLACK

Vin / License Plate
WP0DA2993VS385464 / 7PRJ839

Mileage / Date of Manuf
72,346 / 11/96

Name / Address

PAID
04/07/2017

Item	Description	Qty	U/M	Cost	Total
Labor, Alignment	Hunter Four Wheel Thrust Angle Alignment. See Attached Sheet For Alignment Specifications	4.25		150.00	637.50
Labor, Corner B...	Corner balance suspension and set ride height	2.91666		150.00	437.50
Labor, A Shop	Replace Belts And Warning Roller If Needed.	1.75		150.00	262.50
Belt, Alt, 3.6L L...	Alternator Belt, 3.6L	1		13.76	13.76T
Belt, Alt, 3.6L ...	Alternator Belt, 3.6L, Outer	1		14.38	14.38T
Belt, A/C, 993	A/C Compressor Belt, 993	1		17.47	17.47T
Labor, A Shop	Replace Battery As Needed. NOTES: Charged Battery, Load Tests Good, No Need To Replace At This Time.	0		150.00	0.00
Labor, A Shop	Complete Visual maintenance Inspection	1.25		0.00	0.00
Labor, A Shop	Replace Failing Alternator With BOSCH Remanufactured Alternator. Nose Bearing Is Worn. Replace Belt Tension Sensor With New Switch.	3.25		150.00	487.50
Charging,Alt,02...	BOSCH Remanufactured Alternator Assembly Without Pulley.	1		388.94	388.94T
Sensor, Alt. Bel...	Porsche Alternator Belt Tension Sensor, New	1		130.09	130.09T

Bureau Of Automotive Repair License # 00239756	Sales Tax (8.25%)	\$46.58
	Total	\$2,436.22
	Payments/Credits	\$0.00
Customer Signature	Balance Due	-\$2,436.22

I hereby authorize the work outlined above to be complete inclusive of all necessary parts and/or materials. Further, I acknowledge that an express mechanics lien is in force to secure the amount of the fore mentioned repairs. I hereby grant Pacific Power Motorsports and its employees permission to operate the vehicle for the purposes of testing, inspecting and/or delivery.

Most parts are warranted by their manufacturer, usually for 90 days from the date of purchase, unless otherwise specified. Used or customer supplied parts carry NO WARRANTY EXPRESS OR IMPLIED. Pacific Power Motorsports warranties their work for 3 months or 3000 miles. Parts and labor used for track or competition purposes are warranted against manufacturer's defects only. We do NOT recommend illegal modifications for street legal automobiles. PACIFIC POWER MOTORSPORTS' LIABILITY FOR LOSSES OR DAMAGES, ARISING OUT OF ANY CAUSE WHATSOEVER, IS LIMITED TO FULL REFUND OF THE PURCHASE PRICE OR AT OUR OPTION, REPAIR OR REPLACEMENT OF THE PART(S). PACIFIC POWER MOTORSPORTS SHALL NOT BE LIABLE FOR ANY CONSEQUENTIAL OR INCIDENTAL DAMAGES.

www.pacificpowermotorsports.com



153584

CUSTOMER #: 30311

PORSCHE

INVOICE

Porsche Walnut Creek
2555 North Main Street
Walnut Creek, CA 94597

(925) 280-4900
Fax: (925) 280-4912
www.steadporsche.com

PAGE 1

SERVICE ADVISOR: 881 BRIDGET PATTEN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
BLACK	97	PORSCHE 911	WP0DA2993VS385464		72500/72501	T943	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
22JAN97 DD			WAIT 12MAY17		0.00	CASH	12MAY17
R.O. OPENED		READY		OPTIONS: ENG:64V03436 TRN:2005865			
08:12 12MAY17		09:01 12MAY17					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CUSTOMER STATES HAS THREE REMOTES THAT NEED TO BE PROGRAMED ADVISED GUEST MIGHT NOT PROGRMA NOT KNOWING WHERE REMOTES CAME FROM. CLIENT RECEIVED REMOTES WHEN VEHICLE WAS PURCHASED. IF NEW BATTERIES ARE NEEDED, OK TO INSTALL
 TK CLIENT STATES PROGRAM KEY REMOTE TO VEHICLE
 294 IAP (N/C)
 ,,,72500 PRGRAM KEYS.
 ,,,ONE REMOTE IS DEFECTIVE THAT IS IN THE BAG. TRY TO TEACH OTHER REMOTE'S -SOMETHING IS WRONG WITH IGNITION SWITCH. IT DOES NOT HAVE A MICRO SWITCH ACTIVE TO COUNT TEACHING CYCLES. CANNOT TEACH AT THIS TIME.
 ,,,WILL NEED TO PROPERLY DIAGNOSE VEHICLE CONCERN. IF NEW IGNITION SWITCH IS NEEDED, VEHICLE DASH HAS TO BE REMOVED. ESTIMATE FOR REPLACING IGNITION SWITCH IS \$2250.00
 ,,,PROVIDED THE VEHICLE DOES NOT NEED ADDITIONAL REPAIRS ONCE THE DASH HAS BEEN REMOVED. THE ESTIMATE IS PRELIMINARY FOR REMOVAL AND REPLACEMENT OF IGNITION SWITCH ONLY.

B CHECK AND SET TIRE PRESSURES, TORQUE WHEELS AND MEASURE TIRES
 TP CHECK AND SET TIRE PRESSURES, TORQUE WHEELS AND MEASURE TIRES
 294 CP 0.00 0.00
 ,,,72500 TIRE PRESSURE CHECK SET T/P 36/44.

EST: 187.00 12MAY17 08:12 SA: 881

BAR# AK196618 EPA# 000102813

Original Estimate \$ <input type="text"/> Please read the important information on the reverse side invoice! <input type="checkbox"/> I acknowledge receipt of this invoice. <input type="checkbox"/> I acknowledge the warranty repairs performed. <input type="checkbox"/> I acknowledge notice and oral approval of additional warranty repairs discovered and corrected during this repair visit. Signature X _____ I acknowledge notice and oral approval of an increase in the original estimate price. Initials X _____	PORSCHE WALNUT CREEK 2555 NORTH MAIN STREET WALNUT CREEK, CA 94597 (925) 280-4900 BAR# ARD-196618 EPA# CAL000302147	DESCRIPTION	TOTALS
		LABOR AMOUNT	0.00
		PARTS AMOUNT	0.00
		GAS, OIL, LUBE	0.00
		SUBLET AMOUNT	0.00
		MISC. CHARGES	0.00
		TOTAL CHARGES	0.00
		LESS INS/ADJ.	0.00
		SALES TAX	0.00
		PLEASE PAY THIS AMOUNT	0.00

Pacific Power Motorsports Inc.

Service Invoice

2149 North Broadway
Walnut Creek, CA

Phone (925) 937-2277

Fax (925) 937-2277

Account #	Date	Estimate #
	8/18/2017	2749

Make/ Model	Year / Color
PORSCHE / 993 TARGA	1997 / BLACK

Vin / License Plate
WP0DA2993VS385464 / 7PRJ839

Mileage / Date of Manuf
72,846 / 11/96

Name / Address

PAID
08/18/2017

Item	Description	Qty	U/M	Cost	Total
Labor, A Shop	Vehicle Towed In With Clutch Pedal On Floor, Suspect Hydraulic System Failure.	0		160.00	0.00
Labor, A Shop	Replace Failing Clutch Master Cylinder With New OEM Master Cylinder.	2.25		160.00	360.00
Clutch,Master ...	Porsche 993 Clutch Master Cylinder Assembly, New.	1		187.31	187.31T
Labor, A Shop	Replace Clutch Slave Cylinder With New OEM Slave Cylinder.	2.1		160.00	336.00
Clutch,SlaveCyl...	Porsche 993 Clutch Slave Cylinder Assembly, New.	1		218.28	218.28T
Labor, A Shop	Bleed Clutch Hydraulic System, Test Drive To Confirm Proper Operation.	0.75		160.00	120.00
Fluid,Hydraulic,...	CHF 202 Hydraulic System Fluid, Liter.	0.8		28.07	22.46T

Bureau Of Automotive Repair License # 00239756	Sales Tax (8.25%)	\$35.31
	Total	\$1,279.36

	Payments/Credits	\$0.00
--	-------------------------	--------

Customer Signature	Balance Due	-\$1,279.36
---------------------------	--------------------	--------------------

I hereby authorize the work outlined above to be complete inclusive of all necessary parts and/or materials. Further, I acknowledge that an express mechanics lien is in force to secure the amount of the fore mentioned repairs. I hereby grant Pacific Power Motorsports and its employees permission to operate the vehicle for the purposes of testing, inspecting and/or delivery.

Most parts are warranted by their manufacturer, usually for 90 days from the date of purchase, unless otherwise specified. Used or customer supplied parts carry NO WARRANTY EXPRESS OR IMPLIED. Pacific Power Motorsports warranties their work for 3 months or 3000 miles. Parts and labor used for track or competition purposes are warranted against manufacturer's defects only. We do NOT recommend illegal modifications for street legal automobiles. PACIFIC POWER MOTORSPORTS' LIABILITY FOR LOSSES OR DAMAGES, ARISING OUT OF ANY CAUSE WHATSOEVER, IS LIMITED TO FULL REFUND OF THE PURCHASE PRICE OR AT OUR OPTION, REPAIR OR REPLACEMENT OF THE PART(S). PACIFIC POWER MOTORSPORTS SHALL NOT BE LIABLE FOR ANY CONSEQUENTIAL OR INCIDENTAL DAMAGES.

www.pacificpowermotorsports.com

Short Test



Siemens Digital Motor Electronics SDI3

No Faults Found



Porsche Stability Management - PSM




Current Fault Codes

-  **C140:**
Communication instrument cluster (display)
-  **4444:**
Steering-angle sensor not initialized



All Wheel Drive - PTM

Current Fault Codes





-  **C140:**
Communication instrument cluster (display)
-  **C152:**
Communication PSM control unit (drive)
-  **C202:**
Fault PSM control unit (display)



Porsche Active Suspension Management - PASM

Tire Pressure Monitor - TPM

Current Fault Codes

-  **8001:**
Power supply:
-  **8030:**
Tyre pressure warning
-  **C131:**
Communication gateway control unit (CAN comfort)
-  **C140:**
Communication instrument cluster (display)






Instrument cluster - 9x7

No Faults Found




Vehicle Electrical System


Current Fault Codes







-  **8060:**
Communication with garage door opener
-  **8001:**
Power supply
-  **C131:**
Communication gateway control unit (CAN comfort)




 **C140:**
Communication instrument cluster (display)




Airbag - POSIP

Current Fault Codes 

-  **80F9:**
Unkown fault code, please tell us about this missing information by clicking [here](#)
-  **8016:**
Passenger Airbag OFF light open circuit/short circuit to ground
-  **C140:**
Communication instrument cluster (display)
-  **C158:**
Communication gateway control unit (CAN drive)
-  **8057:**
AWS control unit read out fault memory
-  **8012:**
Voltage supply below lower limit

Advanced Weight System - AWS

Current Fault Codes 


-  **C131:**
Communication gateway control unit (CAN comfort)
-  **C128:**
Communication PAS (comfort) control unit
-  **C140:**
Communication instrument cluster (display)

Steering Column Electronics

Current Fault Codes 

-  **8001:**
Power supply

Air Conditioning

Current Fault Codes 


Cornering Lights


Gateway

No Faults Found 

Porsche Access System - PAS




Current Fault Codes 

-  **8001:**
Power supply
- 8057:**


 Electronic steering column lock undefined status




Front Body Module

Current Fault Codes 


-  **C131:**
Communication gateway control unit (CAN comfort)
-  **C140:**
Communication instrument cluster (display)
-  **8001:**
Power supply

Rear Body Module

Current Fault Codes 

-  **C131:**
Communication gateway control unit (CAN comfort)
-  **C140:**
Communication instrument cluster (display)
-  **8001:**
Terminal 30 voltage supply undervoltage

Left Door Module


No Faults Found 

Right Door Module

No Faults Found 

Convertible Top

Current Fault Codes 



-  **8040:**
Rear left window lifter

Targa Roof

Park Assist

Seat Memory

Current Fault Codes 

-  **C102:**
CAN single-wire operation "comfort"
-  **8001:**
Power supply:

Sports Chronometer

No Faults Found



Short Test

Siemens Digital Motor Electronics SDI3

No Faults Found



Porsche Stability Management - PSM

No Faults Found



All Wheel Drive - PTM

No Faults Found



Porsche Active Suspension Management - PASM

Tire Pressure Monitor - TPM

No Faults Found



Instrument cluster - 9x7

No Faults Found



Vehicle Electrical System

No Faults Found



Airbag - POSIP

No Faults Found



Advanced Weight System - AWS

Current Fault Codes



Steering Column Electronics

Current Fault Codes



Air Conditioning

Current Fault Codes



Cornering Lights

No Faults Found



Gateway

No Faults Found



Porsche Access System - PAS

No Faults Found



Front Body Module

No Faults Found



Rear Body Module

No Faults Found



Left Door Module

No Faults Found



Right Door Module

No Faults Found



Convertible Top

No Faults Found



Targa Roof

Park Assist

Seat Memory

No Faults Found



Sports Chronometer

No Faults Found





Short Test

Siemens Digital Motor Electronics SDI3

No Faults Found



Porsche Stability Management - PSM

No Faults Found



All Wheel Drive - PTM

No Faults Found



Porsche Active Suspension Management - PASM

Tire Pressure Monitor - TPM

No Faults Found



Instrument cluster - 9x7

No Faults Found



Vehicle Electrical System

No Faults Found



Airbag - POSIP

No Faults Found



Advanced Weight System - AWS

No Faults Found



Steering Column Electronics

No Faults Found



Air Conditioning

Current Fault Codes



Cornering Lights

Gateway



No Faults Found

Porsche Access System - PAS



No Faults Found

Front Body Module



No Faults Found

Rear Body Module



No Faults Found

Left Door Module



No Faults Found

Right Door Module



No Faults Found

Convertible Top



No Faults Found

Targa Roof

Park Assist

Seat Memory

No Faults Found



Sports Chronometer

No Faults Found



CUSTOMER #: VS385464

58950



NIELLO
PORSCHE



INVOICE

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
www.niello.com

PAGE 1

EPA # CAR000162230 BAR # ARD239743

SERVICE ADVISOR: 2319 MIKE VAN ALLEN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
BLACK	97	PORSCHE 911	WP0DA2993VS385464	G046FO	73505/73505	T163R	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
22JAN97 DD		23JAN1999	WAIT 27FEB18		0.00	CASH	27FEB18

R.O. OPENED	READY	OPTIONS:	DLR:0132 ENG:3.6_Liter_Gas
13:23 27FEB18	14:37 27FEB18		

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A C/S: KEY PROGRAMMING, CUSTOMER REQUESTS FOR US TO PROGRAM 2
 ADDITIONAL KEYS - 3 KEYS TOTAL
 KEY PROGRAM KEY REMOTE (REMOTES)
 683 CP 180.00 180.00
 2 993-618-259-02 ALARM HAND REMOTE 262.03 262.03 524.06
 73505 1.00 Code new remotes for vehicle and verify operation.
 Vehicle currently has 1 key and 3 remotes.

B PORSCHE MULTI-POINT INSPECTION. NO CHARGE TO THE CUSTOMER.
 COMPLIMENTS OF NIELLO PORSCHE. (VALUE OF \$80.00)
 VI DEFAULT
 683 CP 0.00 0.00

73505 Complete Niello Porsche Multi-point inspection. Front tires 6.8 mm 6.8 mm Rear tires 6.8 mm 6.7 mm Front brakes: 7.0 mm Rear brakes: 7.5 mm Found the following concerns during inspection: No service history on file. Left rear wheel harness is rubbing on left rear axle and wiring is beginning to wear through insulation. Oil leaks from engine and transmission. Front and rear suspension has worn rubber bushings and torn rubber boots. Steering rack bellows are split. Rear spoiler wall is beginning to tear.

C TIRE PRESSURE MEASUREMENTS & TREAD DEPTH INSPECTION.
 TPI TIRE PRESSURE MEASUREMENTS & TREAD DEPTH INSPECTION.
 683 IP (N/C)
 73505 Front tires: 6.8 mm 6.8 mm Rear tires: 6.8 mm 6.7 mm Tire pressures before: Front 32 psi 32 psi Rear 38 psi 38 psi Set tire pressures to 36 psi front and 44 psi rear.

D NO WASH PER CUSTOMER REQUEST
 NW NO WASH PER CUSTOMER REQUEST
 683 IP (N/C)

CUSTOMER COPY

ALL LABOR, ACCESSORIES, AND PARTS INSTALLED BY OUR SERVICE DEPARTMENT ARE WARRANTED AS FOLLOWS: PORSCHE FOR 12 MONTHS. THIS WARRANTY IS IN LIEU OF ANY OTHER EXPRESS OR IMPLIED WARRANTY. WARRANTY VALID ONLY IF VEHICLE IS RETURNED TO OUR SERVICE DEPT. FOR ADJUSTMENTS. AFTER MARKET PARTS ARE ONLY COVERED FOR 90 DAYS.

AUTHORIZED BY: X _____ PRELIMINARY ESTIMATE \$ _____			
REVISED ESTIMATE (1)	DATE	TIME	BY
REVISED ESTIMATE (2)			
REVISED ESTIMATE (3)			

To Our Service Customers
 Our charges for labor are not based on actual mechanics time, but are established by multiplying our retail labor rate by industry time allowances or our own judgment of the time to be charged. You will be charged no more than the estimated price approved by you. However, if we discover that different or additional repairs are indicated, you will be contacted for your advance approval of a revised estimate.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	

I HEREBY ACKNOWLEDGE THAT I WAS NOTIFIED & GAVE ORAL APPROVAL OF THE ABOVE REVISED ESTIMATES:
 x _____
 Customer Signature

**NOTICE TO CONSUMER:
 PLEASE READ IMPORTANT
 INFORMATION ON BACK**

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing or cleaning your vehicle: 1) work in a well ventilated area; 2) do not eat, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components.

Printed in accordance with Proposition 65 in Cal. Health & Safety Code 25249.5 et seq. For further information about Proposition 65, visit <http://www.p65.ca.gov>

CUSTOMER COPY

CUSTOMER #: VS385464

58950



NIELLO
PORSCHE



INVOICE

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
www.niello.com

PAGE 2

EPA # CAR000162230 BAR # ARD239743

SERVICE ADVISOR: 2319 MIKE VAN ALLEN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
BLACK	97	PORSCHE 911	WP0DA2993VS385464	GO46FO	73505/73505	T163R

DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
22JAN97	DD	23JAN1999	WAIT 27FEB18		0.00	CASH	27FEB18

R.O. OPENED	READY	OPTIONS:
13:23 27FEB18	14:37 27FEB18	DLR:0132 ENG:3.6_Liter_Gas

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
EST:	180.00			27FEB18 13:23	SA: 2319		

WAIT CREATED 2018-02-10
08:46:00AM TAKEN BY

CUSTOMER COPY

ALL LABOR, ACCESSORIES, AND PARTS INSTALLED BY OUR SERVICE DEPARTMENT ARE WARRANTED AS FOLLOWS: PORSCHE FOR 12 MONTHS. THIS WARRANTY IS IN LIEU OF ANY OTHER EXPRESS OR IMPLIED WARRANTY. WARRANTY VALID ONLY IF VEHICLE IS RETURNED TO OUR SERVICE DEPT. FOR ADJUSTMENTS. AFTER MARKET PARTS ARE ONLY COVERED FOR 90 DAYS.

AUTHORIZED BY: X				PRELIMINARY ESTIMATE # _____			
REVISED ESTIMATE (1)	DATE	TIME	BY	REVISED ESTIMATE (2)	DATE	TIME	BY

To Our Service Customers

Our charges for labor are not based on actual mechanics time, but are established by multiplying our retail labor rate by industry time allowances or our own judgment of the time to be charged. You will be charged no more than the estimated price approved by you. However, if we discover that different or additional repairs are indicated, you will be contacted for your advance approval of a revised estimate.

**NOTICE TO CONSUMER:
PLEASE READ IMPORTANT
INFORMATION ON BACK**

DESCRIPTION	TOTALS
LABOR AMOUNT	180.00
PARTS AMOUNT	524.06
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	0.00
TOTAL CHARGES	704.06
LESS INSURANCE	0.00
SALES TAX	37.99
PLEASE PAY THIS AMOUNT	742.05

I HEREBY ACKNOWLEDGE THAT I WAS NOTIFIED & GAVE ORAL APPROVAL OF THE ABOVE REVISED ESTIMATES:

Customer Signature _____
By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary.

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will retain used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components.
(Printed in accordance with Proposition 65 in Cal. Health & Safety Code 42629.5 et seq.) For further information about Proposition 65: <http://www.oetbe.org/prop65.html>



Microfinish LLC
208 Plauche Ct
New Orleans, LA 70123
(888) 710-5192

Order ID: 10172287
Order Date: 6/10/2018
Order Time: 2:00:49 PM



Bill To:

Ship To:

Quantity	Item	Description	Price	Item Total	Sub Total
1	2BTL-BC	2 oz Touchup Bottle, 1997 Porsche All Models: Black 741	\$14.95	\$14.95	\$14.95
1	MDAB	Micro Dabbers (Pack of four)	\$0.95	\$0.95	\$0.95
				Shipping Cost: \$10.93	
				Total Taxes: \$0.00	
				Grand Total: \$26.83	

Return Policy: All custom mixed paints are non-returnable. There is a 60 day limitation from the date of order to remix paint or to return non-made to order products (25% restock fee less shipping and handling apply). Please call before sending anything back for individual case instructions and/or a Return Authorization number. If you are unhappy with your color match, send us the test card with the back of card completed. Any remixes are shipped to you free of charge. For additional information, please click on the E-Store Policies link from the home page.



Invoice

Date: 01/15/2019
Job #: 598
EPA #: CAL000429229

Pacific Power Motorsports
 1413 Carback Avenue
 Walnut Creek, CA 94596

Phone 9259372277
Email eleman@pacificpowermotorsports.com
Web www.pacificpowermotorsports.com
F.E.I.N. 26-2206454

License Plate G046F0
Make/Model 1997 Porsche 993 Targa
Odometer 73909
Color Black
VIN WP0DA2993VS385464
Prod. Date 11/1996

Item	Description	Quantity	Unit Price	Sales	Total
LABOR					
LABOR, 1 SHOP	Repair Left Rear Anti-Lock Brake System Sensor Harness	0.75	\$160.00	\$0.00	\$120.00
LABOR, 1 SHOP	Replace Front And Rear Wiper Blades With New Blades.				
LABOR, 1 SHOP	Replace Steering Rack/Gear Bellows With New Units.	0.50	\$160.00	\$0.00	\$80.00
LABOR, 1 SHOP	Remove Left And Right Side Front Lower Control Arms And Replace Forward Bushings With New Bushings. Reinstall Control Arms And Perform Alignment.	3.25	\$160.00	\$0.00	\$520.00
LABOR, ALIGNMENT	Hunter Four Wheel Thrust Angle Alignment. See Attached Sheet For Alignment Specifications	2.25	\$160.00	\$0.00	\$360.00
				Labor Total	\$1080.00
PARTS					
ACCESSORIES, WIPER	Porsche 993 Front Wiper Blade Set, New	1.00	\$31.56	\$2.60	\$34.16
ACCESSORIES, WIPER	Porsche 993 Rear Wiper Blade, New	1.00	\$11.06	\$0.91	\$11.97
STEERING, BOOT	Porsche Steering Rack Boot, New	2.00	\$9.25	\$1.53	\$20.03
SUSPENSION,	Porsche 993 Front Lower Control Arm Forward Bushing Set, New.	1.00	\$172.44	\$14.23	\$186.67
				Parts Total	\$252.83
				Subtotal	\$1313.56
				Sales Tax	\$19.27
				Total	\$1332.83
Payment Terms:				Balance Due	\$1332.83



STAR Certified

SMOG N DASH

2040 N. Main St., #26 • Walnut Creek, CA 94596

Phone (925) 279-1170

BAR No. ARD 268878

37437

SMOG TEST-ONLY INVOICE

		TODAY'S DATE 2/9/19	YEAR 1997	MAKE DORS	MODEL 911
		ODOMETER 73950	LIC. PLATE # 6046FO	MOTOR #	
		WRITTEN BY wgmiller	CUSTOMER P.O. #	G.V.W.R.	
METHOD OF PAYMENT: <input type="checkbox"/> CASH <input type="checkbox"/> CHECK <input checked="" type="checkbox"/> CREDIT CARD		ORIGINAL ESTIMATE \$ 90.00		TEST TYPE: <input type="checkbox"/> BIENNIAL <input type="checkbox"/> CHANGE OF OWNERSHIP <input type="checkbox"/> 2% <input type="checkbox"/> HEP <input type="checkbox"/> INITIAL	
<input type="checkbox"/> CHARGE <input type="checkbox"/> DEBIT CARD		TRANSMISSION: <input type="checkbox"/> AUTO <input type="checkbox"/> STD		ENGINE _____ # OF CYLINDERS _____	
SMOG TEST CHECK OFF		V. I. N. W P O D A 2 9 9 3 V S 3 8 5 4 6 4		EM. LIGHT _____	
P-Pass M-Modified F-Defective D-Disconnected S-Missing N-N/A		OPR.		DESCRIPTION OF WORK	
PCV		C/I		SMOG TEST	51.75
TAC		AP/P		PRETEST <input type="checkbox"/> YES <input type="checkbox"/> NO	
EVP		OXY		CERTIFICATE #	8 25
CAT		WRG		RETEST	
EGR		VAC		GAS CAP	
SPK		OTH		LOW PRESSURE FUEL EVAP TEST (LPFET)	
SMOKE INSPECTION: PCV TAILPIPE				STAR CARS	10.00
TIRE PRESSURE INSPECTION				DYNO FEE	20.00
<input type="checkbox"/> Performed LF: RF: LR: RR: (psi)				EXOTIC & HIGH LINE VEHICLES	
<input type="checkbox"/> Inspection Declined, Reason: Initials: HB				TEST RESULTS: <input type="checkbox"/> PASS <input type="checkbox"/> FAIL <input type="checkbox"/> ABORT <input type="checkbox"/>	
THIS SMOG TEST-ONLY STATION CANNOT PERFORM ANY DIAGNOSTICS, ADJUSTMENTS OR REPAIRS					
I hereby authorize the above smog test to be performed. Smog test fee is due whether above vehicle passes or fails the smog test. You and your employees may operate above vehicle for purposes of testing, inspection and delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of this invoice. You will not be held responsible for loss or damage to vehicle due to fire, theft, accident, dynamometer testing or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read and understand the above and acknowledge receipt of an estimate.					
X		DATE: 2/9/19		TOTAL WORK	81.75
REVISED		PHONE • FAX • EMAIL		CERTIFICATE	8.25
ESTIMATE \$		<input type="checkbox"/> PHONE <input type="checkbox"/> EMAIL		SUB TOTAL	90.00
REASON		<input type="checkbox"/> IN PERSON <input type="checkbox"/> FAX		SALES TAX	
		ADDITIONAL COST \$		GRAND TOTAL	90.00
				I acknowledge notice and oral approval of an increase in the original estimated price.	
				X	



www.esp-global.com

Smog Check Vehicle Inspection Report (VIR)



www.autorepair.ca.gov

Vehicle Information

Test Date/Time: 02/09/2019@11:08

Model Year: 1997
 License: G046F0
 Engine Size: 3.60 L
 GVWR: N/A
 Odometer: 73,950
 Fuel Type: Gasoline

Make: PORSCHE
 State: CA
 Type: Passenger Car
 Test Weight: 3375
 Certification: California
 Exhaust: Single

Model: 911 CARRERA 2
 VIN: WP0DA2993VS385464
 Transmission: Manual
 Cylinders: 6
 VLT Record #: 27929
 Inspection Reason: High Emitter Profile

Overall Test Results

Congratulations! Your vehicle pass daily goal of removing an extra 100 your vehicle well maintained.

the enhanced Smog Check inspection, which helps California reach its is of smog-forming emissions from the air. Thank you for keeping

Smog Check Certificate Number: IZ577528
DMV ID Number: 6922Z642H32

Your Smog Check certificate has been electronically transmitted to DMV. Your certificate is valid for 90 days from date of issuance. Please keep this copy for your records.

IZ577528

ically transmitted to DMV. issuance.

Emission

(Visual/Functional tests at

Result	ECS
Pass	PCV
Pass	Catalytic Converter
Not applicable	EGR Visual
Not applicable	EGR Functional
Not applicable	Fuel Cap Functional
Not applicable	Fuel Cap Visual
Pass	Spark Controls

Control Systems Visual Inspection/Functional Check Results

ed to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test.)

Result	ECS	Result	ECS
Not applicable	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Air Injection	Pass	OBD System Checks
Pass	Vacuum Lines to Sensors / Switches	Pass	Carb. / Fuel Injection
Not applicable	Ignition Timing	Pass	Other Emission Related Components
Pass	Wiring to Sensors	Pass	Oxygen Sensor
Not applicable	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Not applicable	Fuel Evaporative Controls Functional		

ASM Emission Test Results

Test	RPM	%CO2		%O
		MEAS	MEAS	
15 mph	1458	15.3	0.1	
25 mph	1704	15.3	0.0	

HC (PPM)			CO (%)			NO (PPM)			Results
MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
55	9	19	0.50	0.03	0.02	437	67	327	Pass
39	6	16	0.48	0.03	0.02	724	62	104	Pass

MAX = Maximum Allowable Emission

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

SMOG 'N DASH
 2040 N Main St Walnut Creek, CA 94596
 928-279-1170
 Station Number: TC268878

Smog Check Inspection Station Information

Technician Name/Number: HILL, LLOYD/EO631531
 Repair Tech Name/Number:
 Software Version/EIS Number: 1885 / EP728622

I certify, under penalty of perjury, under the laws of the State of California, that the information listed on this vehicle inspection report is true and accurate.

vs of the State of California, that I performed the inspection in accordance with all Bureau requirements, and that the information and accurate.

Date: 2/9/19

Technician's Signature



Invoice

Date: 02/15/2019
Invoice #: 618
BAR #: 00239756
EPA #: CAL000429229

Pacific Power Motorsports
 1413 Carlbak Avenue
 Walnut Creek, CA 94596

Phone 9259372277
Email eleman@pacificpowermotorsports.com
Web www.pacificpowermotorsports.com
F.E.I.N. 26-2206454

License Plate G046F0
Make/Model 1997 Porsche 993 Targa
Odometer 73973
Color Black
VIN WPODA2993VS385464
Next Srvc 08/15/2019
Prod. Date 11/1996

Item	Description	Quantity	Unit Price	Tax	Total
LABOR					
LABOR, ALIGNMENT	Hunter Four Wheel Thrust Angle Alignment. See Attached Sheet For Alignment Specifications	2.75	\$0.00	\$0.00	\$0.00
LABOR, 1 SHOP	Check Drive Belts, Squealing At Times.	1.20	\$0.00	\$0.00	\$0.00
LABOR, 1 SHOP	Test Drive Spiritedly, Clutch Smell?? Check And Advise.	0.60	\$0.00	\$0.00	\$0.00
				Labor Total	\$0.00
				Subtotal	\$0.00
				Sales Tax	\$0.00
				Total	\$0.00
Payment Terms:				Balance Due	\$0.00

Invoice Notes

NOTES:

- a. Performed Alignment And Corrected Toe Setting At Left Rear.
- b. Removed One Shim From Alternator Drive Pulley To Tighten Belt Tension.
- c. Could Not Verify Smell...

Bureau Of Automotive Repair License # 00239756

Most parts are warranted by their manufacturer, usually for 90 days from the date of purchase, unless otherwise specified. Used or customer supplied parts carry NO WARRANTY EXPRESS OR IMPLIED. Pacific Power Motorsports warranties their work for 3 months or 3000 miles. Parts and labor used for track or competition purposes are warranted against manufacturer's defects only. We do NOT recommend illegal modifications for street legal automobiles.

PACIFIC POWER MOTORSPORTS' LIABILITY FOR LOSSES OR DAMAGES, ARISING OUT OF ANY CAUSE WHATSOEVER, IS LIMITED TO FULL REFUND OF THE PURCHASE PRICE OR AT OUR OPTION, REPAIR OR



Invoice

Date: 06/05/2019
Job #: 862
Order #:
BAR #: 00239756
EPA #: CAL000429229

Pacific Power Motorsports
 1413 Carback Avenue
 Walnut Creek, CA 94596

Phone 9259372277
Email eleman@pacificpowermotorsports.com
Web www.pacificpowermotorsports.com
F.E.I.N. 26-2206454

License Plate G046F0
Make/Model 1997 Porsche 993 Targa
Odometer 74144
Color / Couler Black
VIN WP0DA2993VS385464
Next Srvc 08/15/2019
Prod. Date 11/1996

Item	Description	Quantity	Unit Price	Tax	Total
LABOR					
LABOR, 1 SHOP	Engine Oil Was Overfilled, Check And Correct Level.	1.00	\$160.00	\$0.00	\$160.00
				Labor Total	\$160.00
				Subtotal	\$160.00
				Sales Tax	\$0.00
				Total	\$160.00
Payment Terms:				Balance Due	\$160.00

Bureau Of Automotive Repair License # 00239756

Most parts are warranted by their manufacturer, usually for 90 days from the date of purchase, unless otherwise specified. Used or customer supplied parts carry NO WARRANTY EXPRESS OR IMPLIED. Pacific Power Motorsports warranties their work for 3 months or 3000 miles. Parts and labor used for track or competition purposes are warranted against manufacturer's defects only. We do NOT recommend illegal modifications for street legal automobiles.

PACIFIC POWER MOTORSPORTS' LIABILITY FOR LOSSES OR DAMAGES, ARISING OUT OF ANY CAUSE WHATSOEVER, IS LIMITED TO FULL REFUND OF THE PURCHASE PRICE OR AT OUR OPTION, REPAIR OR REPLACEMENT OF THE PART(S). PACIFIC POWER MOTORSPORTS SHALL NOT BE LIABLE FOR ANY CONSEQUENTIAL OR INCIDENTAL DAMAGES.



STAR Certified

SMOG N DASH

2040 N. Main St., #26 • Walnut Creek, CA 94596

Phone (925) 279-1170

BAR No. ARD 268878

45257

SMOG TEST-ONLY INVOICE

TODAY'S DATE 2-3-20		YEAR 1997	MAKE Porsche	MODEL Targa	
ODOMETER 94534		LIC. PLATE # B0416FD	MOTOR #		
WRITTEN BY		CUSTOMER P.O. #	G.V.W.R.		
TEST TYPE: <input type="checkbox"/> BIENNIAL <input type="checkbox"/> CHANGE OF OWNERSHIP <input type="checkbox"/> 2% <input type="checkbox"/> HEP <input type="checkbox"/> INITIAL <input type="checkbox"/> FED. <input type="checkbox"/> CALIF. <input type="checkbox"/> O/S _____ ENGINE _____ # OF CYLINDERS _____ TRANSMISSION: <input type="checkbox"/> AUTO <input type="checkbox"/> STD TIMING _____ EM LIGHT _____					
METHOD OF PAYMENT: <input type="checkbox"/> CASH <input type="checkbox"/> CHECK <input type="checkbox"/> CHARGE <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> CREDIT CARD		ORIGINAL ESTIMATE \$ 150.00			
V. I. N. WP0DA2993US389464					
SMOG TEST CHECK OFF					
P-Pass	M-Modified	F-Defective	D-Disconnected	S-Missing	N-N/A
PCV			C/I		
TAC			AP/P		
EVP			OXY		
CAT			WRG		
EGR			VAC		
SPK			OTH		
SMOKE INSPECTION: PCV		TAILPIPE			
TIRE PRESSURE INSPECTION					
<input type="checkbox"/> Performed LF: RF: LR: RR: (psi)					
<input checked="" type="checkbox"/> Inspection Declined, Reason: Initials: <i>[Signature]</i>					
PAID CASH					
TEST RESULTS: <input type="checkbox"/> PASS <input type="checkbox"/> FAIL <input type="checkbox"/> ABORT <input type="checkbox"/> _____					
THIS SMOG TEST-ONLY STATION CANNOT PERFORM ANY DIAGNOSTICS, ADJUSTMENTS OR REPAIRS					
I hereby authorize the above smog test to be performed. Smog test fee is due whether above vehicle passes or fails the smog test. You and your employees may operate above vehicle for purposes of testing, inspection and delivery at my risk. An express mechanic's lien is acknowledged on above vehicle to secure the amount of this invoice. You will not be held responsible for loss or damage to vehicle due to fire, theft, accident, dynamometer testing or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read and understand the above and understand the amount of my estimate.					
X		DATE: 2-3-20			
REVISED	DATE	TIME	PHONE • FAX • EMAIL	<input type="checkbox"/> PHONE <input type="checkbox"/> EMAIL	
ESTIMATE \$				<input type="checkbox"/> IN PERSON <input type="checkbox"/> FAX	
REASON				ADDITIONAL COST \$	
			I acknowledge notice and oral approval of an increase in the original estimated price.		
			X		
TOTAL WORK		141 75			
CERTIFICATE		8 25			
SUB TOTAL		150 00			
SALES TAX					
GRAND TOTAL					



www.esp-global.com

Smog Check Vehicle Inspection Report (VIR)



www.autorepair.ca.gov

Vehicle Information

Test Date/Time: 02/03/2021@13:33:21

Model Year:	1997	Make:	PORSCHE	Model:	911 CARRERA 2
License:	G046F0	State:	CA	VIN:	WP0DA2993VS385464
Engine Size:	3.60 L	Type:	Passenger Car	Transmission:	Manual
GVWR:	N/A	Test Weight:	3375	Cylinders:	6
Odometer:	74,969	Certification:	California	VLT Record #:	27929
Fuel Type:	Gasoline	Exhaust:	Single	Inspection Reason:	High Emitter Profile

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Smog Check Certificate Number: RM124444

DMV ID Number: 6821M644R024

Your Smog Check certificate will be electronically transmitted to DMV.
Your certificate is valid for 90 days from date of issuance.
Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test.)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	Not applicable	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	Pass	OBD System Checks
Not applicable	EGR Visual	Pass	Vacuum Lines to Sensors / Switches	Pass	Carb. / Fuel Injection
Not applicable	EGR Functional	Not applicable	Ignition Timing	Pass	Other Emission Related Components
Not applicable	Fuel Cap Functional	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Not applicable	Fuel Cap Visual	Not applicable	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls	Bypass	Fuel Evaporative Controls Functional		

ASM Emission Test Results

Test	RPM	%CO2		HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1511	15.2	0.1	55	9	9	0.50	0.03	0.01	437	67	396	Pass
25 mph	1701	15.4	0.0	39	6	7	0.48	0.03	0.02	724	62	17	Pass

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

Smog Check Inspection Station Information

SMOG 'N DASH
2040 N Main St Walnut Creek, CA 94596
928-279-1170
Station Number: TC288878

Technician Name/Number: SALEHI, STEVE/EO639684
Repair Tech Name/Number:
Software Version/EIS Number: 1905 / EP728622

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

Date 2-3-21

Technician's Signature _____

CUSTOMER #: VS385464

76870

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 1

SERVICE ADVISOR: 694 DAVID WELLING

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 1997 Porsche 911.

Table with columns: LINE OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes a rental note for repairs covered by the Porsche Mobility Program.

Table with columns: Description, LIST, NET, TOTAL. Lists various parts and their costs, including Targa roof guides, rails, and support brackets.

Form containing authorization checkboxes, signature lines for customer and dealership representative, and a 'PLEASE PAY THIS AMOUNT' section.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

76870

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 2

SERVICE ADVISOR: 694 DAVID WELLING

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
BLACK	97	PORSCHE 911	WP0DA2993VS385464	G046FO	75128/75148	T806W	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
22JAN97 DD		23JAN1999	17:00 19AUG21		0.00	CASH	16NOV21
R.O. OPENED	READY	OPTIONS: DLR:0132 ENG:3.6_Liter_Gas					
11:16 19AUG21	06:43 16NOV21						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

75148 10.00 Verified customer concern, when closing the glass roof the spring for the sunshade track catches the roof glass. Guide rail on right side slides on the roof frame instead of staying locked in place. Unable to determine why guide rail is loose. Will need to remove roof glass and disassemble roof drive for further inspection. Remove interior trims as needed to access sliding roof mechanism. When removing side trims found some of the covering has come unglued; recommend cleaning and re-gluing prior to reinstalling. Disassemble sunshade drive assembly. Remove all tracks and mechanisms for sunshade operation. Found multiple worn components. Recommend replacing all parts associated with sunroof track assemblies. Replace sunshade tracks and operating mechanisms. Replaced all wear items associated with sunshade operation. Once sunshade tracks were reinstalled it was found that the right side of the glass would still drag on the sunshade spring. Found multiple loose mounts for glass roof. Tighten glass roof mounts and recheck operation; glass roof now clears sunshade assembly. Road test vehicle and found multiple air leaks from Targa roof. Made multiple adjustments to glass roof and wind deflector to minimize wind noise. Perform water leak test once all adjustments were made; no leaks present at this time.

C MULTI-POINT VEHICLE INSPECTION
VI COMPLETED VISUAL INSPECTION

683 IP

(N/C)

75128 Complete Niello Porsche Multi-point inspection. Front tires 8/32 8/32 Rear tires 8/32 8/32 Front brakes: 6.5 mm Rear brakes: 6.0 mm Found the following concerns during inspection:

D CHECK TIRE PRESSURE MEASUREMENTS & TREAD DEPTH INSPECTION.
TPI COMPLETED TIRE INSPECTION

683 IP

(N/C)

75128 Front tires: 8/32 8/32 Rear tires: 8/32 8/32 Set tire pressures to manufacturer specification.

Original Estimate (Parts & Labor)	Total Additional Cost Authorized	Approved By:	Date & Time	Authorization Obtained By:	HAZARDOUS WASTE DISPOSAL COSTS:	DESCRIPTION	TOTALS
\$	\$			<input type="checkbox"/> In Person Approval <input type="checkbox"/> Telephone <input type="checkbox"/> Text <input type="checkbox"/> Email/Fax (See Attached)	* We have added this charge to cover costs associated with the handling, management and disposal of toxic wastes or hazardous substances under California and Federal Law.	LABOR AMOUNT	
Revised Estimate	\$			<input type="checkbox"/> In Person Approval <input type="checkbox"/> Telephone <input type="checkbox"/> Text <input type="checkbox"/> Email/Fax (See Attached)		PARTS AMOUNT	
<input type="checkbox"/> Tire pressure check/inflation service was performed. RF psi LF psi RR psi LR psi <input type="checkbox"/> Customer declined tire pressure check/inflation service. Initials						GAS, OIL, LUBE	
By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you.						SUBLET AMOUNT	
DATE	CUSTOMER SIGNATURE	AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE				WASTE DISPOSAL COSTS *	
					<input type="checkbox"/> ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED.	TOTAL CHARGES	
					<input type="checkbox"/> Some Parts Not Returnable	LESS INSURANCE	
						SALES TAX	
						PLEASE PAY THIS AMOUNT	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

76870

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 3

SERVICE ADVISOR: 694 DAVID WELLING

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 1997 Porsche 911.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Lists services like 'PERFORM OIL CHANGE SERVICE PORSCHE' and 'LUBE MOBIL-1' with associated costs.

75132 1.50 Oil change service complete. Change engine oil and filters. Top up fluids. Complete visual inspection. Front tires 8/32 8/32 Rear tires 8/32 8/32 Front brakes: 6.5 mm Rear brakes: 6.0 mm

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Lists services like 'INSPECT AND REPAIR TRIM FOR RT SEAT ASSEMBLY' and 'COMPLIMENTARY WASH AND VACUUM WITH SERVICE AT NO CHARGE'.

EST: 825.00 19AUG21 11:16 SA: 694
CONTACT:

CUSTOMER COPY

Form containing authorization checkboxes, signature lines, and a table with columns: HAZARDOUS WASTE DISPOSAL, DESCRIPTION, TOTALS. Includes a 'PLEASE PAY THIS AMOUNT' section.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

76870

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
 4525 Granite Drive
 Rocklin, CA 95677
 (916) 625-8300
 Fax: (916) 625-0561
 porsche-rocklin.com

INVOICE



PAGE 4

SERVICE ADVISOR: 694 DAVID WELLING


COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
BLACK	97	PORSCHE 911	WP0DA2993VS385464	GO46FO	75128/75148	T806W	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
22JAN97 DD		23JAN1999	17:00 19AUG21		0.00	CASH	16NOV21
R.O. OPENED		READY		OPTIONS: DLR:0132 ENG:3.6_Liter_Gas			
11:16 19AUG21		06:43 16NOV21					
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
CUSTOMER REQUESTED A LOANER							
BDC APPT CREATED 20 21-07-16							
01:41:00PM TAKEN BY LOUIE							
DEBELLE							

CUSTOMER COPY

Original Estimate (Parts & Labor)	Total Additional Cost Authorized	Approved By:	Date & Time	Authorization Obtained By:	*HAZARDOUS WASTE DISPOSAL COSTS:	DESCRIPTION	TOTALS
\$	\$			<input type="checkbox"/> In Person Approval <input type="checkbox"/> Telephone <input type="checkbox"/> Fax <input type="checkbox"/> E-mail Fax (See Attached)	We have added this charge to cover costs associated with the handling, management and disposal of toxic wastes or hazardous substances under California and Federal Law.	LABOR AMOUNT	2130.00
Revised Estimate	\$			<input type="checkbox"/> In Person Approval <input type="checkbox"/> Telephone <input type="checkbox"/> Fax <input type="checkbox"/> E-mail Fax (See Attached)		PARTS AMOUNT	751.56
<input type="checkbox"/> Tire pressure check/inflation service was performed. RF _____ psi LF _____ psi RR _____ psi LR _____ psi <input type="checkbox"/> Customer declined tire pressure check/inflation service. Initials _____					ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED. <input type="checkbox"/> Some Parts Not Returnable	GAS, OIL, LUBE	80.00
By signing below, you acknowledge that you were notified of and authorized the Dealership to perform the services/repairs itemized in this invoice and that you received (or had the opportunity to inspect) any replaced parts as requested by you.						SUBLET AMOUNT	0.00
DATE	CUSTOMER SIGNATURE	AUTHORIZED DEALERSHIP REPRESENTATIVE SIGNATURE			WASTE DISPOSAL COSTS *	5.66	
					TOTAL CHARGES	2967.22	
					LESS INSURANCE	0.00	
					SALES TAX	60.29	
					PLEASE PAY THIS AMOUNT	3027.51	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

Smog n Dash Work Order Receipt

Smog n Dash ARD: TC268878				PO Auth	DATE IN	ESTIMATE	1895
2040 N MAIN ST#26				Tech:		Results:	Cert:
walnut creek, CA 94596				Fuel Type	drive	GWR	
(925) 279-1170				Gas	RWD		
NAME/COMPANY		ADDRESS		CITY STATE ZIP	Engine	ASP	Induction
					3.6L H6 F	Naturally	Fuel Injection
YEAR		MAKE		MODEL	VIN		ODOMETER
1997		Porsche		911	WP0DA2993VS385464		75651
LIC. PLATE							
g046f0							
Customer authorizes tire pressure:							
Not Checked. Filled last 30 days or will check within 7 days							
N-N/A P-Pass M-Modified F-Defective D-Disconnected S-Missing							
GASOLINE & DIESEL				DIESEL			
PCV		OXY		SCR			
EVAP		WRG		DOC			
CAT		VAC		PTOX			
SPK		EGR		CDR			
AP/P		MIL		DPF			
TC		TAC		CCV			
TAILP		SMOKE		NOx			
TRANS		TEST		MFS			
ENGINE		TIMING		CERT			
Service							
							Amount
Smog Check							\$181.75
Certificate Fee							\$8.25
total labor & fees							\$190.00
total parts							\$0.00
sales tax							\$0.00
PLUS SVC CHARGES							\$0.00
TOTAL							\$190.00
Original Estimate		Initial Estimate					
Orig Amount						Method	
\$190.00						In Person	
Date		1/25/2023				Time	
						01:02 PM	
<p>I hereby authorize the above smog check services to be performed on my vehicle. Shop employees may operate above vehicle for smog check and inspection services, other authorized repairs and delivery at my risk. An express mechanic lien is acknowledged on above vehicle to secure the amount of this invoice. Shop is not responsible for loss of any items left in your vehicle. Smog check customers: By law you may choose another smog check station to perform any repairs, installation, adjustments or subsequent tests. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read and understand the above and acknowledge receipt of an estimate. RETEST Fee for vehicles 2000 - newer is \$15.00 plus certificate fee of \$8.25. We thank you for your business.</p>							
Authorized by (customer signature)							
VIN							
							
SERVICE NOTES							
<p>I ACKNOWLEDGE RECEIPT OF THE ABOVE SERVICES AND OR PRODUCTS. FOR VEHICLES THAT FAIL THE INITIAL SMOG CHECK, THE RETEST FEE IS \$15.00 AND CERTIFICATE FEE IS \$8.25. THE INITIAL SMOG CHECK VALID UNTIL 30 DAYS AFTER THE INITIAL TEST.</p>							
CUSTOMER INITIALS ____ (please initial)							



www.esp-global.com

Smog Check Vehicle Inspection Report (VIR)



www.autorepair.ca.gov

Vehicle Information

Test Date/Time: 01/25/2023@13:00:58

Model Year:	1997	Make:	PORSCHE	Model:	911 CARRERA 2
License:	G046F0	State:	CA	VIN:	WPODA2993VS385464
Engine Size:	3.60 L	Type:	Passenger Car	Transmission:	Manual
GVWR:	N/A	Test Weight:	3375	Cylinders:	6
Odometer:	75,651	Certification:	California	VLT Record #:	27929
Fuel Type:	Gasoline	Exhaust:	Single	Inspection Reason:	High Emitter Profile

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Smog Check Certificate Number: SY686907

DMV ID Number: 6026Y644S324

Your Smog Check certificate has been electronically transmitted to DMV.
Your certificate is valid for 90 days from date of issuance.
Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test.)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	Not applicable	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	Pass	OBD System Checks
Not applicable	EGR Visual	Pass	Vacuum Lines to Sensors / Switches	Pass	Carb. / Fuel Injection
Not applicable	EGR Functional	Not applicable	Ignition Timing	Pass	Other Emission Related Components
Not applicable	Fuel Cap Functional	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Not applicable	Fuel Cap Visual	Not applicable	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls	Bypass	Fuel Evaporative Controls Functional		

ASM Emission Test Results

Test	RPM	%CO2		%O2			HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1458	15.2	0.4	55	9	39	0.50	0.03	0.03	437	67	207	Pass			
25 mph	1652	15.1	0.2	39	6	29	0.48	0.03	0.03	724	62	96	Pass			

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

Smog Check Inspection Station Information

SMOG 'N DASH
2040 N. Main St, Walnut Creek, Ca 94596
(925)279-1170
Station Number: TC268878

Technician Name/Number: JOHANSON-FOWLER, JER/EO643585
Repair Tech Name/Number:
Software Version/EIS Number: 2201 / EP728622

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

Date

1/25/23

Technician's Signature

CUSTOMER #: VS385464

90099

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porsche-rocklin.com

INVOICE



PAGE 1

SERVICE ADVISOR: 6151 ERIC TRIEBULL

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG. Includes details for a 1997 Porsche 911 with VIN WP0DA2993VS385464.

Table with columns: R.O. OPENED, READY, OPTIONS, LIST, NET, TOTAL. Includes repair details for oil change service.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Lists various oil change services and their costs.

75749 Oil change service complete. Drained engine oil and removed oil filters. Installed new oil filters and drain plug gaskets. Filled engine oil to minimum and test drove vehicle.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes repair estimate for rear spoiler damage.

75749 Submitted parts requisition for 3rd brake light lens/assembly. Submitted request for estimate for paint repair on rear spoiler.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes repair estimate for broken seat trims.

75749 Submitted parts requisition for broken trim panels on passenger and driver seats.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes complimentary multi-point inspection.

75749 Performed Porsche Rocklin multi-point inspection: Front brake pads at 8mm. Rear brake pads at 8mm. Battery tested "OK-Recharger", @

Form containing customer and dealer information, a table for 'HAZARDOUS WASTE DISPOSAL' costs, and a signature section for both parties.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

90099

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 2

SERVICE ADVISOR: 6151 ERIC TRIEBULL

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 1997 Porsche 911 with VIN WPODA2993VS385464.

11:17 16OCT23 10:00 20NOV23
LINE OPCODE TECH TYPE HOURS LIST NET TOTAL
55%. X-time inspection complete. Great job taking care of your Porsche!

E COMPLIMENTARY TIRE PRESSURE AND TREAD DEPTH MEASUREMENTS
TPI COMPLIMENTARY TIRE PRESSURE AND TREAD DEPTH MEASUREMENTS
6144 ISP (N/C)
75749 Front tires: 8/32nds Rear tires: 7/32nds. Set front tire pressures to: 36psi, set rear tire pressures to: 36psi; Per specification on placard on vehicle.

F COMPLIMENTARY WASH AND VACUUM WITH SERVICE
WASH COMPLIMENTARY WASH AND VACUUM WITH SERVICE
99 IP (N/C)

G CUSTOMER MOBILITY SHUTTLE
SHUTTLE CUSTOMER MOBILITY SHUTTLE
99 CP 0.00 0.00

H** DIAGNOSE OIL LEAK
REPAIR DIAGNOSIS
6144 CP 255.00 255.00

75749
Cleaned engine affected areas, added UV dye to engine oil. Inspected for leaks.
Most profuse oil leaks are coming from left and right side engine timing covers. DRIVER SIDE: Engine upper valve cover is seeping oil, while lower valve cover leaking oil more profusely. Passenger side valve covers are dry at this time, replacement for future preventative maintenance is at guest's discretion. Slight wetness coming from timing chain housing gaskets, this would require removing timing components; not a profuse leak at this time.
Some wetness noted at middle/front area, (near pulley system), but only slightly; this would indicate that, most likely, the crankshaft pulley seal and/or camshaft cover seal are leaking/weeping. Also noted,

Form with sections: Original Estimate, Revised Estimate, Tire pressure check/inflation service, HAZARDOUS WASTE DISPOSAL, and signature lines for customer and dealership representative.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

90099

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 3

SERVICE ADVISOR: 6151 ERIC TRIEBULL

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 1997 Porsche 911.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes description: 'the oil level sender gasket is seeping oil (not actively dripping)'.

I** Replace front hood struts
REPAIR REPLACED HOOD STRUTS
6144 CP 127.50 127.50
2 993-511-331-00 GAS-PRESSURE SPRING 43.85 43.85 87.70
75749 Replaced front hood struts.

J** DIAGNOSE TRANSMISSION LEAK
REPAIR DIAGNOSIS
6144 CP 255.00 255.00
75749 Inspected transmission for fluid leaks, most profuse leaks are coming joint flange seal areas. Recommend removed and inspect joint flanges on each side for wear/damage; replace if damaged, or axle seals only if joint flanges are OK at sealing surfaces.

K** Replace inner axle boots on right and left sides.
REPAIR REPLACED INNER AXLE BOOTS
6144 CP 1808.50 1808.50
1 928-332-293-02 BELLOWS 95.11 95.11 95.11
4 911-332-257-00 TERMINAL 7.81 7.81 31.24
4 928-332-257-01 TERMINAL 14.93 14.93 59.72
2 999-084-634-02 LOCK NUT 16.52 16.52 33.04
12 900-067-123-02 PAN-HEAD SCREW 6.67 6.67 80.04
1 SW101 CV GREASE 19.83 19.83 19.83
75749 Replaced inner axle boots on right and left sides.

L** REPLACED TRANSMISSION COOLING DUCT
REPAIR REPLACED TRANS COOLING DUCT
6144 CP 127.50 127.50
75749 Added transmission-clutch cooling-duct (hose) and clamps that was previously missing.

M** REPLACE REAR HATCH STRUTS

Form containing customer signature, date, and authorized dealership representative signature. Includes checkboxes for 'Tire pressure check/inflation service' and 'Some Parts Not Returnable'.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

90099

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 4

SERVICE ADVISOR: 6151 ERIC TRIEBULL

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG. Includes details for a 1997 Porsche 911.

Table with columns: DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes dates like 22JAN97 and 20NOV23.

Table with columns: R.O. OPENED, READY, OPTIONS. Includes options like DLR:0132 and ENG:3.6 Liter Gas.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes repair for rear hatch struts.

REPAIR REPLACED REAR HATCH STRUTS
6144 CP 127.50 127.50
2 911-512-331-01 GAS-PRESSURE SPRING 38.75 38.75 77.50
75749 Replaced rear hatch struts.

N** Replace 3rd brake light assembly/lens.
REPAIR REPLACED 3RD BRAKE LIGHT ASSEMBLY
6144 CP 0.00 0.00
1 993-631-060-00 ADDITIONAL BRAKE LIGHT 412.97 412.97 412.97
1 900-631-128-90 BULB 7.40 7.40 7.40
75749

Replaced 3rd brake light lens assembly.
Replaced right brake lamp.

O** Left axle boot torn on driver side, recommend replace right side
outer boot too.

REPAIR REPLACED OUTER AXLE SHAFT BOOTS
6144 CP 255.00 255.00
1 928-332-293-02 BELLOWS 95.11 95.11 95.11
1 911-332-257-00 TERMINAL 7.81 7.81 7.81
1 928-332-257-01 TERMINAL 14.93 14.93 14.93
75749 Replaced outer axle-shaft boots on right and left sides.

Q** Replace seat trim/covers near seatbelt anchors and buckles. Right
and left for passenger seat, Right for driver's seat

REPAIR REPLACED INTERIOR TRIMS
6144 CP 255.00 255.00
1 928-521-147-02-01C COVER BLACK 65.38 65.38 65.38
2 928-521-148-02-01C COVER BLACK 75.36 75.36 150.72
75749

Replaced passenger seat belt anchor and buckle trim panels.
Replaced inner buckle trim panel on driver's seat.

R** Replace right and left timing cover gaskets.

Form with sections: Original Estimate, Revised Estimate, TIRE PRESSURE CHECK, HAZARDOUS WASTE DISPOSAL, and SIGNATURES.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

90099

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 5

SERVICE ADVISOR: 6151 ERIC TRIEBULL

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG. Includes details for a 1997 Porsche 911 with VIN WP0DA2993VS385464.

Table with columns: DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Shows dates for 22JAN97 and 23JAN1999.

Main repair list table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Lists various gaskets and seals with their respective costs.

75749

Replaced right and left side timing cover gaskets and fastener grommets.

The sealing surfaces on the engine side of timing cover area are severely pitted; see photo provided.

In addition to new timing cover gaskets, Porsche sealant was added to help seal any defected areas of engine sealing surface.

Re-assembled, test drove. Raised vehicle and inspected for leaks, no more profuse leaks as before, looks good. Cleaned under-shields and installed.

S** R&R REAR SPOILER FOR PAINT REPAIR

REPAIR R&R REAR SPOILER

6144 CP

255.00 255.00

75749 Installed repaired spoiler and new third brake light assembly.

T** Add valve adjustment during valve cover reseal

REPAIR NO WORK PERFORMED

6144 CP

0.00 0.00

Customer signature and authorization form. Includes sections for 'HAZARDOUS WASTE DISPOSAL', 'ALL PARTS ARE NEW UNLESS OTHERWISE INDICATED', and 'PLEASE PAY THIS AMOUNT'.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

90099

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 6

SERVICE ADVISOR: 6151 ERIC TRIEBULL

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 1997 Porsche 911 with VIN WP0DA2993VS385464.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes note: 75749 has hydraulic valves, valve adjustment not needed.

U** Replace connecting hose for air-cooling
CAUSE: torn

REPAIR REPLACED AIR DUCTS

Table with columns: Description, Quantity, Part Number, Unit Price, Total Price. Lists items like HOSE and HOSE CLAMP.

75749 Replaced four different connecting ducts (hoses) for air-cooling.

V** left valve cover gasket

REPAIR REPLACED LEFT VALVE COVER GASKETS

Table with columns: Description, Quantity, Part Number, Unit Price, Total Price. Lists items like GASKET, COMBINATION SCREW, HEXAGON NUT, HEATER HOSE.

75749 Replaced left side valve cover gaskets.

W** Replace right and left axle seals.

REPAIR REPLACED AXLE FLANGE SEALS

Table with columns: Description, Quantity, Part Number, Unit Price, Total Price. Lists items like SHAFT OIL SEAL, TRANSMISSION FLUID, PARTS WASH.

75749 Replaced right and left axle flange seals. Topped transmission fluid.

Form containing authorization checkboxes, signature lines, and a table with columns: *HAZARDOUS WASTE DISPOSAL, DESCRIPTION, TOTALS. Includes a 'PLEASE PAY THIS AMOUNT' box.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER COPY

CUSTOMER #: VS385464

90099

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 7

SERVICE ADVISOR: 6151 ERIC TRIEBULL

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 1997 Porsche 911.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL

Table listing repair work: X** Replace Crankshaft Pulley Seal. Includes parts list with quantities and prices.

Table listing repair work: Y** BATTERY REPLACEMENT. Includes parts list with quantities and prices.

Table listing repair work: Z** REPLACE VALVE COVER GASKET. Includes parts list with quantities and prices.

Table listing repair work: AA**REPLACE OIL LEVEL SENSOR. Includes parts list with quantities and prices.

AC**FOUR WHEEL ALIGNMENT

Form for Four Wheel Alignment. Includes sections for Original/Revised Estimate, Authorization, Hazardous Waste Disposal, and a table for Description and Totals.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.

CUSTOMER #: VS385464

90099

PORSCHE ROCKLIN

Sales · Service · Parts · Leasing
4525 Granite Drive
Rocklin, CA 95677
(916) 625-8300
Fax: (916) 625-0561
porscherocklin.com

INVOICE



PAGE 8

SERVICE ADVISOR: 6151 ERIC TRIEBULL

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN / OUT, TAG, DEL. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for a 1997 Porsche 911.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes entry for 4FEP PORSCHE FOUR WHEEL ALIGNMENT.

75749
Performed 4-wheel alignment.
Adjusted rear and front toe.
Test drove: OK.

ESTIMATE: 450.00 20OCT23 08:23 SA: 6151
CONTACT:

ESTIMATE: 450.00 16OCT23 11:17 SA: 6151
CONTACT:

#905 SHUTTLE CREATED
2023-10-11 08:37:00AM TAKE N
BY TAYLOR CHYNOWETH

CUSTOMER COPY

Table with columns: Original Estimate, Total Additional Cost Authorized, Approved By, Date & Time, Authorization Obtained By, HAZARDOUS WASTE DISPOSAL COSTS, DESCRIPTION, TOTALS. Includes a signature section for the customer and dealership representative.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK.