

DAN CLARY AUTO SERVICE
 3105 COFFEY LN PO BOX 11663
 Santa Rosa, CA. 95406
 Phone - 707-573-9580 Fax - 707-568-7592
 A DIFFERENT KIND OF AUTO REPAIR

INVOICE


18085

Org. Est. # 034469
 AC165485
 EPA# CAL000354400

INVOICE

Work Completed Date : 11/20/2019

Print Date : 11/20/2019

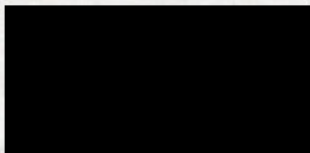

2006 Ford - GT
 5.4L, V8, VIN (S)
 Lic # : HYRPWR
 Unit # :
 Vin # : **6Y400965**
 Hat # :

Odometer In :
 Odometer Out : 2529

Cust ID : 2181

Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
PULLER NI	1.00	180.00	180.00	INCREASE INSURANCE FOR VEHICLE VALUE	120.00
MOTORCRAFT 5-50 ENGINE OIL NI	12.00	12.90	154.80	SERVICE INSTALL CUSTOMER SUPPLIED BLOWER PULLEY AND TUNE	840.00
OIL FILTER 4G7Z6721AC	1.00	32.35	32.35	CHANGE OIL AND FILTER, REPLACE LEAKING OIL DRAIN PLUGS. REMOVE AND INSTALLSUPERCHARGER. REPLACE PULLEY.	
GASKET 4G7Z9H486AA	1.00	71.28	71.28	REPLACE INTERCOOLER GASKET. DOWN LOAD TUNE AND ROAD TEST.	
OIL DRAIN PLUG NI	2.00	5.46	10.92		

Org. Estimate \$1,329.79 Revisions \$0.00 Current Estimate \$ 1,329.79 Additional Cost Revised Estimate

Labor:	840.00
Parts:	449.35
Sublet:	120.00

Sub:	1,409.35
Tax:	40.44
Total:	1,449.79
Bal Due:	\$1,449.79

[Payments -]

I hereby authorize the above repair work along with the necessary material and hereby grant your your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. Warranty on parts and labor is three months or 3000 miles whichever comes first.

TIRE PRESSURE

L/F _____ R/F _____
 L/R _____ R/R _____

SIGNATURE..... Date..... Time.....

UNLEASHED TUNING
TORRIE MCPHAIL
TORRIE@UNLEASHED
TUNING.COM

FORD GT SUPERCHARGER PULLEY REPLACEMENT PROCEDURES

Steeda Part #: 555-3346

This pulley is designed to press onto the supercharger shaft, as is the OEM pulley. Special tools are required both to remove the original pulley and to install the new pulley. Improper installation will result in damage to both the supercharger and the pulley. We highly recommend that this product be installed by a skilled professional utilizing the proper tools. Call Steeda at 954-960-0774 for additional information about installation tools.


This procedure does require that the engine be completely cooled down before removal of the existing pulley or installation of the replacement pulley.

*The replacement of the press-on supercharger pulley for the Ford series superchargers (Cobra, Shelby GT 500, Ford GT, Lightning and Harley-Davidson trucks) is a simple procedure, but **does require that the engine be completely cooled down before removal of the existing pulley or installation of the replacement pulley. It's also required that the new pulley be heated in an oven at 400 for 35-45 minutes to ease in installation, or heat the pulley with a propane torch for 1-1/2 minutes so a glove is required for install. It is recommended that you execute the removal and replacement of the pulley(s) using the additional procedures that follow.***

1. You must allow the engine to return to room temperature before removing or replacing the pulley. **The best procedure is to allow the car/engine to sit overnight before beginning the procedure. In addition, take a measurement from the blower to the first belt groove in order to ensure proper alignment of the Steeda pulley.**
2. Remove the supercharger.
 - a. Disconnect the air inlet tube from the throttle body.
 - b. Disconnect the throttle linkage.
 - c. Disconnect the EGR pipe and vacuum lines to the supercharger.
 - d. Remove the belt. This must be done through the firewall access located behind the speaker inside the cabin.
3. Carefully lift out the supercharger from the engine compartment.
4. If using the Steeda Pulley Puller tool, tap the end of the blower shaft. Match the tap to corresponding thread on the selected puller tool. A Hydraulic press can also be used.
5. Remove the OE Pulley.
6. Heat the new Steeda pulley to 400 degrees for 35-45 minutes or use the Torch method. Wear heat resistant gloves to safely handle the heated pulley.
7. Install the heated pulley over a room temperature shaft. Press the pulley on so the Steeda lettering faces the body of the supercharger. The pulley should be pressed on until the face with 7 holes is flush with the end of the shaft.

Thank you for choosing Steeda. If you have any questions and/or comments about these instructions please call (954) 960-0774 Or e-mail gofast@steeda.com

Ford GT Compressor Pulley.doc 9/06



Details for Order #114-0449629-5576221

[Print this page for your records.](#)

Order Placed: January 16, 2021
Amazon.com order number: 114-0449629-5576221
Order Total: \$1,234.02

Not Yet Shipped

Items Ordered


2 of: *Goodyear Eagle F1 SuperCar Summer Radial Tire - 315/40R19 103Y*

Sold by: Custom Wheel Outlet ([seller profile](#))

Condition: New

Price
\$569.99

Shipping Address:




Shipping Speed:
Standard Shipping

Payment information

Payment Method:
Visa | Last digits: 8681

Billing address



Item(s) Subtotal:	\$1,139.98
Shipping & Handling:	\$0.00

Total before tax:	\$1,139.98
Estimated tax to be collected:	\$94.04

Grand Total:	\$1,234.02

To view the status of your order, return to [Order Summary](#).

[Conditions of Use](#) | [Privacy Notice](#) © 1996-2021, Amazon.com, Inc. or its affiliates

United Auto Center
 1576 PETALUMA HILL ROAD
 SANTA ROSA, CA. Ca
 (707) 545-4267
 Writer: STEVE WILDMAN

INVOICE #1118

INVOICE

unitedauto
 BAR# BAR ARD2626857
 EPA# CAD 982-361313

CUS: [REDACTED] YEAR: 2006
 Home: [REDACTED] MAKE/MODEL: FORD GT
 VIN: ENGINE:
 TRANS/DRIVE: /
 LICENSE/STATE: HYPRWR/MT
 MILES IN/MILES 2958/2958

In: 2/11/2021 Out: 2/11/2021

VEHICLE ISSUE #1: CUSTOMER REQUESTING TIRE REPLACEMENT / CUSTOMER SUPPLIED TIRE

LABOR: CLARK, W TIRE MOUNT AND BALANCE STANDARD 17-20" TIRE (4EA) \$100.00 LABOR

Total for "CUSTOMER REQUESTING TIRE REPLACEMENT / CUSTOMER SUPPLIED TIRE": \$100.00

Payment Rec'd	Visa	Date: 2/11/2021	\$100.00
---------------	------	-----------------	----------

4 NEW TIRES
 \$2000⁰⁰

Recommended Repairs:

Warranty: From the date of delivery for a period of 12 months or 12,000 miles, whichever comes first, this firm will repair free of charge any defects in material and workmanship to the repairs stated on the invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts. A storage fee of \$30.00 per day will be charged 24 hours after notification that work is complete. Neglect/abuse of vehicle will immediately void any and all warranties.

Labor/Jobs	\$100.00
Parts	\$0.00
Sublet	\$0.00
Total Fees	\$0.00
Subtotal	\$100.00
Tax @ 9%	\$0.00
Total	\$100.00
Payments	\$100.00
Balance	\$0.00

Replaced parts may be requested by customer. I hereby authorize the above repair work to be done along with all necessary materials. You and your employees may operate the above vehicle for the purposes of testing, inspection or delivery at my risk. An express mechanic's lien is acknowledged on the above vehicle to secure the amount of repairs thereto. The shop will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. In the event legal action is necessary to enforce this contract, I understand that I am solely responsible for all costs including attorney's fees and court costs. I have read the above and acknowledge receipt of an estimate.

X _____ Date 2/11/2021

000005066

Order Date 03/15/24 04:33 pm

Completed: 09/17/24 12:35 am

BAR #: AL-128876
 EPA # CAL-0001-68497
 19564 8th St E.
 SONOMA, CA 95476
 Phone: 415-331-4512

Job04 TPMS

Removed and replaced all four tire pressure monitor sensors.
 Programmed units and tested for proper operation.

NOTE: Front right wheel has a large dent.

224549	TMPS-S	4.0 @	96.20 = \$	384.80	384.80
--------	--------	-------	------------	--------	--------

Payments to VALTELLINA AUTOMOBILI**Cost Summary**

Status: Completed Work Order

Payments:

Labor	6,200.00
Parts	6,705.15
Subtotal	12905.15
Tax	569.94
Total	\$13475.09
Payments	0.00
Bal Due	13475.09

Thank you for choosing VALTELLINA AUTOMOBILI

I hereby authorize the above repair work to be done with the necessary material and hereby grant you and/or your employees permission to operate the car, truck or vehicle herein described on street, highways or elsewhere for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on above car, truck or vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, accident or any other cause beyond your control.

(Signature) _____



900002021
 NAPA Auto Parts - SAC021
 19425 SONOMA HWY
 PHONE (707) 996-8424
 SONOMA, CA 95476
 (707) 996-8424

Time: 11:10
 Date: 06/12/2026
 Page: 1/1

Invoice Number 928003



eInvoice# SA1000021928003

1
 PREFERRED NAPA CUSTOMER
 THANK YOU FOR YOUR BUSINESS
 COME BACK SOON. CA 99999-0000

Delivery Option:
 Anticipated Time:
 Attention:
 Tax Exemption:
 PO#:
 Terms: NET 25TH

Y
 OCR
 9000020219280031
 Y

Part Number	Line	Description	Quantity	Price	Net	Total	
ODP-AGK25	ODY	BCI 25 AGM BATTERY ()	1.00	591.62	361.9900	361.99	T
		Qty: 1 from: 900002300 - ETA: 06/10/2026 05:30 PM					
ODP-AGK25	ODY	Core Deposit ()	1.00	18.00	18.0000	18.00	TD
Don't miss out! Sign up online for NAPA Rewards & get \$5 back for every \$100 you spend. Go to NAPARewards.com & use claim code 4416816531391 to get started!							

Employee: 5084 , Gary
 Sales Rep: 19 , BRENDAN
 Accounting Day: 10

Customer Signature
 ALL GOODS RETURNED MUST BE ACCOMPANIED BY THIS INVOICE
 I agree to pay total amount
 according to card issuer agreement

*** NOW HIRING ***
 Visit jobs.napa.com
 REF BY: VER BY:

CUSTOMER COPY

	Subtotal	379.99
SONOMA CITY 04-01-2021	10.2500	38.95
Total		418.94
Visa	4689 00827D	418.94
	Name Not	