

Invoice

Date	Invoice #
8/23/2021	1462

Bill To

Ship To
BMW 319

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
73,472 KM			8/23/2021			

Quantity	Item Code	Description	Price Each	Amount
8	11-12-009	Cylinder head fasteners, retorque; remove hood, carburetors.	130.00	1,040.00
1.75	11-34-004	Remove and install valve covers, clean and reseal.	130.00	227.50
7.75	11-61-400	Remove and install carburetor/throttle linkage mounts, repair vacuum leaks, build new heat insulating gaskets.	130.00	1,007.50
3.5	12-11-551	Restore spare ignition distributor to specification, and replace faulty original unit. Adjust ignition dwell and timing.	130.00	455.00
10	13-00-604	Revise and adjust carburetors, fuel mixture, choke operation, high and low idle speeds, transition circuits.	130.00	1,300.00
		Sales Tax	9.00%	0.00

			Total	\$4,030.00
--	--	--	--------------	------------

Bill Watson
 Sonoma, CA

8.16.2021
 08/16
 22.10.63

200 TI

Invoice

Date	Invoice #
7/30/2021	1461

Bill To


Ship To

BMW 319

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
73,472 KM			7/30/2021			

Quantity	Item Code	Description	Price Each	Amount
5	00-00-240	Inspect entire vehicle; evaluate consumables, check for changes in plumbing, wiring, drive belts, fasteners, structural components, safety systems, lubricate all grease fittings on suspension and steering components as possible.	130.00	650.00
3.25	16-00-009	Diagnose cause of engine not taking throttle. Inspect fuel system, drain old gasoline, install 5 gallons of owner's 92 octane/ethanol free fuel. Replace inlet filter to electric fuel pump, test pump fuel output pressure.	130.00	422.50
3.75	12-12-011	Inspect ignition system. Replace spark plugs, test spark plug wire resistance, repair faulty primary ignition circuit, adjust ignition timing.	130.00	487.50
1	11-00-039	Perform compression test on engine, warm: 148/145/145/150/150/150.	130.00	130.00
2.5	11-34-004	Valve lash, measure, and correct.	130.00	325.00
0.5	00-00-249	Change engine oil. filter.	130.00	65.00
6	NGK3228	Spark plug, 10mm, single electrode, BMW 328 engine.	6.00	36.00T
1	NAPA 1516	Oil filter, spin-on. BMW 328 engine.	14.28	14.28T
1	NAPA 3046	Fuel filter, in-line, low pressure.	10.70	10.70T
6	Napa 20-50HM	Motor oil, 20-50/High mileage	9.81	58.86T
		Sales Tax	9.00%	10.79

Total \$2,210.63

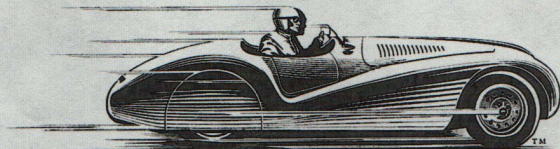

ROAD ROCKETS™

RACING JOY THROUGH HISTORY

12-19-17
 Ck# 6961
 7251.07


Invoice

Date	Invoice #
10/22/2017	1375

Bill To
[Redacted]

Ship To
BMW 319

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
73,455			10/22/2017			
Quantity	Item Code	Description			Price Each	Amount
1.5	00-00-240	Inspect entire vehicle; evaluate consumables, check for changes in plumbing, wiring, drive belts, fasteners, structural components, safety systems.			130.00	195.00
1.75	12-11-004	Inspect ignition distributor, test dwell, lubricate points rubbing block. Test and adjust ignition timing.			130.00	227.50
4	13-00-604	Adjust carburetor fuel mixtures, choke operation, idle speed. Clean accelerator pump circuits, replace faulty center carburetor pump diaphragm. Install lock nuts on air cleaner mounting studs.			130.00	520.00
24.5	34-11-102	Disassemble front wheel brakes, inspect and clean all components. Rebuild front wheel cylinders; free up frozen pistons, resurface cylinders, assemble with silicone brake fluid, replace flexible hoses. Remove rust and scale from brake shoe adjusters, lubricate, prepare for assembly. Clean fluid saturated brake shoes, remove rust and corrosion from brake drums, trial assemble. Resurface front shoes as needed to allow drums to fit, adjust shoes for best fit.			130.00	3,185.00
BILL WATSON, PROPRIETOR				Total		
2892I ARNOLD DRIVE • SONOMA, CALIFORNIA 95476 • shop: 707.939.8000 • mobile: 415.939.6888				BILL@ROADROCKETS.NET • WWW.ROADROCKETS.NET		

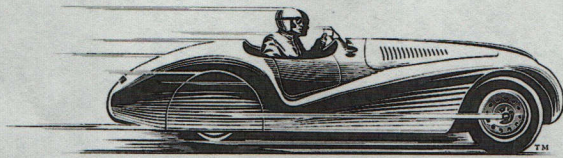

ROAD ROCKETS™

RACING JOY THROUGH HISTORY

Invoice

Date	Invoice #
10/22/2017	1375

Bill To

Ship To
BMW 319

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
73,455			10/22/2017			
Quantity	Item Code	Description			Price Each	Amount
10	34-21-102	Disassemble rear wheel brakes, inspect and clean all components. Rebuild rear wheel cylinders; free up frozen pistons, resurface cylinders, assemble with silicone brake fluid, replace flexible hoses. Remove rust and scale from brake shoe adjusters, lubricate, prepare for assembly. Clean fluid saturated brake shoes, remove rust and corrosion from brake drums, trial assemble. Adjust shoes for best fit.			130.00	1,300.00
8.5	34-31-000	Replace brake master cylinder, purge hard lines of all old brake fluid, flush with acetone to prepare for silicone brake fluid. install silicone brake fluid, bleed system.			130.00	1,105.00
1	61-21-011	Battery, main, test function, remove and replace, clean terminals, build insulated battery hold down strap.			130.00	130.00
3	Napa 45-012	Brake fluid, DOT 5, silicone.			16.82	50.46T
1	Napa M2796	Brake master cylinder, 319, single piston, cast iron body.			160.46	160.46T
6	Napa 2936	Wheel cylinder cup, 319			1.62	9.72T
3	Int. Batt. CHG1047	Battery tender, 12V, 1.25 A.			63.00	189.00T
1	Int. Batt. MT-42	Battery, 12V,60 month, 500CCA. (Includes \$20 core charge.)			134.70	134.70T
		Sales Tax			8.125%	44.23
BILL WATSON, PROPRIETOR						
28921 ARNOLD DRIVE · SONOMA, CALIFORNIA 95476 · shop: 707.939.8000 · mobile: 415.939.6888					Total	\$7,251.07
BILL@ROADROCKETS.NET · WWW.ROADROCKETS.NET						