

KTR ENGINEERING INC.
BOX 560
GROTON, MA 01450
(617) 772-7800

REPAIR ORDER

06/24/88

REPAIR ORDER NO: 99

VEHICLE: 1966 FERRARI
MILEAGE: 78247 M

330GT

START DATE: 06/11/88
COMPLETION DATE: 06/23/88

WORK DESIRED:

CHECK CHARGING AND STARTING SYSTEMS, FIX PASS. SIDE DOOR HANDLE, DRIV.
SIDE WINDOW CABLE AND VENT, CHECK FUEL SMELL. CHECK ROT ON RUCKERS AND
UNDERSIDE.

LABOR CHARGES

DATE	DESCRIPTION	HOURS
06/11/88	TEST VOLTAGE TO COILS DURING CRANKING-SLIGHTLY LOW, REMOVE CAPS AND WIRES, REMOVE AIR BOX, TEST CONTINUITY ON 1 SET OF WIRES, CHECK POINT GAPS IN 1 DISTRIB.	1.00
06/13/88	REMOVE DISTRIBS-SET POINTS-CHECK ADVANCE ON DISTRIB MACHINE, TEST WIRES, CUT DOWN WIRES RE-INSTALL ENDS, REMOVE AND INSTALL 12 PLUGS, RE-INSTALL DISTRIBS, SET TIMING.	6.50
06/21/88	REPAIR RIGHT OUTER DOOR HANDLE.	1.00
06/22/88	REMOVE LEFT WINDOW CABLE AND MOTOR, DISASSEMBLE DRIVE, FABRICATE AND INSTALL NEW CABLE, START INSTALLATION OF DRIVE AND CABLE AND MOTOR.	7.00
06/23/88	FINISH SETTING UP LEFT WINDOW LIFT, INSTALL DOOR PANELS, INSTALL 1 NEW WIRING CONNECTOR.	3.75
06/23/88	REMOVE PLUGS, HELP WITH COMP. CHECK, PLUG FUEL RETURN LINE. #1-105, #2-125, #3-125, #4-115, #5-125, #6-125, #7-140, #8-120, #9-125, #10-120, #11-120, #12-110. LEAK DOWN #1-40% LEAK DOWN PAST RINGS.	1.00
06/23/88	RUN COMP. CHECK, LEAK DOWN #1, INSTALL HEAT BRAID, PLUGS, AIR BOX.	2.75
	TOTAL HOURS:	23.00
	HOURLY RATE: \$	40.00
	TOTAL LABOR: \$	920.00

PARTS CHARGES

QUAN	UNIT	DESCRIPTION	UNIT PR	TOTAL
12		SPARK PLUGS, N9YC	1.73	20.76
1	SET	IGNITION WIRE HEAT SHIELD BRAID	15.00	15.00
		TOTAL PARTS: \$		35.76

=====

TOTAL LABOR :	\$	920.00
TOTAL PARTS :	\$	35.76
TOTAL TAX :	\$	1.79
TOTAL SUBLET:	\$	0.00
TOTAL OTHER :	\$	0.00

SUBTOTAL: \$ 957.55
PAYMENTS: - 0.00
TOTAL: \$ 957.55
=====

RECOMMENDATIONS

[Handwritten signature]
[Handwritten signature]
[Handwritten signature]
6-24-88
Jug

KTR ENGINEERING INC.
BOX 560
GROTON, MA 01450
(508) 772-7800

REPAIR ORDER

02/07/91

REPAIR ORDER NO: 202

VEHICLE: 1967 FERRARI 330GT
MILEAGE: 80399 M #9129

START DATE: 09/12/89
COMPLETION DATE: 02/07/91

WORK DESIRED:

REPAIR RUST AND ROT, CHECK CLUTCH AND ENGINE CONDITION.

LABOR CHARGES

DATE	DESCRIPTION	HOURS
09/13/89	ASSES RUST AND ROT ON ROCKERS AND UNDERSIDE, REMOVE INTERIOR PIECES AS REQUIRED, CUT AWAY 2 SETS OF ROCKER PANELS ON LEFT SIDE.	5.00
09/16/89	CONSULT WITH SHEET METAL AND WELDING SHOP REP. ON RUST AND ROT REPAIR.	1.00
18/89	REMOVE REAR SEAT, RIGHT CARPET, FRONT SEAT, SCRAPE INTERIOR UNDERCOAT.	2.00
09/19/89	FINISH INTERIOR INSULATION REMOVAL, SCRAPE, VACUUM, ETC CUT OUT RUSTED AREA IN RR WHEEL ARCH AND INNER FENDER, BEGIN REMOVAL OF RR ROCKER PANEL, REMOVE EXHAUST SYSTEM BOTH SIDES, MANY RUSTED FASTENERS.	5.50
09/19/89	HELP WITH EXHAUST SYSTEM REMOVAL.	2.00
11/04/89	GO TO SHEET METAL SHOP TO CONSULT ON JOB.	1.00
11/06/89	TRANSPORT CAR FROM SHEET METAL SHOP TO KTR.	0.50
11/06/89	CLEAN, ACID ETCH, PREP, PRIME, PAINT FROM ROCKERS DOWN ON ALL NEW METAL. GRIND AND CUT OUT RUST AREAS ON BODY. DRILL AND RIVET FLOOR TO NEW FRAME RAILS, APPLY SEAM SEALER TO FLOOR SEAMS, WELD INNER AND OUTER PATCH TO LEFT FRONT FENDER.	8.00
11/07/89	WELD PATCH IN LEFT REAR FENDER, OUTER AND INNER, GRIND WELDS, SEAM SEAL ALL REPAIR AREAS, FILL AND SAND 5 REPAIR AREAS.	7.00
11/08/89	FILL AND SAND, REMOVE RIGHT SIDE FENDER VENT, LEFT INNER DOOR PANEL, APPLY SEAM SEALER, REPAIR FIBERGLASS ON RIGHT REAR FLOOR, GRIND, SAND, METAL COND., DOOR SILLS, MASK, PREP, AND PRIME SILLS AND INSIDE REAR QUARTERS, UNDER FENDERS, ETC. SCRAPE UNDER COAT FROM RIGHT INNER FENDER, BEGIN FABRICATING LEFT INNER.	5.00
11/08/89	MIX PAINT TO MATCH, PAINT SILLS, INNER ROCKERS, ETC. RED; PAINT UNDER FENDERS BLACK.	2.00

1/09/89	SHOOT RUST PREVENT IN REAR QUARTERS, ROCKERS, UNDER FENDERS, DRILL AND PLUG VARIOUS HOLES. INSTALL INTERIOR SEATS, CARPETS, ETC., BUFF AND INSTALL ROCKER TRIM ON INTERIOR.	8.00
1/10/89	SAND AND FILL, MASK AND SHOOT FEATHERFILL ON BODY REPAIR AREAS, REMOVE OTHER VENT GRILLE. CONTINUE FABRICATING INNER FENDER PANEL.	3.00
1/11/89	FIT AND DRILL 1 NEW INNER FENDER, FABRICATE, FIT AND DRILL OTHER NEW INNER FENDER PANEL.	9.00
1/13/89	UNMASK, BLOCK SAND, FEATHERFILL BODY REPAIR AREAS, SANDBLAST ORIGINAL RIGHT INNER FENDER, CUT OFF 4 HEADER CONNECTOR PIPES, APPLY SPOT PUTTY AND SAND ON BODY.	3.50
1/16/89	SPOT PUTTY AND SAND, RE-MASK, PREP AND PRIME BODY REPAIR AREAS.	1.00
1/17/89	INSTALL WEATHERSTRIP TO 4 INNER FENDER PANELS, MAKE AND INSTALL 4 BACKUP PLATES FOR FASTENERS, RIVET IN PLACE.	2.50
1/18/89	UNMASK AND SAND PRIMER, RE-MASK AND APPLY ROCKER CHIPGUARD, SHOOT BLACK CHIPGUARD UNDER FENDERS, BODY, AND INNER FENDER PANELS, RE-MASK BODY AND SHOOT SEALER, SAND SEALER, RE-MASK, MIX PAINT AND SHOOT	4.50
1/20/89	UNMASK AND SAND FRONT FENDERS AND LEFT DOOR, PREP AND PRIME SAME AREAS, COMPOUND REAR QUARTERS, ADJUST PAINT, RE-MASK, SHOOT FENDERS, DOOR AND SIDE LOUVERS.	3.50
1/21/89	SET FASTENERS IN NEW SIDE TRIM, INSTALL LOUVERS AND SIDE TRIM, INSTALL 4 INNER FENDER PANELS.	4.00
1/22/89	COMPOUND LEFT FENDER, INSTALL LOGO, SHOOT 1 MORE COAT CHIPGUARD UNDER FENDERS.	2.00
1/24/89	PUT CAR ON LIFT, ADJUST CLUTCH FREE PLAY-SEEMS BETTER, START EXHAUST SYSTEM LAYOUT.	2.00
1/29/89	ASSEMBLE AND HANG RIGHT SIDE EXHAUST SYSTEM.	2.00
1/30/89	ASSEMBLE AND HANG LEFT SIDE EXHAUST SYSTEM, DIAGNOSE AND REPAIR LEAKY FUEL TANK DRAIN PLUG, DRAIN AND RE-FILL GAS.	2.50
2/01/89	WASH, COMPOUND AND POLISH CAR, SAND, MASK, PREP AND PAINT LEFT DOOR, INSTALL ALL SIDE BADGES, MAKE AND INSTALL RUBBER DEAD PEDAL COVER.	6.00
2/02/89	WET SAND AND COMPOUND LEFT DOOR, REPLACE WRONG DRYWALL FASTENERS FOR REAR SEAT BOTTOMS, INSTALL INTERIOR REAR SIDE PANELS, CLEAN INTERIOR, HOOK UP GAS CAP LINKAGE, INSTALL HEADLIGHT TRIM RINGS, REMOVE AND MODIFY 1 LIGHT BUCKET, GLUE ON 1 KNOCK-OFF CENTER.	5.25
2/05/89	PUT CAR ON LIFT, START MODIFYING AND FITTING LEFT CONNECTOR PIPE.	7.00
2/06/89	FINISH LEFT CONNECTOR PIPE, MODIFY AND FIT RIGHT PIPE, ADJUST AND BOLT TOGETHER, CLAMP, ETC.	7.50
2/07/89	INSTALL HEAT SHEILDS, BATTERY, CHANGE SPARK PLUGS.	1.75
2/11/89	CHECK ENGINE ON SCOPE-NEEDS MUCH ADJUSTING.	0.50
1/17/90	POLISH AND STRAIGHTEN ROCKER TRIM, MODIFY CLIPS AND MOULDINGS FOR GOOD FIT, INSTALL ROCKER TRIM.	1.50
3/08/90	CHARGE BATTERY, DRAIN AND TOP UP COOLANT.	0.75
1/24/91	FIRE UP CAR AND MOVE BACK TO SHOP.	1.00
2/01/91	WASH AND POLISH CAR.	3.00



Box 560, Groton, MA 01450

DATE 10-19-86

005342

NAME
ADDRESS
CITY
PHONE

CHECK BELOW	LABOR CHARGE
LUBRICATE ☐	
CHANGE OIL ☐	
CHANGE OIL FILTER CART. ☐	
FLUSH TRANS. ☐	
FLUSH DIFF. ☐	
WASH ☐	
POLISH ☐	

YEAR & MAKE OF CAR - TYPE OR MODEL
330 GT MKII

MILEAGE LICENSE NO.

SERIAL NO. MOTOR NO.

TIME RECEIVED A.M. TIME PROMISED A.M. TERMS ORDER BY
P.M. P.M.

PRICE EACH	REQ. NO.	QTY.	PART NO.	DESCRIPTION	AMOUNT
				MISC. HARDWARE.	10.00
SEE BACK FOR ADDITIONAL PARTS					
Total Parts ▶					

OPER. NO. REPAIR ORDER - DESCRIPTION OF WORK

Total Service ▶

REMOVE STARTER - REBUILD SOLENOID CONTACTS, FABRICATE NEW INSULATORS, FABRICATE NEW SOLENOID STRAP, CLEAN ARMATURE & BRUSHES & RE-ASSEMBLE & INSTALL. CLEAN-UP ALL WIRE CONNECTORS. WELD & BRAZE EXHAUST HANGER, HELICOL ONE MANIFOLD STUD. CLEAN BATTERY BOX & BATTERY.

13.0
x35

Sublet Repairs

Sublet Repairs Total ▶					

Accessories - Tires and Tubes

Total Accessories ▶					

I hereby authorize the above repair work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection, or delivery at my risk. Any express mechanic's lien is acknowledged on above vehicle to secure the amount of repairs therefor.
It is understood that this company assumes no responsibility for loss or damage by theft or fire to vehicles placed with them for storage, sale, repair or while road testing.

AUTHORIZED BY

RD. J. [Signature]

Gas, Oil and Grease

GALS. GAS
QTS. OIL
LBS. GREASE

TOTAL LABOR	455.00
TOTAL PARTS	10.00
ACCESSORIES	
GAS, OIL & GREASE	
MISCELLANEOUS MERCHANDISE	
SUBLET REPAIRS	
TAX	50
Total ▶	\$ 465.50

Total Gas, Oil & Grease ▶



Stainless Steel Brakes

CORPORATION

11470 MAIN ROAD CLARENCE, NY. 14031 716-759-8666 FAX: 716-755-8688
www.ssbrakes.com


* UPS SHIPPER NO
NY 117-299
* PKG ID# 0016538

S
O
L
D
T
O

DATE	OUR WORK ORDER	CUSTOMER P.O.	ORDER DATE	SHIPPED VIA	TERMS	INVOICE NUMBER	
06/25/02	00165389			UPS Ground	CreditCard	001653	
ORDERED	QUANTITY SHIPPED	BACK ORDERED	ITEM NUMBER	DESCRIPTION	UNIT	UNIT PRICE	AMOUNT
1	1	0	A2905	whl.ctr.lock,torq.wr.kit	kl	440.000	440.00
				THANK YOU FOR YOUR ORDER!			
UPS TRACKING NO.: 1Z117299034 859813				PREPAID AMOUNT:		455.80	
NON-TAXABLE	TAXABLE	SALES TAX	SHIPPING & HANDLING	CORE DEPOSIT	INVOICE TOTAL		
440.00	.00	.00	15.85	.00			

ALL SHORTAGE OR DAMAGE CLAIMS MUST BE MADE
WITHIN SEVEN DAYS AFTER RECEIPT OF SHIPMENT.

Cores, if invoiced, are supplied for the convenience of the customer, and remain
Stainless Steel Brakes Corp. Deposits paid will be refunded upon replacement of
acceptable per our stated policy, and if returned within two years, maximum, of

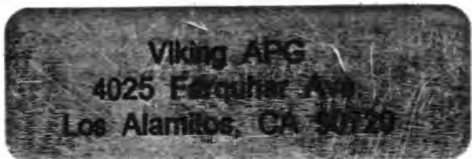

INVOICE NO.

296926

INVOICE

SOLD TO		VIA <i>Fedise</i>	
ADDRESS		<i>Same</i>	
CITY, STATE, ZIP		ZIP	
CUSTOMER'S ORDER	SALESPERSON <i>J.</i>	TERMS <i>Paypal</i>	DATE <i>12-21-02</i>
<i>1</i>	<i>BECKER EUROPA STEREO II RADIO</i>		<i>74.99</i>
	<i>SHIPPING</i>		<i>10.95</i>
			<i>TOTAL (PREPAID)</i>

Thank you!

[eBay home](#) | [my eBay](#) | [sign in](#)[Home](#)[Browse](#)[Sell](#)[Enthusiasts](#)[Search](#)[Services](#)[Help](#)

See this item in eBay's new look for this page.

Ferrari 250 275 330 Jack Hole Plugs

Item # 2418576045

Item located in: Parts & Accessories: Collector Car & Truck: Interior

Current bid **US \$199.00** [Bid](#)Starting bid **US \$199.00**Quantity **1**# of bids **1** (Bid history)Time left **2 days, 10 hours +**Location **San Clemente CA**Country **United States**

Started Jun-07-03 06:15:21 PDT

[✉](#) (Mail this auction to a friend)

Ends Jun-17-03 06:15:21 PDT

[Watch this item](#)Seller (rating) **miuraman (209 ★)**[\(View seller's feedback\)](#) [\(view seller's other items\)](#) [\(ask seller a question\)](#)High bidder **vintageracer53 (17 ★)**

Payment PayPal, money order/cashiers check, or personal check.

PayPal: Fast, easy, secure payment. [Learn More.](#)

Shipping Buyer pays all shipping charges. Seller ships internationally (worldwide).

[Use Anything Points at PayPal! Learn more.](#)

Item Revised

Before To review revisions made to this item by the seller, click here .

Starting Bid

Description

Set of 4 Jack Plugs Freshly Machined and plated, Stainless spring clips. Questions???? Tom Shaughnessy Ferrari Parts and Sales, San Clemente CA (949)366-6211, gt40mirage@aol.com Monterey is around the corner, hope to see you there. Thanks for watching my auctions, more Ferrari items to come.

[eBay home](#) | [my eBay](#) | [sign out](#)



[Home](#)

[Browse](#)

[Sell](#)

[Enthusiasts](#)

[Search](#)

[Services](#)

[Help](#)

[See this item in eBay's new look for this page.](#)

Ferrari 250 275 330 Jack Hole Plugs

Item # 2420389481

Item located in: Parts & Accessories: Collector Car & Truck; Interior

Bidding is closed for this item.

3) is the winner.

Pay using PayPal, money order/cashiers check, or personal check.

[Pay Now](#)



Payment Details

Item price

US \$225.00 *

*Not including any shipping charges

Payment Instructions

Personnel Checks allow 7-10 days to clear.

► **Buyer:** ttreue, If you're not sure how much to pay, you can [request the total](#) from the seller.

► **Seller:** miuraman, you may [create and send an invoice](#) to the buyer.

Current bid **US \$225.00**

Quantity **1**

Time left **Auction has ended.**

Started Jun-20-03 09:18:45 PDT

Ends Jun-30-03 09:18:45 PDT

Starting bid **US \$225.00**

of bids **2** ([Bid history](#))

Location **San Clemente CA**

Country **United States**

[\(Mail this auction to a friend\)](#)

[Watch this item](#)

Seller (rating) **miuraman (221 ★)**

([View seller's feedback](#)) ([view seller's other items](#)) ([ask seller a question](#)) ([Checkout summary](#))

High bidder **ttreue (3)**

Payment PayPal, money order/cashiers check, or personal check.

► PayPal: Fast, easy, secure payment. [Learn More.](#)

Shipping Buyer pays fixed shipping charges. Seller ships internationally (worldwide). See item description for shipping charges.



Seller services [Checkout summary](#) | [Relist this item](#)

[Send a Second Chance Offer](#) to a bidder with no Insertion Fees. **NEW!**

KILIMANJARO DESIGNS, LTD.
940 WARRENTON ROAD • VICKSBURG, MISSISSIPPI 39180
U.S.A. (601) 638-7856

INVOICE 0167/2003



DATE June / 21 / 2003

TO _____

ADDRESS _____

SHIP VIA

F.O.B.

TERMS

DATE REQUIRED

	QUANTITY	STOCK NUMBER/DESCRIPTION	PRICE	PER	
1	1	Gear G1			450
2	1	Hour -			100 ⁰⁰
3					
4					
5					
6					
7					
8		THAMES TANK -			
9		GOOD TANK WITH GAS - SERVICED CALIFORNIA			
10		Parker			

NOTES:

paid \$530.00
#5998
6/29/03

SUB TOTAL

550⁰⁰

SHIPPING

5

TOTAL

555⁰⁰

doi:10.1017/S0022292412001917 Printed in the United Kingdom

[eBay home](#) | [pay](#) | [my eBay](#) | [sign in](#)



[Home](#) | [Browse](#) | [Search](#) | [Sell](#) | ["How To" Center](#) | [Services](#) | [Help](#)

[Back to list of items](#)

Listed in category: [eBay Motors](#) > [Parts & Accessories](#) > [Collector Car & Truck](#) > [Other Parts](#)

Ferrari tool kit item 250/330/365 Hub puller

Item number: 2450756877

You are signed in

[Watch this item](#) (track it in My eBay)



[Go to larger picture](#)

Starting bid: **US \$400.00**

[Place Bid >](#)

Time left: **2 days 20 hours**

7-day listing
Ends Jan-02-04
13:53:58 PST

[Add to Calendar](#)

History: **0 bids**

Location: **San Clemente CA**
United States /Orange
County

[Shipping and payment details](#)

Seller information

[miuraman](#) (296 ★)

Feedback rating: 296

Positive feedback: 99.7%

Registered Jan-03-99 in United
States

[Read feedback reviews](#)


[Ask seller a question](#)

[View seller's other items](#)

[Purchase Protection](#)

Description

This is a 42 style hub puller appropriate for all cars except 330GTC/S and 275's which use the 32 style puller (see other auction) Tom Shaughnessy Ferrari Parts and Sales San Clemente CA (949)366 6211, gt40mirage@aol.com

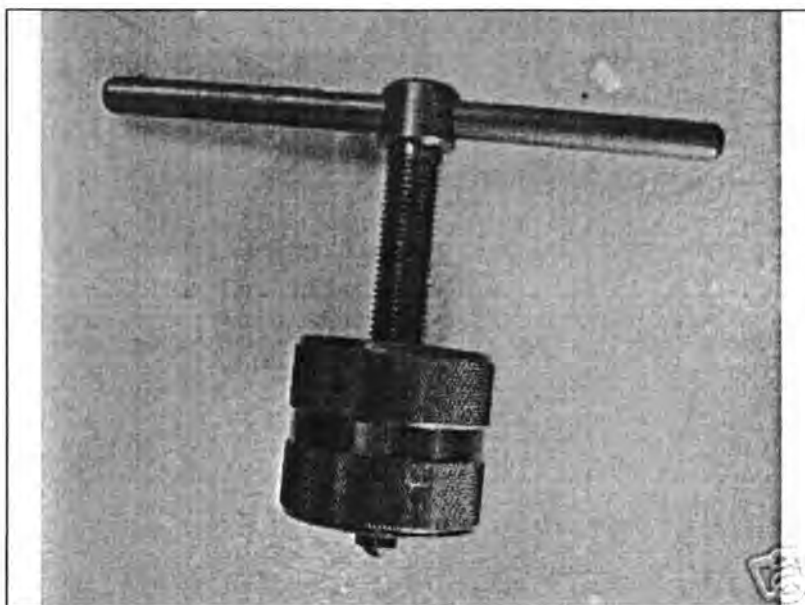

Damper Doctor
1055 Parkview Ave.
Redding, CA 96001-3314

Invoice

Invoice Number:
108549

Invoice Date:
Jan 27, 2004

Voice: 530-246-2984
Fax: 530-246-2987

Page:
1

Ship To

Customer ID		Customer PO	Payment Terms	
CASOK10		FERRARI 330 GT 2+2		
Sales Rep	Shipping Method		Ship Date	Due Date
	UPS GROUND			1/27/04
Quantity	Item	Description	Unit Price	Extension
1.00	FER330	65 FERRARI 330	125.00	125.00
1.00	BAL10	NEUTRAL BALANCE INTERNAL TYPE	25.00	25.00
1.00	BAL10	NEUTRAL BALANCE INTERNAL TYPE	25.00	25.00
1.00	SHI10	SHIPPING AND HANDLING	12.00	12.00

Check No: 316956

Subtotal	187.00
Sales Tax	
Total Invoice Amount	187.00
Payment Received	187.00
TOTAL	0.00



TEL (714) 898-9763 FAX (714) 893-8297
http://jepistons.com

TEL (714) 373-5530 FAX (714) 899-290:
<http://srp.com>

INVOICE NUMBER: 605845
INVOICE DATE: 02-16-04
P.O. NUMBER: TREVE

SOLD
TO

SHIP VIA: UPS GROUND
SHIP DATE: 02-16-04
DUE DATE: 0213

CUST. I.D.:9814

P.O. DATED 01-28-04

TERMS: Prepaid-Special Credit Card JOB ORDER NO. 412903
P.O. NUMBER: TREVE THOMAS SALESMAN: TONY

P.O. NUMBER:

SALESMAN:

PRODUCT I.D.	DESCRIPTION	ORDERED	SHIPPED	U/M	UNIT PRICE	AMOUNT	TAX
222677	FERRARI MISC PISTON TYPE BORE 3.080 DOME HEIGHT 385 COMP. DIST 1.170 PISTON WEIGHT 281	12	12	EA	115.78	1389.36	
728-1250-MW	WIRE LOCK	24	24	EA	2.47	59.28	
728-2250-12-520	SE STRAIGHT WALL PIN	12	12	EA	18.97	227.64	
204267+010	Ring Set	3	3	EA	72.00	216.00	
PF-PistonFeature	PIN FIT	12	12	EA	5.00	60.00	
CD-PistonFeature	CONTACT REDUCTION	12	12	EA	4.00	48.00	
AG-PistonFeature	ALUM GROOVE	12	12	EA	4.00	48.00	
WM-PistonFeature	MILL SKIRT STD WNDML	12	12	EA	0.00	0.00	
RETURN SAMPLE							
REC# 334403	Credit card payment	AUTH. # 186442				1044.07	
					NET AMOUNT:	2048.28	
					FREIGHT:	19.79	
					SUBTOTAL:	2068.07	
					LESS PAYMENTS:	2068.07	
					TOTAL DUE:	0.00	
THANK YOU FOR YOUR ORDER							

RETURN POLICY

All returns require a "Return Materials Authorization" (RMA) number, available from the JE/SRP sales department. Shelf item returns will incur a 10% restocking fee and must be returned within 90 days. Custom pistons are returnable only for defects in workmanship or materials in the as received condition. Under no circumstances will parts be returnable after 90 days. Please check packaging for complete details regarding return policy. JE Pistons/SRP reserves the right to make product improvements /changes without notice & without incurring liability with respect to similar products previously manufactured.

CUSTOMER COPY

INVOICE-101-JE-SRP

Parts and Accessories
for Ferrari Automobiles



5242 ROYAL WOODS PKWY.
SUITE 150
TUCKER, GA 30084

SOLD TO

SALESPERSON		1-800 638-1444		CUST. ORDER NO.		RETAIL	WHSLE	OUT OF ST.	DATE
CHRIS@#23		(770) 934-6857 FAX NUMBER		(770) 493-8852 LOCAL NUMBER			X	Y	02/18/04
TERMS		SHIPPING INSTRUCTIONS		RESALE NUMBER		CREDIT CARD NUMBER - EXPIRATION DATE		PAGE	INVOICE NO.
CREDIT CARD		UPS GROUND						1 OF 1	53515
W/H	LINE	QTY.	SHIP	B/O	PART NO.	DESCRIPTION	LIST PRICE	NET PRICE	EXTENSION
	1	3	3	0	521767	SYNCRD RING 246/DAYTONA	122.50	100.00	300.00
	2	1	1	0	521768	SYNCRD RING 2nd	122.50	100.00	100.00
	3	1	1	0	521769	SYNCRD RING	122.50	100.00	100.00
	4								
	5								
	6								
	7								
	8								
	9								
	10								
	11								
	12								
	13								
	14								
	15								
	16								
	17								
	18								
	19								
	20								
	21								
	22								
	23								
	24								
SUB TOTAL:								500.00	
RETURNS REQUIRE COPY OF INVOICE AND RETURN AUTHORIZATION #									
BACKORDERS TO FOLLOW			NO. PKGS.		ZONE	WT.	SHIPPING CHGS.	SALES TAX	TAXABLE AMOUNT
YES ☐ NO ☒			ID # 5232		1	255R 2	12.50		
								INVOICE TOTAL →	512.50

IMPORTANT!! SUBJECT TO CONDITIONS ON REVERSE SIDE. PLEASE READ REVERSE SIDE.

[eBay home](#) | [pay](#) | [my eBay](#) | [sign in](#) | [help](#)[Home](#) | [Browse](#) | [Search](#) | [Sell](#) | ["How To" Center](#) | [Services](#)[Back to list of items](#)Listed in category: [eBay Motors](#) > [Parts & Accessories](#) > [Collector Car & Truck](#) > [Other Parts](#)

Vintage Ferrari Fiat Alfa Lancia Tool Bag / Jack Safety

Item number: 2470209846

You are signed in

**Your PayPal payment has been sent. Thank you.**[Shipment Status >](#)[View payment status](#)

Leave feedback for zompster if you have already received this item.

Why leave feedback? Your feedback lets other eBay users know what your experience has been with this seller.eBay will never ask for your password or credit card number through email. [Learn more.](#)[Go to larger picture](#)Winning bid: **US \$1,025.00**Ended: Apr-03-04
14:42:34 PSTStart time: Mar-27-04
14:42:34 PSTHistory: 16 bids (US
\$9.99 starting bid)

Winning bidder: (15 ★)

Item location: St. Louis, MO
United States /St. Louis

Ships to: Worldwide

[Shipping and payment details](#)

Seller information

zompster (191 ★)

Feedback Score: 191

Positive Feedback: 100%Member since Dec-31-01 in
United States[Read feedback comments](#)[Ask seller a question](#)[View seller's other items](#)

Description

This is an original Tool Bag with Jack, Lead Hammer, and Road Safety Reflector in Original Red Rubber Case. The Tool Bag is leather like vinyl with brass rivets and leather straps (working but brittle). It measures 20" wide by 6" tall. It is not ripped or torn and has some oil stains and surface scratches. But in very good condition overall. The jack is functional and in excellent condition has slight chips and scratches. The reflector and case are in perfect condition and are stamped Bellux CH-1-624 SF -H-6313 Brevetto Bellu Seregno ITALY. Lead hammer is in good condition, it shows signs of wear on handle and hammer head is used and dented from blows. Should fit vintage Ferrari,

DAYTON WHEEL CONCEPTS, INC.

115 COMPARK ROAD
DAYTON, OH 45459
(937)438-0100
(937)438-1215 FAX



INVOICE NO: 114938

PAGE: 1

DATE: 04/12/04

INVOICE TYPE: REGULAR INVOICE

R
E
M
I
T

DAYTON WHEEL CONCEPTS
ATTN: ACCOUNTING
115 COMPARK ROAD
DAYTON, OH 45459

B
I
L
L
T
O

0

ORDER#	P.O. NUMBER			SHIP VIA	TERMS
S084465	330GT 2+2		Y	0.00	UPS-Residential Net Mastercard
LINE/REL.	QTY. ORDERED	QTY. SHIPPED	QTY. BACK ORDERED	UNIT PRICE	EXTENDED PRICE
1	1.000	1.000	0.000	335.00000	335.00
	Item: 00420				
	Description: BORRANI (FLAT) RST STN				
	U/M: EA				
	Date Shipped: 04/12/04				
	*** INSURE FOR \$500 ***				
	*** SIGNATURE REQUIRED ***				
2	1.000	1.000	0.000	50.00000	50.00
	Item: 07040				
	Description: EXTRA WORK REQUIRED				
	U/M: EA				
	Date Shipped: 04/12/04				
	REPAIR RIM				

ORIGINAL INVOICE

SALES AMOUNT	385.00
MISC CHG	0.00
FREIGHT	15.52
SALES TAX	0.00
PREPAID	400.52
TOTAL	0.00



Packing Slip

SupplyConcepts.com,
Inc.
70 S. Val Vista Drive
Suite A3 Box 618
Gilbert, AZ 85296

Order Date: 4/20/2004
Purchase Order:

Ship Date: 5/4/2004
Customer Contact:

Ship To:

ProToolsDirect Order ID: 4523

Part #	Product Name	Unit Type	Order Qty	Backorder Qty	Ship Qty
5647	Proto 5647 3/4", Drive 2-1/2" Ratchet Adapter	EACH	1		(1)

Comments: Backordered items will ship as they become available.

ACCOUNT #
BILL TO:

ORDER #

SHIP TO:

WHSE LOC.	QTY.	ITEM NO.	DESCRIPTION	UNIT PRICE	EXT. PRICE
AA04EE05 ξ	1	46001 ZP	Glyptal Red Brush On 1 qt	25.99	25.99
AK00EE03 ρ	1	10113 Z	Metal Blackening System	39.99	39.99

04/29/04 01NT01A 1NT01 04/29/04 0000355896 10 01

Net Product \$	65.98
Ship & Processing	12.95
Total Shipment \$	78.93
Amt Charged to MC	78.93

THANK YOU FOR YOUR ORDER



321 KISHIMURA DRIVE
GILROY, CA 95020
(408) 842-6667 • FAX: (408) 842-6673

INVOICE

INVOICE NO.	158250
CUSTOMER NO.	MISC50

BILL TO:

SHIP TO:

SHIP VIA		F.O.B.		TERMS		SALESPERSON	
Ups Blue		Gilroy		MasterCard			
SHIP DATE	ORDER DATE	S.O. #	ORDERED BY		P.O. #	RESALE #	
05/21/04	05/21/04						
ORDERED QUANTITY	SHIPPED QUANTITY	TAX	ITEM NUMBER ITEM DESCRIPTION			UNIT PRICE	EXTENDED PRICE
6	6	Y	41540.014 PUMP JET GASKET CAN USE 41530.012			0.92	5.52
3	3	Y	83101.150 CARB GASKET			0.67	2.01
3	3	Y	41530.001 GASKET			0.92	2.76
6	6	Y	41530.004 GASKET			0.92	5.52
3	3	Y	10016.401 PRIMARY O/S DCL,DCZ,DCF			69.16	207.48
3	3	Y	10016.409 SECONDARY O/S DCL,DCZ,DCF THROTTLE SHAFT			69.16	207.48
12	12	Y	64570.009 INSPECTION COVER FIXING SCREW / THROTTLE PLATE SCREW			2.13	25.56
1	1	N	LABOR TO REBUILD CARBS			1,300.00	1,300.00

PRINT DATE 05/21/04
PRINT TIME 10:00:50 AM
PAGE # 2

TOTAL PAID 0.00
CREDIT APPLIED
BALANCE DUE 2,030.84

SUBTOTAL 1,960.99
SHIPPING /HANDLING 69.85
TAX
INVOICE TOTAL 2,030.84

Prepared By: Jason

TERMS AND CONDITIONS ON REVERSE SIDE.

Fri.21 May 2004 10:0:54



**PIERCE
MANIFOLDS**

321 KISHIMURA DRIVE
GILROY, CA 95020
(408) 842-6667 • FAX: (408) 842-6673

INVOICE

INVOICE NO.	158250
CUSTOMER NO.	MISC50

BILL TO:

SHIP TO:

SHIP VIA		F.O.B.		TERMS		SALESPERSON	
Ups Blue		Gilroy		MasterCard			
SHIP DATE	ORDER DATE	S.O. #	ORDERED BY		P.O. #	RESALE #	
05/21/04	05/21/04						
ORDERED QUANTITY	SHIPPED QUANTITY	TAX	ITEM NUMBER ITEM DESCRIPTION			UNIT PRICE	EXTENDED PRICE
3	3	Y	41655.008 GASKET			6.58	19.74
6	6	Y	99005.071 DCZ, DCS, DCL BASE GASKET			2.99	17.94
12	12	Y	58445.001 FIXING PIN			1.26	15.12
3	3	Y	41705.011 TOP COVER GASKET DCZ, DCL, DCF,			8.31	24.93
3	3	Y	83102.070 NEEDLE VALVE GASKET			0.99	2.97
3	3	Y	79503.200 NEEDLE & SEAT			20.03	60.09
6	6	Y	41540.001 GASKET			0.92	5.52
6	6	Y	64590.003 SCREW			1.26	7.56
12	12	Y	47600.007 SPRING FOR ADJUSTING OR THROTTLE STOP SCREW			2.13	25.56
6	6	Y	64750.001 IDLE MIXTURE SCREW			3.54	21.24
3	3	Y	32610.005 SPLIT PIN			1.33	3.99

PRINT DATE 05/21/04
PRINT TIME 10:00:50 AM
PAGE # 1

TOTAL PAID
CREDIT APPLIED
BALANCE DUE

SUBTOTAL
SHIPPING /HANDLING
TAX

INVOICE TOTAL

Prepared By: Jason

Continued on Next Page.

TERMS AND CONDITIONS ON REVERSE SIDE.

Fri 21 May 2004 10:00:54

EUROPEAN & MIDTOWN

FOREIGN CAR SPARES AND ACCESSORIES

212 BURNET AVE. SYRACUSE, N.Y. 13203-2335 U.S.A.

Phone (315) 422-2187 Fax (315) 476-9421

- ☐ BRITISH USED AUTO PARTS
☐ EUROPEAN AUTO PARTS
☐ MIDTOWN AUTO BODY SERVICE CORP.
☐ MIDTOWN AUTO BOOKS

15319

CUSTOMER ORDER NO.	e-bay	PHONE	DATE 06/06/04	
NAME				
ADDRESS				
SOLD BY CASH C.O.D. CHARGE ON ACCT. MDSE. RETURNED PAID OUT				
QTY	DESCRIPTION	LIST EACH	NET EACH	AMOUNT
	e-bay#7903590734			24.95
	Girling Caliper Kit			
	SP2559			
	postage/handling/insurance			8.00
			SALES TAX	
RECEIVED BY	Paid Via PayPal		TOTAL	32.95

No Return of Special Order Parts
No Return of Electrical Parts
25% Stocking Charge on Returns
No Claims or Returns without this Bill
No Cash Refunds
No Returns After 5 Days

A finance charge of 1 1/2% per month (18% per annum) will be charged on all accounts over 30 days.

VISIT US ON THE WEB

at

www.britishusedautoparts.com

www.englishautoparts.com

www.midtownauto.com

E-mail: midtown@twcnny.rr.com

Parts and Accessories
for Ferrari Automobiles



5242 ROYAL WOODS PKWY.
SUITE 150
TUCKER, GA 30084

SOLD TO

SALESPERSON		1-800 638-1444		CUST. ORDER NO.		RETAIL	WHSLE	OUT OF ST.	DATE		
MARK#12		(770) 934-6857		(770) 493-8852		3302+2	X	Y	06/16/04		
TERMS		SHIPPING INSTRUCTIONS		RESALE NUMBER		CREDIT CARD NUMBER - EXPIRATION DATE		PAGE	INVOICE NO.		
CREDIT CARD		UPS 2-DAY						1 OF 1	54758		
W/H	LINE	QTY.	SHIP	B/O	PART NO.	DESCRIPTION	LIST PRICE	NET PRICE	EXTENSION		
	1	1	1	0	99100011	MAIN BRG. SET, .010" ALL 330	495.00	396.00	396.00		
	2										
	3										
	4										
	5										
	6										
	7										
	8										
	9										
	10										
	11										
	12										
	13										
	14										
	15										
	16										
	17										
	18										
	19										
	20										
	21										
	22										
	23										
	24										
BACKORDERS TO FOLLOW					NO. PKGS.	ZONE	WT.	SHIPPING CHGS.	SALES TAX	TAXABLE AMOUNT	INVOICE TOTAL →
YES ☐ NO ☒					ID # 5232	7588 2	15.90				396.00

IMPORTANT!! SUBJECT TO CONDITIONS ON REVERSE SIDE. PLEASE READ REVERSE SIDE.

Parts for Ferrari



MARANELLO AUTO PARTS

5242 ROYAL WOODS PKWY, SUITE 150
TUCKER, GA 30084

since 1958

SOLD TO

1-800 233-7820

FAX (770) 496-0091 | (770) 496-0003

SALESPERSON

MARK @12

CUST ORDER NO

RETAIL

WHSLE

OUT OF ST

DATE

3302+2

X

Y

06/16/04

TERMS

SHIPPING INSTRUCTIONS

RESALE NUMBER

CREDIT CARD NUMBER - EXPIRATION DATE

PAGE

INVOICE NO

CREDIT CARD

SHIP W/TR

1 OF 1

94668

W/H	LINE	QTY	SHIP	B/O	PART NO	DESCRIPTION	LIST PRICE	NET PRICE	EXTENSION
	1	1	1	0	95180130R	FUEL PUMP KIT-SUP 150 (RP)	125.00	85.00	85.00
	2								
	3								
	4								
	5								
	6								
	7								
	8								
	9								
	10								
	11								
	12								
	13								
	14								
	15								
	16								
	17								
	18								
	19								
	20								
	21								
	22								
	23								
	24								
SUB TOTAL:								85.00	85.00

RETURNS REQUIRE COPY OF INVOICE AND RETURN AUTHORIZATION #

BACKORDERS TO FOLLOW

NO PKGS

ZONE

WT

SHIPPING CHGS

SALES TAX

TAXABLE AMOUNT

YES ☐NO ☒

ID # 5232

ZSS

INVOICE

TOTAL →

85.00

IMPORTANT!! SUBJECT TO CONDITIONS ON REVERSE SIDE. PLEASE READ REVERSE SIDE.

FROM:

jstephan@aol.com
Mega Parts
PO Box 249
Coon Valley, WI 54623

Packing List

Date: 6/20/2004 6:06:52 PM**Buyer:**

il

*Created with eBay Seller's Assistant Pro***SEND TO:**

Sale ID	Qty	Auction ID	Item ID	Part Number	Description	Paymnt Date	Paymnt Type	Bid	Tax	Ship	Ins.	Amount
36700	1	2482128086	7932	MP-669-J	New 1966 Ferrari 330 GT T/L lens seals	6/20/2004	PayPal	\$9.99	\$0.00	\$2.00	\$0.00	\$11.99

TOTAL: \$11.99

Thank you for your purchase. Please leave me feedback on eBay.

MOSTLY BRITISH

FOREIGN AUTOMOTIVE SPECIALIST

SPECIALIZING IN PARTS NEW AND USED, SERVICE, AND RESTORATION

JAGUAR, MG'S, AUSTIN-HEALEY, FERRARI, MERCEDES, SUNBEAM AND TRIUMPH

PO BOX 438 12101 NYS RT 12E CHAUMONT NY 13622

TEL: 315-649-2861 FAX: 315-649-4100 E-MAIL: petroske@gisco.net WEB: www.mostlybritish.com

R 423 0266

Invoice

Invoice Number
12175

Invoice Date
6/21/04

1

Customer ID	Customer PO	Payment Terms	
TRB 13		Check	
Sales Rep ID	Shipping Method	Ship Date	Due Date
	UPS Ground		6/21/04

Quantity	Item	Description	Unit Price	Extension
1.00		For 67 Ferrari 330, 2+2, pair used hood hinges, need cleaning and refinishing	125.00	125.00

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH THE NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION, A DELIVERY AT MY RISK. AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON THE ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS HERETO. IT IS ALSO UNDERSTOOD THAT YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE BEYOND YOUR CONTROL. LABOR GUARANTEED, 50 PERCENT OF ORIGINAL COST, FOR 30 DAYS OR 1000 MILES, WHICHEVER COMES FIRST. PARTS GUARANTEED AS PER MANUFACTURER OR SUPPLIERS OWN GUARANTEE. WE CAN NOT BE HELD RESPONSIBLE FOR PROBLEMS THAT MAY OCCUR ON FAULTY PARTS.

SIGNATURE:

DATE:

Subtotal	125.00
Sales Tax	
Freight	10.00
Total Invoice Amount	\$135.00
Payment Received	135.00
TOTAL	0.00



[Home](#)[Browse](#)[Search](#)[Sell](#)["How To" Center](#)[Services](#)[Back to home page](#)Listed in category: [eBay Motors](#) > [Parts & Accessories](#) > [Collector Car & Truck](#) > [Exterior](#)

1960's VINTAGE FERRARI NOS WINDSHIELD WIPER BLADES!!!

Item number: 2483838370

You are signed in

[Add to watch list in My eBay](#)[Go to larger picture](#)Current bid: **US \$49.00**[Place Bid >](#)Time left: **14 hours 50 mins**
5-day listing
Ends Jul-10-04
09:00:38 PDT
[Add to Calendar](#)Start time: **Jul-05-04 09:00:38 PDT**

History: 1 bid (US \$49.00 starting bid)

High bidder: [nunzio828](#) (169 ☆)Item location: **NY**
United StatesShips to: **Worldwide**[Shipping and payment details](#)

Seller information

[roadtonowhere](#) (175 ☆)

Feedback Score: 175

Positive Feedback: 99.4%
Member since Feb-28-02 in
United States[Read feedback comments](#)[Ask seller a question](#)[View seller's other items](#)[Safe Buying Tips](#)

Description (revised)

you are bidding on a brand new pair of Ferrari windshield wiper blades with part number 241.84.280.0.2. there were many brands of wiper blades made for Ferraris in the 60's like Trico and Carello, but if you were to go to the dealer and get a new pair, they would have given you this part number and these blades made in england by aeramic. they are

about 300mm in length. i know that these were for all 330GT cars, but they were probably for others as well. perhaps the 275 cars the GTC cars and others????

look for my other auctions of manuals, pouches, tools and kits, jacks and a wide variety of other hard to find Ferrari items

Subject: Your invoice for eBay purchases - item #2483838370, 2483979262, 1960's VINTAGE FERRARI NOS WINDSHIELD WIPER BLADES!!!, BORRANI 42MM 3 EARED KNOCK OFF/FERRARI. MASERATI, ALFA

Here's the invoice for your items, ttreue!



Dear ttreue,

Thank you for your purchases. The total for your items below is **US \$239.00**.

Please send payment for your eBay purchases

I accept the following payment methods: Cashier's Check/Money Order.

Pay Now

Item #	Item Title	Qty	Price
2483838370	1960's VINTAGE FERRARI NOS WINDSHIELD WIPER BLADES!!!	1	US \$122.50
2483979262	BORRANI 42MM 3 EARED KNOCK OFF/FERRARI. MASERATI, ALFA	1	US \$99.99
Subtotal:			US \$222.49
Shipping and handling via Standard shipping service:			US \$16.51
Total:			US \$239.00

hi tom and thanks for the repeat business. we will accept your personal check for \$239.00. what else are you looking for? we will be back in italy next month shopping for parts Also, look for our new ebay ID: basta-uno for great parts regards Frank and Paul 321 591 7646

Please email me at februno@aol.com if you have any questions.

I offer the following shipping options:

Standard shipping service: US \$16.51


If you want to mail your payment, please send it and include a copy of this email to:

frank e bruno
114 east 90 street
new york, NY 10128
United States

Thank you again for your purchases.

7/13/2004

Subject: Receipt for Your Payment to flmc-mariko



Dear thomas treue,

This email confirms that you, ttreue, have paid flmc-mariko (mari-ko@mbd.nifty.com) \$400.00 USD using PayPal.

Payment Details

Item #	Item Title	Quantity	Price	Subtotal
2485279255	FERRARI DAYTONA ENGINE MOUNT 4pcs 1car	1	\$382.99 USD	\$382.99 USD

Shipping & Handling: \$17.01 USD

Shipping Insurance (not offered) : --

Total: \$400.00
USD

Shipping Information

Shipping Info:

Address Status:

If you have questions about the shipping and tracking of your purchased item or service, please contact flmc-mariko at mari-ko@mbd.nifty.com.

Thank you for using PayPal!
The PayPal Team

Please do not reply to this e-mail. Mail sent to this address cannot be answered. For assistance, [log in](#) to your PayPal account and choose the "Help" link in the footer of any page.

To receive email notifications in plain text instead of HTML, update your preferences [here](#).



**5242 ROYAL WOODS PKWY, SUITE 150
TUCKER, GA 30084**



SOLD TO

FAX (770) 496-0091 (770) 496-0003

MARK @12

DATE _____

EMAIL

X

Y

08/12/04

TERMS

SHIPPING INSTRUCTIONS

RESALE NUMBER

CREDIT CARD NUMBER — EXPIRATION DATE

PAGE

INVOICE NO.

CREDIT CARD

UPS GROUND

OF

95136

RETURNS REQUIRE COPY OF INVOICE AND RETURN AUTHORIZATION #

BACKORDERS TO FOLLOW

NO.

ZONE

WT

SHIPPING CHGS

SALES TAX

TAXABLE AMOUNT

INVOICE

TOTAL →

YES

NO 1

ID # 5232

10

1999, 2000, 2001, 2002, 2003, 2004, 2005, 2006, 2007, 2008, 2009, 2010, 2011, 2012, 2013, 2014, 2015, 2016, 2017, 2018, 2019, 2020, 2021, 2022, 2023, 2024, 2025, 2026, 2027, 2028, 2029, 2030, 2031, 2032, 2033, 2034, 2035, 2036, 2037, 2038, 2039, 2040, 2041, 2042, 2043, 2044, 2045, 2046, 2047, 2048, 2049, 2050, 2051, 2052, 2053, 2054, 2055, 2056, 2057, 2058, 2059, 2060, 2061, 2062, 2063, 2064, 2065, 2066, 2067, 2068, 2069, 2070, 2071, 2072, 2073, 2074, 2075, 2076, 2077, 2078, 2079, 2080, 2081, 2082, 2083, 2084, 2085, 2086, 2087, 2088, 2089, 2090, 2091, 2092, 2093, 2094, 2095, 2096, 2097, 2098, 2099, 2100, 2101, 2102, 2103, 2104, 2105, 2106, 2107, 2108, 2109, 2110, 2111, 2112, 2113, 2114, 2115, 2116, 2117, 2118, 2119, 2120, 2121, 2122, 2123, 2124, 2125, 2126, 2127, 2128, 2129, 2130, 2131, 2132, 2133, 2134, 2135, 2136, 2137, 2138, 2139, 2140, 2141, 2142, 2143, 2144, 2145, 2146, 2147, 2148, 2149, 2150, 2151, 2152, 2153, 2154, 2155, 2156, 2157, 2158, 2159, 2160, 2161, 2162, 2163, 2164, 2165, 2166, 2167, 2168, 2169, 2170, 2171, 2172, 2173, 2174, 2175, 2176, 2177, 2178, 2179, 2180, 2181, 2182, 2183, 2184, 2185, 2186, 2187, 2188, 2189, 2190, 2191, 2192, 2193, 2194, 2195, 2196, 2197, 2198, 2199, 2200, 2201, 2202, 2203, 2204, 2205, 2206, 2207, 2208, 2209, 2210, 2211, 2212, 2213, 2214, 2215, 2216, 2217, 2218, 2219, 2220, 2221, 2222, 2223, 2224, 2225, 2226, 2227, 2228, 2229, 2230, 2231, 2232, 2233, 2234, 2235, 2236, 2237, 2238, 2239, 2240, 2241, 2242, 2243, 2244, 2245, 2246, 2247, 2248, 2249, 2250, 2251, 2252, 2253, 2254, 2255, 2256, 2257, 2258, 2259, 2260, 2261, 2262, 2263, 2264, 2265, 2266, 2267, 2268, 2269, 2270, 2271, 2272, 2273, 2274, 2275, 2276, 2277, 2278, 2279, 2280, 2281, 2282, 2283, 2284, 2285, 2286, 2287, 2288, 2289, 2290, 2291, 2292, 2293, 2294, 2295, 2296, 2297, 2298, 2299, 2300, 2301, 2302, 2303, 2304, 2305, 2306, 2307, 2308, 2309, 2310, 2311, 2312, 2313, 2314, 2315, 2316, 2317, 2318, 2319, 2320, 2321, 2322, 2323, 2324, 2325, 2326, 2327, 2328, 2329, 2330, 2331, 2332, 2333, 2334, 2335, 2336, 2337, 2338, 2339, 2340, 2341, 2342, 2343, 2344, 2345, 2346, 2347, 2348, 2349, 2350, 2351, 2352, 2353, 2354, 2355, 2356, 2357, 2358, 2359, 2360, 2361, 2362, 2363, 2364, 2365, 2366, 2367, 2368, 2369, 2370, 2371, 2372, 2373, 2374, 2375, 2376, 2377, 2378, 2379, 2380, 2381, 2382, 2383, 2384, 2385, 2386, 2387, 2388, 2389, 2390, 2391, 2392, 2393, 2394, 2395, 2396, 2397, 2398, 2399, 2400, 2401, 2402, 2403, 2404, 2405, 2406, 2407, 2408, 2409, 2410, 2411, 2412, 2413, 2414, 2415, 2416, 2417, 2418, 2419, 2420, 2421, 2422, 2423, 2424, 2425, 2426, 2427, 2428, 2429, 2430, 2431, 2432, 2433, 2434, 2435, 2436, 2437, 2438, 2439, 2440, 2441, 2442, 2443, 2444, 2445, 2446, 2447, 2448, 2449, 2450, 2451, 2452, 2453, 2454, 2455, 2456, 2457, 2458, 2459, 2460, 2461, 2462, 2463, 2464, 2465, 2466, 2467, 2468, 2469, 2470, 2471, 2472, 2473, 2474, 2475, 2476, 2477, 2478, 2479, 2480, 2481, 2482, 2483, 2484, 2485, 2486, 2487, 2488, 2489, 2490, 2491, 2492, 2493, 2494, 2495, 2496, 2497, 2498, 2499, 2500, 2501, 2502, 2503, 2504, 2505, 2506, 2507, 2508, 2509, 2510, 2511, 2512, 2513, 2514, 2515, 2516, 2517, 2518, 2519, 2520, 2521, 2522, 2523, 2524, 2525, 2526, 2527, 2528, 2529, 2530, 2531, 2532, 2533, 2534, 2535, 2536, 2537, 2538, 2539, 2540, 2541, 2542, 2543, 2544, 2545, 2546, 2547, 2548, 2549, 2550, 2551, 2552, 2553, 2554, 2555, 2556, 2557, 2558, 2559, 2560, 2561, 2562, 2563, 2564, 2565, 2566, 2567, 2568, 2569, 2570, 2571, 2572, 2573, 2574, 2575, 2576, 2577, 2578, 2579, 2580, 2581, 2582, 2583, 2584, 2585, 2586, 2587, 2588, 2589, 2590, 2591, 2592, 2593, 2594, 2595, 2596, 2597, 2598, 2599, 2600, 2601, 2602, 2603, 2604, 2605, 2606, 2607, 2608, 2609, 2610, 2611, 2612, 2613, 2614, 2615, 2616, 2617, 2618, 2619, 2620, 2621, 2622, 2623, 2624, 2625, 2626, 2627, 2628, 2629, 2630, 2631, 2632, 2633, 2634, 2635, 2636, 2637, 2638, 2639, 2640, 2641, 2642, 2643, 2644, 2645, 2646, 2647, 2648, 2649, 2650, 2651, 2652, 2653, 2654, 2655, 2656, 2657, 2658, 2659, 2660, 2661, 2662, 2663, 2664, 2665, 2666, 2667, 2668, 2669, 2670, 2671, 2672, 2673, 2674, 2675, 2676, 2677, 2678, 2679, 2680, 26

1

100

225 56

IMPORTANT!! SUBJECT TO CONDITIONS ON REVERSE SIDE. PLEASE READ REVERSE SIDE.

Vendio Checkout

Checkout | Order Confirmation

Thank you! Your order has been confirmed.

You can print a copy of this page for your records.

If you have any questions about the status of your order, please [contact me](#).

Payment

I would like to pay via

Visa/Mastercard

Seller's address:

David R Soderquist
4005 Black Gum Place
Greensboro, NC, 27405
United States of America

Shipping**Shipping Address:****Item #2486628795**

Item Ordered

Site Quantity Price Shipping



Title: Ferrari - Factory Led Hammer For Knockoff's

item#: 2486628795

Date: 2004-08-15 08:29:05



1 71.00 FedEx USA
\$10.00

Additional Comment

Soda:

Thanks.

Tom Treue

Shipping: \$10.00

Insurance: \$2.00

Sub Total: \$71.00

Total Due: \$83.00



Subject: eBay Item Won! FERRARI tool roll and jack bag----- very nice (Item #7918041817)

Congratulations



Dear ttreue,

You have agreed to purchase the following eBay item from mammc on Sep-02-04 14:21:22 PDT:

FERRARI tool roll and jack bag----- very nice - Item #7918041817
Please review the seller's payment instructions below. Pay using PayPal, cashier's check/Money order

 (    )

Payment details:

Item price:	US \$1,200.00
Quantity:	1
Subtotal:	US \$1,200.00
Shipping & handling:	
Standard shipping service:	US \$15.00
Shipping insurance per item:	(not offered)
Sales tax:	(None)

Payment instructions from seller:

Buyer pays for shipping anywhere in the US. I can overnight for slightly more. If you are the High Bidder on my item I would like to be contacted within 24 hours of auction end to coordinate the shipping and payment. Payment by Cashiers Check, Wire Transfer or Certified Bank Check or PAYPAL.

Ship-to zip code: 74501

If location is incorrect, please notify the seller and update for your future purchases.

You may also contact the seller via email to complete the sale at mammc@aol.com. If contacting the seller directly, please do so within 3 business days. You should send payment directly to the seller.

This item can be viewed for up to 90 days at:

[http://cgi.ebay.com/ebaymotors/ws/eBayISAPI.dll?](http://cgi.ebay.com/ebaymotors/ws/eBayISAPI.dll?ViewItem&item=7918041817&ssPageName=ADME:B:EOAB:MT:6)

[ViewItem&item=7918041817&ssPageName=ADME:B:EOAB:MT:6](http://cgi.ebay.com/ebaymotors/ws/eBayISAPI.dll?ViewItem&item=7918041817&ssPageName=ADME:B:EOAB:MT:6)

Note: The seller has been sent a separate email to confirm this sale.

Don't forget to leave feedback after the sale is complete.


 PROFESSIONAL
QUALITY
FASTENERS

 1863 Eastman Avenue, Ventura, CA 93003
(805) 339-2200 (800) 826-3045 Fax: (805) 650-0742

INVOICE

INVOICE NUMBER

0356439-IN

CUSTOMER ID

TOMTR

SHIP DATE		P.O. #		ORDER #	ORDER DATE	TERMS	
9/16/2004				0372311	9/16/2004	CREDIT CARD	
QUANTITY			ITEM NO.	DESCRIPTION	PRICE	AMOUNT	
ORDERED	SHIPPED	B.O.					
24	24	0	#	CUSTOM FERRARI ROD BOLT	0.00	0.00	
SPECIALS INVENTORY LOC R5-D2							
24	24	0	#	*AMN12-4	0.00	0.00	
SPECIALS INVENTORY LOC R4-D3							
1	1	0	LC	LOT CHARGE	511.00	511.00	
SHIP VIA				WEIGHT	ZONE	SALES PERSON	
UPS						9999	
TOTAL					511.00		
DISCOUNT					0.00		

PLEASE PAY FROM THIS INVOICE. NO STATEMENT WILL BE SENT.
 NO DEDUCTIONS FROM INVOICE TOTAL WILL BE ALLOWED WITHOUT
 PRIOR APPROVAL.

[eBay home](#) | [pay](#) | [my eBay](#) | [sign out](#) | [site map](#) | [help](#)[Home](#)[Browse](#)[Search](#)[Sell](#)["How To" Center](#)[Services](#)[Back to home page](#)Listed in
category:[eBay Motors > Parts & Accessories > Collector Car & Truck
Parts > Wheels, Tires, & Hub Caps](#)**FERRARI, MASERATI, BORRANI wheel stickers-
NEW!!!**

Item number: 2497075714

You are signed in

[Email to a friend](#)**Congratulations! You won the item! (Click 'Pay Now' to complete your purchase) (The seller has sent you an invoice.)**[Pay Now >](#)**How much should you pay?** You can [request total](#) from the seller.**Have you already received this item?** If so, please [leave feedback](#) for the seller.**Protect your eBay account and reputation by** [creating a unique eBay password](#).**Payment methods accepted:**

- Money order/Cashiers check
- Other - See Payment Instructions for payment methods accepted

[Go to larger picture](#)

Winning bid: **US \$25.34**

Ended: Oct-30-04
17:37:50 PDT

Start time: Oct-23-
04 17:37:50
PDT

History: [3 bids](#) (US
\$19.99 starting
bid)

Winning bidder: ([26](#) ★)

Item location: Gold Hill,
Oregon
United States

Ships to: Worldwide

Shipping costs: Check item
description and
payment
instructions or
contact seller for
details

[Shipping and payment details](#)**Seller information**[carnutz-juno-com](#) ([137](#) ★)

Feedback Score: 137

Positive Feedback: 100%Member since Nov-14-98 in
United States[Read feedback comments](#)[Add to Favorite Sellers](#)[Ask seller a question](#)[View seller's other items](#)[Safe Buying Tips](#)

From: 330GTRegistry [330GTRegistry@parrotbyte.com]
Sent: Monday, March 21, 2005 5:17 PM
To:
Subject: RE: Emergency window crank on eBay

Hi Tom,

I am just getting a bunch of oil filter wrenches back from the plater tomorrow. They are \$165 plus shipping, so \$170 priority mail to you. If you are interested, please mail a check to:

Kerry Chesbro
2908 200th Ave SE
Sammamish, WA 98075

I forgot to answer your question about the FCA nationals in IN. No I won't be going. I went to the one in Monterey last year and was quite disappointed.

I'll take some pictures of my hold down and measurements when I get a chance.

Which email would you prefer that I use for the registry emails?

Regards, Kerry

-----Original Message-----

From:
Sent: Monday, March 21, 2005 6:25 AM
To: '330GTRegistry'
Subject: RE: Emergency window crank on eBay

Hi Kerry,

Thanks for the plier pic and info. If I don't have to pay too much, I might

try for one or both of the eBay pliers. There are some substantial differences between your pliers and both of the eBay items.


My water pump has some light-to-moderate corrosion and I would like to protect it some. I will change the coolant, anyway.

At one time, I applied for a build sheet, complete with sending in pix or ALL the appropriate serial numbers. They didn't provide the certificate for reasons I don't remember. It was so traumatic that I am in no big hurry to try again, but I will, eventually.

What does your spare tire holddown look like and what size is it? I have one that works, but doesn't seem quite right.

Do you have any of the oil filter wrenches for sale?

From: <service@paypal.com>
To:
Sent: Wednesday, March 23, 2005 6:10 AM
Subject: Receipt for Your Payment to corinlu

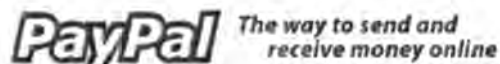

Dear

This email confirms that you, have paid corinlu (CorinLu@Cox.net) \$37.00 USD using PayPal.

Payment Details

Purchased From: corinlu

Item #	Item Title	Quantity	Price	Subtotal
4535345825	PLIERS from OLD PORSCHE,FERRARI,? TOOL KIT..you tell me	1	\$28.77 USD	\$28.77 USD

Shipping & Handling: \$8.23 USD
(includes any seller handling fees)

Shipping Insurance (not offered) : --

Total: \$37.00 USD

Note:

Shipping Information

Shipping Info:

Address Status:

If you have questions about the shipping and tracking of your purchased item or service, please contact corinlu at CorinLu@Cox.net.

Thank you for using PayPal!
The PayPal Team

Your monthly account statement is available anytime; just log in to your account at <https://www.paypal.com/us/HISTORY>. To correct any errors, please contact us through our Help Center at <https://www.paypal.com/us/HELP>.



PROFESSIONAL
QUALITY
FASTENERS

1863 Eastman Avenue, Ventura, CA 93003
(805) 339-2200 (800) 826-3045 Fax: (805) 650-0742

INVOICE

INVOICE NUMBER
0377156-IN
CUSTOMER ID
TOMTR

S
O
L
D

T
O

**HAS BEEN
PAID BY
CREDIT CARD**

SHIP DATE	P.O. #	ORDER #	ORDER DATE	TERMS
4/7/2005	verb.	0389351	3/17/2005	CREDIT CARD

QUANTITY			ITEM NO.	DESCRIPTION	PRICE	AMOUNT
ORDERED	SHIPPED	B.O.				
12	12	0	#	*AU6.020-1	0.00	0.00
1	1	0	LC	LOT CHARGE	590.00	590.00

SHIP VIA	WEIGHT	ZONE	SALES PERSON	TOTAL	590.00
JPS			9999	DISCOUNT	0.00
				FREIGHT	6.77
				TAX	0.00
				INVOICE TOTAL	596.77

PLEASE PAY FROM THIS INVOICE. NO STATEMENT WILL BE SENT.
NO DEDUCTIONS FROM INVOICE TOTAL WILL BE ALLOWED WITHOUT
PRIOR APPROVAL.



PROFESSIONAL
QUALITY
FASTENERS

1863 Eastman Avenue, Ventura, CA 93003
(805) 339-2200 (800) 826-3045 Fax: (805) 650-0742


INVOICE

INVOICE NUMBER
0386992-IN
CUSTOMER ID
TOMTR

S
O
L
D

T
O

⁵⁰¹ HAS BEEN
PAID BY
REDIT CARD

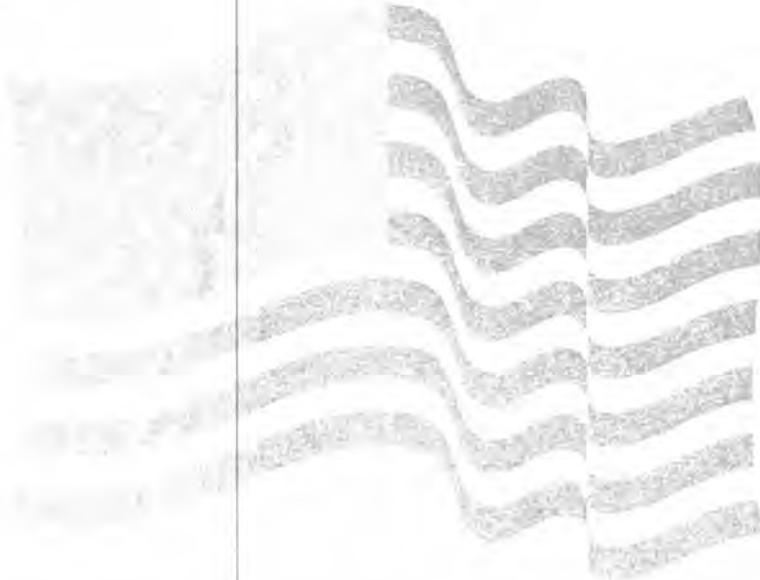SHIP DATE		P.O. #		ORDER #	ORDER DATE	TERMS	
6/28/2005		VERBAL		0393114	4/20/2005	CREDIT CARD	
QUANTITY			ITEM NO.	DESCRIPTION	PRICE	AMOUNT	
ORDERED	SHIPPED	B.O.					
310	310	0	#	*AGW675N-MOD	0.94	291.40	
							
SHIP VIA		WEIGHT	ZONE	SALES PERSON		TOTAL	
BLUE				9999		291.40	
						DISCOUNT	
						0.00	
						FREIGHT	
						5.92	
						TAX	
						0.00	
						INVOICE TOTAL USD ➡	
						297.32	



PLEASE PAY FROM THIS INVOICE. NO STATEMENT WILL BE SENT.

NO DEDUCTIONS FROM INVOICE TOTAL WILL BE ALLOWED WITHOUT PRIOR APPROVAL.

PLEASE PAY FROM THIS INVOICE. NO STATEMENT WILL BE SENT.
NO DEDUCTIONS FROM INVOICE TOTAL WILL BE ALLOWED WITHOUT
PRIOR APPROVAL.

MOSTLY BRITISH

FOREIGN AUTOMOTIVE SPECIALIST

SPECIALIZING IN PARTS NEW AND USED, SERVICE, AND RESTORATION

JAGUAR, MG'S, AUSTIN-HEALEY, FERRARI, MERCEDES, SUNBEAM AND TRIUMPH

12101 NYS RT 12E PO BOX 438 CHAUMONT NY 13622
TEL: 315-649-2861 FAX: 315-649-4100 WEB: www.mostlybritish.com
R 423 0266

Invoice

Invoice Number

1 Invoice Date

1

Vehicle Specifications

Cus	Payment Terms		
	MC		
Sales Rep ID	Shipping Method	Ship Date	Due Date
	UPS Ground		10/11/05

Quantity	Item	Description	Unit Price	Extension
2.00		Ferrari 330 used fan blades, need cleaning	150.00	300.00

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH THE NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION, A DELIVERY AT MY RISK. AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON THE ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS HERETO. IT IS ALSO UNDERSTOOD THAT YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE BEYOND YOUR CONTROL. LABOR GUARANTEED, 50 PERCENT OF ORIGINAL COST, FOR 30 DAYS OR 1000 MILES, WHICHEVER COMES FIRST. PARTS GUARANTEED AS PER MANUFACTURER OR SUPPLIERS OWN GUARANTEE. WE CAN NOT BE HELD RESPONSIBLE FOR PROBLEMS THAT MAY OCCUR ON ALTY PARTS.

Subtotal	300.00
Sales Tax	14.68
Freight	\$314.68
Total Invoice Amount	314.68
Payment Received	0.00
TOTAL	

SIGNATURE:

DATE:





PROFESSIONAL
QUALITY
FASTENERS

1863 Eastman Avenue, Ventura, CA 93003
(805) 339-2200 (800) 826-3045 Fax: (805) 650-0742

INVOICE

INVOICE NUMBER
0400476-IN
CUSTOMER ID
TOMTR

S
O
L
D

T
O

501

**HAS BEEN
PAID BY
CREDIT CARD**

SHIP DATE	P.O. #	ORDER #	ORDER DATE	TERMS
11/1/2005	VRBL	0411251	10/31/2005	CREDIT CARD

QUANTITY			ITEM NO.	DESCRIPTION	PRICE	AMOUNT
ORDERED	SHIPPED	B.O.				
3	3	0	AFN12-1	M8 X 1.00 12PT NUT M10 WRENCH	2.05	6.15

SHIP VIA	WEIGHT	ZONE	SALES PERSON	TOTAL	6.15
UPS			9999	DISCOUNT	0.00
				FREIGHT	5.44
				TAX	0.00
				INVOICE TOTAL USD ➡	11.59

PLEASE PAY FROM THIS INVOICE. NO STATEMENT WILL BE SENT.
NO DEDUCTIONS FROM INVOICE TOTAL WILL BE ALLOWED WITHOUT
PRIOR APPROVAL.

MOSTLY BRITISH

FOREIGN AUTOMOTIVE SPECIALIST

SPECIALIZING IN PARTS NEW AND USED, SERVICE, AND RESTORATION

JAGUAR, MG'S, AUSTIN-HEALEY, FERRARI, MERCEDES, SUNBEAM AND TRIUMPH

12101 NYS RT 12E PO BOX 438 CHAUMONT NY 13622

TEL: 315-649-2861 FAX: 315-649-4100 WEB: www.mostlybritish.com

R 423 0266

Invoice

Invoice Number
13059

Invoice Date
Jan 30, 2006

Page: 1

Bill To:

Ship to:

Sales Rep ID		Shipping Method		Payment Terms	
		UPS Ground		Discover	
				Ship Date	Due Date
					1/30/06

Quantity	Item	Description	Unit Price	Extension
1.00		Ferrari 330 Lucas fan motor, good used, with exchange	250.00	250.00

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH THE NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION, A DELIVERY AT MY RISK. AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON THE ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS HERETO. IT IS ALSO UNDERSTOOD THAT YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO CARS OR ARTICLES LEFT IN CARS IN CASE OF FIRE, THEFT OR ANY OTHER CAUSE BEYOND YOUR CONTROL. LABOR GUARANTEED, 50 PERCENT OF ORIGINAL COST, FOR 30 DAYS OR 1000 MILES, WHICHEVER COMES FIRST. PARTS GUARANTEED AS PER MANUFACTURER OR SUPPLIERS OWN GUARANTEE. WE CAN NOT BE HELD RESPONSIBLE FOR PROBLEMS THAT MAY OCCUR ON FAULTY PARTS.

SIGNATURE:

DATE:

Subtotal	250.00
Sales Tax	
Freight	15.12
Total Invoice Amount	265.12
Payment Received	265.12
TOTAL	



MADENTERPRISE
 35325 FIRCREST
 NEWARK, CALIFORNIA 94560
 (510) 742-6780 FAX (510) 742-6788
 www.madenterprise.com

INVOICE NO.11892

02/01/2006

S
O
L
D

T
O

SHIP DATE SHIPPED VIA TERMS FOB CUSTOMER ORDER NO.

2/10/06 UPS NET ON RECEIPT Newark CA Tom

LN	ORD	SHP	ITEM NO.	DESCRIPTION	PRICE	EXTENDED
* 1	1	/	RJC	Riganti Jack Cover	45.	45.00
2	1	/	RJB	Riganti Jack Bumper	15.	15.00
3	1	/	PHS-SS	Plastic Screwdriver-Small Straight	66.	66.00
* 4	1	/	PHS-MS	Plastic Screwdriver-Medium Straight	77.	77.00
5	1	/	PHS-SP	Plastic Screwdriver-Small Phillips	66.	66.00
* 6	1	/	PHS-MP	Plastic Screwdriver-Med. Phillips	77.	77.00

* RETURNED 2/19/06

Sales Amount: 346.00

Sales Tax at 0. % : 0.00

Sub-Total : 346.00

NET

Shipping & Handling : 23.52
 (includes fuel surcharge if applicable)
 Total : \$369.52

Subject: Re: Tool and Services

In a message dated 3/6/2006 4:26:56 AM Pacific Standard Time, thomas.treue@us.army.mil writes:

I am ready to send my distributors to you for forwarding to Jens Paulsen for rebuild as necessary and proper adjustment. It's been a while (14 months, gulp!); is it still OK to send? I will send with wires for evaluation and possible replacement. How much insurance?

2000\$ send with wires and caps

I have no short rachets

Thomas E Shaughnessy
Ferrari Parts and Sales
1444 N El Camino Real
San Clemente CA 92672
(949) 366 6211
(949) 366 6827 Fax
(949) 378 8405 Mobile
www.vintageferrariaparts.com

Shipment Receipt: Page #1 of 1

PLEASE SAVE FOR YOUR RECORDS

SHIP DATE

Mar 10, 2006

EXPECTED DELIVERY DATE:

Mar 16, 2006 EOD

SHIP FROM:

SHIPMENT INFORMATION:

UPS Ground Commercial

24.62lbs/25lbs Billied

Cust Pack: 17x13x12 in

Declared Value = \$2,000.00

Tracking Number: 1Z730X450310326272

Shipment ID: MAOCY446CNHGJ

Ref 1: -

Ref 2: -

DESCRIPTION OF GOODS:

auto parts

THOMAS E SHAUGHNESSY
1444 N EL CAMINO REAL
SAN CLEMENTE CA 92672-4954
Business

SHIPMENT CHARGES:

Ground Commercial

Service Options

Fuel Surcharge

\$19.20

\$16.00

\$0.67

Total

\$35.87

SHIPMENT THROUGH:

UPS CC MCLESTER OK

MCLESTER OK 74501

500 742-5877

FOR A FULL ONLINE SHIPMENT TRACKING INFO
PLEASE VISIT THE FOLLOWING ADDRESS: www.ups.com
OR CALL 1-800-4USPS (1-800-487-7777)

QUESTIONS ABOUT YOUR SHIPMENT?
CALL 1-800-PICK-UPS (1-800-742-5877)
OR VISIT US SHIPPED THROUGH FACILITY 1161

Signature:

Shipment ID: MAOCY446CNHGJ



SHIP DATE BY 15Ship10m
03/10/2006 03:35 PM Pacific Time

UPS
Please print name, address, and phone number of the shipper and receiver. The shipper must be the owner of the goods being shipped. The receiver must be the person to whom the goods are being shipped. The shipper must be the person who is responsible for the payment of the shipping charges. The receiver must be the person who is responsible for the receipt of the goods. The shipper must be the person who is responsible for the payment of the shipping charges. The receiver must be the person who is responsible for the receipt of the goods.

3/6/2006

Ferrari

FactuurNo 060320058

Rheden, 20-3-2006

Onderdelen / werkzaamheden				
onderdeel no	omschrijving	aantal	prijs per stuk	totaal prijs €
				€ -
				€ -
	Valve adjustmentbolt kit	1	€ 1.575,00	€ 1.575,00
				€ -
	FedEx shipping			€ 50,00
				€ -
				€ -
				€ -
				€ -
				€ -
				€ -
				€ -
				€ -
				€ -
	Sub Totaal			€ 1.625,00

BTW nummer / VAT No			
Klant nummer / Customer No			
	Toeslag voor krediet beperking (bij betaling na 3-4-2006)		
	Finance charge of 2% for (payment after 3-4-2006)		
	BTW / VAT	0,00%	€ -
TOTAAL			€ 1.625,00

Op al onze transacties zijn de BOVAG standaardbepalingen 1997 van toepassing waarover overeenstemmingen is bereikt met de ANWB en de Consumentenbond. Deze standaardbepalingen kunt u inzien bij ons bedrijf en gratis meenemen.


1973.89 USD
1971.03 USD
1966.07
3/23 1958.83

Roelofs Engineering BV
Amhemsestraatweg 271
6991 JG Rheden
tel. +31(0)264951551
fax +31(0)264955025


INGbank Arnhem
65.41.62.476
BIC: INGBNL2A
IBAN: NL17INGB0654162476

KVK 09046188
BTW id. nr. NL806802224B01

Commercial Invoice

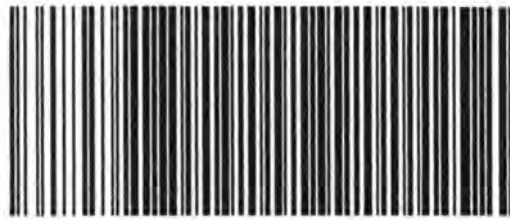

ACI-791898702235

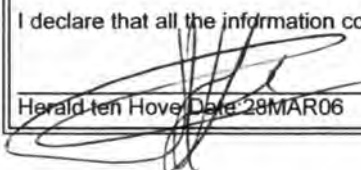ULTIMATE DESTINATION United States		NO. OF PKGS. 1		ECI	
DATE OF EXPORTATION 28MAR06		SHIPPING LABEL NO. 7918 9870 2235		CURRENCY Euro	
SHIPPER/EXPORTER Herald ten Hove 0264951551 ROELOFS ENGINEERING ARNHEMSESTRAATWEG 271 RHEDEN, 6991 Netherlands Shipper's Ref:		IMPORTER Same as Consignee United States Importer Customs Tax ID:			
COUNTRY OF MFR.	DESCRIPTION OF GOODS Packaging type: (FedEx Box)	WEIGHT (KGS)	QTY	UNIT VALUE	COMMODITY VALUE
NETHERLANDS	valve adjustment bolt kit	1.00	1 pieces	1575.00	1575.00
FREIGHT					0.00
INSURANCE					0.00
ADDITIONAL CHARGES					0.00
PURPOSE		TOTAL 1.00			TOTAL CUSTOMS VALUE 1575.00
				Terms of Sale: Free Carrier(FCA/FOB)	
				TOTAL INVOICE VALUE 1575.00	
SIGNATURE OF SHIPPER/EXPORTER:					
I declare that all the information contained in this invoice is true and correct.					
 Herald ten Hove Date 28MAR06					

Thomas Lee Kizer and Laurette Beaudoin Kizer
660 rue de Bois-Guillaume
Lévis, (Québec) G6V 8V2
Canada

30 avril 2006

Subject: Magnesium Fan

Dear Tom;

As you can see, the fans came out quite well. Rewelding with magnesium worked. I used 8mm x 1.25 mm pitch stainless steel set screws. I hope stainless doesn't react with magnesium like it does with aluminum. If you are concerned, by knowing the size, you can change the set screw.

I chose the easy way out when it came to balance. The unbalance was too small for me to measure myself so I used a fan motor and balanced them by trial-and-error and "feel". The use of a bolt and nut as a balance weight allowed me to balance it without permanent modifications. The nut and bolt will also be hidden when installed.

To ensure that the paint stays on, I had them primed with zinc chromate primer just before repainting with TREMCLAD silver gloss paint (closest that I could find to my other fan – which, by the way, is identical except for being die-cast instead of sand cast).

As I said in my last eMail, I'm keeping one fan and sending the other back to you repaired. I want to thank you again for your generosity in offering me the fans.

Tom Kizer



**Receipt****Ship To:****Seller Information:** albydea
alberto.deagostini@portalis.it**Transaction ID:** 4DX080672W520400U

Placed on May 14, 2006

Item #	Item Title	Qty	Price	Subtotal
4638806118	FERRARI 330 Drive shaft mount	1	\$180.00 USD	\$180.00 USD
	Shipping & Handling (includes any seller handling fees) :			\$20.00 USD
	Shipping Insurance (not offered) :			--
	Total:			\$200.00 USD



[eBay home](#) | [Pay](#) | [Register](#) | [sign in](#) | [Site Map](#) | [Community](#) | [Help](#)

Search eBay Motors

[Advanced Search](#)

[Home](#)

[Buy](#)

[Sell](#)

[My eBay](#)

[Buyer Services & Protection](#)

[Tips & Advice](#)

[Back to home page](#)

Listed in category: [eBay Motors](#) > [Parts & Accessories](#) > [Vintage Car & Truck Parts](#) > [Accessories](#)

NOS Ferrari Neiman Key Blank 275 - 365 Daytona,Boxer

Item number: 250008658634

Bidder or seller of this item? [Sign in](#) for your status

[Email to a friend](#) | [Printer Version](#)

This item is pending payment through PayPal.

[Leave Feedback >](#)

To let other eBay users know what your experience has been with this seller, click the **Leave Feedback** button.

Other actions for this item:

You can manage all your items in [My eBay](#) and do the following:

- [View payment details](#) for this item.
- [View PayPal payment](#) for this item.

☐ [Contact Seller](#) about this item.

Additional Options:

- To view other items from this seller, [view seller's other items](#).
- If this listing is similar to an item you want to sell, [list an item like this](#).
- You may [add this seller](#) to your Favorite Sellers in My eBay.

Winning bid: **US \$250.00**

Ended: **Jul-22-06 15:15:26 PDT**

Shipping costs:
US \$2.00

Meet the seller

Seller: [daskey](#) ([242](#) ★)

Feedback: **100% Positive**

Member: since Jun-12-01 in United States

▪ [Read feedback comments](#)

▪ [Ask seller a question](#)



[eBay home](#) | [Pay](#) | [Register](#) | [sign in](#) | [Site Map](#) | [C](#)

Search eBay Motors

[Start new search](#)

[Search](#)

[Home](#)

[Buy](#)

[Sell](#)

[My eBay](#)

[Buyer Services & Protection](#)

[I](#)

[Back to home page](#)

Listed in
category:

[eBay Motors > Parts & Accessories > Vintage Car & Truck Parts > Suspension & Steering](#)

FERRARI 250 and 365 Steering tie rod end NEW set 2 pcs.

Item number: 200026759466

Buyer or seller of this item? [Sign in](#) for your status

[Watch this item](#) in My eBay | [Email to a friend](#)



[View larger picture](#)

[Buy It Now](#) price: **US \$89.00**

[Buy It Now >](#)

End time: **Sep-19-06 07:30:58 PDT**
(4 days 20 hours)

Shipping costs: **US \$16.00**
Standard Flat Rate Shipping
Service ([more services](#))

Ships to: **Worldwide**

Item location: **Torino, Italy**

Quantity: **2 available**

History: [Purchases](#)

You can also: **Watch this item**

[Email to a friend](#) |
[Sell one like this](#)

Meet the seller

Seller: **albydea (7**



Feedback: **99.6% Pos**

Member: **since May-Italy**

- [Read feedback cor](#)
- [Ask seller a questic](#)
- [Add to Favorite Se](#)
- [View seller's othe](#)

Buy safely

1. Check the seller's
Score: 782 | 99.6%
[Read feedback con](#)

2. Learn how you ar

Free Pay
PayPal Protectio
See eligi

Returns: **Seller ac**
returns.
7 Days A

Listing and payment details: [Show](#)

Description

Item Specifics - Item Conditon

Condition: **New**

Set of two pieces right and left steering tie rod end for FERRARI 250 thru FERRARI 365 original ref. no. 76401 (right) and 76402 (left).

The item is brand new and in perfect condition

Shipping worldwide by registered letter 16.00 \$ for each pair.

Thank
You!



15312 Connector Lane, Huntington Beach, California 92649



INVOICE

TEL (714) 898-9763 FAX (714) 893-8297
<http://jepistons.com>TEL (714) 373-5530 FAX (714) 899-290
<http://srp.com>NEW EXPANDED SALES HOURS
BEGINNING AT 6 A.M. PACIFIC TIME.
ALSO CHECK OUT OUR NEW &
IMPROVED WEBSITE AT www.jepistons.comINVOICE NUMBER: 795721
INVOICE DATE: 06-14-07
P.O. NUMBER: RINGSSOLD
TOSHIP VIA: UPS GROUND
SHIP DATE: 06-14-07
DUE DATE:CUST. I.D.: 9815
TERMS: Prepaid-Special Credit Card
P.O. NUMBER: RINGS THOMASP.O. DATE: 06-13-07
JOB ORDER NO.: 615497
SALESMAN: DATA3

PRODUCT I.D.	DESCRIPTION	ORDERED	SHIPPED	U/M	UNIT PRICE	AMOUNT	TAX
RA094-3081 RECH# 512989	SPEC ORDER RING SET Credit card payment	1	1	EA	74.83	74.83	
						84.87	
					TOTAL CREDIT:	84.87	
					NET AMOUNT:	74.83	
					FREIGHT:	10.04	
					SUBTOTAL:	84.87	
					LESS PAYMENTS:	84.87	
					TOTAL DUE:	0.00	
TRACKING #1Z9369514254824070	THANK YOU FOR YOUR ORDER....						
ALL SALES ARE FOB HUNTINGTON BEACH, CALIFORNIA							

RETURN POLICY

All returns require a "Return Materials Authorization" (RMA) number, available from the JE/SRP sales department. Shelf item returns will incur a 10% restocking fee and must be returned within 90 days. Custom pistons are returnable only for defects in workmanship or materials in the as received condition. Under no circumstances will parts be returnable after 90 days. Please check packaging for complete details regarding return policy. JE Pistons/SRP reserves the right to make product improvements /changes without notice & without incurring liability with respect to similar products previously manufactured.

CUSTOMER COPY

INVOICE-101-JE-SRP

TULSA RADIATOR
 RADIATORS, HEATERS, CONDENSERS, GAS TANKS
 4119 SOUTH 87TH EAST AVE.
 TULSA, OK 74145
 PHONE (918) 622-8395

INVOICE

INVOICE NUMBER:
26518
 INVOICE DATE:
Oct 8, 2007
 PAGE:

1

SOLD TO:

Cash-Shop2

SHIP TO:

Cash-Shop2

CUSTOMER ID		CUSTOMER PO		PAYMENT TERMS	
cashsh					
SALES REP ID		SHIPPING METHOD		SHIP DATE	DUE DATE
QUANTITY	ITEM	DESCRIPTION	BACKORDER	UNIT PRICE	EXTENSION
1.00	4	Radiator - Recore: Clean/Reset Inlet & Outlet Tanks on New Core		785.00	785.00
CHECK NO: <i>Paid VISA</i>			SUBTOTAL		785.00
			SALES TAX		
			FREIGHT		
			TOTAL INVOICE AMOUNT		785.00
			PAYMENT RECEIVED		0.00
			TOTAL		785.00

- Engine Remanufacturing
- Parts & Accessories
- Tokico Suspension Products
- Nardi / Mota-Lita / Momo
- Lucas-Girling
- AE / Vandervell
- Bosch

AUTOSPORT SEATTLE

johnnie's
machine
shop
Since 1978

2121 Westlake Avenue,

Seattle, WA 98121 USA

Telephone: (206) 621-1940

www.autosportseattle.com

Inv# 66218/pg 1
Date: 11/08/2007 18:32

Sold By JOHN
Cust # 9184236177

PO 330 FERRARI

Terms:

Paid DC 5/10/07 1200.00
DC 11/15/07 1233.70
2433.70

QUANTITY	LINE	PART NUMBER	DESCRIPTION	CORE	LIST EA.	YOUR COST	EXTENSION	TAX
2.0	LAB2011		RECOND HD FERRA	0.00	400.00	300.00	600.00	N
2.0	LAB2001		SURF HD .0035"	0.00	80.00	60.00	120.00	N
24.0	LAB2051		INST VAL SEAT M	0.00	25.00	20.00	480.00	N
24.0	LAB2030		INST GUIDE	0.00	12.00	7.50	180.00	N
1.0	LAB9902		WELD	0.00	330.00	249.00	249.00	N
2.0	LAB2020		P TEST HD OK	0.00	80.00	60.00	120.00	N
1.0	LAB9999		RESHAPE COMB CH	0.00	200.00	185.00	185.00	N
1.0	NSGUIDES		CUSTOM ID	0.00	16.00	14.50	14.50	N

** THANK YOU FOR THE OPPORTUNITY TO SERVE YOU **

ELECTRICAL OR AND SPECIAL ORDER
PARTS ARE NOT RETURNABLE. INVOICE
MUST ACCOMPANY RETURNS AND

CORES FOR CREDIT. 15% RESTOCKING CHARGE. NO RETURNS AFTER 15 DAYS. LABOR
WARRANTY IS FOR 90 DAYS. WARRANTY DOES NOT INCLUDE, DOWNTIME COSTS OR
CONSEQUENTIAL DAMAGES. NO WARRANTY ON MATERIAL OR LABOR USED FOR RACING.

RECEIVED
BY: X

PAY THIS
AMOUNT

Thank
You!

Quality Specialists

- Engine Remanufacturing
- Parts & Accessories
- Tokico Suspension Products
- Nardi / Mota-Lita / Momo
- Lucas-Girling
- AE / Vandervell
- Bosch

AUTOSPORT SEATTLE

johnnie's
machine
shop
Since 1978

2121 Westlake Avenue,

Seattle, WA 98121 USA

Telephone: (206) 621-1940

www.autosportseattle.com

Inv# 66218/pg 2
Date: 11/08/2007 18:32

Sold By JOHN
Cust # 9184236177

PO 330 FERRARI

Terms: Account

QUANTITY	LINE	PART NUMBER	DESCRIPTION	CORE	LIST EA.	YOUR COST	EXTENSION	TAX
24.0	VWV026109675		VALVE STEM SEAL	0.00	3.14	2.00	48.00	N
12.0	NSINSEAT		330 FERRARI	0.00	16.70	12.60	151.20	N
12.0	NSEXSEAT		330 FERRARI	0.00	16.70	12.60	151.20	N
1.0	S/H999		**SHIP/HANDLING	0.00	0.00	11.20	11.20	N
2.0	S/H999		**SHIP/HAND +SK	0.00	0.00	61.80	123.60	N

** THANK YOU FOR THE OPPORTUNITY TO SERVE YOU **

ELECTRICAL OR AND SPECIAL ORDER
PARTS ARE NOT RETURNABLE. INVOICE
MUST ACCOMPANY RETURNS AND

CORES FOR CREDIT. 15% RESTOCKING CHARGE. NO RETURNS AFTER 15 DAYS. LABOR
WARRANTY IS FOR 90 DAYS. WARRANTY DOES NOT INCLUDE, DOWNTIME COSTS OR
CONSEQUENTIAL DAMAGES. NO WARRANTY ON MATERIAL OR LABOR USED FOR RACING.

RECEIVED
BY: V

PAY THIS
AMOUNT

2433.70

Thank
You!



Black Oxide Industries Inc.

1745 ORANGETHORPE PARK
ANAHEIM, CALIFORNIA 92801
(714) 870-9610 • FAX (714) 447-8322
BLACK OXIDE - PHOSPHATE - PASSIVATE - ZINC PLATING
ELECTROLESS NICKEL - POWDER COATING



PAGE: 1

SHIPPER NO.

1368491

OLD TO

SHIP TO

ORDER

COMMENTS PREPAID BY CREDIT CARD

PROCESSED			PART NUMBER	DESCRIPTION	MATERIAL
EM	QUANTITY	U/M			
1	33	EA.		MISC PARTS	UNKN STEEL

RECEIVE DATE	SHIP DATE
01/16/08	01/17/08
PURCHASE ORDER NUMBER	SHIPMENT
VERBAL/THOMAS	COMPLETE
RHONE NO.	TERMS
() -	
CONTAINERS	SHIP VIA
2 BAGS	UPS

SIGNATURE REQUIRED

BEFORE SIGNING THIS DOCUMENT PLEASE READ TERMS AND CONDITIONS ON REVERSE SIDE. IN SIGNING THIS RECEIPT, I HAVE READ THE TERMS AND CONDITIONS AND FULLY ACKNOWLEDGE ITS CONTENTS AND AGREE THAT THIS DOCUMENT IS EXPRESSLY CONDITIONED ON THE TERMS AND CONDITIONS HEREIN.

ANY WEIGHT OR COUNT DISCREPANCIES MUST BE REPORTED WITHIN (3) DAYS OTHERWISE THE SHIPMENT WILL BE CONSIDERED TO BE CORRECT.

SIGNED BY CUSTOMER OR DESIGNATED AGENT
OR EMPLOYEE OF CUSTOMER.

X

Date

ODE	PROCESSES/TESTS/SERVICES PERFORMED	CODE	PROCESSES/TESTS/SERVICES PERFORMED
155	Special Handling per Customer P.O., and/or Work Order Instructions		
115	Acid Pickle to Remove Existing Rust/Scale and Improve Surface Finish		
198	Commercial Electroless Nickel Coating		
133	Coating Thickness of 0.5 Mils (.0005 in)		

PACKING SLIP



Black Oxide Industries Inc.

1745 ORANGETHORPE PARK
ANAHEIM, CALIFORNIA 92801
(714) 870-9610 • FAX (714) 447-8322
BLACK OXIDE - PHOSPHATE - PASSIVATE - ZINC PLATING
ELECTROLESS NICKEL - POWDER COATING



PAGE: 1

INVOICE NO.

1368491

OLD TO

SHIP TO

RECEIVE DATE	SHIP DATE	INVOICE DATE
01/16/08	01/17/08	01/17/08
PURCHASE ORDER NUMBER	SHIPMENT	
VERBAL/THOMAS	COMPLETE	
RESALE/TAXABLE	TERMS	
TAXABLE	PREPAID	
CONTAINERS	SHIP VIA	
2 BAGS	UPS	

ORDER COMMENTS PREPAID BY CREDIT CARD

PROCESSED			PART NUMBER	DESCRIPTION	MATERIAL	INVOICING			
ITEM	QUANTITY	U/M				QUANTITY	U/M	UNIT PRICE	TOTAL
1	33	EA.		MISC PARTS E NICKEL COM THICK .5 MIL EPA SURCHARGE SALES TAX	UNKN STEEL		LOT	100.00	100.00
						5%		5.00	5.00
						7.75%		8.14	8.14
TOTAL									113.14

ODE	PROCESSES/TESTS/SERVICES PERFORMED	CODE	PROCESSES/TESTS/SERVICES PERFORMED
755	Special Handling per Customer P.O., and/or Work Order Instructions		
715	Acid Pickle to Remove Existing Rust/Scale and Improve Surface Finish		
898	Commercial Electroless Nickel Coating		
833	Coating Thickness of 0.5 Mils (.0005 in)		

ORIGINAL INVOICE



Black Oxide Industries Inc.

1745 ORANGETHORPE PARK
ANAHEIM, CALIFORNIA 92801
(714) 870-9610 • FAX (714) 447-8322
BLACK OXIDE - PHOSPHATE - PASSIVATE - ZINC PLATING
ELECTROLESS NICKEL - POWDER COATING



SHIPPER NO.

RECEIVE DATE	SHIP DATE
	02/13/08

PURCHASE ORDER NUMBER	SHIPMENT

PHONE NO.	TERMS

CONTAINERS	SHIP VIA
1 Bag	U.S. Mail

SIGNATURE REQUIRED

BEFORE SIGNING THIS DOCUMENT PLEASE READ TERM AND CONDITIONS ON REVERSE SIDE. IN SIGNING THIS RECEIPT, I HAVE READ THE TERMS AND CONDITIONS AND FULLY ACKNOWLEDGE ITS CONTENTS AND AGREE THAT THIS DOCUMENT IS EXPRESSLY CONDITIONED ON THE TERMS AND CONDITIONS HEREIN.

ANY WEIGHT OR COUNT DISCREPANCIES MUST BE REPORTED WITHIN (3) DAYS OTHERWISE THE SHIPMENT WILL BE CONSIDERED TO BE CORRECT.

SIGNED BY CUSTOMER OR DESIGNATED AGENT
OR EMPLOYEE OF CUSTOMER.

X

Date _____

OLD TO

SHIP TO

ORDER
COMMENTS

Return Parts To Customer

PROCESSED			PART NUMBER	DESCRIPTION	MATERIAL
ITEM	QUANTITY	U/M			
1	6	Ea.	Buckles		

CODE	PROCESSES / TESTS / SERVICES PERFORMED	CODE	PROCESSES / TESTS / SERVICES PERFORMED

PACKING SLIP

67 FERRARI 9129
EXPENDITURES TO DATE

VINTAGE CONNECTION BILLS PAID (THROUGH 2/11/13) \$248,831.61

VINTAGE CONNECTION BILLS UNPAID, 4/4/13 10,939.88

PAINTING (PAID) 16,722.19

DIRECT COSTS (PAID) 24,214.00

ORIGINAL COST OF CAR 28,000.00

\$328,707.68

DIRECT COSTS

11/13/09

HEADERS	\$ 1025
CLUTCH RELINE	85
CARBS. REBUILD	2031
DISTRIBUTORS	1000
HEADS	2434
STUDS	1300
BAGS + GASKETS	1757
ENG. WORK	1700
PISTONS	2068
VALVES	508
ROCKER ARM UPGRADE	1959
RADIATOR REWORK	785
WHEEL REBUILD	401
DAMPER	187
COATINGS	199
SHIPPING	1275
	\$ 18714
MISC	3000
TIRES	2500
	24214
TOOLS	?

FERRARI 330 GT #9129 RESTORATION

DATE	CHARGE	R. BALANCE	REMARKS
2/5/09	1198.81	1198.81	3042
3/10	5106.82	6305.63	3043
4/3	2776.24	9081.87	3044
5/11	4095.00	13,176.87	3045
6/13	14,552.62	27,729.49	3047
7/8	7,280.00	35,009.49	3048
8/10	14,811.10	49,820.59	3049
9/4	8425.42	58,246.01	3050
10/8	4821.14	63,067.15	3051
11/18	13584.98	76,652.13	3052
2/8/10	5960.81	82,612.94	3053
2/8	2079.51	84,692.45	3053
2/8	7304.82	91,997.27	3053
4/10	13,431.57	105,428.84	3054
5/8	15,548.00	120,976.84	3055
7/9	1866.89	122,843.73	3056
8/6	7097.74	129,941.47	3057
9/19	5200.00	135,141.47	3058
10/14	10270.00	145,411.47	3059
11/5	9730.42	155,141.89	3060
12/12	5980.00	161,121.89	3061
1/9/11	4506.01	165,627.90	3062
3/7	4550.00	170,177.90	3063 (NO FEB 11 BILL)
4/10	8140.81	178,318.71	3064
5/9	7215.00	185,533.71	3065
6/5	8293.06	193826.77	3066
7/24	17284.40	211111.17	3067 + LETTER

DATE	CHARGE	R. BALANCE	REMARKS
8/14/11	8137.81	219248.98	3068
9/30/11	9963.96	229212.94	3069
10/15/11	2470.00	231682.94	3070
7/25/12	16722.19	248405.13	3072 (JOE HALL, PAINTER)
12/10/12	2426.79	250831.92	3073
2/11/13	8582.77	259414.69	3074
3/11/13	6139.11	265553.80	3075 cashed < 3/18
6/1/13	10776.25	276330.05	3076
12/18/13	7919.17	284249.22	3077 FOR NOV7 + DEC8, 2013

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

2/3/2009

Ferrari 330 GT

Dear

I hope you and Judy made through the ice storm ok. Our streets were very slick for two days. Last month we got your car unloaded and put most of the parts on shelves. We also jacked the up to degrease the chassis and wash all the dirt off.

I placed the block assembly on a stand and cleaned the cylinder walls with fresh oil. Our Next step is to remove all of the brake components for inspection. If any part needs to be Sleeved, we will have this done.

Best regards, Chris.

Labor (including car pick-up)
C Campbell 11 hours @ \$65.00
C Eveland 4 hours @ \$65.00

715.00	
<u>260.00</u>	
\$975.00	\$975.00 ✓

Parts and Supplies

3) degreaser @4.19
Milage for car pick-up 280 @.75
Tax

12.75 12.57	
210.00	
1.00 1.05	
\$223.81 223.62	\$223.81 223.62
Total	\$1198.81
	<u>1198.62</u>

paid \$1198.81
#3042
2/5/09

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

Ferrari 330GT

February 28, 2009

Hi Sorry I couldn't make it back in time for the last Ferrari Club meet . We didn't return from Buenos Aires until the 27th of February. Did you have a good turnout?? During the month of February John removed the clutch master cylinder and slave, disassembled, cleaned and inspected and ordered a new master , slave and hose which we have received.. Removed the brake master cylinder and booster, cleaned and inspected and sent out to be rebuilt. Removed, disassembled and cleaned pedal assemble. Bead blasted bracket to remove old pain and corrosion. Made new clutch pedal return spring. Had bracket tumbled to restore finish and has hardware refinished in black oxide.

Removed all brake calipers for rebuild. Bead blasted all caliper parts and hardware. Repaired right rear caliper for stripped threads. Repaired one parking brake arm for damage from broken bolt.

This done all parts were sent out to be black oxide coated or Cad or nickel plated as required. We now have all of these pats in hand.

Tom before we proceed with any reassembly, I think it would be a good idea for you to stop by an give us your thoughts as to how far you want us to go in disassembling and refinishing the balance of the front suspension. This car has been sitting for a long time and most of the paint and plating is in bad shape. It is our opinion that it would be a good idea to cleanup and detail all of this up while we already have so much disassembled., but would like you to come by and give us your thoughts. Give me a call.

During the month of February 2009, the follow work was done on your Ferrari:

J Washam 59 hours @ \$65.00 \$3835.00 ✓ \$3835.00

Materials and parts

Clutch master cylinder	368.40
Clutch slave	106.08
Clutch pedal return spring	2.25
Engine bag	25.50
Caliper rebuild kit	33.54
1-3/4" Cal kit	25.87
Locktabs	6.00
16 caliper bolts	30.75
Black oxide coating	78.00
Zinc plating	36.00
Cad plating	438.00
	\$1150.39
Oklahoma sales tax 8.375%	96.35
	\$1246.74
Freight	25.08
	\$1271.82
Total	\$5106.82 ✓

*paid \$5106.82
#3043
3/10/09*

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

Ferrari 330GT

March 31, 2009

During the month of March, 2009, John reassembled all of the brake calipers and the pedal assembly with a new master cylinder. We have received the rebuilt brake booster and it is ready to be reinstalled when the time comes. We have disassembled the front and rear hubs and rotors. We need to have your thoughts as to how you want us to proceed with the rotors. They have been turned a number of times over the years a while they could be turned down further, they would be under the minimum Ferrari spec regarding thickness.

During the month of March, 2009, the following work was done on your Ferrari:

J Washam 31 hours @ \$65.00	\$2015.00	
C Campbell 2 hours @ \$65.00	<u>130.00</u>	
	\$2145.00 ✓	\$2145.00
	<u>Materials and parts</u>	
Rebuild Ferrari brake booster and master	\$564.00	
Oklahoma sales tax 8.375%	<u>47.24</u>	
	\$611.24	
Shipping	<u>20.00</u>	
	\$631.24 ✓	<u>631.24</u>
	Total	\$2776.24 ✓

*paid \$2776.24
#3044
4/3/09*

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

Ferrari 330GT

April 30, 2009

Hi Tom,

Enjoyed the brunch in Tulsa and Toly's entertaining talk. Too bad the weather was too iffy to drive over in the 550.

During the month of April, we completed the disassembly of the front suspension. As I mentioned, the upper lefthand A Arm bushing had come apart allowing the A Arm to start to gouge the plated cross pin that holds it in place. We are investigating the possibility of finding NOS replacement pins, or having some new ones made. Chris made detailed drawings of the front and rear rotors and they are on order. Once we remove the Steering box, we will proceed with stripping as much of the old black paint in the engine bay and prep it for a new coat of paint. Part of the suspension pieces are plated and part are painted. We will refinish them as indicated. John and Chris are in the process of getting our cars ready to ship to Sonoma for the Wine Country weekend. John has a few more things to do on the racecars and the he will return full time on your car.

During the month of April, 2009, the following work was don on your car:

John Washam 45 hours @ \$65.00 \$2925.00

Chris Campbell 18 hours @ \$65.00 1170.00

Total \$4095.00 ✓

*Paid \$4095.00
3045
5/11/09*

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

May 31, 2009

Ref: Ferrari 330GT

Hi Tom,

John spent the majority of his time this past month stripping all of the old paint and underseal from the engine bay and front suspension, a very tedious job using paint stripper and wire brushes. As you can see under parts and materials, we have order all of the necessary parts to completely rebuild the front suspension. As far as we can tell, the front suspension had not been services or greased for many years and most of the shafts, bushings and bearings were worn out beyond repair. You will be able to see the old parts on your next visit. We also have received four new brake rotors to replace yours which were too worn to turn down.

J Washam 100 hours @ \$65.00	\$6500.00	
C Campbell 16 hours @ \$65.00	<u>1040.00</u>	
	\$7540.00 ✓	\$7540.00

Materials and parts

New front and rear brake rotors	701.25
2 gallon paint remover	91.08
4 clean and strip discs	43.04
2 upper inner suspension pins	430.00
2 lower inner suspension pins	430.00
8 bronze pin bushings inner	296.25
2 suspension bump stops	42.00
8 o rings	16.00
4 spring pivot bushings	98.00
4 sway bar link bushings	20.00
2 silent block bushings	89.25
2 upper outer suspension pins	250.00
2 lower outer suspension pins	250.00
8 bronze pin bushings outer	204.30
2 pilot bushings 18X34	60.20
2 King pins	1662.50
4 king pin bushes	526.75

Page one

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

5/31/09

330Gt Cont'd		
120 bushing pins	90.00	
4 shock boots	86.50	
4 silent block bushings	189.25	
2 bump stop front	288.75	
2 bearings 1AA	129.00	
2 wheel bearings	<u>382.62</u>	
	\$6376.74 ✓	
Oklahoma sales tax 8.375%	<u>534.05</u>	
	6910.79 ✓	
Shipping	<u>101.83</u>	
	\$7012.62 ✓	<u>7012.62</u>
	Total	\$14552.62 ✓

Paid \$14552.62
#3047
6/13/09

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

June 30, 2009

The saga of continuing to clean and repair the engine bay continued this past mont. Once John had finished removing years of accumulated dirt and underseal used to cover up problems, it was apparent that we would have to spend some time replacing rusted out sheetmetal and tubing before we could go back in and repaint the engine bay. Crane as taken a number of before and after pics which will give you an idea of what work was involved. We are now in a position to repaint the engine bay. Chris is working on rebuilding the lower spring holder cups which are both worn and corroded. These are pieces that we cannot buy. We have sent the a arms out to be re-plated and once they return will begin assembly of the front suspension with the new parts.

J Washam 32 hours @ \$65.00	\$2080.00 ✓
C Campbell 6 hours @ \$65.00	390.00 ✓
C Eveland 74 hours @ \$65.00	4810.00 ✓
	\$7280.00 ✓

paid \$7280.00
\$3048
7/8/09

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

July 31, 2009

Ferrari 330GT

Hi Tom,

As you can see in this billing, Crane spent as much time on the paint prep and further sheetmetal repairs to the engine bay area as John spent working on pre fitting the front suspension. We had to have new studs machined for the spring cups. These have to be welded in place using the assembled suspension A arms as Jigs. We also has new aluminum spring seat made as they are not available from anyone. John now has the car back with the bay painted and is starting to assemble the various parts. He will have to assemble each side completely in order to determine the thickness of the brass spacers required to eliminate end plat in the upper and lower A arms. Your old spacers are worn beyond repair. Once he has determined what he need, we can order the necessary pieces and proceed with the final assembly of the front suspension.

During the period from July 1 to July 31, 2009 the following time was spent on your car.

J Washam 94 hours @ \$65.00	\$6110.00 ✓	
C Campbell 6 hours @ \$65.00	390.00 ✓	
C Eveland 93 hours @ \$65.00	<u>6045.00</u> ✓	
	\$12545.00 ✓	\$12545.00

Materials and Parts

Threadloc	31.99
Misc	8.20
WD 40	7.00
Photos	14.57
Primer sealer	35.92
Spray paint	37.50
Sleeve retriever	35.99
Steel bush	6.38
Underseal coating	60.10
Pors 15 rust stopper	49.56
Metal prep 10%	33.92
Body sealer	14.70
Hone kingpins	60.00
Electroless nickel plating	360.00
Paint supplies	172.40
Self etching primer	44.66
Freeze plug	1.39
Masking tape	18.38

Page one

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

7/31/09

July cont'd		
Misc metric nuts and fasteners	68.40	
Machine aluminum spring bases	264.00	
Machine new studs for spring retainers	400.00	
Black oxide plating	102.00	
Epoxy primer	99.20	
Centari black enamel	41.42	
Centari gloss hardener	68.10	
Flattener	55.20	
	\$2090.98	✓
Oklahoma sales tax 8.375%	175.12	✓
	\$2266.10	✓
	Total	\$14811.10

paid \$14811.10
#3049
8/10/09

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

August 31, 2009

Ferrari 330GT

Hi Tom,

Sorry I missed you last weekend, but Both Diana and myself contracted some sort of bug while racing at Laguna Seca. I have pretty much recovered, but Diana is still fighting it. Chris and I are leaving on the 3rd for a race at Lime Rock Ct. and another race the following weekend at Watkins Glen. These two races will wind up the year for us.

As you saw on your recent visit the suspension is rebuilt and back in the car. I think that it is a wise decision to send out the steering unit for a rebuild. Although it was apparent that it has never been taken apart, there was no guarantee that the internal seals were still good after all these years. We now have all of the bits and pieces to reinstall the heater boxes having repaired the leaks in the heater radiators and have found new blower housings to replace the originals which are in bad shape. John is still working on finding a replacement motor for the windshield wipers.

During the period from August 1 to August 31, 2009 the following time was spent on your car:

J Washam 102 hours @ \$65.00	\$6630.00	
C Campbell 3 hours @ \$65.00	<u>195.00</u>	
	\$6825.00 ✓	\$6825.00
Materials and parts		
2 wiper kit motor mounts	\$12.21	
2 Smiths heater blower cases	291.75	
Clean and repair heater cores	160.00	
Primer sealer	26.92	
16 brass suspension shims	398.40	
Freeze plugs	3.50	
Fasteners	47.15	
AN 12 O rings	9.00	
Hone suspension bushings	60.65	
Black oxide parts	80.00	
Zinc plate parts	60.00	
Used right side heater box	<u>295.00</u>	
	\$1444.58 ✓	
Oklahoma sales tax 8.375%	<u>120.98</u> ✓	
	\$1565.56 ✓	
Shipping	<u>34.86</u>	
	\$1600.42 ✓	<u>1600.42</u>
	Total	\$8425.42 ✓

paid \$8425.42 # 3050 9/4/09

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

September 30, 2009

Ref: Ferrari 330GT

Hi Tom,

As you can see we were only able to spend a limited amount of hours on your car in September. The combination of the SCCA runoffs in September, the Mexican Road race on October 15 and the flu all conspired to have to pull John off to do other jobs instead of yours. Since the first of October he has been back on your car and will continue to push forward with getting it finished. In spite of this lost time we did get the following done.

Painted and installed the rebuilt power steering box and linkage, tested cooling fans, cleaned, lubed and stripped and repainted motors and fan blades and assembled and installed on car, cleaned and stripped power steering cooler and tested for leaks. Straightened fins, repainted and installed. Cleaned, stripped, repainted coolant overflow tank and brackets and reinstalled on car. Beadblasted, repaired and coated heater boxes with POR-15 rust preventative. Installed heater cores in boxes and reinstalled on car. Assembled blower fans in new housings and fit to car, fabricate intake screens for housings.

J Washam 55 hours @ \$65.00 \$3575.00 ✓ \$3575.00

Materials and Parts

Hytemp paint	\$13.98	
Krylon spray paint	26.39	
Rebuild power steering box	780.00	
Rebuild power steering pump	234.03	
2 SKF oil seals	18.18	
2 wiper motor mounts	15.90	
	\$1088.48 ✓	
Oklahoma sales tax 8.375%	91.16	
	\$1179.64 ✓	
Shipping	66.50	
	\$1246.14	1246.14
	Total	\$4821.14 ✓

paid \$4821.14
3051
10/8/09

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

October 31, 2009

Ref: Ferrari 330GT

Hi Tom,

During the month of October, John Washam assembled the front hubs, bearings and seals and installed them on the car. He installed the front calipers and temporarily installed the rear calipers in order to have the correct dimensions to fabricate new brake lines. All of the original hydraulic lines were badly rusted and unusable. He also fabricated new steel pressure and return fuel lines as well as new clutch hydraulic line. Sent out wiper motor to be rebuilt and installed it when it was returned. Researched to find source for inner fender weather strip. Researched wiring and fuse panel in order to try and source new fuse holders. Found and ordered new fuel filters. Removed rear suspension and rear axle from car. Found three broken leaves on passenger side rear leaf spring. Started search for replacement springs.

During the month of October 2009, the following time was spent on your car.

J Washam 140 hours @ \$65.00 \$9100.00 ✓ \$9100.00

Materials and Parts

25 feet inner fender weatherstrip	\$146.05
Paint remover	39.58
10 feet 4" DC duct	90.72
10 feet 2 1/2" DC duct	75.85
Wiper motor repair	110.00
Metric fittings	12.50
Inner front wheel bearings	1212.00
Outer front wheel bearings	252.00
3/8" steel tube	28.00
3/16" steel tube	16.40
Ferrari radiator cap	48.25
3 brake hoses	147.00
Large fuel filter	24.55
Small fuel filter	12.40
Front brake pad set	145.00
Hand brake pad set	110.00
Phenolic board for fuses	9.88
8 trailing arm bushings	702.50
4 spring shackle bushings	335.56
4 spring eye bushings	264.56

Page one

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

10/31/09

October 31, 2009 billing cont'd		
50 feet leaf spring rubber	162.50	
2 rear axel seals 48628	11.25	
1 pinion seal	6.00	
Paint supplies	64.80	
Brake line	<u>54.00</u>	
	\$4081.35 ✓	
Oklahoma sales tax 8.375%	<u>341.81</u> ✓	
	\$4423.16 ✓	
Shipping	<u>61.82</u>	
	\$4484.98 ✓	\$4484.98
	Total	\$13584.98 ✓

Paid \$13584.98
3052
11/18/09

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

November 30, 2009

Ref Ferrari 330GT

Hi Tom,

I have been working on getting replacement springs ever since our last billing. Your car has 5 leaf springs, with helper coil springs on the shocks. So far these springs new or used are nonexistent. Earlier 330's and 250's used 10 leaf springs with no helpers. Dimensionally both the 10 and 5 leaf are the same. I have gotten one used 10 leaf from the west coast, but am going to need another since the unbroken left rear spring will not have the same spring rate as the 10 leaf with 5 leaves removed. I am waiting for a second 10 leaf to arrive, but the fellow I am dealing with is very slow. In the meantime, John has cleaned and painted the rear end and we have all of the new bushings in hand ready to install when we get the other spring. We have discussed this question with other knowledgeable Ferrari friends and they all feel that the spring rate of a 10 leaf with 5 leaves removed should be very close to the original 5 leaf that came on the car.

During the month of November the following time was spent on your car:

J Washam 84 hours @ \$65.00 \$5460.00 ✓ \$5460.00

Materials and parts

Black oxide platong	\$98.00
Zinc plating	98.00
Metric fasteners	43.45
Oil seal	33.61
Fuel pump	156.00
3/16 male brake line fitting	2.50

\$431.56 ✓

Oklahoma sales tax 8.375 %

36.14 ✓

~~\$487.70~~ 467.70

Shipping

13.11

~~\$500.81~~ 480.81 ~~500.81~~ 480.81

Total ~~\$5960.81~~ 5940.81

Paid # 5960.81 (15,345.14)
3053
2/8/10
1 of 3

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

December 31, 2009

Ref: Ferrari 330GT

Hi Tom,

It takes me a minute to remember that while I am sending this invoice to McAlester, you are in fact very far away. I hope all is going well with you. As I mentioned in my email, John Washam spent the better part of the short month of December completing the work on the 1950 Cadillac that we are sending to Spain in the second half of January. He was able to spend a small amount of time on your car the last two days of December. We have finally received a complete set of used rear springs from an early 330GT (10 leaves). From these we hope to put together a set of five leaf rears which go on the later 330GT's along with a helper coil spring on the shock absorber. There are simply no new replacement springs available and the few specialty spring manufacturers we approached were not interested in trying to make up a new set.


During the month of December 2009, the following work was done on your car:

J Washam 10 hours @ \$65.00	\$650.00	\$650.00
<u>Materials and Parts</u>		
IGM sticker for power steering pump	\$12.00	
Hand brake pad set	70.00	
Set of used leaf springs	1100.00	
Misc. decals	42.00	
	\$1224.00 ✓	
Oklahoma sales tax 8.375%	102.51 ✓	
	\$1326.51 ✓	
Freight	103.00 ✓	
	\$1429.51 ✓	1429.51
	Total	\$2079.51 ✓

paid # 15,345.14
3053
2/8/10
20F3

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

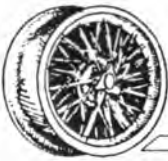

Precision Wire Wheels

714 S. 57th Street • Quincy, IL 62305 • 217-228-8315

INVOICE

T-7455

DATE

12/2/09

CUSTOMER'S ORDER NO.

Judy (915 521 7648)

RECEIVED FROM:

SHIP TO:

6 ea	KNOCK-OFFS, 3 EARED, CONCAVE 42	# 125	ea	# 750.	ea
2 ea	" " " CONVEY, 42	125	ea	250.	ea
4 ea	Engraving, logo & arrows - Smartcare			448.	75
	Deposit ac 667		less	\$ 1000.	ea
	<u>NOTE:</u>		Balance	448.	75 6 12
	3 ea 42 CONCAVE. LH THREAS W/SMARTCARE				
	1 ea " RH THREAS "				
	2 ea " " w/out SMARTCARE				
1 Box	UPS SHIPPING + insurance + uncharge			59.	29
	Thank you! Curt Adams		Balance due.	\$ 508.	04

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

2/4/2010

Ref: 66 Ferrari 330 GT

Clean under rear of chassis. Weld droop limit cable bracket. Touch-up under coating and paint. Sandblast selected leaf springs and paint. Assemble springs with new Teflon liners, rubber support blocks, and bushings.

Repair rusted mount on right bump rubber.

Finish details on rear axle assembly and install into car.

Fit leaf spring assemblies to car and rear axle. Repair or replace rusted hardware as needed.

Fabricate and install new droop limit cables.

Clean, rebuild, and install parking brake cables.

Finish installing brake lines and bleed.

Clean, sandblast, and paint driveshaft assembly. Repair original hardware and install new flex joint.

Assemble shocks and coil springs.

J Washam 103 hours@ \$65.00

6695.00 ✓

6695.00

Parts and Supplies

Leaf spring rubbers

124.00

2) qts. Brake fluid@ 6.99

13.98

3) ½" shrink tubing@ 6.50

19.50

8) 8mm x 1.00 allen bolts@ 1.84

14.72

Parking brake cable

12.70

6) semi flat paint@ 6.49

38.94

4) primer@ 6.49

25.96

10) castle nuts@ .95

9.50

Sandblast leaf and coil springs

155.00

3) 85w140 gear oil@ 6.49

19.47

Leaf spring rubber support kit

120.18

Tax

~~46.40~~ 46.39

Shipping

9.47

~~609.82~~ 609.81

Total

~~609.82~~ 609.81
\$2304.82 2304.81

Paid \$15,345.14
3053
2/8/10
3053

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

March 31, 2010

Ref Ferrari 330GT

Hi Tom,

Time was spent this past month in two separate areas. John disassembled your gearbox and was able to find the parts needed to rebuild it. We are still waiting on some of the parts to be delivered. It appears that this particular "so called" long box was not used on too many cars, but in spite of this we were able to source all of the new parts needed. The box would not have been useable as is. The balance of the time was spent on sorting out the wiring and fabricating a new fuse board. The wiring diagrams we have are only of relative value, as the are very hard to read and decipher. It really comes down to a tedious process of elimination by hooking up the wires we know serve certain purposes and then sorting out the rest. John also rebuilt the blower motors which ran but were pretty noisy. Chris is working on the motor and starting to source some worn or broken parts. Some cam lobes and lifters have slight scoring marks, but we do not feel that they will be detrimental to the correct operation of the motor.

The following time was spent on your car during the month of March 2010.

C Campbell 16 hours @ \$65.00	\$1040.00 ✓
J Washam 159 hours @ \$65.00	<u>10335.00</u> ✓
	\$11375.00 ✓ \$11375.00

Materials and Parts

Flasher	10.15
Light socket	6.76
Mini lamp	4.07
Light socket	5.07
4 lamp pigtails	16.24
Fuses	22.45
Syncro hub (repro)	345.80
2 selector rings	534.75
Lock tab 93747	7.50
Lock tab 95850	7.50
Shift fork	<u>850.00</u>
	\$1810.29 ✓
Oklahoma Sales Tax	<u>151.61</u> ✓
	1961.90 ✓
Shipping	<u>94.67</u>
	\$2056.57 ✓
	2056.57 ✓
Total	\$13431.57 ✓

PD \$13431.57
CK# 3054
4-10-10

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

April 30, 2010

Ref: Ferrari 330GT

Hi Tom

We received the balance of the parts needed to complete the assembly of the gear box and it is now ready to go in the car. Chris continued to work with sourcing parts needed to reassemble the motor. He has ordered a number of items, but we have not received them yet. As you can see from the list of materials and parts, many of these small items were unreasonably expensive, but as with so many of older and newer Ferrari parts one has no choice but to buy from the one or two suppliers that have a lock on the market. I just paid Ricambi \$80.00 each for two rubber gaskets needed to reinstall the fuel pumps on a 550 Maranello. These same parts would have cost a couple of bucks for a Corvette. John had to completely rebuild one of the electric window lift motors as there are no parts available. Going through the wiring is basically a process of elimination. Most of the main systems, lights, turn signals are now fused and connected, but there are still a number of wires to sort out. The Ferrari wiring diagrams are only relatively useful. We have 70 to 75%% of the wiring connected at this time.

During the month of April, the following work was done on your car:

J Washam 107 hours @ \$65.00	\$6955.00
C Campbell 50 hours @ \$65.00	3250.00
C Eveland 28 hours @ \$65.00	1820.00
	<u>\$12025.00 ✓</u> \$12025.00

Materials and Parts

26 feet Brown wire wrapped hose M6	\$374.40
2 collar M6	46.80
52 feet yellow wrapped hose M8	811.20
8 collar M8	211.00
40 feet yellow wrapped hose M 10	652.30
4 collar M10 yellow	117.60
60 Cam cover acorns	215.30
200 metric washers M6 Blk Oxide	39.60
100 metric washers M8	27.00
200 metric washers M8 x 17	165.60
100 metric washers M10	74.00
100 metric hex nuts M6	34.20
20 Metric brass hexnuts M8	48.00
20 metric brass hexnuts M10	48.00
2 cans degreaser	10.00
Door window cable	8.75
6 18mm fiber washers	12.60
10- 12.5 fiber washers	18.00
8- 16mm copper crush washers	16.80

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

4/30/10

cont'd

6- 16.5 copper crush washers	\$12.60	
Loctite	12.00	
Chrome plating	220.00	
Balance pressure plate	<u>75.00</u>	
	\$3250.75	✓
Oklahoma Sales Tax 8.375%	<u>272.25</u>	✓
	\$3523.00	✓
		<u>3523.00</u>
	Total	\$15548.00 ✓

Pd 5-8-10
C# 3055
\$15,548.00

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

June 30, 2010

Ref: Ferrari 330

Hi Tom,

As you are aware, we have not spent much time on your car over the past two months. With racing season upon us we have had to dedicate an inordinate amount of shop time on the race car side of our business. At the same time Chris has had some difficulty in locating parts needed to assemble your motor. We are expecting the needed parts momentarily and once in hand, Chris will assemble the motor.

John will be starting back full time on the Ferrari this month. When do you think you will be coming by?

During the month of June 2010, the following time was spent on your car:

C Campbell 4 hours @ \$65.00	\$260.00 ✓	
J Washam 16 hours @ \$65.00	1040.00 ✓	
	\$1300.00 ✓	\$1300.00

Materials and Parts

Main shaft nut	\$155.90	
Nut	106.45	
Nut	25.00	
Locktab	6.00	
Coupler	46.00	
Bushing	93.45	
5 qts Redline gear oil	60.75	
	\$493.55 ✓	
Oklahoma sales tax 8.375%	41.34 41.33	
	\$534.89 534.88	
Shipping	32.00	
	\$566.89 566.88	566.88
Total	\$1866.89	1866.88

PO 7-9-10
CK# 3056
\$1,866.88

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax (405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

July 31, 2010

Ref Ferrari 330

Hi Tom,

AS you can see we are back working on the Ferrari. John has been able to get both of the electric door windows to work and is waiting on the U channel need to complete the job. He has also repaired the fuel delivery system, including the sender in the tank. Sorting out and reconnecting the wiring continues to be an ongoing job. It appears that there have been many modifications made to the wiring over the years and it takes an inordinate amount of time to sort it out. Chris has received the needed motor parts from Partsource after a long wait and he will start back on the assembly of the motor when we return from Monterey on the 17th of this month. When you come by for a visit, we can take a look at the upholstery situation and determine what you want to do..

During the month of July 2010, the following time was spent on your car.

J Washam 91 hours @ \$65.00 5915.00 ✓ \$5915.00

Materials and parts

The following parts are part of the powersteering+

+Shaft	\$240.00
+Shaft	130.00
+Driven plate	114.00
Timing chains	234.55
2 fuel pump pivot arms repro	36.00
60 mm diaphragm	23.45
Misc.	6.95
Ceramic coating	280.00

\$1064.95 ✓

Oklahoma sales tax 8.375%

89.19 ✓

\$1154.14

Shipping

28.60

\$1182.74 ✓

Total

1182.74

\$7097.74 ✓

paid \$7097.74
#3057
8/6/10

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

August 31, 2010

Ref: Ferrari 330GT

Hi Tom,

John Washam repaired the floor where the transmission mounts and replaced nuts and bolts that were rusted, broken or stripped out. Stripped and cleaned fiberglass transmission tunnel which is cracked and broken. Crane will repair the fiberglass the first week of September. Stripped and painted rear fuel filter assembly and had fittings replated. Made up new fuel lines for pump and filter to fuel tank. Cleaned and checked fuel sending unit. Repair wiring to sending unit. Install pump and filter and paint fuel lines. Wire wiper motor and repair wiper switch. Remove door sills, rear side interior panels and upper trim panels. Trace and repair wiring to interior lights and door switches. Reinstall panels.

We had planned for Chris to continue assembly of your motor upon returning from Monterey, but unfortunately repairs to broken racecars requires his attention in order to have them ready to send to Lime Rock on the 30th. He will continue with the motor when we return from Watkins Glen on the 14th of September. This is our last race outing for the year.

During the month of August 2010, the following time was spent on your car:
J Washam 78 hours @ \$65.00

~~\$5200.00~~

5070.00

No parts were purchased during the month of August

paid \$5200.00
#3058
9/19/10

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

September 30, 2010

Hi Tom,

During the month of September, Crane repaired the fiberglass transmission tunnel which was cracked and missing a piece. John then refitted it to the floor, redrilled the attaching holes, Insulated and installed the cover hardware and reinstalled the cover to the floor. Repaired the bracket that holds the console to the tunnel, made new inner shift boot . Removed door windows to replace window channel. Reinstall windows and adjust. Fabricated new electrical harness for windows and switches. Clean duo more wiring under dash. Installed Fiamm airhorns. Repaired drivers side defroster central box. Replaced defroster hoses. Replaced hoses from heater boxes to defroster box. Repaired choke cable and housing.

This month, Crane will proceed with stripping the paint off the body. Prior to this work, John will remove the front and rear windows as well as the side window door frames. Depending on what appears after the paint has been stripped, we may ask you to come by and take a look. We have ordered all of the new rubber seals needed to reinstall the windshields when the time comes.

During the month of September, the following time was spent on your car:

J Washam 140 hours @ \$65.00	\$9100.00 ✓	
C Eveland 18 hours A \$65.00	<u>1170.00</u> ✓	
	\$10270.00 ✓	\$10270.00

*Paid \$10270.00
3059
10/14/10*

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

October 31, 2010

Hi Tom,

Not too much detail to report this month. John removed all of the trim on the car so that Crane could proceed with stripping off all of the old paint. With the removal of the trim we came across evidence that the car may have been painted fly yellow originally. There are vestiges of this color beneath the door latches and on the door window frames.. Since the car is being taken down to the bare metal, you can repaint it any color you like.

As you can see the car has sustained substantial damage to the right rear corner and across the back of the body where the taillights are located. The quality of the original repair to the areas was very poorly don and the bondo was an inch thick in some places. There is also a large rust hole completely through the back side of the rear inner fender panel. The hole is about 3 inches in diameter and Crane will need to cut it out back to good metal and then patch it on the wheel side and the trunk side..The amount invoice under parts is primarily for all of the rubber pieces we will need to reinstall the front and rear windshields as well as the hood, trunk and doors. These parts all came from Partsource.

During the month of October 2010 the following time was spent on your car:

J Washam 22 hours @ \$65.00	\$1430.00 ✓	
C Eveland 100 hours @ \$65.00	<u>6500.00</u> ✓	
	\$7930.00 ✓	\$7930.00

Materials and Parts

Paint supplies	\$85.53
Rear window seal	391.60
36' door seal	360.00
24' U channel	124.00
11' trunk seal	55.00
10' window scrub molding	84.50
Front windshield seal	431.60
20 gage sheet steel	<u>65.80</u>

	\$1598.03 ✓	
--	-------------	--

Oklahoma sales tax 8.375%	<u>133.84</u> ✓	
---------------------------	-----------------	--

	\$1731.87	
--	-----------	--

Freight	<u>68.55</u>	
---------	--------------	--

	\$1800.42 ✓	
--	-------------	--

Total		
-------	--	--

	<u>1800.42</u>	
--	----------------	--

	\$9730.42 ✓	
--	-------------	--

Paint #9730.42
#3060
Nov 5, 2010

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

November 30, 2010

Ref: Ferrari 330GT

Hi Tom,

During the past month Crane continued working on straightening out the trunk sheet metal area, which you saw during your recent visit. Unfortunately the combination of rust and a poorly executed prior repair have made this a fairly big job.

During the month of November 2010 the following time was sent on your car:

C Eveland 92 hours @ \$65.00 \$5980.00 ✓

Best regards,
John

*paid \$5980.00
#3061
12/11/10*

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net
Tel (405) 525-3313
Fax(405) 525-3316

Chris Campbell
chriscampbell@coxinet.net

December 31, 2010

Ref: Ferrari 330GT

Hi Tom,

The trunk sheet metal is basically finished with the exception of replacing the heavily rusted are at the back of the right rear wheelwell. Crane has removed the rusted metal, but still has to weld in three layers of new metal to fill the hole in. The Pics you sent of the wood in the spare tire area are substantially different from what came with your car. We do feel that the pics better represent the finished product and will wait and see how the pattern you are sending fits.

During the month of December 2010, the following time was spent on the Ferrari:

C Eveland 67 hours @ \$65.00 \$4355.00 ✓ \$4355.00

Materials and parts

Paint supplies

Oklahoma Sales Tax 8.375%

\$139.34

11.67 ✓

\$151.01

151.01

Total

\$4506.01 ✓

*paid \$4506.01
#3062
1/9/11*

www.vintageconnection.com

100 Northeast 50th Street – Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:		Date:
		28-Feb-11
		Vehicle:
		1967 Ferrari 330GT
Hi Tom, Crane has repaired all of the rust in the rear fender and fender well. He still has some hammer and dolly work to do around the rear tail lights. We are very near to the end of the rust problems and should be able to start the painting process soon. Have you decided what color you want?? I purchased the trunk cover on Ebay. We are not sure if it will fit the opening in your trunk, but in the worst of cases will be able to use the hinges and other bits attached to it. John is going thru ebay item by item to see if there might be some other bit or piece we need.		
Labor:	Hours	Rate
C Eveland	70	\$ 65.00
		\$ -
		\$ -
		\$ 4,550.00
		\$ 4,550.00
Parts & Supplies:	Qty.	Cost
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
		\$ -
Sales Tax:	Rate	Amount
	0.08375	\$ -
		\$ -
Shipping & Handling:		
		\$ -
TOTAL DUE		\$ 4,550.00

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:	Date:
	31-Mar-11
	Vehicle:
	1967 Ferrari 330GT

Hi Tom, Glad you were able to stop by last week. As you could see, we are approaching the end of the very time consuming repair and replacement of bent and rusted sheetmetal. Crane is finishing up the areas on the nose around the grill and is proceeding with leading in these areas that need it. As far as the exhaust system goes, our experience has been both good and bad. Stainless exhaust look great and is expensive. Your existing system really looks pretty new and should be installed to see how it works before buying a stainless system. Let us know when you have decided on a color combination. If you decide on Rosso Corso, we will make up some samples and send them to you

Labor:	Hours	Rate		
J Washam	2	\$ 65.00	\$ 130.00	
C Eveland	110	\$ 65.00	\$ 7,150.00	
			\$ -	
			\$ 7,280.00	\$ 7,280.00
Parts & Supplies:	Qty.	Cost		
used trunk boards	1	\$ 275.00	\$ 275.00	
License plate light	1	\$ 194.99	\$ 194.99	
Stars reservoirs	2	\$ 24.00	\$ 48.00	
paint supplies		\$ 108.30	\$ 108.30	
Body leas		\$ 105.50	\$ 105.50	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ 731.79	\$ 731.79
Sales Tax:	Rate	Amount		
	0.08375	\$ 731.79	\$ 61.29	
			\$ 61.29	\$ 61.29
Shipping & Handling:			67.73	
			\$ 67.73	\$ 67.73
TOTAL DUE			\$ 8,140.81	

Pod #8140.81 #3064 4/10/11

www.vintageconnection.com

100 Northeast 50th Street Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:			Date:
			30-Apr-11
			Vehicle:
			Ferrari 330 GT
Hi Tom, During this past month, Crane finished replacing the rusted weatherstripping lips at both lower corners of the rear windshield. He also replaced several areas of rusted through materia on the rear shelf below toe rear window. Two other areas on the front fender rear quarters had new sections inserted to replace rust. He is now completing reappearing badly rusted through areas located on the front A pillars just behind the lower door hinges.. This should be the end of repairing rust damage and Crane will be able to start the preparation gfor the primer base coat.WE will make some paint samples based on the color code you sent and send them off for you to take a look at.			
Labor:	Hours	Rate	
J Washam	111	\$ 65.00	\$ 7,215.00
			\$ -
			\$ 7,215.00
			\$ 7,215.00
Parts & Supplies:	Qty.	Cost	
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
Sales Tax:	Rate	Amount	
	0.08375	\$ -	\$ -
			\$ -
			\$ -
Shipping & Handling:			
			\$ -
TOTAL DUE			\$ 7,215.00

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:	Date:
	31-May-11
	Vehicle:
	Ferrari 330GT

Hi Tom, Since your last visit Crane has finished the rust removal on the body and has completed the lead replacement where necessary. He is now in the process of appling a shin coat of bondo to the body. 95% of this skin coat will be removed by block sanding leaving a smooth true surface to apply the primer coat on. The primer coat will sit bfor about 10 days to allow for curing and shrinkage. Then it will be block sanded several times with finer and finer grit sand paper. This will further true the panel and they will be ready to receive the color coat and the final clear coats. After several weeks of curing, the clear coat will be blocke sanded with several very fine grit paper and the will be power buffed with progressively finer grits od compound. As soon as Crane has the body in primer he will do some final repairs to the doors which are badly cracked where the window frames attache to the doors.I hope to be able to send you some color samples when we return from Sonoma on June 7th.

Labor:	Hours	Rate		
C Eveland	121	\$ 65.00	\$ 7,865.00	
			\$ -	
			\$ -	
			\$ 7,865.00	\$ 7,865.00
Parts & Supplies:	Qty.	Cost		
Paint Supplies		\$ 139.48	\$ 139.48	
Hardboard for spare tire		\$ 21.10	\$ 21.10	
Welding supplies lead		\$ 142.30	\$ 142.30	
Paint supplies		\$ 92.10	\$ 92.10	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	

www.vintageconnection.com

100 Northeast 50th Street Oklahoma City, Oklahoma 73105

			\$	-	5/31/11
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	394.98	\$ 394.98
Sales Tax:	Rate	Amount			
	0.08375	\$ 394.98	\$	33.08	✓
			\$	33.08	\$ 33.08
Shipping & Handling:					
			\$	-	\$ -
TOTAL DUE					\$ 8,293.06

Paid \$8293.06
 #3066
 6/5/11

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:	Date:
	30-Jun-11
	Vehicle:
	Ferrari 330GT

Hi Tom, since your last visit, Chris has almost completed the assembly of your engine. He is waiting on the valve cover studs to complete the job. The assembly sequence requires that the valve covers be bolted in place before the chain covers and distributors can be tightened down. The missing powersteering mounting plate and alternator plate have arrived. I will send you some pics under separate cover. Crane has most of the exterior primed and is working on replacing the front half of the rocker panel under the driver's door. This rocker was replaced once before in the past, but is so out of alignment that it would require over 3/4 inch of bondo to make it appear straight. As I mentioned in my mail of today, faint vestiges of silver paint can be found under close scrutiny. The upholstery is black and not dyed blue. It is possible to see where the original upholstery was glued in place, but we have no idea as to color. You will note that a large part of the parts billing is for rubber gaskets for various applications and for the purchase of the missing powersteering and alternator brackets. When it comes to items like these and other make specific parts, we are at the mercy of the supplier when it comes to price since he usually has no competition.

regards, John	Hours	Rate		
CAMPBELL	64	\$ 65.00	\$ 4,160.00	
Eveland	151	\$ 65.00	\$ 9,815.00	
			\$ -	
			\$ 13,975.00	\$ 13,975.00

Parts & Supplies:	Qty.	Cost	
Paint sample		\$ 74.00	\$ 74.00
paint supplies		\$ 41.62	\$ 41.62
flat wrap		\$ 3.60	\$ 3.60
Paint supplies		\$ 204.31	\$ 204.31
Rust fighter		\$ 37.72	\$ 37.72
application wand		\$ 26.87	\$ 26.87
Primer etching		\$ 159.80	\$ 159.80
Primer converter		\$ 37.40	\$ 37.40
18 inch masking paper		\$ 19.45	\$ 19.45
Semi flat black paint		\$ 7.50	\$ 7.50
silicone sealer		\$ 7.50	\$ 7.50
2 carb cleaner		\$ 7.40	\$ 7.40
4 copper crush washers		\$ 8.20	\$ 8.20

www.vintageconnection.com

100 Northeast 50th Street Oklahoma City, Oklahoma 73105

2 V Prime acrylic		\$	424.32	\$	424.32
2 undercoat hardener		\$	230.25	\$	230.25
12 NKG plugs		\$	28.65	\$	28.65
Spray paint		\$	32.84	\$	32.84
Cam cover studs		\$	104.16	\$	104.16
front indicator gasket		\$	82.80	\$	82.80
Rear lights gaskets		\$	96.00	\$	96.00
Tail light base gasket		\$	28.00	\$	28.00
Side indicator gasket		\$	28.00	\$	28.00
headlamp gaskets		\$	70.00	\$	70.00
headlight grommets		\$	28.40	\$	28.40
doorhandle gaskets		\$	62.47	\$	62.47
undrtrunk gasket		\$	14.60	\$	14.60
bumper bracket gasket		\$	104.40	\$	104.40
bumper guards		\$	302.40	\$	302.40
used power steering bracket		\$	288.00	\$	288.00
used alternator bracket		\$	162.00	\$	162.00
6 acorn nuts		\$	36.00	\$	36.00
4 jack hole plugs		\$	295.00	\$	295.00
				\$	-
				\$	-
				\$	3,053.66
				\$	3,053.66
Sales Tax:	Rate	Amount			
	0.08375	\$ 3,053.66	\$	255.74	
			\$	255.74	\$ 255.74
Shipping & Handling:				38.56	38.56
			\$	-	\$ -
TOTAL DUE				\$ 17,284.40	17322.91

6/30/11

Paid \$17,284.40
3067
JULY 29, 2011

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:		Date:	
		31-Jul-11	
		Vehicle:	
		Ferrari 330GT	
Hi Tom, I sent you a number of pics showing the work being done on the bonnet, That has been completed and the bonnet and trunk lid are ready to be primed for painting. We are still missing the bonnet safety latch and the torsion spring that holds the bonnet open. Petroske says that he may have some used ones, but we have not heard back from him as of today. We have talked to the painter I mentioned and he will come back in the next few days and will give you an estimate on painting the car.			
Labor:	Hours	Rate	
C Campbell	24	\$ 65.00	\$ 1,560.00
c Eveland	92	\$ 65.00	\$ 5,980.00
			\$ -
			\$ 7,540.00
			\$ 7,540.00
Parts & Supplies:	Qty.	Cost	
Rebuild starter and solenoid		\$ 180.00	\$ 180.00
hood nut plates		\$ 27.50	\$ 27.50
Paint supplies		\$ 72.06	\$ 72.06
Paint remover		\$ 56.95	\$ 56.95
Variprime converter		\$ 20.30	\$ 20.30
Plug wires		\$ 56.80	\$ 56.80
Rebuild alternator		\$ 50.00	\$ 50.00
fuel lines		\$ 3.90	\$ 3.90
fiber crush washers		\$ 6.40	\$ 6.40
fiber disc		\$ 30.60	\$ 30.60
aluminum welding rod		\$ 25.34	\$ 25.34
			\$ 529.85
			\$ 529.85
Sales Tax:	Rate	Amount	
	0.08375	\$ 529.85	\$ 44.37
			\$ 44.37
			\$ 44.37
Shipping & Handling:			
			\$ 23.59
			\$ 23.59
			\$ 23.59
			\$ 23.59
TOTAL DUE			\$ 8,137.81

*Paid \$8137.81
3068
8/13/11*

www.vintageconnection.com

100 Northeast 50th Street Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:	Date:
	31-Aug-11
	Vehicle:
	Ferrari 330GT

Hi Tom, During the past month, Crane cut out the rust in the bottoms of the doors and repaired the cracks where the window frames fit into the front of the top of the doors. He also repaired rust on the front of the leading edge of the bonnet. He primed the doors, bonnet and rear deck lid. Using parts from the used spare tire cover, he fabricated a new cove and fitted it in place. After removing and replacing the nut plate on the passenger door, he mounted and fit the doors in place.

Labor:	Hours	Rate		
C Eveland	149	\$ 65.00	\$ 9,685.00	
			\$ -	
			\$ 9,685.00	\$ 9,685.00
Parts & Supplies:	Qty.	Cost		
Paint supplies		\$ 257.40	\$ 257.40	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	

*Paid \$9963.96
#3069
9/30/11*

www.vintageconnection.com

100 Northeast 50th Street Oklahoma City, Oklahoma 73105

[illegible]

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:			Date:	30-Sep-11	
			Vehicle:	Ferrari 330 GT	
Hi Tom, This invoice covers work completed on the Ferrari up to September 20th. As of that date Crane had completed the repairs to the speaker receptacles behind the rear seat. You will recall that I sent you some pics of the work involved in my email dated September 20th. We are hoping to deliver the car to Joe Hall for painting tomorrow October 5th. I am sure that he will keep you informed of his progress.					
Labor:	Hours	Rate			
C Eveland	38	\$ 65.00	\$	2,470.00	
			\$	-	
			\$	-	
			\$	2,470.00	\$ 2,470.00
Parts & Supplies:	Qty.	Cost			
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
			\$	-	
Sales Tax:	Rate	Amount			
	0.08375	\$ -	\$	-	
			\$	-	
Shipping & Handling:					
			\$	-	
			\$	-	
TOTAL DUE			\$	2,470.00	



PROFESSIONAL
QUALITY
FASTENERS

1863 Eastman Avenue, Ventura, CA 93003
(805) 339-2200 (800) 826-3045 Fax: (805) 650-0742

INVOICE

INVOICE NUMBER
0641196-IN
CUSTOMER ID
TOMTR

S
O
L
D

T
O

SHIP DATE		P.O. #		ORDER #		ORDER DATE		TERMS			
12/6/2011		VERBAL		0624031		12/6/2011		CREDIT CARD			
QUANTITY			ITEM NO.		DESCRIPTION		PRICE		AMOUNT		
ORDERED	SHIPPED	B.O.									
32	32	0	#		*AM3.750-1		29.60		947.20		
SHIP VIA		WEIGHT		ZONE		SALES PERSON		TOTAL		947.20	
UPS						9999		DISCOUNT		0.00	
								FREIGHT		10.50	
								TAX		0.00	
								INVOICE TOTAL USD ➡		957.70	

 **PLEASE PAY FROM THIS INVOICE. NO STATEMENT WILL BE SENT.**
NO DEDUCTIONS FROM INVOICE TOTAL WILL BE ALLOWED WITHOUT
PRIOR APPROVAL.

**3400 S. Thomas Rd.
Oklahoma City, OK 73179
Remit payment- P.O. Box 6473
Edmond, OK 73083-6473**

Date	Invoice #
7/25/2012	5548

Bill To

Ship To

P.O. No.	Terms	Rep	Ship Via	FOB	VIN#
	Due on receipt		CPU	OKC	

Description	Qty	Rate	Amount
Ferrari 330 GT.			
Paint & Materials	1	2,250.00	2,250.00T
Labor	1	14,283.75	14,283.75

Subtotal	\$16,533.75
Sales Tax (8.375%)	\$188.44
Total	\$16,722.19
Payments/Credits	\$0.00
Balance Due	\$16,722.19

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:		Date:	
		6-Dec-12	
		Vehicle:	
		Ferrari 330GT	
Disassemble front and rear bumpers, bead blast, clean car, paint in trunk. Take bumpers for plating			
Labor:	Hours	Rate	
C Eveland	18	\$ 70.00	\$ 1,260.00
			\$ -
			\$ 1,260.00
			\$ 1,260.00
Parts & Supplies:	Qty.	Cost	
Bonnet hook		\$ 59.40	\$ 59.40
Chrome plate bumpers		\$ 984.00	\$ 984.00
shop supplies		\$ 18.90	\$ 18.90
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ -
			\$ 1,062.30
			\$ 1,062.30
Sales Tax:	Rate	Amount	
	0.08375	\$ 1,062.30	\$ 88.97
			\$ 88.97
			\$ 88.97
Shipping & Handling:			
			\$ 15.52
			\$ 15.52
			\$ 15.52
TOTAL DUE			\$ 2,426.79

*paid \$2426.79
#3073
12/10/12*

From: service@paypal.com
Sent: Sunday, December 23, 2012 3:43 PM
To:
Subject: Receipt for your PayPal payment to TonyRandazzo308



Dec 23, 2012 13:42:44 PST
Transaction ID: [72H10719T8310673F](#)

Hello

You sent a payment of \$184.74 USD to TonyRandazzo308
(TonyRandazzo308@hotmail.com)

Thanks for using PayPal. To see all the transaction details, log in to your PayPal account.

It may take a few moments for this transaction to appear in your account.

Seller
TonyRandazzo308
TonyRandazzo308@hotmail.com

Note to seller
You haven't included a note.

Shipping address - confirmed

Shipping details
The seller hasn't provided any shipping details yet.



Gift ideas for everyone!

Get inspired. Visit the eBay Gift Guide.

[Shop Now](#)

Description	Unit price	Qty	Amount
Ferrari Emergency Crank Handle OEM Item# 150659994332	\$174.99 USD	1	\$174.99 USD
	Shipping and handling		\$9.75 USD
	Insurance - not offered		—
	Total		\$184.74 USD
	Payment		\$184.74 USD

Payment sent to TonyRandazzo308@hotmail.com

Issues with this transaction?

You have 45 days from the date of the transaction to open a dispute in the Resolution Center.

? Questions? Go to the Help Center at: www.paypal.com/help.

Please do not reply to this email. This mailbox is not monitored and you will not receive a response. For assistance, log

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/525-3313 • Fax 405/525-3316

Client:		Date:	
		6-Feb-13	
		Vehicle:	
Final fit of exhaust manifolds, heat shields, and starter before installing engine. Install heater hose, fab hose clamps, rebuild heater valves, and make the rest of fuel and oil hoses. We had to relocate lower radiator outlet. Install horns, expansion tank, throttle linkage, and choke cable.			
Labor:	Hours	Rate	
J. Washam	113	\$ 70.00	\$ 7,910.00
C. Campbell	3	\$ 70.00	\$ 210.00
			\$ -
			\$ 8,120.00
			\$ 8,120.00
Parts & Supplies:	Qty.	Cost	
engine break-in oil	9	\$ 6.90	\$ 62.10
radiator hardware		\$ 6.48	\$ 6.48
radiator repair		\$ 72.00	\$ 72.00
battery		\$ 111.55	\$ 111.55
1/2' hose		\$ 8.15	\$ 8.15
heater hose		\$ 28.03	\$ 28.03
fuel regulator kit		\$ 44.35	\$ 44.35
power steering hose		\$ 9.65	\$ 9.65
power steering belts	2	\$ 11.45	\$ 22.90
shop supplies		\$ 61.80	\$ 61.80
			\$ -
			\$ 427.01
			\$ 427.01
Sales Tax:	Rate	Amount	
	0.08375	\$ 427.01	\$ 35.76
			\$ 35.76
			\$ 35.76
Shipping & Handling:			
			\$ -
			\$ -
TOTAL DUE			\$ 8,582.77

*Paid \$8582.77
#3074
2/11/13*

www.vintageconnection.com

100 Northeast 50th Street Oklahoma City, Oklahoma 73105

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/523-3313 • Fax 405/523-3316

Client:			Date:	
			5-Mar-13	
			Vehicle:	
			Ferrari 330GT	
Make up hose for oil pressure gauge, Test oil pressure,Good, install throttle cable, install choke cable Paint radiator and install along with necessary hoses. Clean and repair stainless trim to be sent out for polishing. Disassemble clean and polish eggcrate grill. Reassemble.Install battery				
Labor:	Hours	Rate		
J Washam	22	\$ 70.00	\$ 1,540.00	
C Campbell	4	\$ 70.00	\$ 280.00	
C Eveland	56	\$ 70.00	\$ 3,920.00	
				\$ 5,740.00
Parts & Supplies:	Qty.	Cost		
Paint supplies		\$ 184.71	\$ 184.71	
Power steering fluid		\$ 15.78	\$ 15.78	
Paint remover		\$ 52.98	\$ 52.98	
Shop supplies		\$ 114.80	\$ 114.80	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ 368.27	\$ 368.27
Sales Tax:	Rate	Amount		
	0.08375	\$ 368.27	\$ 30.84	
			\$ 30.84	\$ 30.84
Shipping & Handling:				
				\$ -
TOTAL DUE				\$ 6,139.11

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/525-3313 • Fax 405/525-3316

Client:		Date:	
		4-Apr-13	
		Vehicle:	
		1966 Ferrari 330 GT	
Modify exhaust down pipes to fit new headers. Power wash and paint old exhaust system. Install fuel tank assembly. Assemble re-chromed door handle and lock assemblies. Install rear tail lamps, rear bumper and tag lamps, upper trunk seal, and wire trunk lamp. Trace draw in electrical system to faulty voltage regulator. Correct wires to water and oil temp gauges. Remove rear carb manifold and machine for proper carb clearance. Run engine, set timing, and balance carbs. Repair one radiator fan motor.			
Labor:	Hours	Rate	
J. Washam	80	\$ 70.00	\$ 5,600.00
C. Eveland	5	\$ 70.00	\$ 350.00
C. Campbell	4	\$ 70.00	\$ 280.00
			\$ 6,230.00
			\$ 6,230.00
Parts & Supplies:	Qty.	Cost	
primer and paint		\$ 87.25	\$ 87.25
Chrome plating		\$ 1,550.00	\$ 1,550.00
fuel hose and fasteners		\$ 20.40	\$ 20.40
gasoline		\$ 18.00	\$ 18.00
polish all stainless trim		\$ 2,400.00	\$ 2,400.00
antifreeze and distilled water		\$ 33.98	\$ 33.98
grommets		\$ 26.28	\$ 26.28
ceramic coat exhaust down pipes		\$ 138.00	\$ 138.00
voltage regulator		\$ 72.00	\$ 72.00
			\$ -
			\$ -
			\$ 4,345.91
			\$ 4,345.91
Sales Tax:	Rate	Amount	
	0.08375	\$ 4,345.91	\$ 363.97
			\$ 363.97
			\$ 363.97
Shipping & Handling:			
			\$ -
			\$ -
TOTAL DUE			\$ 10,939.88

www.vintageconnection.com

100 Northeast 50th Street Oklahoma City, Oklahoma

73105

paid

10776.25
3076
6/1/13

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/525-3313 • Fax 405/525-3316

Client:	Date:
	7-Nov-13
	Vehicle:
	66 Ferrari 330

Clean and paint door vent window frames, brackets, and hardware as needed. Fit vent windows to frames and install into doors. Fit stainless trim to doors, drip rail, and vent. Install door and side window seals. Re-seal quarter windows to frames. Install headlamp and front parking light assemblies. Install grill assembly. Repair horn button. Remove exhaust and gas tank. Box tank for repair. Re-install tank and exhaust. Install door handles and latches.

*paid \$2919.17
#3077
12/18/13
1 OF 2*

Labor:	Hours	Rate		
J. Washam	79	\$ 70.00	\$ 5,530.00	
C. Campbell	2	\$ 70.00	\$ 140.00	
			\$ -	
			\$ 5,670.00	\$ 5,670.00
Parts & Supplies:	Qty.	Cost		
window channel		\$ 51.48	\$ 51.48	
Door seals		\$ 54.69	\$ 54.69	
vent window seals pair		\$ 187.20	\$ 187.20	
misc hardware		\$ 24.75	\$ 24.75	
Lead for wheel weights		\$ 29.70	\$ 29.70	
Fnt. & Rear window install		\$ 274.93	\$ 274.93	
Heater valve diaphragm		\$ 5.85	\$ 5.85	
Cavis vacuum hose		\$ 13.56	\$ 13.56	
Hood bumpers	9	\$ 8.42	\$ 75.78	
linkage clip		\$ 4.99	\$ 4.99	
primer paint	2	\$ 6.49	\$ 12.98	
Semi flat black paint	2	\$ 6.49	\$ 12.98	
Stainless sheet metal screws		\$ 28.33	\$ 28.33	
Set quarter windows in frames		\$ 80.00	\$ 80.00	

Radiator repair		\$ 133.75	\$ 133.75	
shop supplies		\$ 55.30	\$ 55.30	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ 1,046.27	\$ 1,046.27
Sales Tax:	Rate	Amount		
	0.08375	\$ 1,046.27	\$ 87.63	
			\$ 87.63	\$ 87.63
Shipping & Handling:				
shipping in (Tank 96.00, window seals 9.50)			\$ 105.50	
15) octane fuel @ \$3.60			\$ 54.00	
			\$ 159.50	\$ 159.50
TOTAL DUE			\$ 6,963.40	

OK 12.12.1

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/525-3313 • Fax 405/525-3316

Client:			Date:	
			8-Dec-13	
			Vehicle:	
			66 Ferrari 330 gt	
Install side vents into fenders and rear quarter windows.				
Labor:	Hours	Rate		
J. Washam	13	\$ 70.00	\$ 910.00	
			\$ -	
			\$ -	
			\$ 910.00	\$ 910.00
Parts & Supplies:	Qty.	Cost		
foam seal material		\$ 8.95	\$ 8.95	
light bulbs	4	\$ 1.65	\$ 6.60	
lamp pigtails	2	\$ 5.09	\$ 10.18	
trunk plugs	4	\$ 1.85	\$ 7.40	
shop supplies		\$ 9.10	\$ 9.10	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ -	
			\$ 42.23	\$ 42.23
Sales Tax:	Rate	Amount		
	0.08375	\$ 42.23	\$ 3.54	
			\$ 3.54	\$ 3.54
Shipping & Handling:				
			\$ -	\$ -
TOTAL DUE			\$ 955.77	

*paid \$2919.17
#3077
12/18/13
20F2*

OK Mike

THE VINTAGE CONNECTION, INC.

John E. Harden
johnharden@coxinet.net

Chris Campbell
chriscampbell@coxinet.net

Telephone 405/525-3313 • Fax 405/525-3316

Client:		Date:	
		4-Feb-14	
		Vehicle:	
		1966 Ferrari 330 gt	
Install outer window seals, windows, and adjust. Install interior, front bumper, lower trunk seal, alternator and wiring, air cleaner, and fuel filler lid. Fit, undercoat, and install front inner fenders. Install air ducts to heater boxes. Adjust suspension toe in. Adjust carbs and test drive around 40 miles. Deliver car to Dan Kirkpatrick.			
Labor:	Hours	Rate	
C. Campbell	22	\$ 70.00	\$ 1,540.00
J. Washam	65	\$ 70.00	\$ 4,550.00
C. Eveland	11	\$ 70.00	\$ 770.00
			\$ 6,860.00
			\$ 6,860.00
Parts & Supplies:	Qty.	Cost	
zinc plating		\$ 52.00	\$ 52.00
body j-nuts		\$ 5.99	\$ 5.99
Air filters	3	\$ 15.85	\$ 47.55
undercoating		\$ 28.98	\$ 28.98
alternator belts	2	\$ 11.84	\$ 23.68
battery disconnect		\$ 9.58	\$ 9.58
misc. hardware		\$ 12.25	\$ 12.25
black spaypaint and primer	2	\$ 6.99	\$ 13.98
shop supplies		\$ 32.55	\$ 32.55
			\$ -
			\$ -
			\$ 226.56
			\$ 226.56
Sales Tax:	Rate	Amount	
	0.08375	\$ 226.56	\$ 18.97
			\$ 18.97
			\$ 18.97
Shipping & Handling:			
parts in			\$ 23.50
			\$ 23.50
			\$ 23.50
TOTAL DUE			\$ 7,129.03

20K

www.vintageconnection.com

100 Northeast 50th Street Oklahoma City, Oklahoma 73105

paid \$7129.03
#3029
2/4/14

Timevalve Mfg. Of Florida LLC

2495 Jen Dr.

Unit#7

Melbourne, FL 32940

Invoice

Date	Invoice #
4/14/2014	1611

Bill To

Ship To
pending

P.O. Number	Terms	Rep	Ship	Via	F.O.B.	Project
	e-mail invoice		4/14/2014			

Quantity	Item Code	Description	Price Each	Amount
1	exhaust	1967 Ferrari 330 GT 2+2 (SN9129) complete -with 2 into 1 pipes	5,160.00	5,160.00
1	S.C.P	Spacecoast Plating tips (included in price) painted & ansa decals	0.00	0.00
1	ups	ups N/C	0.00	0.00

*Paid \$5160.00
DC - 4/18/14*

Phone #	Fax #	E-mail	Total	\$5,160.00
(321)254-7200	(321)254-7700	timevalveexhaust@yahoo.com		



DAN KIRKPATRICK INTERIORS

1549 Old Hwy. 33 ~ Chouteau, OK 74337

918/476-6828

DATE

1-20-15

NAME

ADDRESS

CITY, STATE

WORK

COLOR

SERIAL #

START DATE

DELIVER DATE

DESCRIPTION

REAR SEAT CUSHION MODS

DOOR CAPS (4)

RECOVER ALL DASH PARTS

WINDSHIELD PILLARS

STRAIGHTEN CONSOLE TO DASH

3680E SAPPHIRE BLUE LEATHER
BLACK VINYL AS ORIGINAL

I hereby authorize the above restoration work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. You will not be held responsible for loss or damage to vehicle or articles left in vehicle, in case of fire, theft, accident or any other cause beyond your control.

TOTAL

4,150⁰⁰

DEPOSIT

2,000⁰⁰

BALANCE

2,150⁰⁰

SIGNATURE

[Handwritten Signature]

Madera Concepts

55 - B Depot Road • Goleta, CA 93117
(805)962-1579/Fax (805)962-7359

Specializing in exquisite walnut burl dashboard interiors

P A I D
FEB 20 2015

INVOICE

INVOICE #: 00050113

DATE: 2/4/15

Bill To:

Ship To:

Richard Crump

580-370-6396

205 West Maple Ave. Suite 107

Enid, OK 73701

R.O. #/ P.O.		DATE	SHIP VIA	SHIP DATE	TERMS	PG.	
Verbal Greg		2/4/15	2nd DAY AIR	2-20-15	C.O.D. PAID	1	
QTY.	ITEM NO.	DESCRIPTION		PRICE	UNIT	EXTENDED	TX.
1	REFINISH RETURN - WOOD TYPE - SPECIAL FINISH - Note: - DROP SHIP - Note: - Call B4 Shipping	1967 Ferrari 330 GT 2+2 Dash & G.B.D. Hinges - F.W. - Satin - Please Return in Customer's Crate - DROP SHIP TO: Richard Crump - When Finished Take Pictures & Email to: - For Payment		\$730.00		\$730.00	
No. of pcs. / hardware				SALE AMOUNT		\$730.00	
Sale;				SHIP/HNDL		\$172.00	
				SALES TAX		\$0.00	
				TOTAL		\$902.00	
3 pcs. + hardware				BALANCE		\$0.00	

Thank You!

3 pcs. + hardware

6890



DAN KIRKPATRICK INTERIORS

1549 Old Hwy. 33 ~ Chouteau, OK 74337

918/476-6828

DATE FEB. 23 - 2015

NAME _____
ADDRESS _____
CITY, STATE _____
WORK _____

COLOR _____ SERIAL # _____

START DATE _____ DELIVER DATE _____

1967 FERRARI 330
DESCRIPTION

INTERIOR MODIFICATIONS

REAR SEAT CUSHIONS

DOOR CAPS — ALSO ARMRESTS

WINDSHIELD PILLARS

3680E SAPPHIRE BLUE LEATHER

G.A.H.H. HOLLYWOOD, CA

PAID in Full !!
THANKS

I hereby authorize the above restoration work to be done along with necessary materials. You and your employees may operate above vehicle for purposes of testing, inspection or delivery at my risk. You will not be held responsible for loss or damage to vehicle or articles left in vehicle, in case of fire, theft, accident or any other cause beyond your control.	TOTAL	4,250. ⁰⁰
	DEPOSIT	2,000. ⁰⁰
	BALANCE	2,250. ⁰⁰
	SIGNATURE	- 0 -

From: Richard Crump <richardcrumpesq@yahoo.com>
Sent: Thursday, March 05, 2015 3:44 AM
To:
Subject: Fw: 330 INVOICE

I am set to go to Joe Hall's on Friday morning.

The following is an accounting of my time and materials. I was able to complete the job within the time frame and stay on estimate. The only exception is shipping the car at \$1.00/mile.

I hope you find this reasonable and am glad to address any questions you may have.

Richard Crump

330 gt

Invoice:

TIME SPENT: 43.00 hours, as follows:

1.23. Trip to Dan's.

Remove dash, bag and label small parts. Tag wiring.

Photograph all.

Test clock.

Talk with Joe Dichurt about clock repair. Pack and ship clock.

Build crate, pack and ship dash to Madeira. Phone Jeff at Madera several times.

Mask interior and exterior of car. Strip inside of firewall.

Prime and refinish inside of firewall.

Install Dynamat insulation. Install oem-style insulation over the Dynamat.

Remove facias, clean the instruments.

Clean and lube the switches.

Clean the wiring.

Replace/re-insulate all incorrect plastic connectors in harness. (All connections are soldered)

Refinish defroster vents.

Clean and refinish steering column and ignition switch. Repair ignition switch wiring.

Reroute and shorten radio wiring.

Route all miscellaneous ground leads to a common point behind dash, left of glove box.

Reinstall dash. Replace mismatched hardware as necessary.

Replace all dash light bulbs.

Install center console and seats.

COSTS: \$ 692.86, as follows:

Diesel for first trip to Dan's: \$45.00
Shipping: Dash: 120.87. Clock: 66.99
Clock repair 210.00

Shop Supplies: \$300.00

Consisting of:

- Dynamat
- Baggies
- Perm blue
- Fiber Insulation
- Light bulbs for instruments.
- Masking tape
- Rubber tape
- Cigarette lighter
- Primer
- Paint
- Electrical connectors
- Shrink tubing
- Solder
- Solvent
- Metric hardware (nuts, washers, etc.)

TRANSPORT COSTS \$ 525.00 as follows:

2.14 Transport car to Enid. 300 miles:
3. 6 Deliver Car to Moore to paint shop. 225 miles

TOTAL: Labor, 4200 + Costs 742.86 + Transport 525 = \$ 5467.86

For your convenience, the original estimate is pasted below:

Original Estimate: \$5000 + Madera billing. Original budget request was for \$ 6500, to wit:

The following needs to be done:

R&R dash 1/2 day
Pack (wood-crate) and ship dash to wood restoration shop
Dismantle and clean the gauges 2 days
Strip (Mask) and refinish the defroster vent area 1/2 day

Clean the wiring, switches, heater /underdash components 1/2 day
Polish all chrome bezels and related parts 3 hours
Reassemble dash. 1 day
Probably will take two trips to Chouteau 6 hours

Total should be about 45 hours. I think we should budget up to 5000/labor
The wood refinishing by Madera Concepts will be 1029.00 plus S&H.
I would like to have a total budget of 6500. If it takes less time or if the veneer does not have to be replaced, it will be less.

PATRICK OTTIS
1720 TENTH STREET
BERKELEY, CALIFORNIA 94710
BAY NO A12120777

INVOICE NO.

922368

--	--

CUSTOMER'S ORDER: 33067 SOLD BY: 9129 TERMS: CASH ON HAND F.O.B. 82288 MI DATE: 29 JULY 2015

QUANTITY	DESCRIPTION	PRICE	AMOUNT
13 JULY	1 CHECK CHARGING SYSTEM OUTPUT - NONE. THINER CAUSE TO		
	2 DEFECTIVE (NON ORIGINAL) RECHARGER. NOT WILTING TO RECHARGE.		
	3 HAS BEEN MODIFIED - NO GROUND WIRE AND NON FUSION BOND		
	4 WITH PROBLEM BACKED TO LIMITATION SOUT. CUT. BATTERY		
	5 INCORRECT CONNECTORS AT VOLTAGE REGULATOR. INSTALL AND		
	6 HIGHT SHANK TYPE CORRECT CONNECTORS. PARTICULAR NOW		
	7 GROUND WIRE. PINK PILE BACKON WIRE. INSTALL CORRECT		
	8 WIRE VOLTAGE REGULATOR. CHECK CHARGING SYSTEM		
	9 OUTPUT 13.9V @ 3000 RPM. CHECK BATTERY ELECTROLYTE		
	10 LEVELS - GOOD. THINER CHARGE BATTERY OVER NIGHT. 3.0		

PATRICK OTTIS

INVOICE NO.

922369

SI	
A	
C	

CUSTOMER'S ORDER: 33067 SOLD BY: 9129 TERMS: CASH ON HAND F.O.B. 82288 MI DATE: 29 JULY 2015

QUANTITY	DESCRIPTION	PRICE	AMOUNT
19 JULY	1 CHECK SPECIFIC GRAVITY OF BATTERY - (GOOD). REMOVE CHARGES		
	2 AURBAC. WITH MOTOR & TEMPERATURE. REMOVE SPARK PLUGS,		
	3 CHECK MOORE COMPRESSION AND NOTE:		
	4 #12 165 PSI 170 PSI #1		
	5 #11 170 PSI 165 PSI #2		
	6 #10 170 PSI 165 PSI #3		
	7 #9 170 PSI 165 PSI #4		
	8 #8 165 PSI 160 PSI #5		
	9 #7 155 PSI 165 PSI #6		
	10 SODA BAST, RAILTALL, TORQUE AND CONNECT SPARK PLUGS.		

PATRICK OTIS

INVOICE NO.

922370

--	--

CUSTOMER'S ORDER: 35081	SOLD BY: 9129	TERMS:	F.O.B. 82288 MI	DATE: 29 JUN 2015
----------------------------	------------------	--------	--------------------	----------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	PERFORM TORQUE INSPECTION COVER. PAINT INDICATE TIMING		
2	SCRIBES. RUN ENGINE, CHECK IGNITION DUAL & TIMING. ADJUST		
3	SLIGHTLY 7.12 BANK. CHECK BOTH DISTRIBUTORS FOR FULL ADVANCE.		
4	CHECK CABLE ACCELERATOR PUMP FUNCTION - GOOTS. PERFORM AND		
5	CABLE CABLE IDLE STOP. SET COMPARATIVE SYNCHRONIZATION		
6	ON & OFF IDLE. NOTE THROTTLE SHAPES AND BALL SOCKET		
7	LINKAGES ARE WORN MAKING IT DIFFICULT TO GET GOOD		
8	SYNCHRONIZATION. ADJUST THROTTLE CABLE PLAY. LUBRICATE		
9	THROTTLE LINKAGES, BEARINGS, ACCEL. PUMP ROLLERS, PEDAL		
10	ASSEMBLY. NOTE CHECK OVER CENTRAL SPRING TOO LIGHT,		

PATRICK OTIS

INVOICE NO.

922371

SC	
AI	
C	

CUSTOMER'S ORDER: 35081	SOLD BY: 9129	TERMS:	F.O.B. 82288 MI	DATE: 29 JUN 2015
----------------------------	------------------	--------	--------------------	----------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	NOT ORIGINAL. CHECK FLUIDS/ TIRE PRESSURES. ROAD TEST		
2	CAR. CHARGING SYSTEM STOPPED WORKING AT 4000 ENGINE		
3	RPM. MOTOR BARS TOO COOL ON FREEMAN - MISSING ONE BATTERY		
4	THERMISTAT. TURN SIGNALS DON'T CHECK DUE TO CUMMINS/		
5	WHEEL HUBS NOT SYNCHRONIZED WITH STEERING GEARBOX.		
6	CHECK CHARGING SYSTEM OPERATIONS. VOLTAGE REGULATOR HAS		
7	FAILED! FULL FIELD AUTOMATE, WORKS UNTIL 4500 RPM		
8	TURN SIGNALS WORKING! PERFORM AUTOMATE INSPECT. FUEL		
9	TERMINAL IS LOOSE ON PLASTIC MOUNT BLOCK. PERFORM VOLTAGE		
10	REGULATOR.		8.0

PATRICK OTTIS

INVOICE NO.

922372

--	--

CUSTOMER'S ORDER: 330 GT	SOLD BY: 3129	TERMS:	F.O.B. 82288M	DATE: 29 July 2015
-----------------------------	------------------	--------	------------------	-----------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
15 JULY	1 DISASSEMBLE & INSPECT INSIDE OF VOLTAGE REGULATOR. DERIVATIVE		
	2 REGULATOR & ALTERNATOR TO SEPARATE ELECTRICS FOR REPAIR		1.0
27 JULY	3 RETURN ALTERNATOR / VOLTAGE REGULATOR FROM BEING		
	4 SERVICED BY SEPARATE ELECTRICS. INSTALL BOTH ONTO CAR, WITH		
	5 REGULATOR FIRST. RUN MOTOR, BRING TO TEMPERATURE		
	6 CHARGING SYSTEM FAILS @ 4200 ENGINE RPM.		2.5
28 JULY	7 REMOVE ALTERNATOR, DISASSEMBLE AND INSPECT. ROTOR TESTS OK		
	8 ON BEACH BUT AT HIGH SPEED SHORTS TO GROUND. REPLACE		
	9 ROTOR, ASSEMBLE GIVE REPAIRING PLASTIC TERMINAL BLOCK. THIS		
	10 ASSEMBLY BACK ONTO CAR, RUN MOTOR AND CHECK CHARGING		

PATRICK OTTIS

INVOICE NO.

922373

SC	
AI	
C	

CUSTOMER'S ORDER: 330 GT	SOLD BY: 3129	TERMS:	F.O.B. 82288M	DATE: 29 July 2015
-----------------------------	------------------	--------	------------------	-----------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
	1 SYSTEM OPERATION - GOOD. NOTE A MOTOR VIBRATION / RESONANCE		
	2 INTERNAL TO MOTOR		3.0
	3 SIDE LAMP 17.5 WATTS @ 120"		2100"
	4		
	5 NOW AS ORIGINAL MARVELL 'ROD BOP' VOLT REG 350278		995"
	6 TAP ON REGULATOR		8.7
	7		
	8 DISASSEMBLE INSPECT MARVELL VOLTAGE REGULATOR. REPAIR FOR		
	9 NON ORIGINAL SENSOR WIRE PLUGS TO DIODE PODS. REPLACE		
	10 DIODES. INSTALL HEAVY GAUGE WIRE FOR DIODE OUTPUT		

SUBJECT

ALTERNATOR

Patrick, OTIS

INVOICE NO.

922374

--	--

CUSTOMER'S ORDER: 33081	SOLD BY: 9129	TERMS:	F.O.B. 82288 M1	DATE: 29 July 2015
----------------------------	------------------	--------	--------------------	-----------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	REPAIR DOOR PLASTIC TERMINAL BLOCK. ASSEMBLE AND BENCH TEST		
2	TO UNIT (HARD RIN) OF TEST BENCH. DISASSEMBLE AUTOMATICAL		
3	SECOND TIME & P. OTIS. DISCOVER FAULTY ROVER & REPAIR.		
4	SEVENT EIGHTEEN		850 -
5			
6			
7	91 OCTANE FUEL		52 -
8	WASH DETAIL CAB	NO CHARGE	
9			
10	JOB TOTAL		4084 ⁰⁰

PATRICK OTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA 94710
ARD NO 120777

INVOICE NO.

922502

CUSTOMER'S ORDER: 330 GT SOLD BY: 9129 TERMS: THANK YOU F.O.B. 8265Z HI DATE: 02 OCTOBER 15

QUANTITY	DESCRIPTION	PRICE	AMOUNT
22 SEPT	1 INVESTIGATE NON FUNCTIONING DRIVER DOOR LOCK AND 'SLOW'		
	2 DRIVER POWER WINDOW OPERATION. REMOVE DRIVER DOOR		
	3 PANEL / VAPOR BARRIERS. ADJUST, LUBRICATE LOCK MECHANISM.		
	4 LUBRICATE WINDOW FRET CHANNEL AND FOUR CABLE PULLEYS.		
	5 CHECK CABLE TENSION. OPERATE WINDOW SEVERAL TIMES.		
	6 OPERATION IS IMPROVED, WILL REQUIRE REMOVAL AND INSPECTION		
	7 OF WINDOW MOTOR TO MAKE BETTER. REINSTALL DOOR VAPOR		
	8 BARRIERS AND DRIVER DOOR PANEL		3.0
24 SEPT	9 TRUCKLE CHARGE BATTERY ALL DAY. CHECK CHARGING SYSTEM		
	10 OUTPUT - ZERO. REMOVE ALTERNATOR FOR WSP & REPAIR NO CHARGE		

PATRICK OTIS

INVOICE NO.

922503

SC	
AI	
CI	

CUSTOMER'S ORDER: 330 GT SOLD BY: 9129 TERMS: F.O.B. 8265Z HI DATE: 02 OCTOBER 15

QUANTITY	DESCRIPTION	PRICE	AMOUNT
30 SEPT	1 RETRIEVE NEWLY REPAIRED ALTERNATOR FROM SELBET REPRODUCT.		
	2 INSTALL ALTERNATOR, CHECK CHARGING SYSTEM OUTPUT - GOOD.		
	3 NOTE INSTRUMENT LIGHTS COME ON WITH KEY AND HEADLIGHTS		
	4 DON'T FUNCTION		NO CHARGE
01 OCT	5 INVESTIGATE NON OP WATER TEMPERATURE GAUGE, CHECK		
	6 OPERATION OF GAUGE WITH RESISTOR WHEN - SEEMS TO FUNCTION		
	7 NORMALLY LEFT CAR, DRAIN ENGINE COOLANT, REMOVE AND		
	8 REPLACE COOLANT TEMPERATURE SENDING UNIT. CONNECT WIRE.		
	9 FILL COOLING SYSTEM WITH NEW 50:50 COOLANT MIX. START		
	10 AND RUN MOTOR, OBSERVE INSTRUMENT OPERATION AND WATCH		

PATRICK OTTIS

INVOICE NO.

922504

--	--	--	--

CUSTOMER'S ORDER: 330 GT	SOLD BY: 9129	TERMS:	FOB: 82652 H1	DATE: 02 OCTOBER 15
-----------------------------	------------------	--------	------------------	------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	GAUGE READ UP TO 190°F. COOLING FANS COME ON AND CYCLE		
2	NORMALLY. COOLING SYSTEM APPEARS TO RUN TOO COOL INDICATING		
3	EITHER NO THERMOSTAT OR A THERMOSTAT THAT IS STUCK OPEN.		
4	ALSO, THE ELECTRICAL FANS APPEAR TO DRAW MORE CURRENT TO		
5	OPERATE THAN THEY SHOULD.		3.0
6	SHOP LABOR 6.0 HRS @ 120		720 -
7	WATER TEMPERATURE SENDING UNIT 100453		29 50
8	NEW ANTIFREEZE 50-50 COOLANT MIX		25 -
9	PRICES TOTAL		54 50
10	TAX ON PRICES		4 76

PATRICK OTTIS

INVOICE NO.

922505

SC	
AI	
CI	

CUSTOMER'S ORDER: 330 GT	SOLD BY: 9129	TERMS:	FOB: 82652 H1	DATE: 02 OCTOBER 15
-----------------------------	------------------	--------	------------------	------------------------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1			
SUBTOT	DISASSEMBLE, INSPECT ALTERNATOR, FOR NO CHARGE SITUATION.		
2	TRACE ISSUE TO SLIP RINGS ON ROTOR INCORRECTLY PLACED.		
3	LOCATE SLIP RINGS CORRECTLY, ASSEMBLE & BENCH TEST - GOOD.		
4	SECRET FURNITURE		250 -
5			
6			
7	91 OIL AND FUEL		6 50
8	WASH DETAIL CAB		NO CHARGE
9			
10	JOB TOTAL		1035 76

INVOICE
71721 ©2004 REDFORM®

INVOICE
71721 ©2004 REDFORM®

L. BUSKIRK COMPANY

26C Pamaron Way
NOVATO, CA 94949
(415) 883-8575

010673

DATE 2/15/16

NAME

ADDRESS

CITY

YEAR

TYPE OR MODEL

MOTOR NO.

SERIAL NUMBER

LICENSE NUMBER

ODOMETER

67

FERRARI

330 GT

2+2

82714

OPER. NO.

REPAIR ORDER — LABOR INSTRUCTIONSORDER
WRITTEN BYLUBRICATE ☐CHANGE
OIL ☐FLUSH
TRANS. ☐FLUSH
DIFF. ☐WASH ☐POLISH ☐

\$

HEADLIGHT FUSE BLOWS — REPLACE
+ TEST — REMOVE WIRING TO ALT.
+ REATTACH

REMOVE SPARK PLUGS +
INSPECT — ADJUST AIR MIXTURE
SCREWS

REPAIR LICENSE PLATE LIGHT
7 HR. X 120.00

SPECIAL REPAIRS

RETAIN PARTS ☐ DESTROY PARTS ☐

TOTAL PARTS

ESTIMATE AMOUNT

PARTS
LABOR

ADD'L AUTH. AMT.

TIME

BY

ADD'L AUTH. AMT.

ADD'L AUTH. AMT.

ESTIMATE TOTAL

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE, ALONG WITH NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. AN EXPRESS MECHANIC'S LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO. YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT, ACCIDENT OR ANY OTHER CAUSE BEYOND YOUR CONTROL.

AUTHORIZED BY _____

RECEIVED BY _____

GAL. GASOLINE @

QTS. OIL @

LBS. GREASE @

TOTAL GAS - OIL - GREASE

TOTAL LABOR

TOTAL PARTS

GAS, OIL, GREASE

SPECIAL REPAIRS

ENVIRONMENTAL
CHARGES

STATE TAX

TOTAL AMOUNT

840.00

840.00

Unless otherwise provided by law, the seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

L. BUSKIRK COMPANY

26C Pamaron Way
NOVATO, CA 94949
(415) 883-8575
Italian Auto Repair

010869

QUAN.	PART NO.	DESCRIPTION	SALE AMOUNT	
12		SPARK PLUGS	12 00	144 00
2		OIL FILTERS	26 16	52 32
12		SPARK PLUGS	12 00	144 00
1		BATTERY		200 00
		BRAKE FLUID		20 00
2		GAL. A/FRFR2	15 00	30 00
1		LOCK TAB 93747		27 50
1		LOCK TAB 94968		13 10
1		LOCK TAB 93305		29 85
		DEPOSIT CK NO. 857		
		1000.00 1/23/25		
1		ORING	6 48	667.25
		5000.00 CK. NO. 858		2/7/25
1		OIL SEAL	2 64	
1		GASKET	30 00	
1		GASKET	27 50	727.39
		SHIPPING → 15.89	6.61	73.56
		↓ 11.00	14 87	88 43
1		BRAKE SW.	30 00	757.39
1		RE-BUILT	13.00	
		W. SWITCH	11.00	
4		BULBS	66 93	1426.32 + 81434.32

NAME

ADDRESS

CITY

YEAR

TYPE OR MODEL

MOTOR NO.

SERIAL NUMBER

LICENSE NUMBER

ODOMETER

DATE

REPAIR ORDER - LABOR INSTRUCTIONS

ORDER WRITTEN BY

LUBRICATE

CHANGE OIL

FLUSH TRANS.

FLUSH DIFF.

WASH

POLISH

\$

CAR NOT RUN 5 YEARS

SERVICE AS NECESSARY

DRIVER'S SIDE WINDOW? NEW SWITCH

SHIFTER?

DO NOT CHANGE TRANS + DIFF

BALDWIN OIL FILTERS

REMOVE TRANS + DISASSEMBLE

NUT LOOSE ON FRONT OF MAIN SHAFT

CHANGE GAS + FLUSH BRAKES

101 HRS + 150.00

PAID CK NO. 152

RETAIN PARTS ☐ DESTROY PARTS ☐

TOTAL PARTS

2 100 8 00

ESTIMATE AMT. PAID 6000

PARTS LABOR

ADD'L AUTH. AMT.

BALANCE

ADD'L AUTH. AMT.

11408.49

ADD'L AUTH. AMT.

ESTIMATE TOTAL

Unless otherwise provided by law, the seller (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE, ALONG WITH NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. AN EXPRESS MECHANIC'S LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO. YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT, ACCIDENT OR ANY OTHER CAUSE BEYOND YOUR CONTROL.

AUTHORIZED BY

RECEIVED BY

15 GAL. GASOLINE @

12 QTS. OIL @ 16.00

18 LBS. GREASE @ 37.50

TOTAL GAS - OIL - GREASE

TOTAL LABOR

15150 00

TOTAL PARTS

1434 32

GAS, OIL, GREASE

572 00

SPECIAL REPAIRS

ENVIRONMENTAL CHARGES

SHIPPING

88 43

STATE TAX

163 74

TOTAL AMOUNT

17408 49

572.00 572