

PATRICK OTTUS  
 1220 TENTH STREET  
 BERKELEY CALIFORNIA 94710  
 BAR NO AK120777

INVOICE NO.

053391

PAID IN FULL - CK 26290

THANK YOU BRUCE!

mailed  
 12/30/10  
 C

SOLD	
ADDR	
CITY	

SHIP TO:	FANTASY JUNCTION
ADDRESS:	1145 PARK AVE
CITY STATE ZIP	EMERYVILLE, 94608

CUSTOMER'S ORDER:	SOLD BY:	TERMS:	F.O.B.	DATE:
ALFA SPURIT LIGHTWEIGHT	1493 03-498	THANK YOU	12598 KHS	13 DECEMBER 10

INVOICE

QUANTITY	DESCRIPTION	PRICE	AMOUNT
01 DEC.	1 ROAD TEST CAR - ONE MILE TO ASSESS DRIVABILITY & OPERATION		
	2 ASSESS WHAT WAS DESCRIBED AS PILOT BRNG NOISE NO CHARGE		
02 DEC.	3 LFT CAR, INSPECT CHASSIS AND BRAKE SYSTEM. BRAKE		
	4 MASTER LEAKS BRAKE FLUID. SUCK REMAIN BRKE FLUID		
	5 FROM RESERVOIR. REMOVE COTTER PIN FROM CLEVIS - UNBOLT		
	6 REMOVR BRAKE MASTER, DISASSEMBLE. CURAN INSPECT BORE		
	7 OF CYLINDER. MASTER IS TIRID - NOT SLEEPED. INSTALL		
	8 NEW CUSTOMER SUPPLIED BRAKE MASTER. REPLENISH BRAKE		
	9 FLUID. BLEED BRAKE HYDRAULIC SYSTEM AT MASTER AND		
	10 AT 4 WHEELS. REINSTALL TORQUE ROAD WHEELS. CHECK		

PATRICK OTTIS

INVOICE NO.

053155

SOLD TO
ADDRESS
CITY, S

SHIP TO:
ADDRESS:
CITY, STATE ZIP

CUSTOMER'S ORDER: ALFA SPAWT LIGHT	SOLD BY: WRIGHT	1493	TERMS: 03/98	F.O.B. 12598KMS	DATE: 13 DEC 2010
---------------------------------------	--------------------	------	-----------------	--------------------	----------------------

INVOICE

QUANTITY	DESCRIPTION	PRICE	AMOUNT
	1 GEAR OIL LEVELS IN GRAYBOX & DIFF. TOP UP DIFF		5.5
03 DEC	2 CONTINUE INSPECTION OF CAR FOR SAFETY AND RELIABILITY		
	3 TIRES THIRTEEN YEARS OLD FIRESTONE. RECOMMEND PIRELLI		
	4 CONTINUED - SPARE IS NEARLY NEW MICHELIN. ADD ONE QT OIL.		
	5 INSPECT DIM LEFT HEADLAMP OPERATION. REMOVE HEADLIGHT		
	6 DOOR AND LAMP ASSEMBLY. TRACE FAULT TO POOR GROUND		
	7 AT BARREL CONNECTOR AT BULB SOCKET. ASSEMBLE ALL & TEST -		
	8 GOOD. 'FIX' 'CUSTOM' BULB HOLDER AND BRASS BUSH. ROAD		
	9 TEST AGAIN COLD AROUND BLOCK TO ASSESS BRAKING WHILE		3.5
13 DEC	10 ROAD TEST CAR AGAIN TO LISTEN FOR WHINE AND ASSESS		

PATRICK OTTIS

INVOICE NO.

059306

SOLD
ADDR
CITY

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER: <b>ALFA SPURNT</b>	SOLD BY: <b>1493 03798</b>	TERMS:	QTY: <b>12598KMS</b>	DATE: <b>13 DECEMBER 10</b>
---	-------------------------------	--------	-------------------------	--------------------------------

INVOICE

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1	BRAKE OPERATING, LFT CAR AGAIN, ADJUST BRAKE MASTER		
2	PUSH ROD FOR SLIGHTLY HIGHER PEDAL POSITION - INSTALL		
3	HUBCAPS, FUEL CAP		1.5
4	SHOP LABR - 10.5 HRS @ 120		1260
6	CASTROL LMA BRAKE FLUID		7.50
7	GT BRAD PENN 20-50 RACING OIL		8.50
8	PARTS TOTAL		16
9	TAX ON PARTS		1.56
10	JOB TOTAL		17.56



Directors:  
 C.J.Hudson, J.A.Robbins  
 J.Hudson, G.Robbins  
 D.Cawley

V.A.T. Reg.No. 182 6298 47  
 Company Reg.No. 1221249

## LONGSTONE TYRES

Hudsons Yard, Doncaster Road, Bawtry, Doncaster, Yorkshire, DN10 6NX  
 Telephone: 0044 (0) 1302 711123 Fax: 0044 (0) 1302 710113  
 www.longstonetyres.co.uk E mail: sales@longstonetyres.co.uk

Invoice 0000004021

Account ABRA01

23 May 2013

### Amounts in Pound Sterling

For Order 0000003760

Order Date 23/05/2013

Customer VAT Number US

Customer Reference

Code	Description	Quantity	Unit Cost	Discount	Net
1926	155HR15 PIRELLI CINT CA67	4	159.00		636.00
CARR 4-5 FOC	Carriage Free of Charge	1	.00		0.00
	Paid by PayPal Thankyou		.00		

*Originally bought for the <sup>1962</sup> Giulietta Spider - switched to Sprint 11/14*

#### VAT Analysis

Code %	Net	VAT
9 0.00 Export (Outside)	636.00	0.00

Goods 636.00

VAT 0.00

Invoice 636.00

Terms 30 days from end of month



\*\*\* P A R T S A L E I N V O I C E \*\*\*

ALFA PARTS  
 1221 4TH STREET  
 510 525-9435  
 BERKELEY, CA. 94710-

INVOICE # : 27723  
 PAGE # : 1  
 WRITTEN BY : RAY  
 INV.DATE : 08/30/2013

SOLD/SHIP TO

*Sprint*

Customer Number : 5645 Customer P.O. # :None

Ordered by :None

PART NUMBER	DESCRIPTION	ORD	SHIP	RETAIL	PRCE.EA	EX.PRCE
1365 52 419	HUB CAP CLIP	4	4	5.50	5.00	20.00
605 18 410X	BRAKE HOSE FRONT	2	2	24.75	22.50	45.00

(Local Tax Code )	SUBTOTAL ==>	65.00
	SALES TAX ==>	5.85
	FREIGHT ==>	0.00
	MISC CHARGE =>	0.00
	DEPOSIT ==>	0.00
	INV.TOTAL ==>	70.85

\*\* NO RETURN ON ELECTRICAL OR SPECIAL ORDER ITEMS \*\*  
 \*\* RETURNS SUBJECT TO 20% RE-STOCKING CHARGE \*\*  
 \*\* NO RETURNS WITHOUT INVOICE \*\*  
 THANK YOU FOR YOUR PURCHASE

\*\*\* MAIL ORDER INVOICE \*\*\*

ALFA PARTS  
 1221 4TH STREET  
 510 525-9435  
 BERKELEY, CA. 94710-

INVOICE # : 27736  
 PAGE # : 1  
 WRITTEN BY : JRN  
 INV.DATE : 09/03/2013

SOLD/SHIP TO	SHIP TO

Customer Number : 5645 Customer P.O. # :None

Ordered by :None

PART NUMBER	DESCRIPTION	ORD	SHIP	RETAIL	PRCE.EA	EX.PRCE
1365 53 808	WHEEL CYLINDER FRONT RIGH	2	2	135.00	95.00	190.00

SUBTOTAL	190.00
SALES TAX	17.10
FREIGHT	13.90
MISC CHARGE	0.00
DEPOSIT	0.00
<b>INV. TOTAL</b>	<b>221.00</b>

(Local Tax Code )

Shipped By : U.P.S. GROUND

SPECIAL ORDER ITEMS \*\*  
 PACKING CHARGE \*\*


Alfa Parts  
 1221 4th ST  
 Berkeley, CA, 94710  
 510-525-9435

COPY  
 Sale: 09/03/2013 14:25:09

Transaction #  
 Card Type: MasterCard  
 \*\*\*\* \* 3632  
 No: 00457501  
 89546P  
 89546P  
 221.00

POSTAL C  
 Code  
 MATCH  
 ER COPY

Received  
SEP X 9 2013  
Pacific Union Holdings

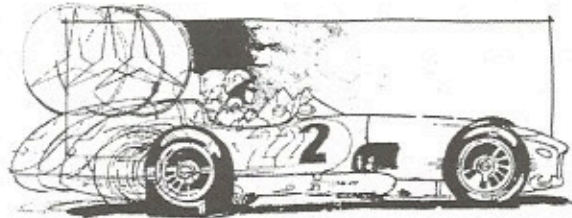

Sprint  
9/11/2013

Received  
SEP X 9 ?  
Pacific Union Holdings

## Rudi & Company

A Division of Rudi and Company Holdings, ULC

Restoration specialists for Mercedes-Benz and other spirited automobiles

RÜDIGER GÜNTHER von KONICZEK  
MANAGING DIRECTOR

275 VIADUCT AVENUE WEST  
VICTORIA, B.C.  
CANADA V9E 2B6

September 4, 2013

### INVOICE

**SOLD – 1 Set of Seat Belts for Alfa Romeo**

As per telephone discussion with Rudi Koniczek

\$300.00 USD

+ Shipping and Handling

\$ 55.00

**GRAND TOTAL AMOUNT OWING**

**\$355.00 USD**

Note: Please make cheque payable to Rudi and Company Holdings ULC in US Funds

International Trade Agents, Appraisers  
Collection and Restoration Management

MEMBERS — M.B.C.A., G.W.G., R.R.O.C.,  
B.D.A., A.M.O.C., F.O.C.  
and OTHER CLASSIC CAR CLUBS

Tel: 250-727-6020

www.rudiandcompany.com

Fax: 250-727-2099

California Car Cover Co.

\* car care by mail \*

9525 De Soto Ave.  
Chatsworth, CA 91311

Phone # 1-800-423-5525  
1-818-998-2100  
Fax # 1-818-998-2442

www.calcarcover.com

PACKING SLIP



Order # 1694832

Bill To Customer # 00474194

Ship To

Order Date		Customer PO Number And PO Date		Payment Method	Ship Via
09/06/13		09/06/13		M/C	UPS Ground
Order Qty	Ship Qty	BackOrder Qty	Item # and Description	Unit Price	Extended Amount
1	1		FF34FR, 57 ALFA ROMEO SPRINT * Custom Work Detail * Fab: No Size: *Pattern Mods/Emb Text* FR	0.00	333.99

Comments SEE CUSTOMER REQUIREMENTS

Merchandise	Sales Tax	Ship/Handle	Total	Pre-Paid	Balance
333.99	31.32	13.99	379.30	379.30	0.00

Thank You For Your Order!  
Please Save This Document For Your Records

Customer Copy

If you have any questions about your order call our  
Customer Service Department at 1-800-423-5525  
Monday -Friday 9a.m. - 5p.m. Pacific Time

Return Policy Please Read

CALIFORNIA CAR COVER COMPANY, WE WANT YOU TO BE COMPLETELY SATISFIED WITH YOUR ORDER AND ORDERING EXPERIENCE. IF YOU FIND IT NECESSARY TO EXCHANGE OR RETURN AN ITEM, PLEASE CALL OUR CUSTOMER SERVICE REPRESENTATIVES FOR A RETURN AUTHORIZATION NUMBER. ALL COVERS ARE GUARANTEED TO FIT. NO RETURNS WILL BE ACCEPTED ON SPECIAL OR CUSTOM ORDERED PARTS AND ACCESSORIES. A RESTOCKING FEE WILL BE CHARGED FOR ALL RETURNED MERCHANDISE NOT EXCHANGED UNDER WARRANTY.



RAUL KWIK TOE  
 5-SPEED, 105/115 REAR AXLE, DC OE  
**LURENCE ANDERSON COMPANY**  
 1214 Tenth Street • Berkeley, CA 94710  
 Phone (510) 527-2938  
 ARD 00126304 • EPA No. CAL 000042641

003996

**REPAIR INVOICE**

PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE  
 \* CODE = N-NEW R-REBUILT O-OEM A-AFTERMARKET C-CUSTOMER SUPPLIED

QTY	*	PART NO. & DESCRIPTION	AMOUNT
1	U	TRANSMISSION 101 MOUNT PLATE	100.00
1	N	TRANS RT SEAL	16.92
1	N	" " NEEDLE BRNG	31.50
1	N	5TH - R LAYSHAFT GLAR	475.00
4	N	FLYWHEEL LOCK TAB 7.75	31.00
1	N	TRANS MAINSH. BRNG	185.00
1	N	" LAYSH. CTR "	120.00
1	N	" " REAR "	95.00
1	N	TRANS MAINSH. REAR BRNG	85.50
1	U	GEAR REV IDLE USEBOX	95.00
2	N	SYNCHRO SLEEVE 15.50	310.00
1	N	TRANS R MAIN SEAL	17.01
3	N	SYNCHRO SLEEVE RING 105.00	315.00
1	N	TUNNEL SHOT BOOT	82.50
1	N	STARTERFLYWHEEL RING GEAR	190.00
1	N	TRANS BRNG RT MAIN	255.00
1	N	" " RT LAYSHAFT	165.00
4	U	#AGE MATCHED ROAD SPRINGS	600.00
1	N	HI BEAM SW	25.00
7	N	20/50W OIL 5	35.00

LABOR CHARGE PER HR.

NAME	DATE	<input type="checkbox"/> MAINTENANCE INSPECTION
ADDRESS	10/8/13	<input type="checkbox"/> LUBRICATION
CITY	AVE #300	<input type="checkbox"/> CHANGE OIL GRADE:
PHONE	ZIP	<input type="checkbox"/> CHANGE OIL FILTER CART.
<input type="checkbox"/> H <input type="checkbox"/> W	REC'D TIME PROM.	<input type="checkbox"/> TRANS.
PH. WHEN READY	WRITTEN BY	<input type="checkbox"/> DIFF.
<input type="checkbox"/> YES <input type="checkbox"/> NO	MILEAGE	<input type="checkbox"/> ROTATE TIRES
YR/MAKE/MODEL	LIC PLATE #	<input type="checkbox"/> ALIGN FRONT END
57 SPRINT. VELOCE LW.	CA 0LR	<input type="checkbox"/>
V.I.N. 1493E*03798	G.V.W.R.	
	MOTOR # 1315	
	*30552	
	CUST. PO# 800Y	
	77313	

OPR. #	REPAIR ORDER • DESCRIPTION OF LABOR
	✓ SEE ATTACHED LIST BY CLIENT
	PD CK # 8314

REPLACED PARTS REQUESTED BY CUSTOMER?  YES  NO TOTAL PARTS

PARTS COST OUTSIDE-SUBLET REPAIRS

2	N	90 H/100	8	16.00
4	N	CHAMPION BGEES	6	24.00
1	N	RUBBER SEAL WINDOW		40.00
1	U	LAYSHAFT GEARSET OK		200.00

INITIAL TO AUTHORIZE SUBLET REPAIRS TOTAL SUBLET REPAIRS

10 GALS. GAS @ 4 = 40 TOTAL GAS, OIL & GREASE

QTS. OIL @ =

LBS. GREASE @ =

ORIGINAL ESTIMATE \$	DATE	TIME	PHONE# • FAX# • EMAIL	<input type="checkbox"/> BY PHONE <input type="checkbox"/> EMAIL	TOTAL LABOR
				<input type="checkbox"/> IN PERSON <input type="checkbox"/> FAX	10,500
I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH THE NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. AN EXPRESS MECHANIC'S LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO. YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT, ACCIDENT, DYNAMOMETER TESTING OR ANY OTHER CAUSE BEYOND YOUR CONTROL. IN THE EVENT LEGAL ACTION IS NECESSARY TO ENFORCE THIS CONTRACT, I UNDERSTAND THAT I AM SOLELY RESPONSIBLE FOR ALL COSTS INCLUDING ATTORNEY'S FEES AND COURT COSTS. I HAVE READ AND UNDERSTAND THE ABOVE AND ACKNOWLEDGE RECEIPT OF AN ESTIMATE. SMOG CHECK CUSTOMERS: BY LAW YOU MAY CHOOSE ANOTHER SMOG CHECK STATION TO PERFORM ANY REPAIRS, INSTALLATIONS, ADJUSTMENTS OR SUBSEQUENT TESTS.					TOTAL PARTS
					3486.43
					GAS, OIL, GREASE 40
					HAZARDOUS WASTE DISPOSAL
					SUBLET REPAIRS
					SMOG CERTIFICATE
					SUBTOTAL
					TAX 313.78
					PLEASE PAY THIS AMOUNT 14300.21

FOLLOWING REPAIRS RECOMMENDED

1.	3.
2.	4.

WARRANTY: FROM DATE OF DELIVERY FOR A PERIOD OF 4,000 MILES OR 90 DAYS, WHICHEVER COMES FIRST, THIS FIRM WILL REPAIR FREE OF CHARGE ANY DEFECTS IN MATERIAL AND WORKMANSHIP TO THE REPAIRS STATED ON THIS INVOICE. ALL WORK TO BE DONE IN THIS SHOP ONLY. THIS DOES NOT INCLUDE TOWING OR CUSTOMER SUPPLIED PARTS.

STORAGE FEE: \$ PER DAY WILL BE CHARGED 24 HOURS AFTER NOTIFICATION OF WORK COMPLETED

PAYMENT:  CASH  CHECK  CHARGE  DEBIT CARD  CREDIT CARD

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE  
 \* CODE = N-NEW U-USED R-REBUILT O-OEM A-AFTERMARKET C-CUSTOMER SUPPLIED

5-SPEED 105/115 R.AXLE, DCOE CO

**LAI RENCE ANDERSON COMPANY**

1214 Tenth Street • Berkeley, CA 94710

Phone (510) 527-2938

ARD 00126304 • EPA No. CAL 000042641

010.06

**REPAIR INVOICE**

* PART NO. & DESCRIPTION	AMOUNT
R RELINED WIDEBACK FRONT BRAKESHOE SET	300.00
CORE FROM ABOVE NOT SUPPLIED	400.00
R RELINED REAR BRAKESHOE	250.00
N HUBCAP CLIP + HDW 10.00	20.00
N SPARE TIRE HOLDOWN	150.00
N INTERIOR MIRROR EARLY SPRINT	200.00
N TUDOR WASH BOTTLE	58.00
N VALVE COVER SV 750 BOLTS	300.00

NAME	DATE	LABOR CHARGE PER HR.
ADD	2/22/14	<input type="checkbox"/> MAINTENANCE INSPECTION
CITY	VE# 300	<input type="checkbox"/> LUBRICATION
PHC	ZIP	<input type="checkbox"/> CHANGE OIL GRADE
<input type="checkbox"/> H	REC'D	<input type="checkbox"/> CHANGE OIL FILTER CART.
<input type="checkbox"/> V	TIME PROM.	<input type="checkbox"/> TRANS.
PH. WHEN READY	WRITTEN BY	<input type="checkbox"/> DIFF.
<input type="checkbox"/> YES <input type="checkbox"/> NO	12902	<input type="checkbox"/> ROTATE TIRES
YR / MAKE / MODEL	MILEAGE	<input type="checkbox"/> ALIGN FRONT END
57 SPRINT VELOCE LTW	12902	<input type="checkbox"/>
V.I.N.	LIC PLATE#	<input type="checkbox"/>
14936A03798	CA 0LR	<input type="checkbox"/>
OPR. #	REPAIR ORDER • DESCRIPTION OF LABOR	<input type="checkbox"/>
	✓ REPLACE EXIST FRONT BRAKESHOE SET DUE TO SIDE-PULL, RESET ALIGNMENT OF SHOES	
	✓ REPLACE REAR BRAKESHOE SET DUE TO BMD CHATTER	
	✓ PERFORM LEAKDOWN: 1:04% 2:06% 3:04% 4:08%	
	SUPPLY MISSING / WRONG: SPARE-TIRE HOLDOWN, CORRECT INTERIOR MIRROR, TUDOR WASH BOTTLE, VALVE COVER HARDWARE	

CEDED PARTS REQUESTED BY CUSTOMER?  YES  NO TOTAL PARTS

OUTSIDE-SUBLET REPAIRS	
INITIAL TO AUTHORIZE SUBLET REPAIRS	TOTAL SUBLET REPAIRS
GALS. GAS @ =	TOTAL GAS, OIL & GREASE
QTS. OIL @ =	
LBS. GREASE @ =	

FOLLOWING REPAIRS RECOMMENDED	
3.	
4.	

NOTE: FROM DATE OF DELIVERY FOR A PERIOD OF 4,000 MILES OR 90 DAYS, WHICHEVER COMES FIRST, THIS FIRM WILL REPAIR FREE OF CHARGE ANY DEFECTS IN MATERIAL AND WORKMANSHIP TO THE REPAIRS STATED ON THIS INVOICE. ALL WORK TO BE DONE IN THIS SHOP ONLY. THIS DOES NOT INCLUDE TOWING OR CUSTOMER SUPPLIED PARTS.

ORIGINAL ESTIMATE \$	DATE	TIME	PHONE# • FAX# • EMAIL	<input type="checkbox"/> BY PHONE <input type="checkbox"/> EMAIL	TOTAL LABOR
				<input type="checkbox"/> IN PERSON <input type="checkbox"/> FAX	300
I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH THE NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. AN EXPRESS MECHANIC'S LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THEREON. YOU WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT, ACCIDENT, DYNAMOMETER TESTING OR ANY OTHER CAUSE BEYOND YOUR CONTROL. IN THE EVENT LEGAL ACTION IS NECESSARY TO ENFORCE THIS CONTRACT, I UNDERSTAND THAT I AM SOLELY RESPONSIBLE FOR ALL COSTS INCLUDING ATTORNEY'S FEES AND COURT COSTS. I HAVE READ AND UNDERSTAND THE ABOVE AND ACKNOWLEDGE RECEIPT OF AN ESTIMATE. SMOG CHECK CUSTOMERS: BY LAW YOU MAY CHOOSE ANOTHER SMOG CHECK STATION TO PERFORM ANY REPAIRS, INSTALLATIONS, ADJUSTMENTS OR SUBSEQUENT TESTS.					TOTAL PARTS
					1678.00
X					GAS, OIL, GREASE
					HAZARDOUS WASTE DISPOSAL
REVISED ESTIMATE \$	DATE	TIME	PHONE# • FAX# • EMAIL	<input type="checkbox"/> BY PHONE <input type="checkbox"/> EMAIL	SUBLET REPAIRS
				<input type="checkbox"/> IN PERSON <input type="checkbox"/> FAX	
REASON				ADD'L COSTS \$	SMOG CERTIFICATE
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.					AUTH. BY
X					REC'D BY
REVISED ESTIMATE \$	DATE	TIME	PHONE# • FAX# • EMAIL	<input type="checkbox"/> BY PHONE <input type="checkbox"/> EMAIL	SUBTOTAL
				<input type="checkbox"/> IN PERSON <input type="checkbox"/> FAX	
REASON				ADD'L COSTS \$	TAX
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE REVISED ESTIMATED PRICE.					15102
X					PLEASE PAY THIS AMOUNT
					2129.02

INTEREST WILL BE CHARGED AT A RATE OF 1 1/2% PER MONTH ON ACCOUNTS OVER 30 DAYS

THANK YOU

TERMS ARE CASH UNLESS PRIOR ARRANGEMENTS ARE MADE  
 SEE IMPORTANT INFORMATION ON BACK

PAYMENT:  CASH  CHECK  CHARGE  DEBIT CARD  CREDIT CARD

Albany Annex

Henk Boverhuis  
 2490 Hilgard Avenue  
 Berkeley, CA 94709

4/1/14

# Invoice

Date	Invoice #
3/31/2014	298

Bill To

P.O. No.	Terms	Project
Alfa Giulietta Sprint	Due on receipt	

Description	Qty	Rate	Amount
Road test. Remove carpet and shift boots. Replace loose shift lever pinch bolt nut with nyloc and tighten. RE-install boots and carpet. Remove right headlight. Polish outside of plastic lens and clean inside as best as possible with plastic cleaner. Diagnose rattle in the rear, when rear axle is loaded rear springs bow and interfere with body (paint removed at towers). Change oil (20w50 Brad Penn supplied) and oil filter. Replaced drain plug. Replace fuel filter. Check for vibration at 3000 to 3500 RPM. Transmission too high and hitting tunnel. Adjust transmission mount bracket with washers to get clearance. Make final shims for bracket. Check for full throttle, too much carpet and no relief for throttle stop on floor. Changed transmission oil from hypoid 90 to Swepco 80w90, seems to shift better. Remove glove box to access right w/washer. Install new used washer bottle and plumb to pump. Pump non/op, removed and bench tested (no suction and no pressure). Adjusted brakes. Replace split nut on drive shaft. Check toe to straighten steering wheel (10mm / 1 degree 30 minutes toed in). Failed to adjust, tie rod frozen. Removed tie rod and freed ends with torch. Cleaned threads and applied anti-seize. Re-install tie rod, road test. Adjust toe to 3mm / 20 minutes in. Steering wheel now straight. Installed final shims in cross member. Removed front wheels and drums to inspect brakes. Picked up old springs from Laurence and spoke with Conrad on details. Straighten multi-gauge in dash. Modify carpet for throttle stop and adjust for full throttle.	21.5	90.00	1,935.00
Gas Cap, Polished Stainless with shipping.	1	26.35	26.35
Shifter Plate	1	11.40	11.40
Shifter Seal	1	12.00	12.00
Oil Filter cartridge	1	15.00	15.00
Fuel Filter in Bowl	1	11.75	11.75

<b>Total</b>
<b>Payments/Credits</b>
<b>Balance Due</b>

Albany Annex

Henk Boverhuis  
2490 Hilgard Avenue  
Berkeley, CA 94709

# Invoice

Date	Invoice #
3/31/2014	298

Bill To

Description	Qty	Rate	Amount	P.O. No.	Terms	Project
				Alfa Giulietta Sprint	Due on receipt	
Swepeco 201 gear oil, 80w90 per pint	8	10.00	80.00			
				<b>Total</b>		\$2,091.50
				<b>Payments/Credits</b>		\$0.00
				<b>Balance Due</b>		\$2,091.50

LAURENCE ANDERSON CO.

1214 TENTH STREET  
BERKELEY, CA 94710

57045-527-2938

15 APR 14

DEAR

ENCLOSED FIND FULL REFUND FOR SPECIAL  
ORDER PARTS NOT RECEIVED:

- |        |   |
|--------|---|
| \$200. | 1. ORIGINAL INTERIOR MIRROR   |
| 58.    | 2. TUDOR WASH BOTTLE AS ORIGINAL                                      |
| 300.   | 3. 6 NEW CHROME 750 VELOCE 'LO' STYLE<br>VALVE COVER NUTS AS ORIGINAL |

558  
9% 50.22

\$ 608.22 CHECK # 12390

HAPPY MOTORING! KEEP THE REV'S UP!



Albany Annex

Henk Boverhuis  
 2490 Hilgard Avenue  
 Berkeley, CA 94709

# Invoice

Received  
**APR 25 2014**

Date	Invoice #
4/23/2014	301

Bill To

*Pd  
 4/27/14*

Description	Qty	Rate	Amount	P.O. No.	Terms	Project
				Alfa Giulietta Sprint	Due on receipt	
Replace road springs with "sport" springs.	8	90.00	720.00			
Sand high spots off brake shoes. Adjust and bleed all four brakes.	7	90.00	630.00			
Remove fasteners from motor mounts and allow motor to find it's sweet spot. Adjust hand brake (Ralph). Repair clutch linkage to remove slop. Install new rubber for right rear quarter window. Tie wrap shift boot for odors. Check jack for operation (foot loose). Tighten all exhaust nuts and check gaskets for leaks. Checked wiring for oil temperature gauge, OK. Check on turn signal switch knob. Oiled and installed new air filter. Checked visors. Glue sides of glove box. Replace cap on brake reservoir with better unit. Mount w/washer pump and plumb jets, left jet plugged.						
Used brake reservoir cap	1	35.00	35.00			
Exhaust manifold to pipe gasket.	2	3.90	7.80			
Clevis pin.	2	4.10	8.20			
Clutch linkage bushing	1	9.60	9.60			
Exhaust hanger plate	1	5.10	5.10			
1/4 window weatherstrip	2	24.00	48.00			
				<b>Total</b>		\$1,463.70
				<b>Payments/Credits</b>		\$0.00
				<b>Balance Due</b>		\$1,463.70

Albany Annex

Henk Boverhuis  
2490 Hilgard Avenue  
Berkeley, CA 94709

7/15/14

# Invoice

Date	Invoice #
7/14/2014	317

Bill To

P.O. No.	Terms	Project
Alfa Giulietta Sprint	Due on receipt	

Description	Qty	Rate	Amount
Parts not billed at time of service			
Air filter Element	1	45.00	45.00
Drain Plug 27mm Magnetic	1	17.50	17.50

<b>Total</b>	\$62.50
<b>Payments/Credits</b>	\$0.00
<b>Balance Due</b>	\$62.50

Sprint

Ray's Auto Service

10/23/14

6985 Dublin Blvd  
Dublin, CA 94568-3016  
(925)829-8272  
BAR REG AH241173

Year Make.  
Engine  
License No License  
MLG in/out /  
Vin

Date 10/16/14 Schedule 10/16/14

INVOICE : 21080

08:38AM

Page 1

REMARKS AND LABOR DESCRIPTIONS	HRS	PRICE	PARTS & LUBRICANTS	QTY	PRICE	TOTAL
			BATTERY INTERSTATE MT-58R	1.00	121.95	121.95

DATE	TIME	PHONE	APPROVED	AMOUNT	All Parts Are New Unless Shown As (U) Used or (R) Rebuilt		Labor		Parts & Lubricants					
							Labor	0.00	121.95					
							Sublet	0.00						
I acknowledge notice and oral approval of an increase in the original estimated price					This vehicle will be reassembled within 3 days of the date shown above if I do not authorize the recommended services.					Hazard Wste		0.00		
							SHOP				Gasoline		0.00	
							Sub Total				Sales Tax		10.98	
							Deposit				Disc. Applied		0.00	
							TOTAL				BALANCE DUE		132.93	

Visa / VISA

X

ACCEPTANCE SIGNATURE  
I accept the charges and terms of this agreement.

ll by Gy

I authorize the above repairs and necessary materials. Your employees may operate vehicle for inspection, testing, delivery at my risk. You will not be responsible for loss or damage to vehicle or items left in it. I agree to pay reasonable storage on vehicle left more than 48 hours after notification that repairs are completed. An express Mechanics Lien is acknowledged on above vehicle to secure the amount of repairs thereto. Labor is guaranteed for 90 days or 4000 miles whichever occurs first. All other guarantees are those made exclusively by the manufacturer. Warranty work that is based on this repair order must be performed at this shop. ALL REMOVED PARTS WILL BE DISPOSED OF UNLESS I INITIAL HERE \_\_\_\_\_.



**AlfaStop**

P.O. Box 50  
 BELPER  
 Derbyshire  
 DE56 1AS  
 ENGLAND

Tel: +44 (0) 177 382 2000  
 Fax: +44 (0) 177 382 1900  
 Email: sales@alfastop.co.uk  
 Website: www.alfastop.co.uk  
 VAT: GB 893 1405 18

*Sprint*  
**Alfa Stop**  
 12/1

**INVOICE**

<b>Invoice No.</b>
9089
<b>Date</b>
Nov 10, 2014

Payment terms: Paid pre-despatch

Reference 1413912300

**Invoice To**

**Deliver To**

**Shipped via:** UPS AWB # 1Z2X12A5D998724188

Line	Item	Description	Qty	Each £ ex-VAT	Total £ ex-VAT	VAT £
1	1BK102	Supply of parts for Alfa Romeo Giulietta Veloce, c. 1960	1	67.50	67.50	0.00
2	1FU124	Giulietta Parts Books / Catalogues set	1	72.00	72.00	0.00
3	1EN116	Veloce Weber 40DCOE carburettor air intake support bracket, late 750 & 101 series	1	22.80	22.80	0.00
4	1EN163	Engine limit buffer, Sprint Veloce, Spider Veloce, SS & SZ	1	75.00	75.00	0.00
5	1BK103	Rubber engine mountings, modified type with 1x stud, 750 & 101 series, set of 2	1	35.00	35.00	0.00
6	1BK117	Giulietta Workshop manuals set	1	48.00	48.00	0.00
7	S & P	750 series Owner handbook / instruction book, leather bound, limited edition, English text	1	32.00	32.00	0.00
8	INS	Shipping and packing	1	6.00	6.00	0.00
		Insurance				
		GOODS OF EU ORIGIN				
		NET WEIGHT - 2.5 Kg				
		SIGNED				
		P.A. STEVENS, BELPER, ENGLAND				

**Customer Message**

Thank you for choosing AlfaStop. We hope that we can help you again in the future.

We are confident that you will be pleased with your purchases. However should you wish to return an item, please contact us beforehand and obtain a Returns Number BEFORE sending it. AlfaStop will advise on a suitable customs declaration if returning from outside the EU. Any returned item must be sent carriage paid together with a copy of the original invoice. Parts will only be considered for credit if returned unused, in the original packaging, and in a condition suitable for immediate resale. AlfaStop reserves the right to raise a re-stocking charge of up to 20%.

**Subtotal:** £358.30

**VAT:** £0.00

**Total:** **£358.30**

*Martin Cook*

*£561.78*

**AlfaStop**

P.O. Box 50  
 BELPER  
 Derbyshire  
 DE56 1AS  
 ENGLAND

**PACKING/DELIVERY NOTE**

<b>Refers to Invoice No.</b>
9089
<b>Date</b>
Nov 10, 2014

Tel/ Fax: 0177 382 2000/ 0177 382 1900

Email: sales@alfastop.co.uk

Website: www.alfastop.co.uk

VAT: GB 893 1405 18

<b>Invoice To</b>	
-------------------	--

<b>Deliver To</b>	
-------------------	--

Line	Location	Item	Qty	Description
1	OFF	1BK102	1	Giulietta Parts Books / Catalogues set
2		1FU124	1	Veloce Weber 40DCOE carburettor air intake support bracket, late 750 & 101 series
3	X 5Q6	1EN116	1	Engine limit buffer, Sprint Veloce, Spider Veloce, SS & SZ
4	X 5Q7	1EN163	1	Rubber engine mountings, modified type with 1x stud, 750 & 101 series, set of 2
5	OFF	1BK103	1	Giulietta Workshop manuals set
6	OFF	1BK117	1	750 series Owner handbook / instruction book, leather bound, limited edition, English text

All goods supplied remain the property of AlfaStop until paid for in full.

Please check the order for completeness and immediately inform AlfaStop of any shortages

Any damage to this consignment **MUST** be reported immediately to AlfaStop and the carrier

Albany Annex

Henk Boverhuis  
 2490 Hilgard Avenue  
 Berkeley, CA 94709

2/17/15

# Invoice

Date	Invoice #
2/16/2015	351

Bill To

P.O. No.	Terms	Project
Alfa Giulietta Sprint	Due on receipt	

Description	Qty	Rate	Amount
Transport vehicle in enclosed trailer	60	1.35	81.00
Remove motor with transmission: includes draining oil and coolant, removing radiator, hoses, water pump, exhaust manifold, carb air box, linkage, fuel line, wiring, shift lever, clutch linkage and driveshaft. Note: driveshaft is fully compressed, too long. Drop off driveshaft, generator with regulator and headers for repairs.	9.5	105.00	997.50
Used 750 driveshaft for parts.	1	200.00	200.00
U-joint for 1300	2	45.05	90.10
Driveshaft bushing	1	95.00	95.00
Deliver used driveshaft, u-joints and bushing to driveshaft shop.	37	1.35	49.95
Mount motor and transmission on engine stand. Remove starter motor. Remove lower bell housing. Remove transmission from motor on stand. Remove clutch and flywheel. Remove lower sump. Remove upper sump. Pick up driveshaft and generator.	4.5	105.00	472.50
Shorten and balance driveshaft with new u-joints and bushing.		231.00	231.00
Repair generator and test with regulator.		339.40	339.40
Remove one main bearing and one rod bearing cap to check on wear. Not perfect but OK. Block has been line bored and main bearing caps have been cut .035". Rear main seal has been staked to keep it in. Shim found to make up clearance between sump and rear cap. One cigarette seal fell out. Tail bushing for starter motor fell out, pivot pin was about to and drive gear is badly worn. Drop off starter for repairs.	3.5	105.00	367.50
Clean all parts and install new cigarette seal. Install upper sump and shim with RTV and new gasket. Install lower sump with form-a-sealer. Pick up starter motor.	4.5	105.00	472.50
Repair Marelli starter motor and rebuild solenoid.		498.00	498.00
Pan gasket	1	93.75	93.75
Oil pump o-ring Veloce	1	62.50	62.50
Cigarette seal, rear main	1	3.75	3.75

<b>Total</b>
<b>Payments/Credits</b>
<b>Balance Due</b>

Albany Annex

Henk Boverhuis  
 2490 Hilgard Avenue  
 Berkeley, CA 94709

# Invoice

Date	Invoice #
2/16/2015	351

Bill To

P.O. No.	Terms	Project
Alfa Giulietta Sprint	Due on receipt	

Description	Qty	Rate	Amount
Install flywheel and clutch assembly. Install transmission on motor. Install starter motor and generator. Pick up modified headers and prime. Right aftermarket motor mount has a badly installed heli-coil and new motor mount won't thread in.	4	105.00	420.00
Modify #1 cylinder pipe in aftermarket headers to copy factory Veloce headers.		350.00	350.00
Repair aftermarket Veloce motor mount with insert.		140.00	140.00
Install right motor mount. Place header in bay. Drop engine and transmission in and secure motor mounts and transmission mount.	5	105.00	525.00
Compress flex joint and install. Install driveshaft with center support and lube u-joints / slip joint. Install transmission crossmember and speedo cable. Install throttle linkage. New carburetor support interferes with throttle linkage. Throttle pivot is from 105 car. Modify pivot and adjust linkage. Carburetor support 5/8" too long (105 not 101). Shorten support.	4	105.00	420.00
Install shorten carb support. Install air box and choke cable. Install water pump and heater hoses. Repair solenoid electrical connector. Water pump gasket 1300	4	105.00	420.00
Bolt exhaust manifold to head with correct brass nuts. Bolt exhaust pipe to headers. Install lower bell housing. Install clutch linkage. Install cross brace. install tach cable.	1	25.00	25.00
Exhaust manifold gaskets	3.5	105.00	367.50
8M 1.0 brass exhaust manifold nuts	4	3.15	12.60
Oil filter canister hits lower A-arm mounting stud. Removed spacer between block and oil filter mount. Chase damaged threads on studs in block. Re-mount oil filter mount and canister, canister now hits sump. Mount 750 Normale filter and clears sump and frame. Obtained used oil filter assembly. Cleaned and installed with new filter element and seal. Add motor oil. Lube suspension/steering. Adjust brakes.	8	3.15	25.20
	6	105.00	630.00

**Total**

**Payments/Credits**

**Balance Due**

Albany Annex

Henk Boverhuis  
 2490 Hilgard Avenue  
 Berkeley, CA 94709

# Invoice

Date	Invoice #
2/16/2015	351

Bill To

P.O. No.	Terms	Project
Alfa Giulietta Sprint	Due on receipt	

Description	Qty	Rate	Amount
Used oil filter assembly 101	1	250.00	250.00
Oil filter cartridge	1	15.65	15.65
Oil filter gasket	1	3.25	3.25
20w50 Brad Penn motor oil	8	8.95	71.60
Installed voltage regulator. Installed radiator with hoses. Filled with coolant and distilled water. Install air filter mounting brackets and air filter housing. Re-install hood. Checked all levels, topped up steering box. Road test and wash.	4	105.00	420.00
Hose clamps	6	1.35	8.10
8M fuel line	1.5	4.80	7.20
Replace weak electrical fuel pump with high volume Bendix Blue Top. Change electrical connectors and fuel hose. Replaced transmission mount to correct 90 degree error. Deliver car to Kwik Tow Ralph.	5	105.00	525.00
Fuel pump Bendix Blue Top	1	156.25	156.25
Transmission mount rear 750/101	1	78.15	78.15

<b>Total</b>	\$8,924.95
<b>Payments/Credits</b>	\$0.00
<b>Balance Due</b>	\$8,924.95

\*\*\* PART SALE INVOICE \*\*\*

ALFA PARTS  
 1221 4TH STREET  
 510 525-9435  
 BERKELEY, CA. 94710-

INVOICE # : 31783  
 PAGE # : 1  
 WRITTEN BY : RAY  
 INV. DATE : 03/23/2015

*pd 4/11  
 Sprind*

SOLD/SHIP TO

Customer Number : 2071 Customer P.O. # :None

Ordered by :None

PART NUMBER	DESCRIPTION	ORD	SHIP	RETAIL	PRCE. EA	EX. PRCE
607 10 891	1/4 GLASS GROMMET SET (4)	1	1	20.00	18.00	18.00

	SUBTOTAL	18.00
(Local Tax Code )	SALES TAX	1.62
	FREIGHT	8.38
	MISC CHARGE	0.00
	DEPOSIT	0.00
	<b>INV. TOTAL</b>	<b>28.00</b>

ALFA PARTS  
 1221 4th St  
 Berkeley, CA 94710  
 510-525-9435  
 27320661446002

03/23/2015 11:48  
 Trans #: 4 Batch #: 32

**Sale**  
 \*\*\*\*\*7455  
 Type: VISA  
 Entry: Manual  
**AMOUNT: \$28.00**  
 Resp: CAPTURE  
 Code: 073666  
 Ref #: 628475  
 Cvv Resp: M-CVV2  
 AVS Resp: ADDRESS AND  
 POSTAL CODE MATCH

Thank You  
 Please Come Again

**CUSTOMER COPY**

404-07/31/2017 Draft # REC 4

**SPECIAL ORDER ITEMS \*\***  
**% RE-STOCKING CHARGE \*\***  
**WITHOUT INVOICE \*\***  
**YOUR PURCHASE**

\*\*\* PART SALE INVOICE \*\*\*

ALFA PARTS  
 1221 4TH STREET  
 510 525-9435  
 BERKELEY, CA. 94710-

INVOICE # : 32412  
 PAGE # : 1  
 WRITTEN BY : RAY  
 INV. DATE : 06/22/2015

*Alfa  
Sprint*

SOLD/SHIP TO

Customer Number : 2071 Customer P.O. # :None

Ordered by :None

PART NUMBER	DESCRIPTION	ORD	SHIP	RETAIL	PRCE.EA	EX.PRCE
1365 76 473	TEMP SENDER OIL/WATER 750	1	1	105.00	95.00	95.00

	SUBTOTAL ==>	95.00
(Local Tax Code )	SALES TAX ==>	9.03
	FREIGHT ==>	0.00
	MISC CHARGE ==>	0.00
	DEPOSIT ==>	0.00
	<b>INV. TOTAL ==&gt;</b>	<b>104.03</b>

69 961-07/30/2018 Draft # REC 2

**SPECIAL ORDER ITEMS \*\***  
**10% RE-STOCKING CHARGE \*\***  
**WITHOUT INVOICE \*\***  
**FOR YOUR PURCHASE**

ALFA PARTS  
 1221 4th St  
 Berkeley, CA 94710  
 510-525-9435  
 27520001446002

06/22/2015 9:06  
 Trans #: 2 Batch #: 95

Acct: Sale  
 Type: \*\*\*\*\*7769  
 Entry: VISA  
 AMOUNT: \$104.03  
 Resp: CAPTURE  
 Code: 288800  
 Ref #: 06113147  
 CVV Rsp: P-Not Processed

Thank You  
 Please Come Again

CUSTOMER COPY

**Jeff Abramson**

---

*Alpha Sprint*

**From:** Patty Koniczek <pkoniczek@shaw.ca>  
**Sent:** June 25, 2015 2:01 PM  
**To:**  
**Subject:** RJS Seatbelts  
**Attachments:** Scan0918.pdf

*6/26/15*

Hi Jeff,

Please find attached the invoice for 2 RJS Seatbelts (including shipping) for a total of \$325.00 USD. The seatbelts were sent via Expedited Parcel USA on June 24, 2015. At your convenience, please mail a cheque to:

Rudi and Company Holdings ULC  
275 Viaduct Ave. West  
Victoria, BC V9E 2B6  
Canada

Thank you, Jeff. If you have any questions or concerns, please feel free to email or call me at 250-744-3332.

Cheers,  
Patty Koniczek



ALFA PARTS EXCHANGE  
 211 ACAMPO UTTERFIELD RD  
 LAWRENCE, MA 01840  
 06/30/2015  
 Trans # 1  
 Batch # 1

**Sale**  
 \*\*\*\*\*1852  
 Ref: AUTH/TKT 0955291  
 CVV #: 165181818102591  
 AVS Rsp: M-CVD Matches  
 Y-AddrZip Match

Cardholder acknowledges receipt of goods and obligations set forth in the cardholder's agreement with issuer.

Sprint 307358

CUSTOMER'S ORDER NO. DEPARTMENT DATE 6/30/15

NAME \_\_\_\_\_  
 ADDRESS \_\_\_\_\_  
 CITY, STATE, Z \_\_\_\_\_

SOLD BY	CASH	C.O.D.	CHARGE	ON.ACCT.	MDSE. RETD.	PAID OUT
---------	------	--------	--------	----------	-------------	----------

QUANTITY	DESCRIPTION	PRICE	AMOUNT
1			
2	1750 Rebuildable Engine		
3			1200.00
4			<u>1200.00</u>
5			
6			
7			
8			
9			
10			
11			
13			
14			
15			
16			
17			

\*\*\* P A R T   S A L E   I N V O I C E \*\*\*

ALFA PARTS  
1221 4TH STREET  
510 525-9435  
BERKELEY, CA. 94710-

INVOICE # : 33150  
PAGE # : 1  
WRITTEN BY : JRN  
INV. DATE : 09/17/2015

SOLD/SHIP TO



Customer Number : 5645 Customer P.O. # :None

Ordered by :None

PART NUMBER	DESCRIPTION	ORD	SHIP	RETAIL	PRCE.EA	EX.PRCE
1365 53 807	WHEEL CYLINDER FRONT LEFT	2	2	135.00	125.00	250.00

*Alfa*

	SUBTOTAL ==>	250.00
(Local Tax Code )	SALES TAX ==>	23.75
	FREIGHT ==>	0.00
	MISC CHARGE =>	0.00
	DEPOSIT ==>	0.00
	INV. TOTAL ==>	273.75

\*\* NO RETURN ON ELECTRICAL OR SPECIAL ORDER ITEMS \*\*  
\*\* RETURNS SUBJECT TO 20% RE-STOCKING CHARGE \*\*  
\*\* NO RETURNS WITHOUT INVOICE \*\*  
THANK YOU FOR YOUR PURCHASE

Add to bendix

**Jeff Abramson**

---

**From:** Lawrence Dickman <ldandtb@pacbell.net>  
**Sent:** March 09, 2016 6:31 PM  
**To:**  
**Subject:** Re: Alfa Sprint missing window trim, list

Installed new fuel pump- old one trickled for volume and made 1/4 # pressure.  
New battery installed.

Float levels correct now, I installed Brass floats, took out the plastic type the new webbers come with( not a fan of them).  
1/2 done with window aluminum trim, small issue due to glass not being parallel with B-pillar at leading edge, but think I have a solution.

Your car didn't have a front exhaust hanger, I got a Used set out of stock and luckily found a correct for your case Spilt case trans Veloce cross bracket. I also got new rubber Isolaters to go into the bracket set. Will help support headers and look stock.  
Road testing final jetting on hold due to windows out and rain.

Larry

**From:** Lawrence Dickman [<mailto:ldandtb@pacbell.net>]  
**Sent:** March 02, 2016 9:31 PM  
**To:**  
**Subject:** Re: Alfa Sprint missing window trim, list

I though I responded to this last week, sorry.

The alum. pieces I had are not the ones you need, still looking, I can fab new ones, they are not that complicated. If have to fabricate, pls do

Holes in exhaust fixed with section of new stainless to prevent rust out again in the low water/condesation collection point, but there is some exhaust fit issues in front due to overall engine height differences. I may need to cut and reshape.

Trans seems good in all gears.

Carbs are giving me problems, still need some jetting...

Throttle linkage was actually barely giving you 1/2 throttle before? That is now sorted out.

I have the generator and a bosch regulator checked and work well, I have made changes to Bosch reg to disguise it to look like the Marelli, I will use the Marelli round cover over the Bosch ultimately.

Oil temp sender is bad, need to change at oil change.

Oil pressure banjo fitting keeps seeping, or it's the crimped end of the hose seeping?

Your battery seems to have given up after all the past overcharges, I am trickle charging it but it doesn't look good. I can pick-up a new one if it turns out bad. Pls replace

Brakes are better, but not quite there, Right front drum is a bit egg shaped, with shoes really adjusted, drum grabs and loosens twice in one rotation

Have you had any fuel pump/pressure issues in the past? It seemed to take a long time for the pump to fill carbs when I first got it going. Some of those Bendix style pumps had issues( last few years of production, your is pretty new) from the factory. Internal check

valves not reliable or just didn't work. This maybe the thing giving me issues with carbs? I am going to put an inline press gauge friday. I don't recall. Pls replace if necessary.

A lot of marginal news.

Larry

**From:**

**To:** "Larry Dickman Jr. ([ldandtb@pacbell.net](mailto:ldandtb@pacbell.net))" <[ldandtb@pacbell.net](mailto:ldandtb@pacbell.net)>

**Sent:** Wednesday, February 24, 2016 5:54 PM

**Subject:** Alfa Sprint missing window trim, list

Hi Larry, attached is a picture showing the aluminum trim piece that attaches to the glass on the vent window. I have also included the list Guy gave you. Could you please give the status of each item. Thanks, Jeff

Here's what the Alfa needs:

1. Locate/ install aluminum strips for quarter windows. At the front of the quarter there is an aluminum piece which is stepped downward in the direction of the glass. See attached photo & compare to car.
2. The charging system has been problematic. It repeatedly over-charges. It will work its way up to 15V again after adjusting regulator eventually. I think it would be best to work out putting in a nice Nippon Denso or other suitable alternator along with the 1750. The stock voltage regulator could be put in a box and a "dummy" put in its place. Maybe just getting another one that is no good, taking out the guts and using it as a "pass thru" if possible so it retains some of the details of being a Veloce.
3. Put stock springs on car. Make sure not banging/knocking.
4. Transmission "notchy" when shifting up to 2nd gear
5. Weld up holes in tail pipe at rear on the bottom.
6. Confirm oil temp gauge working
7. Car feels rough when in hard turn, lots of feedback through steering wheel i.e. knocking and vibration
8. When driving to SF for Mille', Brakes first pulled left, then right, then stopped. Was told by Mille' participant that if you drive in reverse then press hard on brakes they will adjust. I tried this and it seemed to work. Something else wrong? Brakes grind and whine but otherwise work well when not pulling side to side.
9. Metallic vibration noise under vehicle at idle-in bell housing, mostly when cold
10. One of the previous mechanics to work on it says the steering box or Pittman arm was re-assembled incorrectly. The RH tie rod link is adjusted out to the max to compensate for the incorrect arm geometry.

**Subject:** Re: Sprint Veloce

**From:** Lawrence Dickman (ldandtb@pacbell.net)

**To:**

**Date:** Thursday, March 31, 2016 2:52 AM

1750 engine build.

Cylinder head, new guides, seals, new exhaust and intake valves. resurfaced tappets.

Intake, 10.5mm lift cam, 280 deg duration for a little sportier feel. .014 clearance. Using a "larger intake cam works well due to the relatively small intake valves compared to the exhaust valves. On more aggressive builds I install oversize intake seats and valves, still leaving the Exh. all stock size.

Exhaust 9.5mm stock 1750 cam, .016 clearance. same was used for intake also on stock 1750.

Veloce oil pan, windage tray and trap doors all reused from 1300 that came out.

Oil pump long 9 tooth helical gear style.

1750 block and front cover modified for Pass. dip stick, rear case breather and driver side oil press. line banjo.

New 1750 Piston and liner set, 9.7 to 1 compression, includes new wrist pins and rings. balanced

1750 Crank, .010 on mains and rods, Nitrided, 6 galley holes drilled tapped to 8x1mm and plugs installed, rather than the peened in alum. plugs. balanced

Connecting rods new small end bushings installed resized big and small ends. balanced

Flywheel from old engine, resurfaced, disc and pressure plate were in near new condition, all balanced.

New timing chains, main, thrust and rod bearings, pilot bushing.

Early non breather valve cover modified for Veloce nuts and Tig welded front eyelets.

Original water pump, rebuilt, new bearings, impeller shaft machined for ceramic seal, housing mod. to fit 1750 front cover.

1600 dia. front pulley, balanced with crank, etc. larger dia. than 1300 and smaller than a 1750.

Just a note. The original 1300 Veloce headers may be the choke point at higher RPM due to their small dia. tubes. I did not notice any up to 5.5K (trusting the tach.) going to 6.5-7 may show a brick wall?

Larry

---

**From:**

**To:** Lawrence Dickman <ldandtb@pacbell.net>

**Sent:** Tuesday, March 29, 2016 2:51 PM

**Subject:** Sprint Veloce

Thanks for spending the time to explain everything and unload the engine. When you can, could you e-mail me any of the specifics for the engine. Also, do you know what the timing is set at as well as what jets/tubes went into the carburetors.  
Regards,

**Subject:** Re: Sprint Veloce  
**From:** Lawrence Dickman (ldandtb@pacbell.net)  
**To:**  
**Date:** Tuesday, March 29, 2016 4:27 PM

Weber's  
32mm venturi's were 28mm before.  
40 accel jets same  
50F11 idle jets, were 45F9 before.  
130 main jets were 120's  
180 air correctors, were 210's  
I installed brass floats, not a fan of the late plastic type it had.

Marelli dist 9-10 deg. initial advance at warm idle 33-34 deg. max  
I slowed down the advance on the dist. was all in to early for long stroke engine.

I will get engine info to you later tonight.

Larry

---

**From:**  
**To:** Lawrence Dickman <ldandtb@pacbell.net>  
**Sent:** Tuesday, March 29, 2016 2:51 PM  
**Subject:** Sprint Veloce

Thanks for spending the time to explain everything and unload the engine. When you can, could you e-mail me any of the specifics for the engine. Also, do you know what the timing is set at as well as what jets/tubes went into the carburetors.  
Regards,

3/30/6

## ESTIMATE OF AUTO REPAIRS

AS LISTED FOR LABOR AND MATERIALS  
VERBAL AGREEMENTS NOT BINDING - ESTIMATES FREE

OWNER				ATE
ADDRESS				ST. NO.
INSURANCE				ORDER NO.
ADDRESS				DENSE NO.
YEAR/MONTH	MODEL	MILEAGE	MOTOR NO.	SERIAL NO.
1957	Spint Vela			

QUAN.	DESCRIPTION OF LABOR OR MATERIAL	PART NO.	MATERIAL	LABOR
1	1750 Engine rebuild general detail work and Cyl. head machine, new guides rods and ex valves.		250 <sup>00</sup>	800 <sup>00</sup> 400 <sup>00</sup>
1	10.5 mm intake cam sup in			
1	9.7-1 Main P&L set		620 <sup>00</sup>	
	New Gasket set, timing chain Main & Rod .010 bearings, etc		460 <sup>00</sup>	
4	Rods resical / new wrist pin brush			200 <sup>00</sup>
1	Crank draft galle holes drilled and tapped to 5/16 mm, cleaned polished .010 M&R			80 <sup>00</sup>
	1750 Block modified for oil press. line & rear weather, Front cover dranged to dip stick type and spice removed			170 <sup>00</sup>
1	Rebuild 250 waterpump / produce shaft, new ceramic seal and sealed bearings		70 <sup>00</sup>	160 <sup>00</sup>
8	Qt Breakin oil 158 30wt.		80 <sup>00</sup>	
1	oil filter		10 <sup>00</sup>	
	Balance - crank rods pistons p&L & dirc		250 <sup>00</sup>	

PARTS PRICE BASED ON STANDARD CATALOG PROCUREMENT PRICE LISTS. SUBJECT TO CHANGE WITHOUT NOTICE. PROCUREMENT AND DELIVERY CHARGES MAY BE ADDED FOR SPECIAL SERVICE OR ITEMS NOT AVAILABLE LOCALLY.		TOTAL MATERIALS	1740 <sup>00</sup>
OLD PARTS REMOVED FROM CARS WILL BE JUNKED UNLESS OTHERWISE INSTRUCTED IN WRITING. THE ABOVE IS AN ESTIMATE BASED ON OUR INSPECTION AND DOES NOT COVER ADDITIONAL PARTS OR LABOR WHICH MAY BE REQUIRED AFTER THE WORK HAS BEEN OPENED UP. OCCASIONALLY, AFTER WORK HAS STARTED, WORN PARTS ARE DISCOVERED WHICH ARE NOT EVIDENT ON FIRST INSPECTION. BECAUSE OF THIS THE ABOVE PRICES ARE NOT GUARANTEED.		TOTAL LABOR	1760 <sup>00</sup>
ESTIMATED BY		TOTAL MATERIALS	
ESTIMATE APPROVED BY		TAX	
AUTHORIZED AND ACCEPTED		PAID OUT - TOW & STORAGE	
BY OWNER OR AGENT		SUBLET REPAIRS	
DATE		<b>TOTAL</b>	3500 <sup>00</sup>

## ESTIMATE OF AUTO REPAIRS

AS LISTED FOR LABOR AND MATERIALS  
VERBAL AGREEMENTS NOT BINDING - ESTIMATES FREE

OWNER			DATE
ADDRESS	PHONE	EST. NO.	
INSURANCE	3/30/16		ORDER NO.
ADDRESS	PHONE	LICENSE NO.	
YEAR/MAKE	MODEL	MILEAGE	MOTOR NO. SERIAL NO.

QUAN.	DESCRIPTION OF LABOR OR MATERIAL	PART NO.	MATERIAL	LABOR
	1730 engine test fit into 750 Sprint chassis fit headers generator etc.			340 <sup>00</sup>
1	New Exh manifold & modify existing intake manifold & 2 reedbars 1 shim waterjet for lt side		120 <sup>00</sup>	90 <sup>00</sup>
1	German Bosch reg. test stand modified to look like Marelli		40 <sup>00</sup>	60 <sup>00</sup>
1	Exh repair, O2 sensor bung install fit & refines front angle		10 <sup>00</sup>	90 <sup>00</sup>
1	Used 101 veloce exh hanger assembly, 2 new rubber bush installed		5 <sup>00</sup> 100 <sup>00</sup> 65 <sup>00</sup>	
1	new lower val. nose		15 <sup>00</sup>	
1	R&R Weber carbs, clean inject replace 28mm venturi to 32mm rejet 50F9's to 50F11's main s to 130 & Air Corr. 150		100 <sup>00</sup>	200 <sup>00</sup>

PARTS PRICE BASED ON STANDARD CATALOG PROCUREMENT PRICE LISTS. SUBJECT TO CHANGE WITHOUT NOTICE. PROCUREMENT AND DELIVERY CHARGES MAY BE ADDED FOR SPECIAL SERVICE OR ITEMS NOT AVAILABLE LOCALLY.		TOTAL MATERIALS	455 <sup>00</sup>
OLD PARTS REMOVED FROM CARS WILL BE JUNKED UNLESS OTHERWISE INSTRUCTED IN WRITING. THE ABOVE IS AN ESTIMATE BASED ON OUR INSPECTION AND DOES NOT COVER ADDITIONAL PARTS OR LABOR WHICH MAY BE REQUIRED AFTER THE WORK HAS BEEN OPENED UP. OCCASIONALLY, AFTER WORK HAS STARTED, WORN PARTS ARE DISCOVERED WHICH ARE NOT EVIDENT ON FIRST INSPECTION. BECAUSE OF THIS THE ABOVE PRICES ARE NOT GUARANTEED.		TOTAL LABOR	780 <sup>00</sup>
ESTIMATED BY		TOTAL MATERIALS	
ESTIMATE APPROVED BY		TAX	
AUTHORIZED AND ACCEPTED		PAID OUT - TOW & STORAGE	
BY OWNER OR AGENT		SUBLET REPAIRS	
DATE		<b>TOTAL</b>	1235 <sup>00</sup>



## ESTIMATE OF AUTO REPAIRS

AS LISTED FOR LABOR AND MATERIALS  
VERBAL AGREEMENTS NOT BINDING - ESTIMATES FREE

Pleasanton CA 94566

OWNER			DATE
ADDRESS	PHONE	EST. NO.	
INSURANCE	5/30/16	ORDER NO.	
ADDRESS	PHONE	LICENSE NO.	
YEAR/MAKE	MODEL	MILEAGE	MOTOR NO. SERIAL NO.

QUAN.	DESCRIPTION OF LABOR OR MATERIAL	PART NO.	MATERIAL	LABOR
	Brake shoe Adjustments			160 <sup>00</sup>
	Axial & lateral all wheels			
	bleed brakes, clean Lt Frt shoes		10 <sup>00</sup>	
	adj parking brake cables			
	strut, etc.			
12	Gallons 91 oct. fuel		36 <sup>00</sup>	
6	QT BP 20-50 oil		80 <sup>00</sup>	
1	Gall Anti Freeze		10 <sup>00</sup>	
2	QT Trans gear oil Spixax		20 <sup>00</sup>	
1	New fuel pump & 3ft green fuel line		110 <sup>00</sup>	
1	Rebuild trans replace 5 aftermarket			300 <sup>00</sup>
	flat synchros, change out		230 <sup>00</sup>	
	early shift fork for HD late		60 <sup>00</sup>	
	type New seals & rear mount		110 <sup>00</sup>	
1	Re-align frame arms			80 <sup>00</sup>
	re-adjust drag link and			
	tie rods			
2	Fabricate Alum channels for Brit Glass/R&R			160 <sup>00</sup>
1	Rechrome & rebuild chrome push-lock		90 <sup>00</sup>	40 <sup>00</sup>
	Shifter			
1	New Napa #35 Battery		104 <sup>00</sup>	
4	R&R Front & rear springs/new rear rubber isolator			140 <sup>00</sup>

PARTS PRICE BASED ON STANDARD CATALOG PROCUREMENT PRICE LISTS. SUBJECT TO CHANGE WITHOUT NOTICE. PROCUREMENT AND DELIVERY CHARGES MAY BE ADDED FOR SPECIAL SERVICE OR ITEMS NOT AVAILABLE LOCALLY.		TOTAL MATERIALS	590 <sup>00</sup>
OLD PARTS REMOVED FROM CARS WILL BE JUNKED UNLESS OTHERWISE INSTRUCTED IN WRITING. THE ABOVE IS AN ESTIMATE BASED ON OUR INSPECTION AND DOES NOT COVER ADDITIONAL PARTS OR LABOR WHICH MAY BE REQUIRED AFTER THE WORK HAS BEEN OPENED UP. OCCASIONALLY, AFTER WORK HAS STARTED, WORN PARTS ARE DISCOVERED WHICH ARE NOT EVIDENT ON FIRST INSPECTION. BECAUSE OF THIS THE ABOVE PRICES ARE NOT GUARANTEED.		TOTAL LABOR	580 <sup>00</sup>
ESTIMATED BY		TOTAL MATERIALS	
ESTIMATE APPROVED BY		TAX	
AUTHORIZED AND ACCEPTED		PAID OUT - TOW & STORAGE	
BY OWNER OR AGENT	DATE	SUBLET REPAIRS	
		<b>TOTAL</b>	<b>1730<sup>00</sup></b>



### Final Details for Order #108-0768888-8029834

[Print this page for your records.](#)

**Order Placed:** April 21, 2016  
**Amazon.com order number:** 108-0768888-8029834  
**Order Total: \$11.38**

*Alfa &  
SS  
1 for each*

**Shipped on April 21, 2016**

**Items Ordered**

2 of: *Allstar ALL76152 Red Plastic Battery Disconnect Protective Boot*  
Sold by: Amazon.com LLC

**Price**  
\$5.24

Condition: New

**Shipping Address:**

1

Item(s) Subtotal: \$10.48  
Shipping & Handling: \$0.00  
-----  
Total before tax: \$10.48  
Sales Tax: \$0.90  
-----

**Shipping Speed:**  
Two-Day Shipping

**Total for This Shipment: \$11.38**  
-----

### Payment information

**Payment Method:**  
Visa | Last digits: 9252

Item(s) Subtotal: \$10.48  
Shipping & Handling: \$0.00  
-----  
Total before tax: \$10.48  
Estimated tax to be collected: \$0.90  
-----

**Billing address**

1

**Grand Total: \$11.38**

**Credit Card transactions**

Visa ending in 9252: April 21, 2016: \$11.38

To view the status of your order, return to [Order Summary](#).

[Conditions of Use](#) | [Privacy Notice](#) © 1996-2016, Amazon.com, Inc. or its affiliates

[Print this page for your records](#)

**Order Placed:** November 3, 2016  
**Amazon.com order number:** 108-7470973-5813000  
**Order Total:** \$27.90

**Shipped on November 3, 2016**

**Items Ordered**

1 of: *Bosch 30019 12V Voltage Regulator for VW Beetle*  
Sold by: Amazon.com LLC

**Price**  
\$25.71

Condition: New

**Shipping Address:**

Item(s) Subtotal: \$25.71  
Shipping & Handling: \$0.00  
-----

Total before tax: \$25.71  
Sales Tax: \$2.19  
-----

**Shipping Speed:**  
Two-Day Shipping

**Total for This Shipment: \$27.90**  
-----

**Payment information**

**Payment Method:**

Visa | Last digits: 9252

Item(s) Subtotal: \$25.71  
Shipping & Handling: \$0.00  
-----

**Billing address**

Total before tax: \$25.71  
Estimated tax to be collected: \$2.19  
-----

**Grand Total: \$27.90**

**Credit Card transactions**

Visa ending in 9252: November 3, 2016: \$27.90

To view the status of your order, return to [Order Summary](#).

[Conditions of Use](#) | [Privacy Notice](#) © 1996-2016, Amazon.com, Inc. or its affiliates



PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

# Invoice

<b>Bill To</b>	<b>Date</b>	8/31/2017
	<b>Invoice #</b>	202024
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	8	Sand body work and undercarriage with 120 grit paper. Sand left and right side front end and left and right sides with 120 grit.	105.00	840.00
Labor	10.25	Grind previous repairs to underside of car where panel replacements were welded and sat above plates creating bumps. Apply bonding filler. Sand with 80 grit followed by 120 grit paper.	105.00	1,076.25
Labor	5.5	Sand filler on undercarriage, left and right sides.	105.00	577.50
Labor	8	Complete sanding of underside of floor. Spot fill. Sand fill. Prep to prime underside: blow out cavities, wipe down, mask and bag vehicle.	105.00	840.00
Labor	4.5	Spray epoxy primer on underside of floor/body.	105.00	472.50
Labor	10	Body work to front dash at mirror hole and unnecessary button switch as well as a dent. Body work to interior of floor, front and rear where penetration of old welds through thin panels created tits. Sand with 120 grit. Apply filler. Sand with 320 grit. Body work to left and right side floor. Body work to rear interior of trunk. Apply filler. Sand.	105.00	1,050.00
Labor	7.75	Grind welds on interior of floor and trunk area. Feather area in trunk floor. Sand with 120 grit. Disassemble and blast trunk lid, stay and spring. Apply primer to stay and spring. Straighten back panel of trunk (trunk to rear of interior.)	105.00	813.75
Labor	10	Body work to dash. Apply filler. Block sand 120 grit. Straighten and fill door jambs. Straighten and fill front of the jambs, hood, and block sand front end.	105.00	1,050.00
Labor	8	Straighten areas in trunk. Apply filler. Sand 80 grit. Apply filler. Sand 180 grit. Apply filler. DA sand 320 grit.	105.00	840.00
Labor	7.5	Body work in front hood jamb - left and right side. Sand with 120 grit and 180 grit. Body work on front dash. Sand front dash with 120 grit and 180 grit. Mask dash and floor and rear decklid. Mask front end and rear floor.	105.00	787.50
Labor	7.75	Scuff interior of trunk. Seam seal inner trunk in repair areas. Weld in 3 wire tie straps and dress welds. Blow and vacuum interior and trunk. Remove wax and grease from trunk interior in preparation to prime. Mask and bag vehicle in preparation to prime interior.	105.00	813.75
Labor	2	Prime interior, trunk and dash.	105.00	210.00
Labor	3	Touch up paint in trunk where unable to access with the paint gun.	105.00	315.00
Labor	4	Sand trunk floor 320 grit. Scuff trunk floor interior in preparation for paint. Mask and bag car in preparation for paint.	105.00	420.00
Labor	7	Block left side rocker panel. Bodywork left quarter panel, and top. Mask inside trunk and outside of car. Paint trunk.	105.00	735.00
Labor	1	Prime and paint rear jam.	105.00	105.00
Labor	7.75	Grind off filler from both left and right quarter wheel wells. Weld up a few rust through spots. Apply filler. Block sand with 80 grit. Apply putty and block sand putty.	105.00	813.75
Labor	3.5	Remove glue off inside of case on left side of car.	105.00	367.50
Labor	0.5	Pick up shocks.	105.00	52.50

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



9/1/17

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	8/31/2017
	<b>Invoice #</b>	202024
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
		Labor Subtotal		12,180.00
Parts	1	Cart of bare metal seam sealer	52.85	52.85T
Parts	2	Quart epoxy primer	67.48	134.96T
Parts		4 oz epoxy primer, 2 oz reducer		0.00T
Parts	1	Platinum plus putty	54.74	54.74T
		Parts Subtotal		242.55
Reimbursab...	1	Box 120 grit sandpaper	34.81	34.81
Reimbursab...	1	Box sanding discs	43.52	43.52
Reimbursab...	1	Box 3" 180 Hookit sandpaper	31.74	31.74
Reimbursab...	1	Box 3" 320 Hookit sandpaper	42.84	42.84
Reimbursab...	1	Box 3" 120 Hookit sandpaper	47.00	47.00
		Reimbursables Subtotal		199.91

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$12,622.46
	<b>Sales Tax (8.1..</b>	\$19.71
	<b>Total</b>	<b>\$12,642.17</b>
	<b>Payments/Credits</b>	\$0.00
	<b>Balance Due</b>	<b>\$12,642.17</b>



9/27/17

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

*Credit will show  
 you next + bill*

<b>Bill To</b>	<b>Date</b>	9/15/2017
	<b>Invoice #</b>	202039
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	5.5	Block sand right side, front end and rear body of car using 220 grit sandpaper.	105.00	577.50
Labor	4	Block sand exterior body of car with 220 grit sandpaper.	105.00	420.00
Labor	1	Labor and reimbursables to restore set of 4 Koni shocks	1,263.53	1,263.53
		Labor Subtotal		2,261.03
Parts	1	Gallon panel adhesive	186.30	186.30T
Parts	1	Quart panel adhesive	46.57	46.57T
Parts	1	Parts to restore set of 4 Koni shocks	582.21	582.21T
		Parts Subtotal		815.08
Reimbursab...	1	Bag of automix caps	17.40	17.40
Reimbursab...	0.5	Pack 60 grit grinding discs	31.18	15.59
Reimbursab...	15	Cutoff wheels	4.00	60.00
Reimbursab...	1	Shipment of cutoff wheels	5.76	5.76
Reimbursab...	1	Roloc sanding discs	12.12	12.12
Reimbursab...	1	Masking tape	13.75	13.75
Reimbursab...	1	Guide coat	6.50	6.50
		Reimbursables Subtotal		131.12

?  
 ?  
 -ok  
 ]-?  
 ]-?

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$3,207.23
	<b>Sales Tax (8.1..</b>	\$66.23
	<b>Total</b>	\$3,273.46
	<b>Payments/Credits</b>	-\$1,155.00
	<b>Balance Due</b>	\$2,118.46

10/5/17



PETERSON MOTORSPORTS, LLC  
22255 ARNOLD DR SONOMA, CA 95476  
PH 707-996-7764

# Invoice

<b>Bill To</b>	<b>Date</b>	9/30/2017
	<b>Invoice #</b>	202050
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	8.5	Grind down aluminum penetration bumps on inner right door skin. Remove rust from interior frame. More planishing. Hand sand inaccessible areas. Remove upper hinge pin. (Labor recategorized from insurance invoice.)	105.00	892.50
Labor	1.25	Install deck lid. Begin straightening edges.	105.00	131.25
		Labor Subtotal		1,023.75

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$1,023.75
	Sales Tax (8.1..)	\$0.00
	<b>Total</b>	<b>\$1,023.75</b>
	Payments/Credits	-\$997.50
	<b>Balance Due</b>	<b>\$26.25</b>

hasselgren engineering  
 1221 4th st.  
 Berkeley Ca.94710  
 510 524 2485

Date : 10-16-2017      Time : 13:14:56  
 INF=.5              Mode : A-Sweep

T13:51 D10-16 J:140/:120 F:16 S:42 : 9.0      STK:na    air box cast  
 C:                      alfa gtv1750    cam:  
 WEB 45dcoe9 CHK:38 P:45 AX:45 i:55f  
 EX:gta std w tail pipe and muffleschev 92

FileName : GTV10.D11

Speed RPM	C_TQ lbft	C Power C_HP	OILpsi PSI	ecm	Water° °F	FOilOut °F	BSFC lb/hr	fuel p
3500	102.8	68.54	61.1	.81	179	78	.523	3.1
3600	112.7	77.26	62.4	.8	179	78	.543	3.1
*3700	114.4	80.65	63.9	.8	179	78	.495	3.1
*3800	115.9	83.89	65.8	.81	179	78	.487	3.1
*3900	116.8	86.8	67.9	.8	179	79	.477	3.1
*4000	117.9	89.85	70.1	.78	179	80	.464	3.1
*4100	118.8	92.75	72.5	.8	179	80	.454	3.1
*4200	120	95.97	74.9	.79	179	80	.448	3.1
*4300	121.8	99.76	77.2	.82	179	80	.439	3.1
*4400	123.4	103.4	79.1	.83	179	80	.45	3.1
*4500	124.1	106.3	80	.86	179	78	.476	3.1
*4600	124.4	108.9	80.7	.86	179	78	.486	3.1
*4700	124.4	111.3	81.2	.87	179	78	.494	3.1
*4800	125	114.3	81.6	.88	179	78	.508	3.1
*4900	124.9	116.6	82.1	.86	179	79	.495	3.1
*5000	125.2	119.2	82.4	.85	180	79	.483	3
*5100	125.3	121.7	82.9	.85	180	80	.461	3.1
*5200	124.1	122.8	83.2	.85	180	79	.435	3.1
*5300	123	124.2	83.6	.84	180	78	.417	3.1
*5400	123	126.4	83.9	.84	180	78	.411	3.1
*5500	121.8	127.6	84.1	.85	180	78	.409	3.1
*5600	119	126.9	84.3	.84	180	79	.422	3.1
*5700	118	128	84.6	.84	180	80	.436	3.1
*5800	116	128.1	84.7	.84	180	78	.441	3.1
*5900	114.3	128.5	84.8	.84	182	80	.468	3
*6000	112.6	128.7	84.9	.83	183	80	.496	3.1
*6100	110.7	128.6	85	.82	183	79	.508	3
*6200	108.5	128.1	85	.81	183	79	.515	3.1
*6300	106.3	127.5	85	.8	181	80	.523	3
*6400	104.6	127.4	85.2	.8	180	78	.534	3.1
*6500	102.6	127	85.1	.79	175	80	.556	3.1

Average data in \* band  
 5100    118.21   114.21   80.2    .83    179.79   79    .47    3.09



Alfa Sprint

10/20/17

Jeff Abramson

**From:** Lawrence Dickman <ldandtb@pacbell.net>  
**Sent:** October 18, 2017 8:29 PM  
**To:**  
**Cc:**  
**Subject:** Engine and diff.

Engine dyno	\$1868
New titanium valve spring retainers	\$150
New valve spring set	\$95
Gasket set	\$170
Engine rebuild labor	N/C
Engine rebalance	N/C

Differential, disassembly, clean, cut off end flanges, index to 101 configuration and tig weld. repaint tubes, reassembly, new seals  
 Trunion disassemble , paint, adjust ball reassemble. clean E brake cable assembly  
 New rear brake cylinder retainer clips and rubber gaiters(old clips damaged and missing one lock, no rubber left)  
 Pick up and delivery

\$825

1Rear drum replacement due to worn out steel liner, both rears surfaced \$180  
 1Front drum replacement RF , surfaced, due to old one ovaled \$150

Total \$3438



12/1/17

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	11/30/2017	
		Invoice #	202076	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	1	Restoration / calibration of tachometer	607.50	607.50
		Labor Subtotal		607.50
Reimbursab...	1	Shipping of tachometer for calibration	19.19	19.19
Reimbursab...	1	Shipment of restored tachometer	19.28	19.28
		Reimbursables Subtotal		38.47
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$645.97
			Sales Tax (8.1..	\$0.00
			<b>Total</b>	<b>\$645.97</b>
			Payments/Credits	-\$386.85
			<b>Balance Due</b>	<b>\$259.12</b>



5/17/17

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	5/15/2017	
		Invoice #	201952	
		Project	1957 Alfa	
Item Code	Quantity	Description	Rate	Amount
Labor	4	Meet with insurance adjuster. Begin disassembly of left door.	105.00	420.00
Labor	6.5	Remove bumper and brackets and license plate. Remove left and right signal lights. Remove chrome molding and left and right front grill. Remove right fender molding. Remove right door molding. Remove right rear quarter panel.	105.00	682.50
Labor	1.75	Begin tearing down left door and windshield wipers.	105.00	183.75
		Labor Subtotal		1,286.25
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$1,286.25
			Sales Tax (8.0..)	\$0.00
			<b>Total</b>	<b>\$1,286.25</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$1,286.25</b>



PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

6/6/17

# Invoice

<b>Bill To</b>     <div style="text-align: center; font-size: 2em; font-family: cursive;">Alfa</div>	<b>Date</b>	5/31/2017
	<b>Invoice #</b>	201957
	<b>Project</b>	
		1957 Alfa

Item Code	Quantity	Description	Rate	Amount
Labor	1.5	Help remove bolts in order to pull the engine.	105.00	157.50
Labor	5.5	Remove engine - all unbolted but unable to remove due to space restrictions.	105.00	577.50
Labor	2	Help remove the transmission.	50.00	100.00
Labor	7.75	Pull transmission, clutch and flywheel out. Remove engine from vehicle.	105.00	813.75
Labor	2.5	Help remove engine.	105.00	262.50
Labor	8.5	Remove right door. Remove electrical components. Remove washer bottle and bracket. Remove horn. Remove coil and bracket. Remove front wiring harness. Mark, bag and tag all removed items.	105.00	892.50
		Labor Subtotal		2,803.75

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$2,803.75
	Sales Tax (8.0..	\$0.00
	<b>Total</b>	<b>\$2,803.75</b>
	Payments/Credits	\$0.00
	<b>Balance Due</b>	<b>\$2,803.75</b>

6/20/17



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	6/15/2017	
		Invoice #	201973	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	14.5	Remove tires and wheels. Remove muffler. Remove gas tank. Remove batteries. Remove brake lines. Disassemble and remove suspension: shocks, coil springs, trailer arms.. Remove drive shaft and rear axle and rear end.	105.00	1,522.50
Labor	10	Remove right and left seat belts, right and left side seats, front and rear carpet, and rubber floor mats on right and left sides. Remove battery, fire extinguisher, heater core and firewall.	105.00	1,050.00
Labor	8.5	Remove emergency brake handle and cable, wiring from under vehicle, gas tank, trunk latch assembly, fuel lines, fuel filter, left and right seats, carpet and vinyl, gas cap and seal, seat belts and head liner.	105.00	892.50
Labor	10	Remove gas pedal, choke cable, mirror, heater vents, glove compartment, trim, face plates, steering wheel, dash trim, ashtray, chrome plug.	105.00	1,050.00
Labor	8.25	Remove steering wheel, steering column, gauges, switches on dash and wiring from right side firewall. Mark, tag, bag and take pictures of all parts. Rebuild light switch for easier removal and installation.	105.00	866.25
Labor	1	Transport engine block to engine shop.	50.00	50.00
Labor	9.5	Store parts and seats. Empty gas from original gas tank for storage. Build rotisserie for vehicle. Remove wiring harness completely from vehicle including fuse box.	105.00	997.50
Labor	4	Make brackets for attaching vehicle to rotisserie. Start welding together front brackets. Pick up parts to mount car to rotisserie.	105.00	420.00
Labor	4.25	Weld bracing on rotisserie clamps. Mount vehicle to rotisserie.	105.00	446.25
Labor	5	Remove lower hinge pin of right door. One is stuck. Blast and coat with self etching primer. Straighten right door.	105.00	525.00
		Labor Subtotal		7,820.00
<b>Due Upon Receipt</b>		<b>Subtotal</b>	\$7,820.00	
		Sales Tax (8.0..)	\$0.00	
		<b>Total</b>	<b>\$7,820.00</b>	
		Payments/Credits	\$0.00	
		<b>Balance Due</b>	<b>\$7,820.00</b>	



PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

7/3/17

# Invoice

<b>Bill To</b>	<b>Date</b>	6/30/2017
	<b>Invoice #</b>	201983
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	9	Straighten right door. Planish outer skin. Work on releasing upper hinge pin. Remove lower inner skin to frame sealant.	105.00	945.00
Labor	5	Degrease engine compartment undercarriage and mask inside of car.	105.00	525.00
Labor	7	Straighten right door frame. Remove corrosion from inner frame. Sandblast inaccessible areas. Start trunk lid corrosion removal. Sandblast frame area.	105.00	735.00
Labor	10	Wiring or wire sanding undercarriage of car. Reference pictures show bondo coverage, pocking, weld areas etc). Use purple pad in crevices.	105.00	1,050.00
Labor	8.75	Straighten deck lid aluminum.	105.00	918.75
Labor	1.25	Mask and self etch prime frame on deck lid.	105.00	131.25
Labor	10	Continue wire sanding of undercarriage of car.	105.00	1,050.00
Labor	10	Continue wire sanding undercarriage of car.	105.00	1,050.00
Labor	2.25	Media blast weld area in prep for welding on deck lid.	105.00	236.25
Labor	10	Continue wire sanding undercarriage of car.	105.00	1,050.00
Labor	10	Wire sand engine compartment of car.	105.00	1,050.00
		Labor Subtotal		8,741.25
Reimbursab...	1	Sanding discs 1396	21.78	21.78
Reimbursab...	1	Sanding discs 1397	21.78	21.78
Reimbursab...	1	Cleaning wheels	9.74	9.74
Reimbursab...	6	Bags of sand	13.00	78.00
Reimbursab...	1	Half box acid brushes and pads	30.80	30.80
Reimbursab...	9	Steel brush	1.79	16.11
		Reimbursables Subtotal		178.21

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$8,919.46
	Sales Tax (8.0..	\$0.00
	<b>Total</b>	<b>\$8,919.46</b>
	Payments/Credits	\$0.00
	<b>Balance Due</b>	<b>\$8,919.46</b>



8/3/17

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	7/31/2017
	<b>Invoice #</b>	202000
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	7.75	Straighten driver side floor underneath car. Cut out rust and fabricate patch panel. Weld in patch panel.	105.00	813.75
Labor	6.5	Strip undercarriage on right side fender and front of heater panel.	105.00	682.50
Labor	8.25	On left side bottom weld multiple rust holes. Straighten sheet metal. Fabricate patches. Weld in patches. Dress welds.	105.00	866.25
Labor	10	Continue stripping the undercarriage focusing on the front and back sides of the left and right sides of fender and on left and right quarters.	105.00	1,050.00
Labor	6.75	Weld rust holes. Dress welds. Fabricate forward passenger side floor patch and weld in.	105.00	708.75
Labor	10	Continue sandblasting and stripping undercarriage of left side fender.	105.00	1,050.00
Labor	4.75	Help with sandblasting and sand removal. Weld additional holes in floor and dress welds. Detail undercoat residue off vehicle.	105.00	498.75
Labor	5	Detail undercoat removal. Grind previous weld from old repairs. Dress rot holes in floor.	105.00	525.00
Labor	9	Strip inside of left fender. Body work on left side front end and on quarter panel on right side. Sand right fender and quarter panel.	105.00	945.00
Labor	8.75	Cut out rot from floor. Fabricate patches. Weld in patches. Dress welds.	105.00	918.75
Labor	1.5	Strip left fender.	105.00	157.50
Labor	8.75	Straighten dent on lower frame member. Weld additional screw hole. Weld on new wiring straps. Blow out sand and rust.	105.00	918.75
Labor	3.75	Weld and dress more rust holes. Fabricate patch and weld it in. Continue welding and dressing holes.	105.00	393.75
Labor	1	Remove rust and paint in engine bay.	105.00	105.00
		<b>Labor Subtotal</b>		<b>9,633.75</b>
Parts	1	Gallon Vette panel adhesive	182.25	182.25T
Parts	1	Tube panel bonding adhesive	59.53	59.53T
Parts	1	Platinum putty	54.74	54.74T
		<b>Parts Subtotal</b>		<b>296.52</b>
Reimbursab...	1	Gallon POR 15 strip gel	47.76	47.76
Reimbursab...	5	Face mask protective shields	1.31	6.55
Reimbursab...	1	Spray socks	3.15	3.15
Reimbursab...	2	Boxes green discs	55.33	110.66
Reimbursab...	15	Coatings removal discs	12.37	185.55
Reimbursab...	1	1/3 Gallon bug and tar remover	19.68	19.68
Reimbursab...	1	Box cubitron	21.74	21.74
Reimbursab...	1	Box cubitron belts, 80 grit	19.64	19.64
Reimbursab...	0.5	Roll 120 grit sand paper	79.11	39.56

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	7/31/2017	
		Invoice #	202000	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Reimbursab...	0.5	Box fine maroon sanding pads	32.17	16.09
		Reimbursables Subtotal		470.38
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$10,400.65
			Sales Tax (8.1..	\$24.09
			<b>Total</b>	<b>\$10,424.74</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$10,424.74</b>





8/16/17

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	8/15/2017	
		Invoice #	202012	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	4.25	Cut and weld on wiring harness straps. Grind welds on previous panel replacement job. Apply bonding filler and sand with 120 grit paper.	105.00	446.25
Labor	0.5	Sand bondo in rear compartment with 120 grit.	105.00	52.50
Labor	8.75	Fill poor quality previous repair pane with panel adhesive. Sand with 80 grit followed by 120 grit. Weld and dress rust holes.	105.00	918.75
Labor	4	Apply bonding filler and sand with 80 grit followed by 120 grit paper.	105.00	420.00
Labor	1	Grind rear floor to back panel.	105.00	105.00
Labor	4.5	Sand undercarriage with 120 grit. Sand body work on right side and left undercarriage.	105.00	472.50
Labor	7	Cut and grind nonfunctional metal strip. Weld to exterior floor next to rear body panel. Weld up additional rust holes. Weld in small patch on right rear rocker. Begin removing undercoating on right inner rocker area in order to access rust holes.	105.00	735.00
Labor	3.5	Sand body work on left and right side in undercarriage with DA 120 grit followed by block 80 and 120 grit.	105.00	367.50
Labor	7.5	Fill previous panel replacement on floor with bonding filler. Weld additional rust holes. Straighten left wheel well and apply bonding filler. Straighten right wheel well and expose poor panel replacement weld.	105.00	787.50
Labor	6	Weld right wheel well. Dress weld. Cut out rusted panel and prep in wheel well.	105.00	630.00
Labor	8.5	Sand body work on undercarriage right side and inside quarter on right side.	105.00	892.50
Labor	5.5	Cut out additional rot in right wheel well. Fabricate patch panels. Weld in patch panels. Dress welds. Weld rust hole near engine compartment. Dress welds. Dress welds on previous repairs for smoothing with bonding filler.	105.00	577.50
Labor	10	Continue sanding bonding on undercarriage with 120 grit.	105.00	1,050.00
Labor	8.5	Continue cutting out rust, making patch panels and welding them in. Dress welds.	105.00	892.50
		<b>Labor Subtotal</b>		<b>8,347.50</b>
Reimbursab...	0.5	Box 120 grit sandpaper	34.81	17.41
Reimbursab...	0.5	Box 80 grit sandpaper	31.73	15.87
Reimbursab...	1.5	Roll 120 grit gold stick sandpaper	84.50	126.75
		<b>Reimbursables Subtotal</b>		<b>160.03</b>
<b>Due Upon Receipt</b>			<b>Subtotal</b>	<b>\$8,507.53</b>
			<b>Sales Tax (8.1..</b>	<b>\$0.00</b>
			<b>Total</b>	<b>\$8,507.53</b>
			<b>Payments/Credits</b>	<b>\$0.00</b>
			<b>Balance Due</b>	<b>\$8,507.53</b>



10/25/17

# Invoice

PETERSON MOTORSPORTS, LLC  
22255 ARNOLD DR SONOMA, CA 95476  
PH 707-996-7764

<b>Bill To</b>		<b>Date</b>	10/15/2017	
		<b>Invoice #</b>	202065	
		<b>Project</b>	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	2	Mask hood underneath. Scuff hood. Test paint and clear coat hood.	105.00	210.00
		Labor Subtotal		210.00
Parts	1	Half pint red test paint (Red is same color as car was painted - not the more purple red.)	83.70	83.70T
Parts	1	Aluminum for door repairs	79.86	79.86T
			0.00	0.00
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$373.56
			Sales Tax (8.1..	\$13.29
			<b>Total</b>	<b>\$386.85</b>
			Payments/Credits	-\$6.25
			<b>Balance Due</b>	<b>\$380.60</b>



12/15/17

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	12/15/2017
	<b>Invoice #</b>	202093
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	0.25	Tack weld bottom sections of doors.	105.00	26.25
Labor	4.25	Cut and bend lower right door. Repair panel. Clean out old seam sealer from flange bend. Glue same with panel bond. Fit door to vehicle.	105.00	446.25
Labor	3.75	Fit repair panel to right door - trimming and filing 45 degree corners on door on and off vehicle several times to achieve fit.	105.00	393.75
Labor	4.75	Grind left quarter panel door opening. Weld in rods to close gap on left quarter panel.	105.00	498.75
Labor	8	Install deck lid. Fit deck lid. Hammer and dolly lip. Find latch and striker and install them. Grind left quarter panel to door opening gap a bit more. Cut left quarter panel to deck lid opening gap. Straighten channel. Tack into place.	105.00	840.00
Labor	5.25	Straighten aluminum shell on deck lid. start to adjust hood. Install and align edges for height. Remove hood light, mouldings and insulation. Straighten aluminum shell. Straighten aluminum hood.	105.00	551.25
Labor	8.25	Remove trunk lid from car. Remove weather stripping and inspect trunk lid for cracks. Mark cracks. Set up tig-welder, prep trunk lid and weld all cracks. Note difficulty because aluminum is thin and contaminated. Grind and sand down all welds. Re-inspect trunk lid. Mark more cracks. clean and weld them. Weld top right edge of trunk lid to build it up helping gap.	105.00	866.25
		Labor Subtotal		3,622.50
		????????????????Check for insurance billing????????????		

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$3,622.50
	<b>Sales Tax (8.1..</b>	\$0.00
	<b>Total</b>	\$3,622.50
	<b>Payments/Credits</b>	\$0.00
	<b>Balance Due</b>	\$3,622.50



12/21/17

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	12/31/2017	
		Invoice #	202102	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	8.75	Remove right door and set up for welding bottom patch piece on door. Clamp and tack-weld it approximately 1in. intervals. Weld door. Find crack on door. Clean and weld. (Time intensive welding due to welding new aluminum to old material. Also necessary to hammer and dolly between welds to ensure shape retention.) Grind and sand welds. Grind and sand welds on trunk lid. Grind and sand most of welds on right door.	105.00	918.75
Labor	4.75	Gather suspension parts for refurbishing. Disassemble running gear. Tumble polish and blast parts.	105.00	498.75
Labor	2.5	Strip gas cap. Bead blast 2 gas tank straps, 2 trailing arms, 1 drum and 2 springs.	105.00	262.50
Labor	7	Tumble polish parts. Work on disassembling front suspension.	105.00	735.00
Labor	7.25	Finish disassembling front suspension. Sandblast, clean and degrease parts. Stage in booth for epoxy coating.	105.00	761.25
Labor	5	Paint 18 parts with epoxy.	105.00	525.00
Labor	2.25	Tumble, sandblast and mask for painting final parts from suspension.	105.00	236.25
		Labor Subtotal		3,937.50
Parts	1	Gallons epoxy primer with hardener	269.93	269.93T
		Parts Subtotal		269.93
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$4,207.43
			Sales Tax (8.1..)	\$21.93
			<b>Total</b>	<b>\$4,229.36</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$4,229.36</b>

1/19/18



PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

# Invoice

<b>Bill To</b>	<b>Date</b>	1/15/2018
	<b>Invoice #</b>	202104
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	7.75	Remove paint and clean suspension parts. Beadblast and tumble polish suspension parts. Mask parts. Remove and de-grease front bearings and seals.	105.00	813.75
Labor	2	Paint 2 spindles, 2 caps and 2 backing plates with epoxy primer and hardener.	105.00	210.00
Labor	1.5	Clean control arms.	105.00	157.50
Labor	3.75	Tune and polish a few hammer and dollies to finish right door. Hammer and dolly out weld line for lower door section patch. Sand welds more and hammer out again to flatten without thinning too much. Weld 2 additional cracks and grind down.	105.00	393.75
Labor	5	Paint suspension parts, drums, roll bar, etc with epoxy primer and hardener.	105.00	525.00
Labor	8	Help wire up parts for epoxy application. Finish metal work on gas tank cover. Putty steering column upper. Sand putty. Remove universal from drive shaft - 2 caps broke. Sand upper column with 220 grit.	105.00	840.00
Labor	10	Remove tape from parts. Body work o on right side door with body filler. Sand body work with 36 and 80 grit sand paper.	105.00	1,050.00
Labor	5.75	Refit right door after welds. Beadblast bolts and washers and nuts for suspension. Gather all remaining bolts for plating.	105.00	603.75
Labor	7	Continue gathering hardware for plating. Document with photos. Disassemble foot pedal assembly, brake master cylinder and brake lines. Bead blast all mount hardware and brake lines.	105.00	735.00
Labor	3.75	Continue beadblasting of hardware, brake parts and numerous misc. parts in preparation for plating.	105.00	393.75
Labor	5	Strip gas tank and air cleaner and parts. Bead blast air cleaner and parts.	105.00	525.00
Labor	8	Disassemble pedals and pedal pocket shafts. Remove trunk striker, hood striker and latch and disassemble. De-grease and beadblast all parts. Tumble polish pedal pocket. Bead blast more brake lines and clean. Clean master cylinder and remove pedal fork and bead blast. Bead blast pedals, shaft and mask. Bead blast all related bolts, nuts and washers.	105.00	840.00
Labor	10	Finish stripping gas tank. Strip heater core. Mask heater core. Paint gas tank. Paint heater core. Paint 21 miscellaneous parts. Strip sway bar. Paint sway bar.	105.00	1,050.00
Labor	5.75	Disassemble parking brake assembly. Degrease and bead blast painted parts. Straighten twisted and bent handle portion. Bag and label remaining parts. Finish storing loose parts. Lay out wiring harness. Inspect for damage: Find multiple cracks in protective cover tube; worn wires and corrosion. Strip rust through area under hood and repair.	105.00	603.75
Labor	2	Photograph wire ends on harness. Pack harness for shipping. Apply filler to fuel tank. Sand filler with 80 grit paper. Reapply filler to fuel tank. Sand filler with 120 grit.	105.00	210.00
Labor	4.25	Reapply filler to fuel tank. Sand 120 grit. Cut out rust on underside of hood. Weld in repair panel of right underside. Begin to straighten left side under hood. Find rusted out area. Apply filler on additional areas of fuel tank.	105.00	446.25
		Labor Subtotal		9,397.50

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	1/15/2018
	<b>Invoice #</b>	202104
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Parts	0.5	Gallons black epoxy primer and hardener.	269.93	134.97
		Parts Subtotal		134.97

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$9,532.47
	<b>Sales Tax (8.1..</b>	\$10.97
	<b>Total</b>	\$9,543.44
	<b>Payments/Credits</b>	\$0.00
	<b>Balance Due</b>	\$9,543.44

2/2/18



PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

# Invoice

<b>Bill To</b>	<b>Date</b>	1/31/2018
	<b>Invoice #</b>	202108
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	9	Unwire and untape epoxyed parts after removing from booth. Cut out rust from other front side underneath hood. Fabricate panel. Weld panel in and grind welds. Planish deck lid more after welding. Apply filler to outside. Block filler with 36 grit paper. Repeat. Send all photos of documentation to office for records.	105.00	945.00
Labor	8.5	Block deck lid with 36 grit paper. Recoat filler. Block with 80 grit paper. Recreate oval fill in pin holes. Planish hood more. Apply filler. Block with 36 grit.	105.00	892.50
Labor	1	Black oxide plating of parts	189.00	189.00
Labor	8.25	Block hood with 36 grit paper. Reapply filler. Block hood again with 36 grit paper followed by 80 grit paper. Pop pin holes. Fill low spots. Block low spots with 80 grit paper. Apply putty on hood.	105.00	866.25
Labor	8.5	Block hood with 80 grit paper. Apply putty to pin holes and block with 120 grit paper. Apply filler to underside of hood. Assemble left side front suspension.	105.00	892.50
Labor	7.25	Build right front suspension. Attach mounts to both left and right front suspensions. Mount left and right rear end straps. Gather mount gear for rear end installation.	105.00	761.25
Labor	0.75	Press out races from right front hub and clean everything. Order new bearings, races and seals. Help with front brakes.	105.00	78.75
Labor	7	Install rear end upper retainer stabilizer. Install rear end left and right trailing arms. Bolt to rear end. Build sub assemblies to remove bolts, nuts and washers from play.	105.00	735.00
Labor	1	Wipe down vents and steering column with bug and tar remover. Hang vents and column for paint. Strip brake reservoir and brake reservoir mount. Spray gas tank with bug and tar remover.	105.00	105.00
Labor	1.5	Paint gas tank and steering column and heater vent parts.	105.00	157.50
Labor	7.75	Assemble clutch and brake pedal assembly. Install master brake cylinder on assembly. Install front tie rod pivot on frame. Sort out bolts for each assembly - air box, radiator, exhaust etc. Start installation of spring coil and shocks for rear suspension.	105.00	813.75
Labor	0.5	Paint 2 vents black.	105.00	52.50
Labor	5.5	Measure replacement bearings, races and seals for front hubs. Install races on right hub. Grease bearing. Install hub and bearing on spindles. Remove left hub. Remove old bearing and races. Install new. Install right side of rear end.	105.00	577.50
		Labor Subtotal		7,066.50
Parts	1	Box black strip caulk	28.15	28.15
		Parts Subtotal		28.15
Reimbursab...	1	Shipping of parts for cad clear plating	15.73	15.73
Reimbursab...	1	Shipping of parts for black oxide plating	20.00	20.00
Reimbursab...	1	Black oxide waste disposal charge	7.00	7.00

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	1/31/2018
	<b>Invoice #</b>	202108
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Reimbursab...	0.33	Box 80 grit paper	19.95	6.58
Reimbursab...	1	Shipping of wiring harness for restoration	25.68	25.68
		Reimbursables Subtotal		74.99

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$7,169.64
	Sales Tax (8.1..)	\$2.29
	<b>Total</b>	<b>\$7,171.93</b>
	Payments/Credits	\$0.00
	<b>Balance Due</b>	<b>\$7,171.93</b>





2/20/18

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	2/13/2018	
		Invoice #	202115	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	6.25	Finish installing left side rear end coil shock trailing arm. Center A arm support. Change brackets on emergency brake and install rear cable assembly. Move car outside and blow off all parts and underside. Wipe down. Install rod mechanisms for shifter and emergency brake. Install center drive shaft.	105.00	656.25
Labor	7.5	Begin installing steering column under dash then remove to paint dash board with trim black. Clean brake line, fuel line and battery line front to rear. Install brake line, fuel line and battery line. Install kill switch with sealant. Assemble lower "A" arms onto left and front suspensions. Gather mount gear for front tie rods. Bead blast battery cable clamp. Tap left front frame rail for damper installation.	105.00	787.50
Labor	7.25	Install clutch rod. Move to lift and remove vehicle from rotisserie. Install left suspension, coil, shock and brake line. Bead blast all 4 coil seats. Paint bare seat black. Install right suspension.	105.00	761.25
Labor	1	Cadmium plating of parts	108.00	108.00
Labor	7.75	Finish installing right coil spring. Tighten left and right suspension bolts. Install steering column and steering wheel. Install left, right and center steering linkages. Build carburetor linkage and hood latch with new plated pieces. Install tires.	105.00	813.75
		Labor Subtotal		3,126.75
Parts	2	Bearings	44.53	89.06T
Parts	2	Hubs	64.80	129.60T
Parts	2	Wheel seals	12.81	25.62T
		Parts Subtotal		244.28
Reimbursab...	1	Shipment of bearings, hubs, wheel seals	15.00	15.00
Reimbursab...	1	Hand plug tap	40.90	40.90
Reimbursab...	10	Green rolod discs	1.47	14.70
Reimbursab...	2	Surface conditioning discs for metal	1.15	2.30
		Reimbursables Subtotal		72.90
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$3,443.93
			Sales Tax (8.1..	\$19.85
			<b>Total</b>	<b>\$3,463.78</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$3,463.78</b>



PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

3/5/18

# Invoice

<b>Bill To</b>	<b>Date</b>	2/28/2018
	<b>Invoice #</b>	202124
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	6.5	Glue felt onto fuel cell straps. Die threads on straps for excessive epoxy. Recoat POR 15 on threads. Mount tank. Connect fuel line to fuel pump. Attach inner fuel cover in trunk. Install deck lid striker and spring prop and adjust. Attempt to install sway bar front but need engine weight, once installed, to spread attachment point. Sort remaining coated bolts to respective parts or parts bags for assembly. Store all additional exposed parts to shelf. Install left and right latches after spring return replacement.	105.00	682.50
Labor	13	Complete body work on rear trunk and rear trunk jamb.	105.00	1,365.00
Labor	0.5	Help line up trunk.	105.00	52.50
Labor	8	Install hood with striker and latch. Adjust to fit. Massage edges to fit body. Apply filler to body to form proper gap.	105.00	840.00
Labor	3.25	Body work in front of door using bondo and sanding with 80 grit paper.	105.00	341.25
Labor	8	Apply putty to outside of hood to pin holes. Block with 150 grit. Block underside filler with 150 grit and re-apply putty. Block with 150 grit. Sand underside of hood frame with 150 grit and scuff. Block sand hood opening channel area on body with 150 grit and re-apply putty and block sand again. Chase pin holes.	105.00	840.00
Labor	3.25	Body work on left fender using putty and sanding with 120 grit and repeating. Paint brake reservoir clamp black.	105.00	341.25
Labor	8	Putty gap on deck lid to body. Cut gap open. Block sand with 80 grit to shape. Putty rear shelf. Block sand to shape with 80 grit. Putty channel for pin holes in hood area with 120 grit.	105.00	840.00
Labor	9.5	Putty deck lid opening and sand with 120 grit paper to form gaps. Putty deck lid and block sand with 80 grit and 120 grit papers. Mask off rear end of vehicle. Hang deck lid and hood for primer.	105.00	997.50
Labor	1.75	Mask front jamb. Prime inside and outside of hood and deck lid and body panel.	105.00	183.75
Labor	2.5	Wet sand front deck lid with 600 grit paper.	105.00	262.50
Labor	7.5	Cut pin holes, putty and block sand right door with 120 followed by 180 grit paper. Massage door frame to opening on right door. Block edges of panel with 80 grit paper. Move right quarter edge to door. Move right front quarter to door.	105.00	787.50
		Labor Subtotal		7,533.75
Parts	1	Wiring harness	2,872.80	2,872.80
		Parts Subtotal		2,872.80
Reimbursab...	1	Shipment of wiring harness	50.00	50.00
		Reimbursables Subtotal		50.00

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$10,456.55
	<b>Sales Tax (8.1..)</b>	\$233.42
	<b>Total</b>	<b>\$10,689.97</b>
	<b>Payments/Credits</b>	\$0.00
	<b>Balance Due</b>	<b>\$10,689.97</b>

3/16/18



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	3/15/2018
	<b>Invoice #</b>	202132
	<b>Project</b>	
	<b>1957 Alfa Romeo</b>	

Item Code	Quantity	Description	Rate	Amount
Labor	8.25	Cut pin holes on hood. Fill with putty. Block sand hood with 120 grit paper. Check and repeat process. Panel bond right door. Help mask for re-prime.	105.00	866.25
Labor	3.5	Mask front windows, side windows and right door. Mask front and rear hood and all around bottom of car. Prime using 3 quarts gray primer.	105.00	367.50
Labor	4	Wet sand inside and outside of hood with 600 grit paper.	105.00	420.00
Labor	3.5	Putty jams on right door. Block with 120 grit paper. Re-putty jams and sand with 180 grit paper. Chase pin holes on exterior of doors.	105.00	367.50
Labor	0.5	Prime portion of right door with 1 quart primer.	105.00	52.50
Labor	2.5	Block right quarter and jams with 400 grit sand paper.	105.00	262.50
Labor	17.5	Block body with 400 grit sand paper.	105.00	1,837.50
Labor	2.75	Block right door jamb with 120 grit sand paper.	105.00	288.75
Labor	3.25	Putty right door low spots. Block sand with 120 grit paper. Sand and block right door jamb. Putty pin holes on body. Block sand with 320 grit paper. Block sand roof with 320 grit paper. Blow off car body and doors. Back mask and bag body for primer.	105.00	341.25
Labor	2.75	Mask right side fender, door and quarter. Bag car. Prime right side fender, door and quarter panel.	105.00	288.75
Labor	6.75	Unmask vehicle. Install right door jamb hardware and hang door. Install hood hardware, hood and adjust. Refit right door gaps and apply putty and block sand. Install deck lid.	105.00	708.75
Labor	2.5	Install deck lid and align. Block deck lid and sand with 180 grit. Sand opening gap for fit with 180 grit.	105.00	262.50
		Labor Subtotal		6,063.75
Parts	1.75	Platinum plus putty (30 oz)	46.53	81.43T
Parts	4	Quarts gray primer	28.68	114.72T
		Parts Subtotal		196.15
Reimbursab...	0.75	Roll 120 grit sand paper	50.88	38.16
Reimbursab...	1	4" spreader	0.65	0.65
Reimbursab...	1	5" spreader	0.70	0.70
Reimbursab...	0.25	Box 320 grit hookit sand paper	26.98	6.75
Reimbursab...	0.25	Box 120 grit hookit sand paper	29.60	7.40
Reimbursab...	0.25	Roll 320 grit stikit sand paper	50.88	12.72
Reimbursab...	0.25	box 180 grit hookit sand paper	31.74	7.94
Reimbursab...	3	Rolls masking tape	15.02	45.06
Reimbursab...	1	Roll 400 grit stikit sand paper	55.45	55.45
				174.83

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$6,434.73
	<b>Sales Tax (8.1..)</b>	\$15.94
	<b>Total</b>	<b>\$6,450.67</b>
	<b>Payments/Credits</b>	\$0.00
	<b>Balance Due</b>	<b>\$6,450.67</b>

4/2/18



# Invoice

PETERSON MOTORSPORTS, LLC  
22255 ARNOLD DR SONOMA, CA 95476  
PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	3/31/2018
	<b>Invoice #</b>	202145
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	2	Mask inside of deck lid. Mask inside of right door.	105.00	210.00
Labor	4.5	Body work with filler on inside of deck lid. Block inside and outside of deck lid with 180 grit.	105.00	472.50
		Block inside and outside of right door with 180 grit.		
Labor	2	Prime right door and deck lid.	105.00	210.00
				892.50
Parts	3	Quarts gray primer	28.68	86.04T
Parts	0.1	Liter hardener	67.50	6.75T
		Parts Subtotal		92.79

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$985.29
	Sales Tax (8.1..)	\$7.54
	<b>Total</b>	<b>\$992.83</b>
	Payments/Credits	\$0.00
	<b>Balance Due</b>	<b>\$992.83</b>



4/19/18

# Invoice

PETERSON MOTORSPORTS, LLC  
22255 ARNOLD DR SONOMA, CA 95476  
PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	4/15/2018
	<b>Invoice #</b>	202163
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	2.5	Block sand right door with 180 grit.	105.00	262.50
		Labor Subtotal		262.50

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$262.50
	Sales Tax (8.1..)	\$0.00
	<b>Total</b>	<b>\$262.50</b>
	Payments/Credits	\$0.00
	<b>Balance Due</b>	<b>\$262.50</b>

5/3/18



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	4/30/2018
	<b>Invoice #</b>	202171
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	8	Block right quarter and fender and front with 180 grit. Wet sand front dash with 600 grit.	105.00	840.00
		Sand right door jamb inside and outside with 400 grit. Repair and install right door.		
Labor	3.5	Mask front dash for paint. Install deck lid.	105.00	367.50
Labor	3	Go to Berkeley to look at Alfa cars.	105.00	315.00
		Labor Subtotal		1,522.50
Reimbursab...	1	Quart fast reducer for dash	24.82	24.82
		Reimbursables Subtotal		24.82

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$1,547.32
	Sales Tax (8.1..)	\$0.00
	<b>Total</b>	\$1,547.32
	Payments/Credits	\$0.00
	<b>Balance Due</b>	\$1,547.32



5/15/18

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	5/15/2018
	<b>Invoice #</b>	202172
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	3	Mask front deck and bottom of car. Mask right door. Bag whole car.	105.00	315.00
Labor	1	Remove deck lid and tape on weather strip. Re-hang deck lid and adjust for fit. Review all gaps on vehicle and areas of concern (grill, lights, etc.) for fit and gaps.	105.00	105.00
Labor	1	Cadmium plating of parts	60.75	60.75
Labor	6	Wet sand front hood with 600 grit. Unmask and mask bottom part of car. Paint deck red and clear coat.	105.00	630.00
Labor	2.5	Wet sand bottom of car with 1000 grit. Prime.	105.00	262.50
Labor	3	Wet sand top part of dash. Mask top part of dash. Paint dash black.	105.00	315.00
Labor	0.5	Fine line mask dash board between colors.	105.00	52.50
Labor	1.5	Unmask front dash of car.	105.00	157.50
Labor	7	Use filler to even out measured areas then sand areas for perfect evenness. Sand jams around trunk and fenders to doors and hood for perfect gap measurement. Use filler and sanding to fit and adjust signal lights and front grill pieces for perfect connection.	105.00	735.00
Labor	7.5	Fit left and right rear signal lights. Fit left and right rear bumper brackets. Fit license plate bracket. Fit rear license plate and trunk. Fit left and right front bumper brackets. Fit 2 emblems on right side, 2 emblems on left side and 2 emblems on trunk. Fit left and right headlights. Sand hood and left and right fenders with 400 grit.	105.00	787.50
Labor	1	Work on right door gaps to achieve correct spacing.	105.00	105.00
Labor	4.5	Fit part on hood front chrome. File holes on front of hood both sides and wiper squirters.	105.00	472.50
Labor	2.25	Check trunk gaps - even. Putty, block and measure gaps on right door. Repeat to evenness.	105.00	236.25
		Labor Subtotal		4,234.50
Reimbursab...	1	Shipment of cadmium plated parts	13.00	13.00
		Reimbursables Subtotal		13.00

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$4,247.50
	<b>Sales Tax (8.1..)</b>	\$0.00
	<b>Total</b>	\$4,247.50
	<b>Payments/Credits</b>	\$0.00
	<b>Balance Due</b>	\$4,247.50

6/8/18



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	5/31/2018	
		Invoice #	202187	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	3.5	Check hood gaps - even. Remove trunk and mask. Backmask right door opening and deck lid opening. Mask off dash separately. Bag off vehicle for priming.	105.00	367.50
Labor	4	Remove car bag and tape. Sand primer edges with 220 grit. Hang right door. Install deck lid and weather strip and adjust. Blow off car and wipe down. Tighten left and right front grill mouldings. Install emblem and back onto right fender. Set hood moulding on tape down. Locate mirror and right door handle and review vehicle project with owner. Labor Subtotal.	105.00	420.00  787.50
Reimbursab...	1	Shipping of parts for chroming Reimbursables Subtotal	20.43	20.43 20.43
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$807.93
			Sales Tax (8.1..	\$0.00
			<b>Total</b>	<b>\$807.93</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$807.93</b>



7/11/18



**PETERSON MOTORSPORTS, LLC**  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

# Invoice

<b>Bill To</b>	<b>Date</b> 6/30/2018
	<b>Invoice #</b> 202217Rev
	<b>Project</b>
	1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	3.5	Remove front vent chrome and head lamp. Remove gasket on head lamp bucket and shim for chrome ring fit. Re-install head light bucket. Apply filler and sand with 80 grit.	105.00	367.50
Labor	7	Remove right and left head lamps. Remove shims. Rebolt and fit chrome rings without gaskets. Remove left head lamp and apply filler. Block and retrace head lamp assembly. Re-apply filler and block with 80 grit. start fitting right head lamp and ring. Remove vent mouldings, center "painted" and upper polished aluminum. Remove side markers and front running lights and left and right bumper bolt covers. Left head lamp assembly is lying flush. Start on filler for curvature. Apply and block with 80 grit. Repeat. ** Boris re-fit headlights and fixed the buckets.**	105.00	735.00
Labor	6.5	Block right quarter, right door and rocker and right fender with 400 grit. Block left quarter.	105.00	682.50
Labor	9.25	Block left head lamp area and re-apply filler. Block with 80 grit and apply putty. Block with 120 grit. Re-fit head lamp. Sand right head lamp area with 80 grit. Install head lamp. Apply filler and block with 80 grit. Repeat. Check door handles fit to car. Straighten left and right head lamp bucket flange to allow head lamp bezel to sit and clip on properly without glue and foam.	105.00	971.25
Labor	7.75	After removing head lamp assembly, put filler on right head lamp face body. Mark and measure left tail lamp. Remove left tail lamp from body. Block filler to line. Hammer and dolly metal to shape of tail light. Mark and measure right tail light. Block with 80 grit. Hammer and dolly to shape. Apply putty and block with 120 grit. Sand small depression on wheel well lip of left quarter with 120 grit. Apply putty and block with 120 grit. Sand around repaired areas with 400 grit. Bag off vehicle. Mask repaired areas for priming.	105.00	813.75
Labor	4	Prime front headlights, rear lights and left rear wheel well.	105.00	420.00
Labor	10	Sand jambs on left and right doors and inside of hood with 320 grit and 400 grit. Sand jambs on inside left and right fenders and inside front end with 320 and 400 grit. **Sanding inside engine compartment.**	105.00	1,050.00
Labor	8.5	De-bag and de-mask car. Block left and right tail light areas with 180 and 400 grit. Block left quarter wheel well with 180 and 400 grit. Needs more work. Check with wax and grease remover. Sand left and right inner quarter window areas with 220 and 400 grit. Check sanded areas on left and right door jambs with 400 grit. Sand left and right lower sills with 400 grit. Putty, block and sand hood channel on right side. Bag vehicle. Mask off left quarter well and hood channel and left and right sills.	105.00	892.50
Labor	1	Chroming of emergency brake	101.25	101.25
Labor	10	Sand left and right side jambs and right side of rear trunk jamb with 1000 grit. Mask left and right side door jambs on inside. Paint left and right door jambs and quarters with base coat white. **Tighten door gaps.*	105.00	1,050.00

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	6/30/2018	
		Invoice #	202217Rev	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	8.5	Putty left and right door opening edges for minor defects. Remove deck lid, latch, striker and hinges. Sand inner quarter windows. Blow off and wipe down car. Mask for jambing. Collect all chrome pieces for inspection. Disassemble inner dome lights, outer mirror, front marker lights, windshield squirter, grille emblem and trunk latch.	105.00	892.50
Labor	9.5	Apply finishing glaze and sand left and right rear shock covers with 400 grit. Sand left and right louvers with 400 grit. Paint left and right door jambs and inside quarters with red and clear coat. Sand inside of hood with 400 grit.	105.00	997.50
Labor	8	Disassemble lock on trunk latch and clean. Find dash chrome, photo document and pack for chroming along with other parts retrieved from storage boxes. Write up parts list. Sand underside of deck lid with 400 grit. Re-do steel frame underside deck lid. Sand putty with 120 grit.	105.00	840.00
		Labor Subtotal		9,813.75
Parts	0.5	Platinum plus putty	46.53	23.27T
Parts	0.5	Quarts gray acrylic primer	35.01	17.51T
		Parts Subtotal		40.78
Reimbursab...	1	Shipment of chromed emergency brake	15.00	15.00
		Reimbursables Subtotal		15.00
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$9,869.53
			Sales Tax (8.1..	\$3.31
			<b>Total</b>	<b>\$9,872.84</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$9,872.84</b>



7/19/18

# Invoice

**PETERSON MOTORSPORTS, LLC**  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	7/15/2018	
		Invoice #	202225	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	1.25	Paint left and right rear shock covers white, followed by red and clear coat.	115.00	143.75
Labor	3.5	Strip primer off metal frame of deck lid. Finish sanding underside with 400 grit. Clean residue out of lip and panel bond lip to frame. Mask off metal frame on deck lid for priming.	115.00	402.50
Labor	2.5	Prime inside of deck lid and rear shock covers with gray urethane primer.	115.00	287.50
Labor	1.5	Apply solvent to head light buckets. Brush off paint with bristle brush. Rinse. Re-apply stripper. Brush off stripper. Rinse and air dry. Apply stripper to inside of headlight buckets. Use brush to remove paint and stripper. Rinse with water and air dry.	115.00	172.50
Labor	0.5	Work on head light buckets.	115.00	57.50
Labor	1	Paint headlight buckets with black epoxy primer.	115.00	115.00
		Labor Subtotal		1,178.75
Parts Purcha...	2	Bearings	26.97	53.94T
		Parts Subtotal		53.94
Reimbursab...	1	Shipping of parts for chroming	49.38	49.38
		Reimbursables Subtotal		49.38
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$1,282.07
			Sales Tax (8.1..	\$4.38
			<b>Total</b>	<b>\$1,286.45</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$1,286.45</b>



9/7/18

# Invoice

**PETERSON MOTORSPORTS, LLC**  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	8/31/2018
	<b>Invoice #</b>	202255
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	8.75	Sand inside engine compartment with 3M scotch brite. Mask inside of engine compartment, bottom of frame, on sides and underneath left and right wheels. Mask rest of car. Paint inside engine compartment base white then red and clear.	115.00	1,006.25
Labor	3.5	Mask front dash and paint black.	115.00	402.50
Labor	6.25	Straighten two mouldings. Go through parts and list. Start installing wiring harness.	115.00	718.75
Labor	9.75	Polish aluminum on car including right and left side inner and outer door mouldings, moulding on left door step, hood inner moulding, front and rear aluminum, front fenders and pillar mouldings.	115.00	1,121.25
Labor	9	Continue polishing aluminum on car including right door bottom moulding, right door jamb moulding, screws for jambs, left and right quarter window chrome, left door window chrome, right door chrome and handle, left door chrome, right and left door inner trim panels.	115.00	1,035.00
Labor	8	Install wiring harness. Install switch on steering column. Install new wires through steering column with fittings. Install voltage regulator and relays in engine area. Install pedal assembly - gas pedal bar. Tap all bolt holes due to primer and paint build up.	115.00	920.00
Labor	7.25	Continue polishing aluminum on car including right and left side rear bumper brackets and front bumper brackets, rear windshield chrome, front windshield chrome, right and left side top chrome.	115.00	833.75
Labor	9	Polish rear and front bumper. Start installing bumpers. Install battery and battery cable. Install tire jack. Install and seal cover over fuel pump in trunk.	115.00	1,035.00
Labor	7.5	Install choke and windshield washer pump. Install wiring on gas gauge. Oil and bullet crimp wiring on gas tank and shrink tube. Install fan and wiper switches. Run speedometer cable, tachometer cable, emergency brake cable, gas pedal stop and oil pressure line. Loosen rear bumper, install and tighten. Remove mount on front bumper. Slot hole 1/4 inch and install on car.	115.00	862.50
Labor	7.75	Install carpet in rear trunk. Clean and polish moulding on fenders and bottom of frame. Clean tires. Bead blast 2 springs for head lamp and paint black. Install right and left side door strikers. Remove glue from leather in glove compartment. Polish right fender and right rear quarter.	115.00	891.25
Labor	7.5	Install trunk stop, trunk spring and hinges, heater box with cable, valve and hoses and windshield wiper motor. Install right front strap fuel line and connect and heat tube shrink connector on second fuel filter. Install dash plug, right front brake line, left front brake line and rear main brake line running to front. Install brake fluid distributing block and connect wiring. Install brake reservoir. Install cigarette plug, 2 model plates, clutch rod to pedal and cable to gas pedal rod.	115.00	862.50
Labor	9.75	Bead blast and paint coil black. Mask, install and polish lettered and copper mouldings on rear trunk. Install left and right rear and side carpet. Install left and right seat belts. Install left side bottom steel plate moulding for door bottom.	115.00	1,121.25

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	8/31/2018	
		Invoice #	202255	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	8.5	Glue on front foot firewall sound pad. Screw in grommet for firewall carpet. Sanp in firewall carpet. Glue in glove box vinyl bottom. Straighten and install trim for glove box. Install radio cover. Drill for carpet screws and install carpet. Install fire extinguisher. Wire up right head lamp. Adjust bucket for chrome ring right head lamp. Polish ring and install. Repeat process to left head lamp and make ground wire. Crimp and solder wire. Install left and right seat belts with sealant.	115.00	977.50
Labor	8.75	Install left and right brackets and chrome on front of car. Begin helping to install headliner. Sand radiator with 400 grit and scotch brite. Paint radiator black.	115.00	1,006.25
Labor	7.75	Install fuel filter front and connect line. Install fitting and connect to power line and heat shrink tubing. Install and glue headliner foam. Work on installing headliner.	115.00	891.25
Labor	1	Labor to rechrome parts	2,304.96	2,304.96
Labor	7.5	Continue installing headliner. Install front windshield. Clean glass and seal and install locking strip. Repeat process for rear glass. Issues with locking strip and headliner.	115.00	862.50
Labor	1	Help install front and rear windshields.	115.00	115.00
		Labor Subtotal		16,967.46
Parts	1	Can trim adhesive	23.30	23.30
		Parts Subtotal		23.30
Reimbursab...	1	Shipment of rechromed parts	50.00	50.00
		Reimbursables Subtotal		50.00
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$17,040.76
			Sales Tax (8.1..	\$1.89
			<b>Total</b>	<b>\$17,042.65</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$17,042.65</b>

9/23/18



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	9/15/2018
	<b>Invoice #</b>	202266
	<b>Project</b>	
	<b>1957 Alfa Romeo</b>	

Item Code	Quantity	Description	Rate	Amount
Labor	9.25	Attempt, without success, to install popped out areas of locking strip on back window while in place. Remove rear window and locking strip. Re-bend locking strip and re-install on glass. Re-install glass on car. Wire up wiper motor, heater box, switches, ignition and all gauges with cables and oil pressure line. Re-glue and attach left kick panel carpet. Tap out electrical and cable nuts in firewall. Install 1 seal and bracket.	115.00	1,063.75
Labor	7.5	Install dash defroster. Install left and right vents in dash. Install dash chrome mouldings.	115.00	862.50
Labor	8.5	Install second and third cable seals and steering column seal on firewall. Install dash mirror and left and right visors. Jack up car and roll transmission under it. Align cross support for bolt to transmission. Check chrome parts. Gather samples of needed parts. Dremel out chrome channel on dash from chrome build in channel. Install interior dome lights and passenger roof grip handle. Build front side marker light. Remove and install light dimmer switch for dash chrome and clearance. Solder bullet terminal onto ground wire for front marker lights.	115.00	977.50
Labor	9.75	Remove tires. Clean and re-glue edges of all quarter panels, inside and outside of glove compartment and on all interior leather. Install left and right rear panel screws. Install left and right quarter side chrome mouldings on jambs. Install striker inside rubber pieces and black stoppers on both doors. Install chrome on right quarter window.	115.00	1,121.25
Labor	10.25	Re-glue left quarter inner trim. Install transmission, drive shaft donut and front half drive shaft. Thread nut for emblem to 3x0.6mm. Install clutch plate, pressure plate and torque bolt. Remove oil filter and bracket. Sand blast exhaust manifolds and paint. Remove engine fan with puller. Attempt to install engine into bay but issues dealing with mount.	115.00	1,178.75
Labor	1	Help with attempt to install engine.	115.00	115.00
Labor	6.25	Install chrome on left quarter window and rear flat panel. Install radiator and vents in top of dash for heater.	115.00	718.75
Labor	9.25	Remove studs on left side engine mounting point. Use bolts on engine mount. Install oil filter and bracket. Install fan and belt and tension belt. Install transmission, starter, radiator and manifolds.	115.00	1,063.75
Labor	0.5	Help with transmission installation.	115.00	57.50
Labor	10	Install side nuts for rubber pieces on doors. Install left and right floor mats and carpet hold downs. Install radiator hoses on top, bottom and rear. Install cross member. Install water bottle on firewall. Work on installing exhaust bracket. Measure, trim and sand a rubber mount for proper fit.	115.00	1,150.00

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	9/15/2018	
		Invoice #	202266	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	9.5	Route and connect speedometer cable, tachometer cable and brake cable. Bolt together exhaust hanger assembly on transmission. Put back spare plugs and wires in way of engine hoist. Bring exhaust pipe out on stand for cleaning. Seal plug in engine block for heater pipe support. Connect hoses to pipe. Install accelerator linkage under carburetors. Measure, cut and die one of linkages and connect. Connect fuel line to carburetors. Connection on starter doesn't allow bullet end of harness to enter. Remove starter for access on solenoid to repair and re-install.	115.00	1,092.50
Labor	3.75	Install brake coupling and cable hanger. Paint five trunk pieces, striker, latches and washers with black epoxy primer.	115.00	431.25
Labor	9	Connect coil to distributor. Connect harness to water temperature sensor. Connect choke cable to carburetor. Drill out emergency brake handle with 8 mm bit in seat pocket for button return. Wet sand both sides of button with 400 grit to reduce thickness in order to fit newly chromed handle and operate freely. Adjust release, install into tube, attach cable and bolt in place. Install shifter and glue foam seal to floor. Install upper inner boot, lower boot over and clamp. Bolt in cover plate and install last boot with clamp. Install lock assembly into trunk lock housing. Remove lower inner trunk latch and bead blast. Loosen main wiring harness under dash. Loosen main wiring harness in engine compartment. Pull length through both holes in firewall and start to connect wires to voltage regulator and relays.	115.00	1,035.00
Labor	9.25	Connect wires to voltage regulator and relays. Re-route wire on harness engine compartment. Build hood, insert padding, route wiring through, bolting outer moulding to inner ones. Review wiring harness diagram. Clean tape off left and right doors. Clean compound off jambs of left and right doors. Tap threads for hinge bolts and rubber stops. Cut out excessive paint build up from latch mounting holes. Install rubber stops and latches. Blast paint off lower door pivot bolts and mount on doors. Hang left and right doors and adjust pivot pins. Put terminals and heat shrink tubing on replaced dynamo wires and attach.	115.00	1,063.75
Labor	1.25	Drain oil. Install breather tube and drain plug with new oil gasket. Remove plug from side of block. Install oil pressure sensor line in side of block and run up to fitting coming through firewall. Pour oil back in car. Help hang both doors.	115.00	143.75
		Labor Subtotal		12,075.00
Parts	1	Lower door weather stripping	168.75	168.75T
Parts	1	Upper door weather stripping	182.25	182.25T
Parts	1	Quarter glass weather stripping	182.25	182.25T
Parts	1	U joint	48.66	48.66T
Parts	1	Gas cap	30.37	30.37T
Parts	1	Cast blast paint	17.55	17.55T
		Parts Subtotal		629.83
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$12,704.83
			Sales Tax (8.1..	\$51.17
			<b>Total</b>	<b>\$12,756.00</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$12,756.00</b>



12/11/18

# Invoice

**PETERSON MOTORSPORTS, LLC**  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	9/30/2018
	<b>Invoice #</b>	202280
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	6.25	Wet sand left and right rear shock covers with 1500 grit. Polish and install left and right rear shock covers. Place black caulk sealant on right roof drip rail moulding.	115.00	718.75
Labor	9.25	Install trunk grommet from old wiring harness to new. Remove chrome dash moulding in way of switch. Glue felt onto air cleaner. Bolt brackets to firewall. install air cleaner and hose to carburetor. Assemble trunk latch, shim hook to right side, shim lock piece to hold button in place. Clean vent pipes to air cleaner, heater box and interior from grill area. Install vent tube to air cleaner and interior vent. Swap front brake drums (marked in Italian). File thread on one stud of right front hub. Sand out paint from drive shaft yoke. Press in new universal joint. Attach spline end with collar and bolt in drive shaft to car. Adjust emergency brake. Adjust clutch rod. Put load on right front suspension to align shock bottom. Install holding plate. adjust shock anti blowout cable.	115.00	1,063.75
Labor	4.75	Polish chrome trim on drip moulding on left side. Install left quarter chrome moulding. Help install hood. Install black caulk sealant on drip moulding on back side.	115.00	546.25
Labor	8.5	Install hood. Adjust left front shock cable stop after loading suspension. Strip caulk left rood drip moulding and place on car. Screw in main piece. Raise motor left side and make shims for motor mount on left side. After cutting washer shims and bolting in, not enough stud from mount protrudes through frame. Fabricate aluminum triangle shim for placement between engine and motor mount. Engine now clears front frame by 5mm - as high as it will go.	115.00	977.50
Labor	0.5	Help line up left motor mount spacer.	115.00	57.50
Labor	4	Use aluminum prep and scotch brite and then wet sand inner quarter window chrome and inner door roof rail chrome on both sides.	115.00	460.00
Labor	8.75	Adjust hood latch cable latch and striker. Install front sway bar. Fit up right dash chrome for light pull switch locking ring clearance. Install right outer handle. Build left door mirror and install. Re-adjust right door. Install ash tray assembly. Install light switch. Install right upper dash chrome. Install glove box inner upper trim. Install shifter area carpet. Clean up touched up area and re-glue trim where necessary.	115.00	1,006.25
Labor	8.75	Tap nuts for fender emblems. Die studs for fender emblems. Install emblem and badges on fenders. Micropolish and install grille emblem and grille. Dismantle damaged left door handle for re-keying. Make determination to retain new key set from new handle. Apply tape seal to left door opening and screw into place. Too many minor gaps so apply strip caulk on top and screw in but screws unable to compress all sealant. Remove moulding and clean off all sealant. Install steering wheel. While installing left quarter glass seal moulding, determine that original vinyl head liner doesn't line up. Remove rear shelf, rear inner panel and left quarter inner panel to unseat vinyl in that area and stretch and re-glue it. Tap out all trunk bolt holes and mount to car for safety.	115.00	1,006.25

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>





# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	9/30/2018	
		Invoice #	202280	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	8.75	Remove deck lid. Glue new weather stripping to underside of deck lid. Install windshield nuts and seals. Go over wiring harness to find door switch light wires. Re-install deck lid and adjust. Finish install horn button. Heat gun head liner in left quarter window area and glue. Install inner chrome moulding. Re-attach drip rail moulding in quarter glass area. Install inner quarter side panel, rear panel and rear shelf. Install license bracket and license plate.	115.00	1,006.25
Labor	7.5	Wire up trunk light. Route wires for deck lid license light and connect. Tie cables in way of engine. Grease all fittings on front end suspension. Remove rear of rear drive shaft to remove broken grease fitting on universal joint. Re-install drive shaft. Remove trunk license light. Cut gasket for better fit. Re-install. Work on wiring under dash for heater fan. Remove air cleaner for new boot.	115.00	862.50
Labor	7.25	Bend left quarter glass moulding to align with mounting holes and screw in. Cut seal to length and curve and install strip to fit left quarter glass. Bend and mount left door upper seal moulding. Install battery. Fill gas tank with 5 gallons race fuel. There is gas leak at fuel filter. Replace gaskets with generic but did not work.	115.00	833.75
Labor	7.5	Remove right inner quarter trim. Heat gun headliner quarter glass area for moulding coverage. Remove lines from filter. File banjo fittings to remove imperfections causing leak. File filter housing. Reassemble lines to filter and check for leaks. Bolt hold down frame to seal around gas pedal. Cut and modify seals by hand and install and connect cable. Bolt air cleaner back in place.	115.00	862.50
Labor	0.5	Go to machine shop to pick up parts.	115.00	57.50
		Labor Subtotal		9,458.75
Parts	1	Cover set	74.25	74.25T
Parts	1	Washer set	20.25	20.25T
Parts	1	Door handle gasket set	57.37	57.37T
Parts	1	Trunk weather strip	94.50	94.50T
Parts	2	Copper washers	1.14	2.28T
		Parts Subtotal		248.65
Reimbursab...	5	Gallons race fuel	9.25	46.25
		Reimbursables Subtotal		46.25
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$9,753.65
			Sales Tax (8.1..	\$20.20
			<b>Total</b>	<b>\$9,773.85</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$9,773.85</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

10/16/18

<b>Bill To</b>	<b>Date</b>	10/15/2018
	<b>Invoice #</b>	202286
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	1	Solder extension onto horn wire. Solder terminal onto horn wire. Fill radiator with 1 gallon antifreeze.	115.00	115.00
Labor	1	Clean and bolt down left and right seats.	115.00	115.00
Labor	8.75	Install right drip rail moulding. Install right quarter glass seal moulding. Install right front door opening moulding under drip moulding. Cut and trim all 3 seals for door and quarter glass seal mouldings. Cut and trim left door upper drip seals. Install all seals. Hang left door. Fix heater hose leak under dash. Disconnect fuel pump. Remove spark plugs and blow out gas, add oil and turn over. Attach right heater tube bracket at right tire well. Package chrome pieces to be sent for re-chroming.	115.00	1,006.25
Labor	6	Install trim on right door. Install trim on front fenders and rear quarter panels. Install tail lights.	115.00	690.00
Labor	9.25	Work on wiring for horn button. Cut and shrink wrap terminal for left front turn signal. Start to make new exhaust hanger for muffler. Bleed brakes and adjust drum shoes to pressure. Bleed brakes again. Adjust throw on brake master cylinder. Master brake cylinder is leaking - need to remove. Work on wiring issues.	115.00	1,063.75
Labor	0.75	Remove front drums to re-align front shoes. Then adjust front brakes. Inspect front brake master cylinder. It is weeping fluid.	115.00	86.25
Labor	2	Disassemble and clean master cylinder. Order parts.	115.00	230.00
Labor	1	Install wheels on car and wipe down.	115.00	115.00
Labor	10.75	Remove master cylinder. Cut and change wrong fitting on wire C1 to gauge light. Pull double butt bullet fitting from old harness. Bead blast fitting for conductivity and shrink wrap, cut and solder double butted wire lead for second C1 wire and heater fan to heater fan switch. Connect interior lights to switch one heat shrink end of second C1 wire in engine compartment. Third C1 wire not needed. Remove grille for horn access. Horn and light switch in steering wheel sticking and sporadic. Disassemble switch, clean and reassemble. Add ground wire to left gauge. Needs same on center gauge. Pull wire 14 and 15 horn and light to both relays. Solder bullet to wire 14 and shrink wrap. Track down major short found in rear lights and re-wire. Blow out and wipe down vehicle. Cut seals. Left side door in way of frame.	115.00	1,236.25
Labor	3.5	Work on wiring for blinkers and tail lights not turning off. Still not working. Glue peeling vinyl on all parts for interior of left door and install. Tap out chromed new left inner door handle for set screw and install. Issue with outer door handle release bolt at angle causing jamming. Need to modify release bolt.	115.00	402.50
Labor	8.25	Measure, cut and glue weather strips onto right door. Trim weather strips for fit. Remove rear upper door seal moulding, channel and quarter channel to file bottoms for door clearance at upper rear. Re-install. Partially loosen right front weather strip, channel and drip rail to file bottom for door clearance at upper front. Glue peeling vinyl for right door interior. Install right door inner panels. Begin installing master brake cylinder.	115.00	948.75

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	10/15/2018	
		Invoice #	202286	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Labor	0.75	Bolt in master brake cylinder and brake lines. Re-install bracket in way of lines.	115.00	86.25
Labor	1.5	Bleed brakes. Bleed twice - pedal still not getting firm.	115.00	172.50
Labor	0.25	Install clip on master cylinder rod. Help troubleshoot running lights issue.	115.00	28.75
Labor	1.25	Clean seat tracks with solvent. Paint both tracks silver.	115.00	143.75
Labor	7	Tighten and adjust brakes. Bleed brakes. Back off brakes to correct adjustment but pedal is soft. Remove right side drum and brake assembly. Wheel cylinder pistons are not returning properly. Spring is not on correctly. Dismantle wheel cylinders, clean, inspect and reassemble. Put right front brake assembly back together properly and inspect left front as well. Adjust brakes and bleed again. All good.	115.00	805.00
		Labor Subtotal		7,245.00
Parts	1	Gallon anti-freeze	17.54	17.54T
Parts	2	Fuses	2.68	5.36T
Parts	5	Fuses	0.66	3.30T
Parts	1	Sliding window channel base set	147.15	147.15T
Parts	1	Brake master cylinder	303.75	303.75T
Parts	1	Brake master cylinder kit	47.25	47.25T
Parts	1	Window channel gasket	241.65	241.65T
Parts	1	Turn signal assembly kit	337.50	337.50T
		Parts Subtotal		1,103.50
Reimbursab...	1	Shipment of sliding window channel base set	15.00	15.00
Reimbursab...	1	Shipment of window channel gasket	15.00	15.00
Reimbursab...	1	Shipment of door handle and ring for chroming	19.42	19.42
Reimbursab...	1	Shipment of turn signal assembly kit	14.00	14.00
		Reimbursables Subtotal		63.42
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$8,411.92
			Sales Tax (8.1..	\$89.66
			<b>Total</b>	<b>\$8,501.58</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$8,501.58</b>



11/2/18

# Invoice

**PETERSON MOTORSPORTS, LLC**  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	10/31/2018
	<b>Invoice #</b>	202295
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	4.5	Check new front indicator lights - not new but used. Cut new door window channel fitting according to old channel length. Cut pieces for left door. Jack up car. Remove wood blocks from drivers seat frame. Sand blast frame. Paint frame with black top coat. Remove staples and tacks from wood blocks.	115.00	517.50
Labor	0.25	Spot paint seat base. Attach wood blocks.	115.00	28.75
Labor	4.75	Remove right handle. Gather bolts and washers to extend reach of release button to latch without having them jam between latch and inner door. Grind to shape welded washer to create lobe. Paint bolts and put into handles and adjust left and right handles. Install both handles. Wire front running lights. Wash lenses and micro machine polish lenses. Drill for mount hole on left side and install. Install left light and partial right.	115.00	546.25
Labor	0.25	Dismantle, lube and re-assemble drivers seat adjusters. Tig weld washers to screws for door handles.	115.00	28.75
Labor	8.75	Finish ground wire on right front marker light. Bolt tail light in. Clean trunk mat and vacuum trunk. Wash and install spare tire. Build mirror on right door. Install inner upper moulding on left door. Install left door cap moulding and window frame. Wipe down exterior of car. Loosen seal moulding on left front near door top. File for clearance. Put both sliding windows into left door. Install right door inner upper moulding. Measure, cut and trim right door run channels. Install left and right inner kick panel chrome mouldings.	115.00	1,006.25
Labor	8.5	Install right windows on door. Remove right windows and pinch center of double window track together to gain more movement for glass to slide. Re-install both windows but still sliding difficulty. Measure left door for lower moulding clips. Mark and drill holes and install clips. Straighten left door lower moulding for dings and better fit. Repeat process for right door. Fix turn light wiring problem found under dash in wiring harness. Tighten steering tube at steering wheel. Heat shrink tube wires not needed in harness under dash. Connect coil and check fluid. Needs oil. Write up "to do" list.	115.00	977.50
Labor	2.5	Mask car. Touch up jam of right door. Wet sand area.	115.00	287.50
Labor	2	Remove seals and seal mouldings and drip moulding from right side. Re-install all mouldings and drip mouldings and seal.	115.00	230.00
Labor	4.25	Install right quarter glass. Connect fuel pump. Top off oil with 3.25 quarts 15/40. Re-glue door seal ends. Repair detent on under dash vent handle. Order washer pump. Air fill tire to pressure. Vacuum interior. Clean windows. Seal wiper caps. Clean wheels and tires.	115.00	488.75
Labor	1.5	Make template for front exhaust mount bracket. Use template to fabricate bracket: cut, drill, sand, grind and weld. Clean and paint bracket. Machine spacers for bracket. Test fit.	115.00	172.50
Labor	3	Install header to exhaust pipe gaskets and hangar. Adjust head lamps. Adjust wipers. Check oil. Shorten hood wire, crimp and shrink tube terminal.	115.00	345.00
		Labor Subtotal		4,628.75

<b>Subtotal</b>
Sales Tax (8.1..)
<b>Total</b>
Payments/Credits
<b>Balance Due</b>



# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

Bill To		Date	10/31/2018	
		Invoice #	202295	
		Project	1957 Alfa Romeo	
Item Code	Quantity	Description	Rate	Amount
Parts	1	Window opener ornament	76.95	76.95T
Parts	2	Gallon motor oil	26.98	53.96T
		Parts Subtotal		130.91
Reimbursab...	1	Shipment of window opener ornament	14.00	14.00
Reimbursab...	1	Shipment of window channel for replacement	24.97	24.97
		Reimbursables Subtotal		38.97
<b>Due Upon Receipt</b>			<b>Subtotal</b>	\$4,798.63
			Sales Tax (8.1..	\$10.64
			<b>Total</b>	<b>\$4,809.27</b>
			Payments/Credits	\$0.00
			<b>Balance Due</b>	<b>\$4,809.27</b>



11/20/18

# Invoice

PETERSON MOTORSPORTS, LLC  
 22255 ARNOLD DR SONOMA, CA 95476  
 PH 707-996-7764

<b>Bill To</b>	<b>Date</b>	11/15/2018
	<b>Invoice #</b>	202305
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	2.5	Load car and seats on trailer, strap down and transport to upholstery shop for seat and door panel covers. Return to shop.	115.00	287.50
Labor	1.5	Drive to upholstery shop, pick up car and return.	115.00	172.50
Labor	1	Labor to re-cover seats and cover door panels	1,012.50	1,012.50
Labor	1	Labor to re-chrome door handle and ring	251.61	251.61
Labor	1	Labor to install custom fabricated tailpipe with chrome tip	84.37	84.37
Labor	1.25	Tap out set screw on returned chromed handle for right inner door. Hone inner reception area for release latch pin to fit properly. Sand down tips of screws for inner left door upper aluminum moulding.	115.00	143.75
Labor	1	Labor to repair washer pump and pusher assembly	230.85	230.85
Labor	1.75	Air up tires and put car on turn plates. Check camber and caster. Adjust toe. Inspect brakes.	115.00	201.25
		Labor Subtotal		2,384.33
Parts	1	Custom fabricated tailpipe	67.50	67.50T
Parts	1	Chrone exhaust tip	27.00	27.00T
Parts	1	Windshield washer foot	222.75	222.75T
Parts	1	Parts used to repair washer pump and pusher assembly	13.50	13.50T
		Parts Subtotal		330.75
Reimbursab...	1	Shipment of windshield washer foot	12.00	12.00
Reimbursab...	1	Shipment of re-chromed door handle and ring	19.00	19.00
		Reimbursables Subtotal		31.00

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$2,746.08
	<b>Sales Tax (8.1..</b>	\$26.87
	<b>Total</b>	<b>\$2,772.95</b>
	<b>Payments/Credits</b>	\$0.00
	<b>Balance Due</b>	<b>\$2,772.95</b>

12/31/18



PETERSON MOTORSPORTS, LLC  
22255 ARNOLD DR SONOMA, CA 95476  
PH 707-996-7764

# Invoice

<b>Bill To</b>	<b>Date</b>	12/15/2018
	<b>Invoice #</b>	202320
	<b>Project</b>	
		1957 Alfa Romeo

Item Code	Quantity	Description	Rate	Amount
Labor	0.5	Troubleshoot why tachometer does not work. Put car on stands. Cable to motor is tight but cable exiting nut is loose.	115.00	57.50
Labor	1.25	Test cables on engine side and back of tachometer. Test tachometer drive input for cable. Tachometer gear is broken. Dust car and wipe down with waterless wash n wax.	115.00	143.75
		Labor Subtotal		201.25

<b>Due Upon Receipt</b>	<b>Subtotal</b>	\$201.25
	Sales Tax (8.1..	\$0.00
	<b>Total</b>	<b>\$201.25</b>
	Payments/Credits	\$0.00
	<b>Balance Due</b>	<b>\$201.25</b>