CA 95020 11749698 BORA YEAR: 74 E: BORABYU BY: FMA	MERCED FERARR BAR# A	CHURCH ST ES BENZ, BI I,TOYOTA,HO F088155	REIGN CAR REPAIR , MORGAN HILL, CA 95037 MW,PORSCHE/AUDI,VW,VOLVC ONDA,NISSAN,LEXUS,GM VEP
t Type	(408) /	79-8480	11/03/07 INVOICE 3499
INSTALL AND	FMA FMA	AMOUNT 130.00 520.00	PLEASE NOTE ********
CHECK TO SEE IF CARBURETORS WANTS TO GO TO EUROPEAN JETS	FMA FMA	520.00	PLASTIC OR RUBBER PARTS THAT BREAK DUR
After researching data base for Euro	FMA		NG DISSASSEMBLY OR
to American jet size. The jets are	FMA		ASSEMBLY, WILL NOT B
so close wouldn't make that much of	FMA		OUR FAULT. WE ALSO
a difference. Also, cam timing must	FMA		WILL NOT BE RESPONSI
be set to match. REMOVED AIR CLEANER ASSEMBLY (notice	FMA FMA		LE FOR ADDITIONAL WO K REQUIRED TO CORREC
d seal to top coming apart & melted	FMA		PROBLEMS ASSOCITATED
onto bottom section)?? REMOVE LOWER	FMA		WITH PLASTIC OR RUBB
SECTION, REMOVE ALL AIR HORNS, SET	FMA		R COMPONENTS.X
AND REMOVE ALL CARB TOPS. SET FLOATS	FMA		
REPLACE TOP GASKETS, IDLE JETS TO	FMA		
LOWER SETTING. CLEAN ALL 8 GASKETS	FMA		
ON LOWER SECTION, REPLACE. REPLACE ALL AIR HORN GASKETS. SET IDLE CO%	FMA FMA		
ALL AIR HORN GASKEIS. SEI IDLE CO% AND AIR VOLUME FLOW.	FMA		
	FMA		
ALIGNMENT	FMA	260.00	
NOTE: ALL PAPER WORK AND ALIGNMENT	FMA		
PRINTOUTS, MUST BE KEPT FOR ONE YEAR	FMA		
WITHOUT PRINTOUTS, WE WILL NOT WARRN	FMA		
TTY ANY ALIGNMENTS!	FMA		
NOTE: MANY EUROPEAN VEHICLES REQUIRE A FULL TANK OF GAS.	FMA FMA		
**MORE OR LESS TIME COULD BE NEEDED*	FMA		
INSTALL 3501b BAGS INTO SEATS.	FMA		
	FMA		
DO NOT USE "E" BRAKE.			
SPLIT FIRE PLUGS, CLEAN THEM			
SPENT TIME RESEARCHING JET DATA,	FMA		

Any warranties on parts and accessories sold hereby are made by the

manufacturer. The above shop disclaims all warranties, including impliedwarranties of merchantability or fitness for the particular purpose, and does not authorize any person to assume for it any liability. Bosch warranties are for 12 months unlimited milage (which ever comes first). Freds warranty is for 12 months or 12,000 miles (which ever comes first)

1

laraas		Construction of the second sec	the second se	States and a state of the state of the state	the second s	AUTOMOTIV	and the second se
		olksw	agen Vo	lvo T	oyota Lex	kus Honda	Acura
MAKE: MASERA MILES: 16537	MODEL: BORA LICENSE: BORABYU	BY: FMA	16415 C MERCEDES FERARRI, BAR# AF0	HURCH BENZ, TOYOTA 88155	ST, MORGA BMW, PORS A, HONDA, NI	CAR REPAIR IN HILL, CA CHE/AUDI,VW SSAN,LEXUS, 7 INVOICE	I MOLVIC
TIMING IS NO REMOVED REAR FLOAT LEVEL CHKD ALL JET FRED NOTICED ALL OVER IT time as oil REMOVED PLUG IN ULTRA CLE to age of oi CUSTOMER OR I NOTICED LEFT	CARBURETOR AND (off 2mm) RESET	CHKD DOUBLE IL DRIPS r some il pan) D SAVED customr E PER	FMA FMA FMA FMA FMA FMA FMA FMA FMA FMA				
1 8119 1 N013	<pre>C NUMBER 002 .9972448N 0972448 05046 05055 0031</pre>	RUBBER WATER P GASKETS GASKET IDLE JE GASKET	' PART ON MODULE O-RING 'UMP O-RIN T ION GASKE			PRICE 909.73 2.28 2.30 18.68 39.84 99.12 19.92 2.62	

Any warranties on parts and accessories sold hereby are made by the manufacturer. The above shop disclaims all warranties, including impliedwarranties of merchantability or fitness for the particular purpose, and does not authorize any person to assume for it any liability. Bosch warranties are for 12 months unlimited milage (which ever comes first). Freds warranty is for 12 months or 12,000 miles (which ever comes first)


THANKS FOR USING FRED'S. We take pride in or	LABOR TOTAL	910.00	
work and hope you are satisfied. If you have any	OTHER CHARGES	.00	
questions, feel free to call anytime. Happy	PARTS TOTAL	1112.83	
motoring!! Please read the other side of this	SALES TAX	91.81	
ivoice.	PD IN ADVANCE	984.78	
Please sign here X	PAID BANKCARD	1129.86	


omotive

Work Order ID
Customer Number
Name
License
Year:
Technician
Mileage
Time Printed

12.00

No.

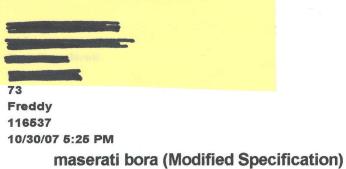

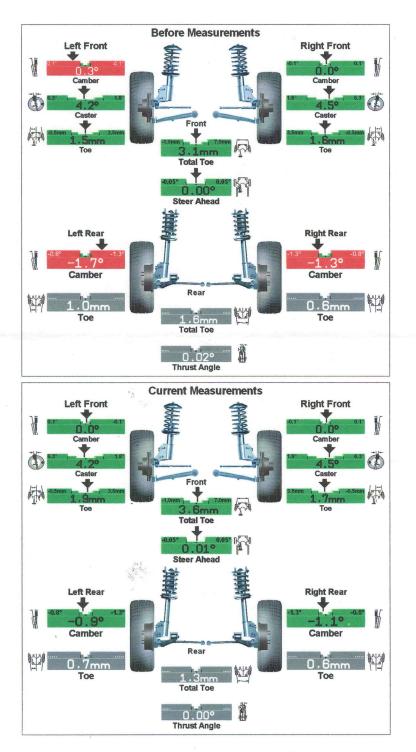

The steering wheel was level before the alignment.

The steering wheel is currently level.


•

.

RPM Re 462

Restoration & Performance Motorcars



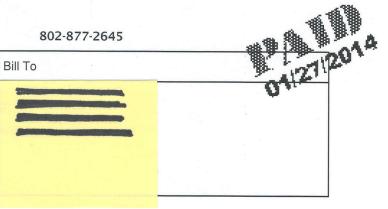

Date	Invoice #
5/22/2014	5924



Yr/Ma	ake/Model		Serial Number:	Odometer Reading:	Pro	ject/Job	Terms	
1974 M	laserati Bora	a	11749US698	19050			Net 30	
Item	Quantity		Descripti	on	List	Rate	Amount	
Labor	3		al draw. The voltmeter is live all		. 95.00	285.00		
			not only when the key is on.			-		
Labor	4	Window	regulators are slow, install new	brass gears		95.00	380.00	
Labor	2		nd balance new tires			95.00	190.00	
Labor	3		arburetor balance. It was kind of		3	95.00	285.00	
Labor	5	remove a	and replace the valve for the seat	and pedals. Pack/ship the valve		95.00	475.00	
abor	5	Remove	and replace clutch the first time.	We had to install another new		95.00	475.00	
83.6			ylinder as the first one was defec			55.00	175.00	
abor	. 1		seems too small. Engine doesn't o			95.00	95.00	
arts			Disc, Cover, Release bearing	erank won and I unnk	1	750.00		
arts		Pilot Bea				20 (200 C200000 N20	750.00	
arts	1		ydraulics, master, slave, hose			25.00	25.00	
	1					550.00	550.00	
arts	2		regulator gears brass			50.00	100.00	
Parts			all lock cylinders.		a	160.00	160.00	
arts		Brake flu				25.00	25.0	
arts	4		R15 Michelin XWX			465.00	1.860.0	
hipping	1	Shipping	g all kinds of parts in and out. Ke	eys, seat/pedal valve, clutch		85.00	85.00	
		compont					0010	
Sublet Rep	1	Rubber b	oushings for all suspension comp	onents		2,100.00	2,100.00	
Sublet Rep		Cut keys				50.00	50.00	
Sublet Rep			pedal/seat valve			450.00		
Transport			t the car from Emeryville, CA. to	a VT			450.00	
Tansport		Tanspor	it the car from Emeryvine, CA. to	0 v 1.		2,600.00	2,600.00	
and and								
			12					
						12		
		. X				5 I I I I I I I I I I I I I I I I I I I		
and the second								
10								
	1 A 1							
2					1. 1			
					T	otal	\$10,940.00	
de Star				F	- Payments/C		-\$10,940.00	
And the second s		1 × 1			·		410,910.00	
S					Balance	Duo		
2 2					Dalalice	Due	\$0.0	



Restoration & Performance Motorcars

Invoice

Vergennes, VT 05491
802-877-2645
Bill To
051061
051


	Date	Invoice #
5	/2/2016	8052



Yr/Ma	ake/Model	Serial Number:	Odometer Reading:	Proje	ect/Job	Terms
1974 M	laserati Bora	n 11749US698	19050			Net 30
Item	Quantity	Descriptio	on and a second s	List	Rate	Amount
Storage Labor Gas, Oil & Parts	10 14 10 4		buretors		125.00 95.00 2.30 65.00	1,250.00 1,330.00 23.00 260.00
Start -						
	S				- 	
. in #						
2						
	55. 1	Δ.				
	je L					
			r.	Te	otal	\$2,863.00
Royal .			F	Payments/Cr		-\$2,863.00
				Balance		\$0.00

Restoration & Pe 462 Monkton Road

Restoration & Performance Motorcars

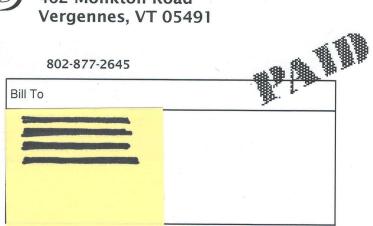


Date	Invoice #
11/30/2016	8289




Yr/Ma	ake/Model	Serial Number:	Odometer Reading:	Pro	ject/Job	Terms	
1974 M	aserati Bora	a 11749US698	9US698 19714	19714		Net 30	
Item	Quantity	Des	cription	List	Rate	Amount	
Gas, Oil &		Fill with Gas and Sta-Bil for the wi	nter		50.00	50.00	
Parts	1	Thermostat			65.00	65.00	
arts	2	V-Belts for the front of engine. Alt,	, water Pump, hyd pump		120.00	240.00	
arts	8	Carburetor Air Horn Gasket			4.00	32.00	
arts	1	Reverse light switch			120.00	120.00	
arts	1	Ignition cable set			240.00	240.00	
arts	1	MSD igntion unit			250.00	250.00	
Parts	1	Oil Filter			16.69	16.69	
arts	5	Coolant			12.00	60.00	
Parts	10	Quarts Oil Brad Penn 20-50			6.00	60.00	
Parts	3	Quarts Transmission oil			25.00	75.00	
arts		Cleaners for the front of the engine	Lots of oil on the belts and pulleys		20.00	20.00	
abor	8	11-1-16. Flush fuel system Clean c	but carburetors. Install springs in the		105.00		
		accelerator nump diaphragms to kee	ep them from leaking. Drain coolant		103.00	840.00	
		and remove the t-stat.	ep them nom leaking. Drain coolaint				
abor	7		of the enigne. Clean and replace belts.		105.00	725.00	
	·	Change oil, check all fluids. Clean	the car Fill with gas Deverse light		105.00	735.00	
		switch broken and shorting the wire	and car. I'll with gas. Reverse light		<i>N</i> .		
abor	6	11-25-16 Ignition system coming an	ad going replace with an MSD with	· · · · · · · · · · · · · · · · · · ·	105.00	(20.00	
storage	8	Storage May 1 2016 to January 1 20			105.00	630.00	
toruge	0	Storage May 1 2010 to Sandary 1 20	5107	-	125.00	1,000.00	
. Sheet inter-			34 C				
			Sec. 1		,		
5							
				1			
6	- The						
					2 5		
	*						
~					S		
		× ×	1	Т	otal	\$4,433.69	
ANA S. F.							
		14 - C		Payments/C	realts	-\$4,433.69	
5.00 4				Balance			

Restoration & Performance Motorcars



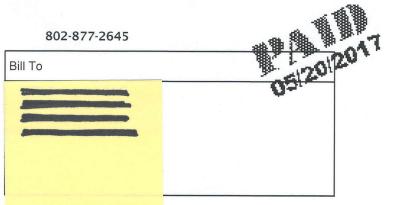

Date	Invoice #
5/17/2017	14314

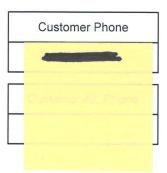


Yr/Ma	ake/Model		Serial Number:	Odometer Reading:	Pr	oject/Job	Terms
1974 M	laserati Bora	1	11749US698	19714			Net 30
Item	Quantity		Descript	tion	List	Rate	Amount
Parts	1	LMH Hydi	aulic fluid			40.00	40.00
Parts	1	Radiator co	ooling fan switch		0	25.00	25.00
Parts	1	Battery Ch			1. ¹ . 1. 1. 1.	65.00	65.00
Gas, Oil &		Fill tank w	ith 93 octane			55.00	55.00
Labor	3	Get the car		d levels. Test drive. LH Radiator		105.00	315.00
Labor	2	Engine star The low hy	ts and doesn't start intermitte draulic fluid sender was not	working. Remove, clean and		105.00	210.00
Labor	2	Vapor barr		etting into the mechanism causing		105.00	210.00
Labor	2	Clutch isn't	blow. Repair. fully disengaging. The push ting the full stroke. Shorten a	rod was a little too long so we		105.00	210.00
Labor	2		s like hell. Replace with a "d	elete plate". radio is in a bag in		105.00	210.00
ransport		Transport t	he car to RI Josh Ferris			650.00	650.0
Storage	4	Storage, Ja	nuary 1 to May 1.			125.00	500.00
						с. · ·	
	-	. 101 - 2					
							4 S.
				с	-	Total	\$2,490.00
tor.		×		F	Payments/0	Credits	-\$2,490.00
					Balanc	e Due	\$0.00

Restoration & Performance Motorcars

RPM

462 Monkton Road Vergennes, VT 05491

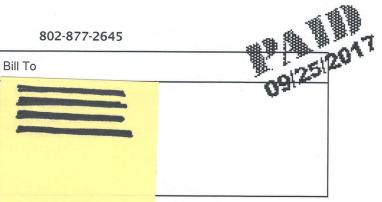

Date	Invoice #
9/18/2017	14440



Yr/Ma	ake/Model	Serial Number:	Odometer Reading:	Pro	oject/Job	Terms				
1974 M	laserati Bora	a 11749US698		Net 30						
Item	Quantity	Descrip	List	Rate	Amount					
Parts Gas, Oil & Parts Labor Labor	1 1 3 5	less "twitchy" at speed. Fill with gas put the rear tires to see if the car gets a little		162.30 50.00 410.00 105.00 105.00	162.30 50.00 410.00 315.00 525.00					
ransport		Transport the car to RI September 20, 2		450.00	450.00					
		1. Sec. 1. Sec	24. ·							
831 M.			5 N							
					· · · · ·					
		· · · · · · · · · · · · · · · · · · ·	- 							
			for the second sec							
· · · · ·			24							
	×									
	2 2									
				1	Fotal	\$1,912.30				
and the second sec		т. Та	ayments/C		-\$1,912.30					
			Balance	Balance Due						

AROCC-66 PRINTED IN	1 U.S.A.				(()		di i					. 1		()		())					
Unless otherwise provided by law, the selier (above named dealership) hereby expressly disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of said products.	ESTIMATE TOTAL	ADD'L AUTH. AMT.	ADD'L AUTH AMT.	ADDL AUTH AMT. CONTROL AUTH AMT. CONTROL AUTH AMT.	ESTIMATE AMOUNT PARTS	TOTAL PARTS				SPECIAL REPAIRS		/() CK#2048	PARD 9113/19									ass of the	salt supply 8-	2 cooper seals 2	13 Tox clavos	QUAN. PART NO. DESCRIPTION AMOUNT	ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIE
UTS, OIL @ LBS, GREASE @ TOTAL GAS - OIL - GREASE	SOLINE @		AUTHORIZED BY	OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT, ACCIDENT OR	ALE ABOVE VEHICLE FOR PORTOSES OF LESTING, INSPECTION ON DELIV- ERY AT MY RISK AN EXPRESS MECHANICS LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO, YOU	I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE, ALONG WITH NECESSARY MATERIALS, YOU AND YOUR EMPLOYEES MAY OPER-	RETAIN PARTS		an toel punps -	chear and correct day	clean on test tilter los	claim to stock wide an	Fuel state scicens -	clear that lovel - dea	open and clean carburate	+ Froin fault to pourps - th	+ Dialin des tauk - replac	- clear on tool sister.	LUBRICATE CHANGE FLUSH DIFF.	OPER. NO. REPAIR ORDER - LABOR INSTRUCTIONS	TO MUSCIAL DOID AM SERIAL NUMBER	PHONE	ADDRESS	t	Email: service@DinoMotors.com		1321 S. Railroad Ave.
STATE TAX TOTAL AMOUNT	CHARGES	SPECIAL REPAIRS	GAS, OIL, GREASE	TOTAL PARTS 78/ 72		TOTAL LABOR				fricel wins	Slug	2 seats - in in		a all jets -	03	o sue was uslue	re Food Hoses	1545 × 150 2.20	WASH POLISH S	NS WRITTEN BY	LICENSE NUMBER ODOMETER	ROMISED	TIME RECEIVED DATE OT 107119	AR# 285587	10Motors.com 003987	V71-0406	and Ave.