

2003 - in CA. before delivery:  
Waterpump Rebuilt, Engine Oil Service  
Engine resealed, Engine Bay Detailed  
June, 2003 - Complete S.S. Dual X-5+ (Time valve)  
Nov, 2004 - Nardi Steering Wheel Rebuilt  
Feb, 2005 - Hard Top Headliner Replaced  
July, 2005 - Ayers Restoration, Gardiner, ME  
replace all body rubbers, paintless dent  
repair; wet sand, buff & detail complete  
July - Sept, 2006: Paul Russell & Co (see receipts)  
July, 2009 - Front Calipers Rebuilt, New Pads  
Replaced Brake Hoses  
Aug, 2011 - Generator: checked, cleaned, repaired  
April 2014 - Replaced All Dashboard Knobs  
SEPT 2015 - 12VOLT AGM 65 Battery installed  
Sept. 2017 - Re-foamed Driver's Seat  
Rechromed F & R bumpers  
" Headlight Rims  
Installed new OEM Knock offs  
" New Hood, Trunk, & Side Roundels  
July, 2018 - Coolant Flush @ 13,501 km  
Sept 2019 - Most Recent O&F (Brad Penn)  
20-50  
June, 2020 - Lubed Suspension



# PAUL RUSSELL AND COMPANY

106 Western Avenue, Essex, MA 01929



Peter Starr  
PO Box 628  
Biddeford, ME 04005

Invoice Date Jul 21, 2006  
Customer ID starr01  
Mileage 11,727  
Chassis No. 70077  
Engine No.  
Invoice No. 14963

Black 1957 BMW 507

## Labor Description

### MECHANICAL

RE:

Clean undercarriage and inspect for leaks  
Test drive - leaks at oil dipstick tube housing  
Replace crushed seal and install  
Leak at output shaft housing detent cover  
Replace gasket and install cover  
Tachometer inoperative - missing signal wire to sending unit  
Test sending unit inoperative

<u>Qty</u>	<u>Item</u>	<u>Description</u>	<u>Unit</u>	<u>Extended</u>
3.75	ser	Service Labor	95.00	356.25
1.00	nip	permatex	9.00	9.00

Mechanical Labor	3.75	Hrs.	\$	356.25
Body Labor		Hrs.		
Metal Labor		Hrs.		
Upholstery Labor		Hrs.		
Outside Services				
Parts			\$	9.00
Fluids				
Sales Tax				
Total			\$	365.25

# PAUL RUSSELL AND COMPANY

106 Western Avenue, Essex, MA 01929



Peter Starr  
PO Box 628  
Biddeford, ME 04005

Invoice Date Jul 28, 2006  
Customer ID starr01  
Mileage 11727  
Chassis No. 70077  
Engine No.  
Invoice No. 14988

Black 1957 BMW 507

## Labor Description

MECHANICAL

RE:

Remove driveshaft and pinion yoke


Remove tachometer and send out to have converted to electronic style

<u>Qty</u>	<u>Item</u>	<u>Description</u>	<u>Unit</u>	<u>Extended</u>
2.25	ser	Service Labor	95.00	213.75
1.00	nip	47-62-12 pinion seal	20.00	20.00

Mechanical Labor	2.25 Hrs.	\$	213.75
Body Labor	Hrs.		
Metal Labor	Hrs.		
Upholstery Labor	Hrs.		
Outside Services			
Parts		\$	20.00
Fluids			
Sales Tax			
Total		\$	233.75

# PAUL RUSSELL AND COMPANY

106 Western Avenue, Essex, MA 01929

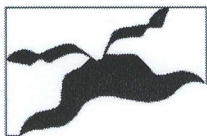

Peter Starr  
PO Box 628  
Biddeford, ME 04005

Invoice Date Aug 04, 2006  
Customer ID starr01  
Mileage  
Chassis No. 70077  
Engine No.  
Invoice No. 15009

Black 1957 BMW 507

## Labor Description

### MECHANICAL

RE:

Remove pinion seal flange, clean, replace seal and install

Reinstall pinion yolk and torque nut to 110 ft/lbs

Reinstall driveshaft - replaced hardware with proper length bolts and lock washer

Fill rear differential with 90W gear oil

Determine mounting location and hardware for tonneau/hardtop

<u>Qty</u>	<u>Item</u>	<u>Description</u>	<u>Unit</u>	<u>Extended</u>
4.25	ser	Service Labor	95.00	403.75
1.00	nip	Miscellaneous parts	23.10	23.10
2.00	gear oil	GL4 gear oil 80W-90 18per qt	4.25	8.50

Mechanical Labor	4.25	Hrs. \$	403.75
Body Labor		Hrs.	
Metal Labor		Hrs.	
Upholstery Labor		Hrs.	
Outside Services			
Parts		\$	23.10
Fluids		\$	8.50
Sales Tax			
Total		\$	435.35



# PAUL RUSSELL AND COMPANY



106 Western Avenue, Essex, MA 01929

Peter Starr  
PO Box 628  
Biddeford, ME 04005

Invoice Date Aug 10, 2006  
Customer ID starr01  
Mileage 11727  
Chassis No. 70077  
Engine No.  
Invoice No. 15013

Black 1957 BMW 507

## Labor Description

### MECHANICAL

RE:

Convert tachometer to coil signal pickup type for customer request

Install and wire tachometer

*N. Hollywood Speedometer, FL  
"printed circuit board" failed per Paul Russell & Co 10/2006*

### SUB-MECHANICAL

Convert tachometer to coil sensor

<u>Qty</u>	<u>Item</u>	<u>Description</u>	<u>Unit</u>	<u>Extended</u>
1.00	ser	Service Labor	95.00	95.00
1.00	sub m	See Sub-mechanical note	298.35	298.35

Mechanical Labor	1.00	Hrs.	\$	95.00
Body Labor		Hrs.		
Metal Labor		Hrs.		
Upholstery Labor		Hrs.		
Outside Services			\$	298.35
Parts				
Fluids				
Sales Tax				
Total			\$	393.35

**PAUL RUSSELL  
AND COMPANY**

106 Western Avenue, Essex, MA 01929



Peter Starr  
PO Box 628  
Biddeford, ME 04005

Invoice Date Sep 12, 2006  
Customer ID starr01  
Mileage  
Chassis No. 70077  
Engine No.  
Invoice No. 15113

Black 1957 BMW 507

**Labor Description**

<u>Qty</u>	<u>Item</u>	<u>Description</u>	<u>Unit</u>	<u>Extended</u>
1.00	136 267 02 96	shift boot	27.00	27.00
1.00	nip	hardtop seal set	275.00	275.00
1.00	nip	tool set	295.00	295.00
1.00	sub ship	Parts Shipping, insured	9.00	9.00

Mechanical Labor	Hrs.	
Body Labor	Hrs.	
Metal Labor	Hrs.	
Upholstery Labor	Hrs.	
Outside Services	\$	9.00
Parts	\$	597.00
Fluids		
Sales Tax		
Total	\$	606.00

# PAUL RUSSELL AND COMPANY

106 Western Avenue, Essex, MA 01929



Peter Starr  
PO Box 628  
Biddeford, ME 04005

Invoice Date Sep 22, 2006  
Customer ID starr01  
Mileage 12,082  
Chassis No. 70077  
Engine No.  
Invoice No. 15175

Black 1957 BMW 507

## Labor Description

MECHANICAL - WARRANTEE - NO CHARGE

CH:

Assist as needed on tachometer issue and wipe car down for delivery

GP:

Diagnose drive train noise - appears to be coming from transmission reverse idles and lay shaft bearings

Diagnose and repair tachometer and temperature gauge

Temperature gauge was inoperable due to an unsoldered connection at the gauge

Re-solder wire - operations check okay

Tachometer was wired incorrectly - power came from blinker system and signal was on wrong side of coil

Provide power directly from fuse #4 from front and switch signal wire to negative side of coil

Reassemble gauge and steering column

Check operations for both gauges - ok

<u>Qty</u>	<u>Item</u>	<u>Description</u>	<u>Unit</u>	<u>Extended</u>
1.00	ser	Service Labor	0.00	0.00
5.25	ser	Service Labor	0.00	0.00
1.00	nip	Miscellaneous parts	0.00	0.00

Mechanical Labor	6.25 Hrs.	\$	0.00
Body Labor	Hrs.		
Metal Labor	Hrs.		
Upholstery Labor	Hrs.		
Outside Services			
Parts		\$	0.00
Fluids			
Sales Tax			
Total		\$	0.00