

So

Invoice

Invoice Number: 100219A - FINAL

Invoice Date: Oct 9, 2019

Page:

Customer PO	Payment Terms	Due Date	Sales Rep ID
#19 LOTUS 23	Net 10 Days	10/19/19	

Quantity	Description	Unit Price	Extension
	**************************************	A.40	1
2.00	INSTALL SEAT BELTS, CHARGED BATTERY, CLEANED CAR, PULLED PLUGS,	125.00	250.00
	GOT OIL PSI, REINSTALLED PLUGS. RAN CAR TO CHECK OIL LEAKS.		
	SET PRESSURE IN TRAILER TIRES, MOVE TRAILER IN PADDOCK, TRAILER	0005	
	JACK PROBLEMS & BATTERY.	7.80%	Continue
1.00	EVENT ON SATURDAY, CHECKED CAR OUT & FOUND BAD DONUT ON RIGHT	350.00	350.00
	AXLE. INSPECT CAR , TOP OFF FUEL, MOVED TRAILER BACK TO SHOP.		
	PREP CAR AFTER CSRG SONOMA:		
6.50	INSPECT TACH CABLE & REPAIR, OIL LEAK AT PUMP REPAIRED. SERVICE	125.00	812.50
	CLUTCH HYD.		
	BASIC PREP SERVICE OF: INSPECTION, CHECK FLUID LEVELS, N&B, BRAKE		
	SERVICE, CHECK CONDITION OF PADS, ROTORS & TIRES. EMPTY CATCH CANS		
	& CLEAN CAR IN AND OUT.		
	INSTALLED NEW SWITCH ON TRAILER JACK AND CHARGED BATTERY. LOADED		
	CAR IN TRAILER.		

1.00	USED DRIVE DONUT	60.00	60.00
1.00	SIM-29064 BK 5 POINT HARNESS	178.13	178.13
1.00	ROCKER SWITCH HVY DUTY (TRAILER)	26.97	26.97
2.00	GALL #110 RACE FUEL	11.00	22.00

Continued

Continued

Continued

Continued

Continued

Check No:

Check No:

Continued



Sol

Invoice

Invoice Number: 100219A - FINAL

Invoice Date: Oct 9, 2019

Page:

Customer PO	Payment Terms	Due Date	Sales Rep ID
#19 LOTUS 23	Net 10 Days	10/19/19	

Quantity	Description	Unit Price	Extension
	RL-600 BRAKE FLUID	16.95	16.95
100 mm (100 mm) 100 mm (100 mm) 100 mm	TACH PROBLEM TO THE TAKE THE SAME OF FOUR REPORT OF RECEIVE AND THE TRACE TO SHE.	350.04	
	PREP CAREATOR GENERAL REPAIRS. CIL LEAK AT PUMP REPAIRED. SERVICE ENGRESSE PREP SERVICE OF TREPCTION, CHECK PLUID LEVELS, HER, BRAKE SERVICE ONE COMPLETION OF PARS, PORCES & TIRES. EMPTY CATCH CAMS	125.01	612.5
eris (Son Coarles	USED PRIVE DONGT	60.0	
	STAM-29064 BE 5 POINT HARNESS ROCKER SWITCH BYY DUTY ITRAILER) DALL \$110 MACE BUEL	178.1 26.9 11.0	

Subtotal 1,716.55
Sales Tax 24.70
Total Invoice Amount 1,741.25
Payment Received 1,741.25

Check No:

WARNING-RELEASE- There are dangers and risks associated with auto racing which can result in property damage, serious physical injury or death.

Customer voluntarily accepts, assumes and incurs all such risks, dangers and damages incurred, associated with auto racing. CUSTOMER RELEASES, WAIVER, DISCHARGES AND COVENANTS, NOT TO SUE MCGEE MOTORSPORTS, INC. OR IT'S EMPLOYEES.

**OVERDUE INVOICES WILL BE SUBJECT TO A FINANCE CHARGE OF 19.8% ANNUALLY



Solo

Invoice

Invoice Number: 102418A - FINAL

Invoice Date: Oct 24, 2018

Page:

1

Customer PO	Payment Terms	Due Date	Sales Rep ID
#19 LOTUS	Net 10 Days	11/3/18	

Quantity	Description	Unit Price	Extension

	HELP FOR CSRG SONOMA		/ 25050
2.00	INSTALLED BATTERY, PRIMED OIL SYSTEM; STARTED AND RAN CAR; CHANGED	125.00	250.0
	WHEELS ON CAR; MOVED TRAILER INTO PADDOCK SPOT. HAD RKR RESEAT	CALC	
	TIRE.		
	8/10	101/4	

Subtotal
Sales Tax

Total Invoice Amount
Payment Received

TOTAL

250.00

Check No:

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and /or attorneys fees in the

Roger Kraus Racing Ent, Inc.

2896 Grove Way Castro Valley, CA 94546 (510) 582-5031 BAR # 102319

Repair Order # 94454

2018 AVON ACB9

Inv Date: 9/04/2018 @ 9:08am

VIN:

Engine:

Trans:

ODO In: 0

Color:

License #

Vehicle Problems

Requests for Service

Services Performed

) may be charged.

Hrs

Customer states	that: Request	ts for Service	& Vehicle	Problems -

Labor Service	 Usage tax tires 	s ca only SB	1.00	1.75	1.75
New A	V7290M	Avon 6.5/23-13 A25	1.00	306.00	306.00
Used S	TDR	Tire Disposal Race	1.00	5.00	5.00
Labor Service	- Mount & bal ra	ice w sale RLS	1.00	25.00	25.00

Warranty

All returned race tires are subject to a 20% restocking charge. Returned Goods Authorization's are required for all returns. All returns must be made in 60 days.

Thank You Please Come Again

CUSTOMER COPY

Customer acknowledges receipt of merchandise and services.

Sub Total Sales Tax (AC) 337.75 28.77

Discard old parts

Original Estimate:

366.52 **Total** 366.52



Sold

Invoice

Invoice Number: 022618C - FINAL

Invoice Date: Mar 1, 2018

Page:

Customer PO	Payment Terms	Due Date	Sales Rep ID
#19 LOTUS	Net 10 Days	3/11/18	

Quantity	Descr	iption	Unit Price	Extension	Job ID
	**************************************	SUBLET LABOR			1
4.00	MOUNT/BALANCE 2/26/18		20.00	80.00	
			8		

Subtotal
Sales Tax

Total Invoice Amount
Payment Received
TOTAL

80.00

Check No:

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and /or attorneys fees in the

Roger Kraus Racing Ent, Inc.

2896 Grove Way Castro Valley, CA 94546 (510) 582-5031 BAR # 102319

Repair Order # 92193

2018 AVON ACB9

VIN: Engine: Trans: ODO In: 0 Color: License #

nay be charged.

Vehicle Problems	Requests for Service	Services Performed	Hrs	Qty	Price		Ext
Customer states that: R	Requests for Service & Vehicle	e Problems -					
Labor Service - Than New AV7267 New AV7290		13 A25		2.00 2.00	259.00 306.00		0.00 518.00 612.00
Labor Service - Usag	ge tax tires ca only BK		4.00		1.75		7.00
Labor Service - ON 1	TRAC FREIGHT AND HANDLII	NG CHARGES BK	2.00		43.90	1	87.80
Labor Service - Cred	it Card On File BK						0.00

Notes

Warranty

SHIP TO: MCGEE MOTORSPORTS 29127 ARNOLD DR SONOMA CA 95476 ATT: MIKE 707-996-1112

> Batch #: 051001 02/20/18 AVS: Y

Invoice #: 1

APPR CODE: 249826 AMEX

ANIEX *********1001 Manual CNP
/

AMOUNT

\$1,316.61

RRN: 239651469

12:09:55

CVC: M

APPROVED

Thank You Please Come Again

CUSTOMER COPY

X

Customer acknowledges receipt of merchandise and services.

All returned race tires are subject to a 20% restocking charge. Returned Goods Authorization's are required for all returns. All returns must be made in 60 days.

Sub Total Sales Tax (SP) 1,224.80 91.81



Invoice

Invoice Number: 041719B - FINAL

Invoice Date: Apr 17, 2019

Page:

Sol	

Customer PO	Payment Terms	Due Date	Sales Rep ID
#19 LOTUS	Net 10 Days	4/27/19	

Quantity	Description	Unit Price	Extension

8.00	REFILLED COOLING SYSTEM, CHARGED AND REINSTALLED BATTERY. FITTED	125.00	1,000.00
	BROKEN FIRE SYSTEM LINE IN ENGINE BAY AND ZIP TIE TO MOTOR TO HOLD		
	IT.		
	FOUND BAD ING SWITCH WHEN STARTING MOTOR, REPLACED. REPLACE BAD		
	BUSHING IN L/R UPPER CONTROL ARM. INSPECTED GEAR BOX & TOPPED OFF		
	FUEL.	/	
	BASIC PREP SERVICE OF: INSPECTION, CHECK FLUID LEVELS, N&B, BRAKE		
	SERVICE. CHECK CONDITION OF PADS, ROTORS & TIRES. EMPTY CATCH	46	
	CANS & CLEAN CAR IN AND OUT.		-

1.00	PICK UP TRAILER IN MARTINEZ - FUEL & BRIDGE COST	50.00	50.00

1.00	WATER WETTER	9.95	9.95
1.00	IGNITION SWITCH	4.70	4.70
1.00	LOTUS CONTROL ARM BUSHING	10.00	10.00
1.00	RL-600 BRAKE FLUID	16.95	16.95
1.00	GALLON #110 FUEL	11.00	11.00
1.00	REDLINE 75W90 GEAR OIL	17.49	17.49

Subtotal	1,120.09
Sales Tax	5.69
Total Invoice Amount	1,125.78
Payment Received	
TOTAL	1,125.78

Check No:

WARNING-RELEASE- There are dangers and risks associated with auto racing which can result in property damage, serious physical injury or death. Customer voluntarily accepts, assumes and incurs all such risks, dangers and damages incurred, associated with auto racing. CUSTOMER RELEASES, WAIVER, DISCHARGES AND COVENANTS, NOT TO SUE MCGEE MOTORSPORTS, INC. OR IT'S EMPLOYEES.

** OVERDUE INVOICES WILL BE SUBJECT TO A FINANCE CHARGE OF 19.8% ANNUALLY



S

Invoice

Invoice Number: 091916A - OPEN

Invoice Date: Oct 1, 2016

Page:

Customer PO	Payment Terms	Due Date	Sales Rep ID
#19 - LOTUS 23	Net 10 Days	10/11/16	

Quantity	Description	Unit Price	Extension
11.49	**************************************	8.80	
1.00	REMOVED MOTOR AND TRANS, SHIP MOTOR TO VEGHER, INSPECTED TRANS	4,080.00	4,080.00
	AFTER REMOVING. DELIVER HEADER AND OIL LINES & TANK TO VEGHER.	27 11.86	
	HAD RADIATOR REPAIRED AND FLUSH	1704 24,98	71.76.798
	PICKED UP MOTOR AND PARTS FROM VEGHER. REINSTALLED MOTOR AND	170 75 (0)	
	TRANS, PAINTED RADIATOR, FOUND BAD MASTER CYLINDER, HAD REBUILT	197 56,85	
	AND FOUND BAD BRAKE LAMP SWITCH.	10.00	
	RAN MOTOR TO OPERATING TEMP. CHECKED OIL LEVEL, WATER LEVEL,		
	REMOVED OIL FILTER, INSTALLED SECOND NEW ONE TO CHECK FIRST FOR		
	PARTS, FUELED CAR.		
	BASIC PREP SERVICE OF: INSPECTION, N&B, BRAKE SERVICE AND CLEAN.		
	HELPED ON CSRG SONOMA TEST DAY AND EVENT NO CHARGE		
	TOTAL LABOR \$4080.00		
	********************* SUBLET LABOR ****************		
1.00	RADIATOR REPAIR	218.75	218.75
1.00	HAZARDOUS WASTE/FACILITY FEE	60.00	60.00
	TOTAL SUBLET LABOR\$278.75		

2.00	1516 OIL FILTERS	9.84	19.68
1.00	026J 0611 SWITCH BRAKE LIGHT	33.34	33.34

Subtotal
Sales Tax
Continued
Continued
Continued
Continued
Continued
Continued
Total Invoice Amount
Payment Received
TOTAL
Continued

Check No:



Solo

Invoice

Invoice Number: 091916A - OPEN

Invoice Date: Oct 1, 2016

Page:

Customer PO	Payment Terms	Due Date	Sales Rep ID
#19 - LOTUS 23	Net 10 Days	10/11/16	

	AN 901-3A .38 CRUSH WASHER, ALUM	0 = 0	
1 00 0		0.50	0.50
1.00	GIRLING M/CYL REPAIR KIT .625	43.21	43.21
1.00 W	NATER WETTER	11.95	11.95
9.00	QTS REDLINE 40W OIL	14.95	134.55
1.00 0	QT REDLINE 75/90 GEAR OIL	16.49	16.49
1.00 F	REDLINE RL-600 BRAKE FLUID	16.95	16.95
8.00	GAL #110 RACE FUEL	10.00	80.00
I	TOTAL PARTS\$356.67		
	NEW YEAR THE PERSON AND PRESENTED THE PROPERTY OF THE PERSON FOR		
	MATERIAL STORE BY ANY SEAT AND EVEN NO CERTIFIES		
	Control of the contro		
			719,76
	A STATE OF THE STA		40.00
		9.80	19.69
		53.36	37,34

Subtotal Sales Tax

Total Invoice Amount

Payment Received

4,715.42 29.43 4,744.85

4,744.8

Check No:

TOTAL

WARNING-RELEASE- There are dangers and risks associated with auto racing which can result in property damage, serious physical injury or death.

Customer voluntarily accepts, assumes and incurs all such risks, dangers and damages incurred, associated with auto racing. CUSTOMER RELEASES, WAIVER, DISCHARGES AND COVENANTS, NOT TO SUE MCGEE MOTORSPORTS, INC. OR IT'S EMPLOYEES.


** OVERDUE INVOICES WILL BE SUBJECT TO A FINANCE CHARGE OF 19.8% ANNUALLY



INVOICE #	4306	DATE 10/1/16	WRITTEN BY	nvegher
		SHIP TO:		
ORDER DATE		TERMS OF PAYMENT	SHIP DATE/ VIA	
	7744	upon receipt/personal check okay		
NOTES:	Lotus Twi	in Cam/Lotus 23B Headers :To invoice for labor, parts & materials	14 - 1483 PSC	
QTY.	TYPE	DECORPTION	ALL VALUES SHOV	
	TYPE	DESCRIPTION	UNIT PRICE	EXTENSION
(hrs)		LABOR	\$95.00/hr stand	lard rate
5.25	923 F 800	A STATE STATE OF A STATE OF THE		0.00 0.00 0.00
		LABOR - TO	ΓAL	0.00
		PARTS & MATERIALS		
1 270	lot	Custom made headers - fit flanges, neck down tubes to fit port, fab headers & secure at collector	1400.00	1400.00 0.00 0.00
174	7305	The Color of the Application of the Indian Color of the C	50.00	0.00
.4	70/9	J-bend, clear, 1.63"x.049x4"	23.60	94.40
2	Tree N	J-bend, clear, 1.63"x.049x3"	22.50	45.00
2		U-bend, clear, 1.63"x.049x4"	20.95	41.9
2		Bend, clear,45°, 2.25x.049x6"	29.60	59.2
3		Tube, crew, 2.25"x.049	7.95	23.8
1		Throat, 4-way, 1.63"x.049 (15 deg)	430.00	430.0
1		Merge collector, 2" mild steel	24.55	24.5
1		Degreed taper, 2-2.25" .049x7deg	24.30	24.3
1	set, lot	Lotus steel flanges	260.00	260.00
	101	Freight in, material & flanges	COST	37.68
		The state of the s	4	0.00
		PARTS - TOT	AL	2440.88
		MISCELLANEOUS		
		Sept 1 in the second se		0.00
	can	Brake/sensitive surface cleaner	5.50	0.00
	100	MISCELLANEOUS - TOT	AL	0.00
		TOTAL LABOR	T. I	0.00
	. led.	TOTAL PARTS		2440.88
	* (1/3)	TOTAL MISCELLANEOUS		0.00
		SUB-TO	TAI	2440.88
			AX 8.25%	201.37
		- 1 2 4 4 5 1 1 N C 2 4 1 1 N C 2 4 1 1 N C 2 4 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1		
		TOTAL BALANCE D	UE	\$ 2,642.

Please remit to: Veloce Motors West, 426 Petaluma Blvd. North, Petaluma, CA 94952-2873

THANK YOU FOR YOUR BUSINESS!

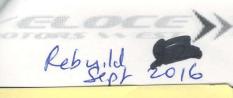

		DATE 9/30/16	WRITTEN BY	nvegher
		SHIP TO:	26 50 160 30 110 00	
	4.		228.60	20, 30
PO NO		TERMS OF PAYMENT	SHIP DATE/ VIA	
al		upon receipt/personal check okay	11 201	170.503
ES:	Lotus Twir	Cam engine: To invoice for labor, parts & materials to repair post blow up	35 00	35 00
		Manager Street	ALL VALUES SHOW	
TY.	TYPE	DESCRIPTION	UNIT PRICE	EXTENSION
		LABOR	95.00	/hr standard
1	lot	Disassemble, clean & inspect engine components	100.200	incl.
1		Engine rebuild	7.6	3200.00
2	hrs	Cut new block to clear crank; drill & tap holes to hold in core plugs; clean up	95.00	190.00
	1110	sharp edges on block	00.00	100.00
25	hrs	Pre-assemble; check pistons, rods & head; measure piston to valve and	95.00	498.75
		piston to head; cc & check for compression ratio; machine pistons .040" off		
		crown & reassemble; check CC - aok- 13:1; remove rods and pistons,	7 70	
75	hrs	number pins; break sharp edges; clean for assemble On assembly of head, note crack in #4 intake follower bore sleeve; remove	95.00	356.25
15	1115	follower bore; install with use of liquid nitrogen new oversize follower bore;	95.00	330.23
		machine for new follower & cut tops of follower sleeve for cam lobe clearance	-	
75	hrs	Pressure check cylinder head post repair	95.00	71.25
.5	hrs	Straighten exhaust cam	95.00	47.50
75	hrs	On re-attaching the carburetor return spring plate, there was a noted amount	95.00	261.25
		of play in the assembly; on taking apart, the original bronze bushing	29.05	
		literally fell out of the housing; I over bored the housing using a ream & made	20	
		two new bushings; lubed & installed them; reinstall carb throttle cable plate &	77 803	
		throttle return spring housing (this is not a normal repairs item on an	- 333	
		engine bill)		
	let	Book with the second of the	29 98	40.00
1	lot	Engine Dyno Session		1200.00
1	lot	Post dyno inspection		incl.
		LABOR - TOTAL		5825.00
		OUTSIDE SERVICES		
1	lot	Coating on rod bearings	-	50.00
1	lot	Shipping on bearings for coating		30.00
1	lot	Weld damage to head; remachine chambers & seat bores; make two valve		1440.00
		seats & install; R&R one exhaust guide; face & tip valves; cut & radius valve seats; blend seats to ports & chambers		
1	lot	Machine followers - remove .075"	2470	210.00
1	lot	Surface head		100.00
1	lot	Sonic clean oil tank - pressure ck - ok; filler neck has small leak		110.00
		OUTSIDE SERVICES - TOTAL	1	1940.00
		PARTS & MATERIALS		
1	new	Block, Kent L - blank	1599.00	1599.00
1	lot	Bore cylinders; install torque plate, hot hone & pressure test new blank block	315.00	315.00
1	lot	Freight in, block	Cost	62.00
1	set	Pistons		900.00
1	set	Piston rings		175.00
1		Valve, intake	35.00	35.00
4		Valves, exhaust	41.45	165.80
2		Valve seats, custom made	36.00	72.00
1		Valve guide	12.00	12.00
8		Valve lash caps	6.55	52.40
1		II am to the control of the control	49.95	99.90



VOICE #	4272		DATE		9/30/16	WRITTEN BY	nvegher
1		Cam follower oversize bronze bore				28.00	28.0
1	set	Rod bearings, narrow				160.00	160.0
1	set	Main bearings				110.00	110.0
1		Jackshaft, w/full oil groove, iron				228.00	228.0
1	A STATE OF THE PARTY OF THE PAR	Jackshaft thrust plate				68.25	68.2
1	A DOMESTIC	Front seal				11.70	11.7
1		Head gasket				125.00	125.0
1		Pan gasket				35.00	35.0
1						35.00	35.0
1	1	Valve cover gasket				8.00	8.0
1		Top chest gasket				10.00	10.0
1		Rear plate gasket					
1	321	Water pump belt				11.50	11.5
1	83	Oil pump, used - excellent				375.00	375.0
1	The Hall	Oil pan, used - excellent				300.00	300.0
1	50	Oil pump gasket				7.25	7.2
1		Crank sprocket				97.25	97.2
1		Timing chain, premium				80.00	80.0
1	1	Master link, clipped type				10.50	10.5
8	1 3 3 3 3	Carb rubber cups				2.50	20.0
8		Jet nuts, 5/16"				0.90	7.2
1	541	Carb soft mount				10.00	10.0
5	51	Dowty washers, 1/2"				2.50	12.5
4	6.1	Spark plugs, C57				6.35	25.4
4		Spark plug wire number rings				1.85	7.4
1		Oil filter (on dyno)					19.1
					PARTS - TOTAL		5290.2
		Taranta o	88.7		TAILTO - TOTAL		0200.2
0.5	tube	MATERIALS silicone, pure, white				29.00	14.5
						11.50	69.0
6	gal	Dyno fuel				10.50	126.0
12	qt	Engine break in oil (Joe Gibbes)				5.50	16.5
3	can	Brake/sensitive surface cleaner				5.50	
1	lot	Incidental materials/supplies				00.00	15.0
1	lot	Hazardous waste disposal fee				20.00	20.0
		F. 134.4 .62.5	<u> </u>	444	MISCELLANEOUS - TOTAL	165-16	261.0
		TOTAL LABOR	MI E	40.00	100		5825.0
		TOTAL OUTSIDE SERVICES					1940.0
		TOTAL PARTS			2.99		5290.2
		TOTAL MATERIALS				1.0	261.
	18	0 130 0 193 1			SUB-TOTAL	720.5	13316.2
	79	09 2 194.3			TAX	8.25%	457.9
	1	100 100 100 100 100 100 100 100 100 100			TOTAL BALANCE DUE		\$ 13,774.1

Please remit to: Veloce Motors West, 426 Petaluma Blvd. North, Petaluma, CA 94952-2873

THANK YOU FOR YOUR BUSINESS!

DUE TO THE STRESSES IMPOSED BY RACING THERE ARE NO WARRANTIES ON PARTS EXPRESS OR IMPLIED.
SOLE RESPONSIBILITY FOR THE OPERATION OF THE ENGINE RESTS ON THE END USER

New enjoye

HOW BLOCK ETC. LEO F-7 45 000 65 150 38 chokes 55-F-8 25" Stock horr 34° ADU @ 5000

Listing of: (memory data)

Channel Group: Corrected Torque and Power Page 1 of 1

Printed on Aug 29 2016 at 17:22:21 Test Description: Accel. Test - 200 rpm/second

	EngSpd RPM	STPTrq Clb-ft	STPPwr CHp	Oil P psig	BSFC lb/hph	WtrOut degF	AirTmp degF	Fuel A lb/hr	BaroP inHg
			*						
	5200	58.9	58.4	84.9	0.295	178	77	14.2	29.96
	5300	69.1	69.7	85.0	0.245	178	77	14.3	29.96
_	5400	133.6	137.4	88.4	0.482	179	77	58.3	29.96
	5500	133.9	140.3	88.4	0.462	178	77	57.0	29.96
	5600	134.6	143.5	88.3	0.474	178	77	59.8	29.96
	5700	133.5	144.9	88.1	0.481	178	77	61.2	29.95
	5800	132.5	146.3	87.8	0.468	178	77	60.0	29.95
	5900	133.6	150.1	87.7	0.460	178	77	60.6	29.96
	6000	133.5	152.5	87.6	0.444	179	77	59.4	29.96
	6100	136.7	158.8	87.4	0.399	179	77	55.6	29.96
	6200	136.9	161.6	87.7	0.395	180	77	55.9	29.96
	6300	137.8	165.3	88.0	0.414	181	77	59.9	29.96
	6400	138.5	168.7	87.9	0.430	182	77	63.5	29.96
	6500	139.7	172.9	88.0	0.423	182	77	63.9	29.96
	6600	139.6	175.5	88.2	0.431	182	77	66.0	29.96
	6700	139.2	177.6	88.3	0.416	182	77	64.5	29.96
	6800	139.9	181.1	88.2	0.425	182	77	67.0	29.96
	6900	137.3	180.4	88.3	0.433	184	77	67.9	29.96
	7000	137.9	183.7	88.3	0.432	185	77	68.9	29.96
	7100	135.7	183.4	88.3	0.438	186	77	69.5	29.96
	7200	134.3	184.0	88.7	0.431	184	77	68.6	29.96
	7300	134.3	186.6	89.6	0.426	184	77	68.5	29.96
	7400	133.6	188.2	90.4	0.419	184	77	67.9	29.96
	7500	133.0	190.0	91.0	0.420	183	77	68.5	29.96
	7600	131.4	190.1	92.7	0.449	183	77	73.1	29.96
	7700	131.9	193.4	93.5	0.482	184	77	79.7	29.95
	7800	130.0	193.1	94.7	0.489	184	77	80.6	29.95
	7900	129.2	194.3	94.9	0.480	187	77	79.3	29.95
	8000	127.4	194.1	94.9	0.472	187	77	77.8	29.96
	8100	125.6	193.7	95.6	0.503	186	77	82.4	29.95
	8200	122.7	191.6	97.5	0.520	185	77	83.9	29.95
	8300	121.8	192.5	98.8	0.536	183	77	86.6	29.95

Invoice

Aircraft Windshield Company 10871 Kyle Street Los Alamitos, CA 90720 (562) 430-8108 / (562) 598-5109 fax

Date	Invoice #
9/25/2012	35659

	Ship To

P.O. No.	Terms	Rep	Ship Date	Ship Via	FOB	Traveler
verbal	Due on receipt	JLG	9/28/2012	UPS	Los Alamitos	35659

Quantity	AW Number	Description	Price Each	Amount
7		1	700.00	700.00
1	misc	Lotus 23 Windshield 3/16" Clear	700.00	700.00
1	misc	Lotus 23 Left Door window 3/16" Clear	95.00	95.00
1	misc	Lotus 23 Right Door window 3/16" Clear	95.00	95.00
1	misc	Lotus 23 Left Headlight cover 1/8" Clear	95.00	95.00
1	misc	Lotus 23 Right Headlight cover 1/8" Clear	95.00	95.00
1	freight	UPS shipping charges 61" x 21" x 10" 30#	95.00	95.00
		Sales Tax	7.75%	0.00
			·	

Total \$1,175.00

Payments \$0.00



VVOICE #	# 3478	DATE 3/29/11	WRITTEN BY	nvegher
		SHIP TO:		
RDER DATE		TERMS OF PAYMENT upon receipt/personal check okay	SHIP DATE/ VIA	
		customer pick up		
OTES:	Lotus B23	3:To invoice for labor, parts & materials to align car & check valve lash for CSRG ever	nt, April 1-3, 201	1
		The state of the s	L VALUES SHOWN	
QTY.	TYPE	DESCRIPTION	UNIT PRICE	EXTENSION
(1)		LABOR	\$85.00/hr stan \$90.00/hr mac	
(hrs)		Desire and Constitute and Heart and Constitute and	\$90.00/III IIIaC	42.
0.5		Receive car & move into position; put car on alignment platform		42.
7.5		Perform a full alignment: set caster, camber, toe, cornerweights & ride heights; advise cutomer of		637.
4		Top up fluids; charge battery; fire engine & warm up; check valve lash & perform le down inspection on engine - all valve lash numbers are within spec & leak down was between 2-4% for all four cylinders; clean valve cover & install new gasket	ak	340.
0.25 Move car off platform; mo		Move car off platform; move to back of shop for pick up		21.
		LABOR - TOTAL		1041.
		PARTS & MATERIALS		
1	,	Lotus Twin Cam valve cover gasket		28.
		PARTS - TOTAL		28.
		MISCELLANEOUS		
	gal	Gas	9.10	0.
6	qt	Engine oil, Brad Penn, DFV specific	8.50	51.
1	pt	Water wetter	12.50	12
	pt	Brake fluid	25.35	0
		MISCELLANEOUS - TOTAL		63
		TOTAL LABOR		1041
		TOTAL PARTS		28
		TOTAL MISCELLANEOUS		63
		SUB-TOTAL		1133
		TAX		8
		TOTAL BALANCE DUE		\$ 1,141.

Please remit to: Veloce Motors West, 426 Petaluma Blvd. North, Petaluma, CA 94952-2873

K YOU FOR YOUR BUSINESS!