

PATRICK OTTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA 94710
BAR NO AK 120777

INVOICE NO.

8713

INVOICE

©1997 REDIFORM® 7L721

SOLD

ADDR

CITY

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CALIF SPY

SOLD BY:

4487

TERMS:

THANK YOU

F.O.B.

08217 VHS

DATE:

5 FEBRUARY 99

23 NOV.	1	CLEAN EXHAUST MANIFOLDS AND DOWN PIPES - PACK CAREFULLY & SHIP	
	2	FOR HIGH HEAT SATIN BLACK PAINT. ORGANIZE BAG MOTOR HARDWARE	
	3	4 PIECES	1.0
30 NOV.	4	CLEAN & FILE MOTOR GASKET SURFACES - CHAMFER STUD HOLES - BRUSH	
	5	OUT PASSAGES - CLEAN REMNR OLD SILICONE SEALER ETC.	1.0
3 DEC	6	RETRIEVE BLOCK - MAIN CAPS FROM NORMAN RACING - ORDER NEW	
	7	PISTONS FROM J.E. - MEASURE BORES	1.5
25 JAN	8	GLASS BEAD NEWLY RECEIVED CYLINDER HEADS FROM PANEUA. DELVRD	
	9	TO NORMAN RACING FOR INSPECTION & PRESSURE CHECK. BOX SHIP	
	10	1ST SET HEADS BACK TO PARTSOURCE.	1.5

PATRICK OTTIS

INVOICE NO.

8714

INVOICE

©1997 REDIFORM® 7L721

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CAUF SPY

SOLD BY:

4487

TERMS:

F.O.B.

08217 KHS

DATE:

5 FEB 99

4 FEB	1	DELIVER BLOCK WITH NEW J.E PISTONS AND TORQUE PLATE TO	
	2	WILMUT CREEK FOR CUL. BORING	1.0
	3	SHOP LABOY. TO DATE 6.0 HRS @ 70	420 ⁻
	4		
	5	ALUMINUM ENGINE ENAMEL	30 ⁻
	6	PAIR 250 CYLINER HEADS - IDENTICAL TO THOSE REMOVED IN VALVE	
	7	SIZE BUT NEVER DECKED AND REQUIRES NO WELDING (DOES NEED	
	8	VALVE SEATS) PANBUA	2400 ⁻
	9	PARTS TOTAL TO DATE	2430 ⁻
	10	TAX ON PARTS	200 ⁴³

PATRICK OTIS

INVOICE NO.

8715

INVOICE

©1997 REDIFORM® 7L721

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTR/CAUF SPY

SOLD BY:

4487

TERMS:

F.O.B.

08217 KMS

DATE:

5 FEB 99

SUBJECT	1	STRIP, BRAD, PREP HIGH HEAT PAINT & EXHAUST MANIFOLDS & 2 EXH	
	2	DOWN PIPES SATIN BLACK. - IN OUT INCL SHIP INS. HPC UTAH	488 ⁷⁵
SUBJECT	3	INSTALL 60MM BAR IN CRANK BORE - MEASURE ASSURE BOTH BLOCK	
	4	DECK HEIGHTS PROPER - NORMAN RACING	75 ⁰⁰
SUBJECT	5	PLATE IN NICKLE AS ORIG WATER PIPE FROM BACK OF HEADS ELECTROFORM	50 ⁻
SUBJECT	6	CRANKSHAFT - MAGNAFLUX - JOURNALS VERY SCRATCHED - GRIND	
	7	OIO/OIO REHNE PUGS - CLEAN TRAPS ETC SAMMY HALE	756 ⁻
	8		
	9		
	10	SUBJECT TOTAL TO DATE	1369 ⁷⁵

PATRICK OTTIS

INVOICE NO.

8716

INVOICE

©1997 REDIFORM® 7L721

SOLD TO:

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

2506TE/CAUFSPY

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

1			
2	SHIP EXHAUST MANIFOLDS & DOWN PIPES TO UTAH W/ INS.		25"
3	SHIP PISTON SAMPLE TO J.F. W/ INS.		15"
4	SHIPPING CHARGES - 2 CYLINDER HEADS FROM MAINE FOR INSPECTION		38"
5	SHIPPING RETURN SHIPPING W/ INS. ON CYL HEADS TO MAINE		40"
6			
7	SHIPPING TOTAL		118"
8			
9			
10	JOB TOTAL TO DATE		4538 ²²

PP
2/9/99
CK 2773

PATRICK OTTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA, 94710
BAR NO AK 120777

INVOICE NO. 1

8817

INVOICE

©1997 REDIFORM® 7L721

SO

AD

CIT

CUSTOMER'S ORDER

2506TE/CALIF SPY

SOLD BY:

4487

TERMS:

THANK YOU

F.O.B.

08217 KMS

DATE:

8 APRIL 99

22 FEB	1	RETRIEVE BLOCK WITH PISTONS FROM WALNUT CREEK. ORGANIZE	
	2	CATCH AND FLY WHEEL FASTENERS - DELIVER WITH CRANK	
	3	RODS AND PISTONS FORZ ROD BUSHING & SIZING AND BALANCE 2.0	
25 MAR	4	RETRIEVE ENGINE BALANCE - RODS ETC.	NO CHARGE
2 APRIL	5	FIT BLOCK INTO MOTOR STAND	.5
	6	SHOP LABOYZ TO DATE 2.5 HRS @ 70	175 ⁰⁰
	7		
	8	J.E PISTON SET. SPECIAL ORDER. INCL PINS - PISTON RINGS	2022 ³⁰
	9	12 PISTON ROD BUSHINGS @ 19 ⁹⁵	239 ⁴⁰
	10	TIMING CHAIN 22110	230 ⁻

PATRICK OTTIS

INVOICE NO. 2

8818

INVOICE

©1997 REDIFORM® 7L721

SOLD

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

2506TE/CAL SPY

SOLD BY:

4487

TERMS:

THANK YOU

F.O.B.

08217 KMS

DATE:

8 APRIL 99

1	MAIN BEARING SET STD 99181122			875 ⁰⁰
2	ROD BEARING SET STD 9514000			790 ⁰⁰
3	THRUST BEARING SET STD. 100146			23 ⁸⁰
4	24 VALVE GUIDES 160413 @ 15 ⁰⁰			360 ⁰⁰
5	24 VALVE GUIDE STEM SEALS 1221434 @ 4 ⁰⁰			96 ⁰⁰
6	12 INTAKE VALVES 17694 34x97 @ 85 ⁰⁰			1020
7	12 EXHAUST VALVES 17695 29.5x95 @ 85 ⁰⁰			1020
8	GASKET SET 2506T 95100112			585
9	2 GERMAN HEAD GASKETS (WELL SUPERIOR) 10889 @ 295			590 ⁰⁰
10				

PATRICK OTTIS

INVOICE NO. 3

8819

INVOICE

©1997 REDIFORM® 7L721

SOLD TO: [REDACTED]

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER 2506TE/CAL SPY	SOLD BY: 4487	TERMS:	F.O.B. 08217 KHS	DATE: 8 APRIL 99
------------------------------------	------------------	--------	---------------------	---------------------

	1	PARTS TOTAL TO DATE		7851 ⁵⁰
	2	TAX ON PARTS @ 8.25%		647 ⁷⁴
SUBJECT	3	(REFUND) ON CRANKSHAFT REPAIR MIXUP FURNAS CRANK WAS		
	4	MAGNAFLUXED, POLISHED, REMOVED PLUGS CLEAN TRAPS - SAMMY		
	5	HALE @ COST OF 325 ⁰⁰		(431)
SUBJECT	6	MEASURED PISTONS - INSTALL TORQUE PLATE - BORE BLOCK TO SIZE		
	7	WITH SPECIAL FINISH (WITH IN .0002 TAPER/ OUT OF ROUND, FIT		
	8	ALL PINS TO PISTONS @ .0001.) SCRUB WITH HOT SOAP AND WATER		
	9	FINAL CLEAN BLOCK / PISTONS - MORGAN MACHINE		750 ⁰⁰
	10			

PATRICK OTTIS

INVOICE NO.

4

8820

INVOICE

©1997 REDIFORM® 7L721

SOLD

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CAL SPY

SOLD BY:

4487

TERMS:

F.O.B.

08217 KMS

DATE:

8 APRIL 99

	1			
SUBJECT	2	BORE SMALL ENDS OF PISTON RODS TO ACCEPT ROD BUSHES-HASSEL	350 ⁰⁰	
SUBJECT	3	RODS BORED TO EXACT LENGTH - 12 EACH INCLUDES RESIZING AND		
	4	REBUSHING - HASSELGREN RACING	520 ⁰⁰	
SUBJECT	5	PIN FLYWHEEL AND CLUTCH ASSEMBLY TO ASSURE POSITIVE		
	6	ALIGNMENT AND TO RETAIN BALANCE - HASSELGREN	40	
SUBJECT	7	BALANCE MTR ASSY - FLYWHEEL CLUTCH RODS PISTONS-HASSEL	300 ⁰⁰	
	8			
	9			
	10	JOB TOTAL TO DATE		10,203 ²⁴

PAID
4/15/99
CVC 3039

PATRICK OTTIS
1220 TENTH STREET
BERKELEY, CALIFORNIA, 94710
BAR NO AK 120777

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO. 1.

1301 (10518)

SOLD TO	[REDACTED]
ADDRESS	[REDACTED]
CITY	[REDACTED]

CUSTOMER'S ORDER	SOLD BY:	TERMS:	F.O.B.	DATE:
250 GTR/CALIF SPY	4487	THANK YOU	08217 KMS	29 JUNE 99

26 APRIL	1	CHECK, MEASURE CRANKSHAFT. CHECK	WEIGH	PISTONS, RODS
	2	WASH CLEAN PREPARE CRANK, PISTONS	RODS AND RINGS	
	3	PREPARE ALL FOR ASSEMBLY		5.5
27 APRIL	4	REMOVE, TAP, REHEUCOLL # 3 INLET MANIFOLD STUD IN		
	5	BLOCK. REMOVE ALL CYLINDER HEAD STUDS (FINGER TIGHT)		
	6	TAP, CLEAN HOLES, REINSTALL STUDS WITH RED LOCKTITE		
	7	BACK INTO BLOCK. GUN BRUSH CLEAN BLOCK OIL GALVEYS.		
	8	CHECK ADJUST PISTON RING GAPS IN CYLINDERS - DESIGNATE		
	9	TO BORES, CHECK CYLINDER HEAD STUD THREADS. CLEAN		
	10	PREPARE BLOCK DECK SURFACES, SUMP GASKET SURFACES		

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1302

2.

SOLD TO:

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

2506 TR/CAUF SPY

SOLD BY:

4487

TERMS:

F.O.B.

00217 KHS

DATE:

29 JUNE 89

	1	AND TIMING CASE GASKET SURFACE ON BLOCK.	7.0
28 APR	2	CLEAN MAIN BEARING CAPS, CLEAN MAIN BEARINGS, INSTALL	
	3	UPPER BRNG INSERTS, FINAL CLEAN CRANKSHAFT - INSTALL	
	4	INTO BLOCK WITH THRUST BEARINGS - INSTALL CAPS WITH	
	5	BEARING) - TORQUE. - CENTER MAIN STUDS PUL OUT OF	
	6	BLOCK. DISASSEMBLE - HELICOIL REPAIR PULLED STUDS.	
	7	REASSEMBLE ALL TORQUE ALL. INSTALL REAR CAP WITH	
	8	OILING SEALS. MACHINE NEW FLYWHEEL BOOTS WITH REDUCED	
	9	HEADS - ASSEMBLE INSTALL FLYWHEEL TO CRANK & TORQUE 6.5	
29 APR	10	ASSEMBLE ALL PISTONS TO RODS - INSTALL AND START LOCKS	

PATRICK OTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO. 3.

1303

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTR/CALIF SPY

SOLD BY:

4487

TERMS:

F.O.B.

08217 KMS

DATE:

29 JUNE 99

	1	AT PINS. INSTALL PISTON RINGS TO PISTONS - THESE ASSEMBLERS	
	2	INTO CRANKCASE. - LUBE RINGS WITH 30WT NON DETERGENT.	
	3	WASH ROD BRNGS - INSTALL & TORQUE. INSTALL OIL GAUGE	
	4	PWGS - SAFETY WIRE	6.0
3 MAY	5	CLEAN CYLINDER HEADS - MARK REQUIRED CAM COVER MOUNTING	
	6	STUD HOLES - NEW HEADS - WITH ORIGINAL CAM COVER. DEWDR	
	7	TO NORMAN POZ. STUD MODIFICATION - WELD & SURFACE	1.0
4 MAY	8	CLEAN TIMING CASE AND ACCESSORIES THAT ATTACH TO IT.	
	9	INSTALL REMOVED CRANKCASE STUDS. CLEAN LUBRICATE ASSEMBLE	
	10	OIL PUMP TO TIMING CASE WITH OUTER COVER AND GASKET.	

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1304

A.

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTR/CAUF SPY

SOLD BY:

4487

TERMS:

F.O.B.

08217 KHS

DATE:

29 JUNE 99

	1	CLEAN LUBRICATE. INSTALL CATCH ASSEMBLY, PILOT BEARING	
	2	TO FLYWHEEL.	6.0
5 MAY	3	CONTINUE WITH TIMING CASE ASSY AND DRIVEN ACCESSORIES.	
	4	INSTALL TIMING CASE WITH NEW CHAIN TO CRANKCASE. INSTALL CHAIN	
	5	TENSIONER. ASSEMBLE WATER PUMP TO COVER. INSTALL OIL PUMP	
	6	HOUSING. CLEAN MOTOR. SUMP CASTING - INSTALL TO MOTOR. CLEAN	
	7	INSTALL WINDAGE TRAYS - INSTALL SUMP COVER. CLEAN INSTALL	
	8	OIL TEMP SEND UNIT - DRAIN PLUG - SAFETY WIRE.	8.5
6 MAY	9	CLEAN, SEAL INSTALL OIL PRESSURE RELIEF VALVE AND COMPONENTS	
	10	INTO OIL FILTER HOUSING. INSTALL GENERATOR DRIVE PULLEY	

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO. 5.

1305

SOLD TO: [REDACTED]
ADDRESS:
CITY, STATE, ZIP

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER 2506TTC/CAL SPY	SOLD BY: 4487	TERMS:	F.O.B. 08217 KHS	DATE: 29 JUNE 99
-------------------------------------	------------------	--------	---------------------	---------------------

	1	AND KEY ONTO SHAFT	1.0
11 MAY	2	LAY OUT INSTALL ORIG CAM COVERS ON NEW CYLINDRZ HEADS, DRILL	
	3	TAP NEW STUD HOLES IN CYLINDRZ HEADS (RELOCATION) WASH	
	4	HEADS THOROUGHLY - HEAT - PAINT PREPARE FOR ASSY	5.0
15 MAY	5	CLEAN CAREFULLY ALL CYLINDRZ HEAD PARTS - VALVES, SPRINGS,	
	6	RETAINERS ETC AND ASSEMBLE ALL. GUN BRUSH CAMSHAFTS. CURR	
	7	ROCKERS - REMOVE ADJUSTING SCREWS. CHECK VALVE TO VALVE	
	8	CLEANER @ OVERLAP - MEASURE COMBUSTION CHAMBRZ VOL. 7.0	
17 MAY	9	MEASURE PISTON PROTRUSION - CHAMBRZ DEPTH & PISTON CROWN ETC	
	10	INSTALL CYLINDRZ HEADS - O-RINGS ETC TORQUE. INSTALL CAMSHAFTS	

PATRICK OTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1306

6.

SOLD TO	
ADDRESS	
CITY, STATE, ZIP	

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER 250 GTR/CAL SPY	SOLD BY: 4487	TERMS:	F.O.B. 08217 KHS	DATE: 29 JUNE 99
-------------------------------------	------------------	--------	---------------------	---------------------

	1	WITH ROCKER SHY ASSYS - TORQUE. ADJUST VALVES - CHECK CAM	
	2	TIMING. ADJUST CHAIN TENSION.	6.5
18 MAY	3	FINAL TIME CAMSHAFTS - RESET VALVES. MACHINE NEW LEFT SIDE	
	4	CAM DRIVE GEAR BOOTS AND INSTALL WITH END PLATE. ASSEMBLE.	
	5	IGN. DIST. ANGLE DRIVES AND TIME TO CAMS (ANGLE DRIVES HAVE	
	6	ALL NEW SEALS - O-RINGS. WIRE BRUSH CAM COVER STUDS FOR	
	7	THREAD REPAIR & INSTALLATION	5.0
19 MAY	8	CONTINUE WITH CAM COVER STUDS - DIE NOT ALL THREADS & INSTALL	
	9	STUDS TO CYLINDER HEADS. CUT GASKEI - INSTALL ASSEMBLY FOR	
	10	PUMP DRIVE. CLEAN CHAIN & CAM COVERS - INSTALL TO CYLINDER	

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1307^{7.}

SOLD

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CAL SPY

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

29 JUNE 99

	1	HEADS - CUTTING AND FITTING NEW CAM ENVRN GASKETS. CHECK INTAKE	
	2	MANIFOLDS AS SUPPLIED WITH MOTOR & NOTE THEY HAVE BEEN	
	3	MACHINED TO FIT VALVE OF PREVIOUSLY VERY 'MACHINED' HEADS 6.0	
21 MAY	4	REPAIR AND FIT WATER PIPE AT REAR OF CYLINDER HEADS - CUT	
	5	NEW GASKETS - FINAL INSTALL PIPE, MANUFACTURE INSTALL PROPER	
	6	"THU" NUTS ON DIRT ANGLE DRWRS AS ORIGINAL. ROTATE MOTOR	
	7	INSTAND SUCH THAT WE CAN FUL CHAMBER - CALCULATE COMPRESSION	
	8	RATIO 10.65 TO 1. RETURN INTAKE MANIFOLD FROM CYLINDER -	
	9	DRWWR TO NORMAN RACING FOR WRID MODIFICATION.	6.5
26 MAY	10	RETRIEVE MANIFOLDS, INSTALL WITH O-RINGS TO CYL HEADS, COAT	

PATRICK OTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1308 8.

SOLD TO	[REDACTED]
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER 2506TE/CAL SPY	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 29 JUNE 99
------------------------------------	------------------	--------	--------	---------------------

	1	WOT PRUSSIAN BWE - MEASURE PORT DIA IN HEADS - RETURN	
	2	MANIFOLDS TO NORMAN FOR PORTING.	1.5
27 MAY	3	CLEAN, GRASS BRAD, PAINT MANIFOLDS - INSTALL TO ENGINE.	STRAP
	4	LIFT MOTOR - INSTALL INTO CHASSIS WITH GEARBOX - SCOTT	4.5
	5	INSTALL MOTOR - GEARBOX INTO CHASSIS - PETE	2.0
28 MAY	6	INSTALL STARTER MOTOR WITH LEADS - SECURE ALL MOTOR MOUNT	
	7	HARDWARE	1.5
1 JUNE	8	INSTALL GENERATOR AND BRACKET, NEW PB 50 BYPASS PULVER	
	9	AND LINES TO IT (WASH & BLOW OUT FIRST) - FAN, BELT, & TENSION	
	10	CHECK WATER PUMP - SEND FOR MODIFICATION (POORLY MADE AS	

PATRICK OTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1309

a.

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

2506TR/CAL.SPY

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

29 JUNE 99

	1	RECEIVED)	INSTALL NEW CARBS TO MANIFOLD GASKETS - BLOCKS - CARBS	
	2	TO MANIFOLDS - FUEL LINES TO CARBS.		4.0
2 JUNE	3	MODIFY EXH. MANIFOLD FLANGES AT CYLINDER HEADS (NEW HEADS)		
	4	AND INSTALL WITH STARTER HEAT SHIELD. DRILL AND WELDCOIL REPAIR		
	5	ALL HEAT SHIELD STANTIONS ON EXH MANIFOLDS. CHECK FIT OF WATER		
	6	PIPE @ FRONT OF MOTOR AFTER NORMAN MODIFICATION. CLEAN		
	7	LUBRICATE. INSTALL DRIVESHAF, U. JOINT. LUBRICATE & SAFETY WIRE		
	8	INSTALL IGNITION DISTRIBUTORS, CARBURATOR, LINKAGES, THROTTLE		
	9	CABLE - SCOTT		8.5
	10	ASSIST WITH MODIFICATION OF EXHAUST MANIFOLDS. PETER		1.0

PATRICK OTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1310 10.

SOLD	[REDACTED]
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER 250 GTR/CAL SPY	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 29 JUNE 99
-------------------------------------	------------------	--------	--------	---------------------

3 JUNE	1	INSTALL EXH. HEAT SHIELDS - SECURE COTTER PIN DRIVESHAFT DONUTS	
	2	HDWRZ. GLASS BEAD WRINKLE FINISH NEWLY MODIFIED WATER PIPE.	
	3	INSTALL ^{CUT FIT} WATER NEW WATER HOSES. INSTALL PAN SWITCH. CONTROL	
	4	GENERATOR. INSTALL CRANK CASE. FILLER BREATHER PIPINGS -	
	5	FILL MOTOR WITH OIL, FILL WITH WATER RICE	5.5
7 JUNE	6	GAP INSTALL NEW SPARK PLUGS. REPLACE PLUG WIRE ENDS WITH	
	7	NICKER 'BOSCH' ENDS. INSTALL 16N WIRES & CAPS TO MOTOR. STARTER	
	8	TIME IGNITION DISTS.	3.0
8 JUNE	9	INSTALL NEWLY WRINKLED WATER PIPE, HOSES, HEATER HOSES,	
	10	BY PASS HOSE. CONTROL PAN SWITCH LEADS. FUEL FEED LINES TO	

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1311

SOLD

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CAMP SPY

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

29 JUNE 99

1	PUMP - PROPER HOSE CAMPS ON WATER HOSES ETC. FUL COOLING	
2	SYSTEM - RETRIEVE FURL, PRIME PUMP, START RUN MOTOR.	
3	SEVERAL FURL HOLES LEAK - REMOVE DISASSEMBLE - REASSEMBLE	
4	REPAIR WITH LOTITE 518 SEALANT. INSTALL ALL REPAIRED INTERIOR	
5	PARK BRACE - SEATS - ALL REPAIRED.	8.5
6	RUNNING OF MOTOR REVEALS SLIGHT KNOCKING OR	
7	RATTLING INSIDE MOTOR. UNBOLT REMOVE CAM COVERS/	
8	CYLINDRICAL HEADS FOR INSPECTION. NOTE SLIGHTEST WITNESS	
9	MARKS FROM PISTON CROWN IN COMBUSTION CHAMBERS (THREE	
10	CYLINDERS) DISASSEMBLE CYLINDRICAL HEADS COMPLETE FOR	

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1312 12.

SOLD TO:

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CAUF SPY

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

29 JUNE 99

	1	MACHINING OF CHAMBERS FOR PISTON CLEARANCE	
	2	ALL DISASSEMBLY OF MOTOR & EXH ETC. NO CHARGE	
11 JUNE	3	UNBOLT REMNR RADIATOR FOR REPAIR - DISASSEMBLE REMNR	
	4	SHADR W/FRAME ETC - DELIVER TO RADIATOR SHOP	2.0
17 JUNE	5	PREP PAINT RADIATOR SATIN BLACK POLYURETHANE	1.0
21 JUNE	6	INSTALL RADIATOR, CONNECT ALL - FILL W/ COOLANT. START RUN	
	7	MOTOR, ADJUST IGNITION TIMING, ADJUST CARBURATION. ROAD	
	8	TEST TO SAN RAFAEL BRIDGE SEVERAL TIMES	3.5
22 JUNE	9	REMR EXH. HEAT SHIELDS - TIGHTEN EXH HEADERS - REPAIR STRIPPED	
	10	STUD - REINSTALL ALL - ROAD TEST AGAIN	2.0

PATRICK OTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

13.

1313

SOLD TO	[REDACTED]
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:	
ADDRESS:	
CITY, STATE, ZIP	

CUSTOMER'S ORDER 250 GTR/CAL	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 29 JUNE 89
---------------------------------	------------------	--------	--------	---------------------

23 JUNE	1	REMOVE IGNITION WIRES - CAM COVERS AND RELATED FOR CYLINDER	
	2	HEAD RETORQUE/VALVE ADJ.	1.0
24 JUNE	3	RETORQUE CYLINDER HEADS. CHECK ASSURE ALL VALVE CLEARANCES	
	4	CORRECT. REASSEMBLE CAM COVERS, LINKAGES, HEAT SHIELDS -	
	5	WITH NEW BLACK BODY WASHERS AS ORG ETC. INSTALL HOOD, AIR	
	6	BOX, BEZEL PAN, RUN - CHECK ALL FOR LEAKS. REMOVE	
	7	FRONT ROAD WHEELS - CHECK FOR SQUEAKING WHILE CAR IS	
	8	'BACKED' REMOVE CHAMFER EDGES OF BRAKE PADS - ADD SPRING	
	9	TRANSIN TO PAD RETAINERS - REASSEMBLE ALL - TEST	6.0
25 JUNE	10	DRIVER CAR TO MOALS FOR HEAD LAMP SURROUNDS	1.0

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1314

14.

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CAL

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

29 JUNE 99

29 JUNE	1	RETRIEVE CAR FROM MOALS - REMOVE BEAM PAN - ADJUST		
	2	CATCH - HAVE CAR WASHED - FINISH	✓	1.5
	3	SHOP LABOR 135.5 HRS @ 70	✓	9485 ⁰⁰
	4			
	5	NEW MOTOR HOWIE		30 ⁻
	6	WATER PUMP SEAL 95850601		45 ⁶¹
	7	2 DIST ANGLE DRIVE SEALS 101137 274110 @ 38 ⁹⁰		77 ⁸⁰
	8	TACH DRIVE SEALS 12 227		12 ⁰⁰
	9	24 VAWR SCREWS 17880 @ 11 ⁵⁰		276 ⁰⁰
	10	24 VAWR STEM SEALS 119766 @ 4 ⁸⁰		115 ²⁰

PATRICK OTT

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1315

15.

SOLD TO	[REDACTED]
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:	
ADDRESS:	
CITY, STATE, ZIP	

CUSTOMER'S ORDER 250 GTE/CAL	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 29 JUNE 99
---------------------------------	------------------	--------	--------	---------------------

1	24 VALVE SEATS - INTAKE AND EXHAUST @ 16 ⁰⁰	384 ⁰⁰
2	12 BOSCH PLUG WIRE ENDS 0356 100 014 @ 4 ⁵⁰	54 ⁰⁰
3	12 NGK B6ES SPARK PLUGS @ 3 ⁰⁰	36 ⁰⁰
4	20 7MM BRASS EXHAUST MANIFOLD NUTS @ 50¢	10 ⁰⁰
5	1 1/8, 1 1/4 inch WATER HOSE	30 ⁰⁰
6	12 JUBILEE HOSE CLAMPS @ 6 ⁰⁰	78 ⁰⁰
7	2 GALLONS ANTIFREEZE @ 7 ⁹⁵	15 ⁹⁰
8	4 EXH DOWN PIPE FLANGE GASKETS 20268 @ 10 ⁵⁰	42 ⁰⁰
9	12 EXH HEADER TO CYL HEAD GASKETS 17454 @ 10 ⁵⁰	126 ⁰⁰
10	WRINKLE FINISH FOR WATER PIPE	8 ⁰⁰

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

INVOICE NO.

1316

✓

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 6TH/CAL SPY

SOLD BY:

4487

TERMS:

F.O.B.

08217 KMS

DATE:

29 JUNE 99

1	RUSTOLEUM SATIN BLACK PAINT PRZ RADIATOR		8 ⁻
2	10 QTS KENDALL GT-1 20/50 MOTOR OIL @ 3 ⁰⁰		30 ⁻
3	FRAM PB-50 OIL FILTER		10 ⁻
4	FRAM PH-2815 OIL FILTER		18 ⁹⁵
5	2ND MOTOR GASKET SET \$580	NO CHARGE	
6	PARTS TOTAL	✓	1407 ⁴⁶
7	TAX ON PARTS		116 ¹¹
8			
SUBJECT	9 WELD FILL CAM COVER STUD HOLES IN BOTH CYLINDER HEADS AND		
10	SURFACE CYL HEAD/CAM COVER MATING SURFACE - NORMAN R.		180 ⁻

PATRICK OTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

INVOICE NO.

1317

SOLD TO:	[REDACTED]
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:	
ADDRESS:	
CITY, STATE, ZIP	

CUSTOMER'S ORDER	SOLD BY:	TERMS:	F.O.B.	DATE:
250 GTR/CAVR SPY	4487		08217 KHS	29 JUNE 99

SUBURT	1	RECORE REBUILD RADIATOR - BERKELEY RADIATOR	700~
SUBURT	2	MODIFY WATER PIPE AT FRONT OF MOTOR - NORMAN RACING	60~
SUBURT	3	AUM. WELD ADD 1/8" SURFACE TO WATER MANIFOLD IN VALVE	
	4	OF MOTOR - NORMAN RACING	120~
SUBURT	5	AUM WELD ADD 1/8" SURFACE TO INTAKE MANIFOLD & PORT	
	6	CYLINDER HEADS - NORMAN RACING	600~
SUBURT	7	MACHINE INSIDES OF BOTH CAM COVERS TO CLEAR ROCKER	
	8	ROCKER ASSSEMBLYS NORMAN RACING	150~
SUBURT	9	MACHINE COMBUSTION CHAMBERS OF BOTH CYLINDER HEADS	
	10	FOR PISTON CLEANER - NORMAN RACING	180~

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

1318 18.

APD
C129199
SW 3/16
JF

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CAUF SPY

SOLD BY:

4487

TERMS:

F.O.B.

08217 KMS

DATE:

29 JUNE 99

SUBJECT	1	INSPECT AND REJECT TWO SETS OF CYLINDER HEADS. REMOVE	
	2	VALVE SEATS FROM THIRD SET. REMACHINE SEAT BORES TO TRUE	
	3	INSTALL NEW SEATS AND MATCH TO PORTS AND CHAMBERS. REMOVE	
	4	AND REPLACE GUIDES AND FIT TO VALVE STEMS. CUT RADIUS	
	5	AND LAP VALVE SEATS SETTING VALVE HEIGHTS. FIT ORIGINAL	
	6	CAM CAPS TO REPLACEMENT HEADS - NORMAN RACING	3220"
SUBJECT	7	PRESSURE CHECK THREE SETS CYLINDER HEADS - TITO'S	100"
	8	92 OCTANE FUEL - 18" + 32"	50"
	9	WASH DETAIL CAR	NO CHARGE
	10	JOB TOTAL	16368 ⁵⁷

PATRICK OTTUS

1720 TENTH STREET

BERKELEY, CALIFORNIA, 94710

BAR NO AK 120777

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6561

SO

AD

CI

CUSTOMER'S ORDER

250 GTE/CALIF SPY

SOLD BY:

4487

TERMS:

THANK YOU

F.O.B.

08888 KHS

DATE:

17 AUGUST 99

6 AUG	1	REMOVE IGNITION AND CAM COVERS ET AL	NO CHARGE
9 AUG	2	RETORQUE CYLINDER HEADS, CHECK ADJUST ALL VALVE CLEAR.	
	3	CHECK TENSION TIMING CHAIN - REASSEMBLE CAM ENDS - NO CHARGE	
10 AUG	4	REMOVE BELLY PAN, CHECK ADJ. CATCH - READJUST CATCH	
	5	LINKAGE ARMS	NO CHARGE
	6	INSTALL NEW DOWN DRAFT HOSES WITH ORIGINAL CLAMPS, REMOVE	
	7	ROAD WHEELS - REMOVE REPLACE FRONT REAR BRAKE PADS.	
	8	REASSEMBLE ALL - ROAD TEST - NO OIL LEAKS	3.5
12 AUG	9	DRAIN ENGINE COOLANT - DISASSEMBLE WATER PUMP FOR INSPECTION	
	10	REPLACE IMPURER BACKING - REASSEMBLE RUN & CHECK. NO CHARGE.	

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6562

SOL

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTE/CALSPY

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

17 AUG 99

13 AUG	1	REMOVE DRIVER DOOR PANEL, HANDLES ETC. TO ACCESS TOP WINDOW	
	2	CHANNEL "BRUSH". DRILL SCREWS AFFIX INITIAL CHANNEL	
	3	(WAS WEATHERSTRIP GLUED) MAKE WINDOW STOP SO THAT GLASS	
	4	CANNOT GO LOWER THAN BRUSH. REASSEMBLE ALL. REMOVE	
	5	REPLACE PREVIOUSLY GLUED LEFT DEF. VENT	2.5
	6	SHOP LABOR. 6.0 HRS @ 70	420 ⁻
	7	ADJUST LEFT TAILPIPE ANGLE TO MATCH RIGHT	NO CHARGE
	8	6 FT INCH CURVE DOWN DRAFT TUBE	10 ⁻
	9	2 ORIGINAL CHENEY CLAMPS FOR DOWN DRAFT TUBE @ 25 ⁰⁰	50 ⁻
	10	DEFROSTER VENT 20402905	42 ⁵⁰

PATRICK

©1998 REDIPOLY

SOLD BY: [REDACTED]

ADDRESS: [REDACTED]

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER: 750 GTR/CALIF SPY

SOLD BY: 4487

TERMS:

F.O.B.

DATE: 17 AUG 99

1	FRONT GIRLING BRACE PADS GP-53	PO 8/18/99	126 ²⁰
2	REAR GIRLING BRACE PADS GP-52		46 ⁵⁰
3	WATER PUMP IMPROVED BACKING 26644		80 ³¹
4	WATER PUMP LOCK TAB 101434		2 ³¹
5	WATER PUMP NUT 101436		3 ⁸⁷
6	PARTS TOTAL 361 ⁶⁹	TAX ON PARTS	29 ⁸³
7			6 ⁵⁰
8	92 OCTANE FUEL		
9	WASH DETAIL CAR.	NO CHARGE	
10		JOB TOTAL	818 ⁰²

PATRICK OTTIS

1220 TENTH STREET

BERKELEY, CALIFORNIA, 94710

BAR NO AK 120777

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6878

PD
1/25/2000
CX 2329

SOL

ADD

CITY

CUSTOMER'S ORDER

250 GTE/CALIF SPY

SOLD BY:

4487

TERMS:

THANK YOU

F.O.B.

09425 KHS

DATE:

17 JANUARY 00

13 DEC

- 1 CHECK ADJUST TIRE PRESSURES TO 32lb. CHECK FILL BATTERIES
- 2 WITH WATER AND CHARGE. CHECK FLUID LEVELS, PRIME
- 3 CARBURETORS WITH FUEL - START RUN MOTOR. CHECK ALL FOR
- 4 LEAKS. PUT CAR IN AIR, NOTE FUEL DRIPPING FROM MAIN
- 5 SUPPLY HAND LINE ALONG CHASSIS FOR MECHANICAL PUMP. LOSEN
- 6 SEPARATE LINE FROM CHASSIS AND SOLDER REPAIR LEAK AT BUNG.
- 7 REMOVE BROW PAN, CHECK ALL FOR LEAKS. INVESTIGATE NON-OP
- 8 ELECTRIC FUEL PUMP. REMOVE PUMP, DISASSEMBLE. NOTE BROKEN
- 9 POINT SUPPORT BLOCK. REMOVE REPAIRER WITH LAST KNOWN ORIGINAL!
- 10 ASSEMBLE & CHECK OPERATION. NOTE THIS FUEL PUMP FAILURE

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6879

SOLD TO	[REDACTED]
ADDRESS:	
CITY, STATE, ZIP	

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER 250 GTR/CAMF	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 17 JAN 00
----------------------------------	------------------	--------	--------	--------------------

	1	ALSO CAUSED BLOWN FUSE - REPAIR FUSE		6.0
3 JAN	2	PREPARE TO DELIVER CAR TO MUFFLER SHOP FOR RESONATOR		
	3	REPLACEMENT - NOTE MOTOR CRANKS, BUT MOTOR WON'T START		
	4	LOAD TEST BATTERY - NOTE INSUFFICIENT VOLTAGE TO RUN MOTOR.		
	5	FIT SHOP BATTERY - RUN - DELIVER CAR TO ELECTRICIAN		1.5
4 JAN	6	RETRIEVE CAR FROM MUFFLER SHOP - DELIVER TO NORMAN RACING		
	7	FOR BATT CUT OFF SWITCH MOUNT FABRICATION		1.0
5 JAN	8	RETRIEVE CAR FROM NORMAN RACING. REMOVE CLEAN LUBRICATE		
	9	HOOD STAY. INSPECT NOTE MOTOR NUMBER 3635 HAS INTERNAL		
	10	NUMBER 572 E. REMOVE WINDSHIELD WIPER SWITCH. SKETCH		

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6880

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTR/CAMF

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

17 JAN 00

	1	FAX ATTEMPT LOCATING ANOTHER SWITCH.	1.5
14 JAN	2	GLASS BEAD PAINT SATIN BLACK NEWLY FABRICATED BATT. CUT	
	3	OFF BRACKET AND BATTERY HOLD DOWN. REMOVE SHOP BATTERY	
	4	& FIT APPROPRIATE NEW INTERSTATE - SECURE. DISASSEMBLE	
	5	INSPECT REPAIR WIPER SWITCH. ASSEMBLE INSTALL & CHECK	
	6	NOW AGAIN OK - 2 SPEEDS PWS PROPER PARK OPERATION. REMOVE	
	7	TUNNEL AND FLOOR CARPETS. LOCATE PLACE FOR MASTER CUT	
	8	OFF SWITCH INSTALLATION - PUNCH HOLES IN BULKHEAD FOR	
	9	BATTERY CABLES TO SWITCH FROM BATTERY	4.5
17 JAN	10	DRILL HOLES, INSTALL MASTER CUT OFF SWITCH BRACKET/PLATFORM	

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6881

SOLD TO:

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

ISO 670/CAUF

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

17 JAN 00

1	INSTALL MASTER SWITCH. CUT MAKE NEW BATTERY CABLES WITH		
2	PROPER ENDS — INSTALL WITH GROMMETS THROUGH A BULKHEAD.		
3	& CONNECT TO BATTERY. VACUUM, CURAN INSTALLATION DEBRI		
4	FROM INSIDE CAR. START RUN CAR, FUEL, DRIVE TO		
5	SAN RAFAEL BRIDGE & BACK. WITH MOTOR AT TEMPERATURE		
6	REPAIR AIR BOX - CHECK CARB SYNEH - ADJUST; PUT IDLE SPEED		
7	@ 900 RPM - REINSTALL AIR BOX		3.0
8			
9	SHOP LABOR 17.5 HRS @ 80		1400 ⁰⁰
10			

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6882

SOLD BY: [REDACTED]
ADDRESS:
CITY, STATE, ZIP

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER 250 GTE/CAUF	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 17 JAN 00
----------------------------------	------------------	--------	--------	--------------------

1	NEW ORIGINAL FISPA FUEL PUMP POINT MNT. BLOCK (UNOBTAINABLE)	250 ⁰⁰
2	RADIATOR CAR - TWO EAR. 101499	25 ⁸⁰
3	GROUP 41 (BLACK) BATTERY	75 ⁰⁰
4	#2 WELDING CABLE	17 ⁸⁶
5	4 BATTERY CABLE ENDS + HEAT SHRINK ETC.	15 ⁰⁰
6	COMPETITION STYLE BATTERY CUT OFF SWITCH	39 ⁹⁹
7	2 ANSA TAILPIPER FE 0227 & FE 0237 @ 600	1200 ⁰⁰
8		
9	PARTS TOTAL	1623 ⁶⁵
10	TAX ON PARTS	133 ⁹⁵

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6883

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTR/CAUF

SOLD BY:

4487

TERMS:

F.O.B.

DATE:

17 JAN 00

	1				
SUBJECT	2	FLAT BED TOW FROM SAN FRANCISCO - BETTS			217 ⁵⁰
SUBJECT	3	CUT WELD INSTALL NEW ANSA EXHAUST TIPS - MNR HANGERS			
	4	ON TIPS - TOUCH UP PAINT - MUFFLER WORKS			240 ⁰⁰
SUBJECT	5	FABRICATE MOUNTING PLATFORM BRACKET FOR BATTERY CUT			
	6	OFF SWITZER. FABRICATE BATTERY HOLDDOWN - NORMAN RAE.			180 ⁰⁰
	7	SUBJECT TOTAL			637 ⁵⁰
	8	92 OCTANE FUEL			20 ⁻
	9	WASH DETAIL CAR		NO CHARGE	
	10	JOB TOTAL			3815 ¹⁰

PATRICK OTT'S

1220 TENTH STREET

BERKELEY, CALIFORNIA 94710

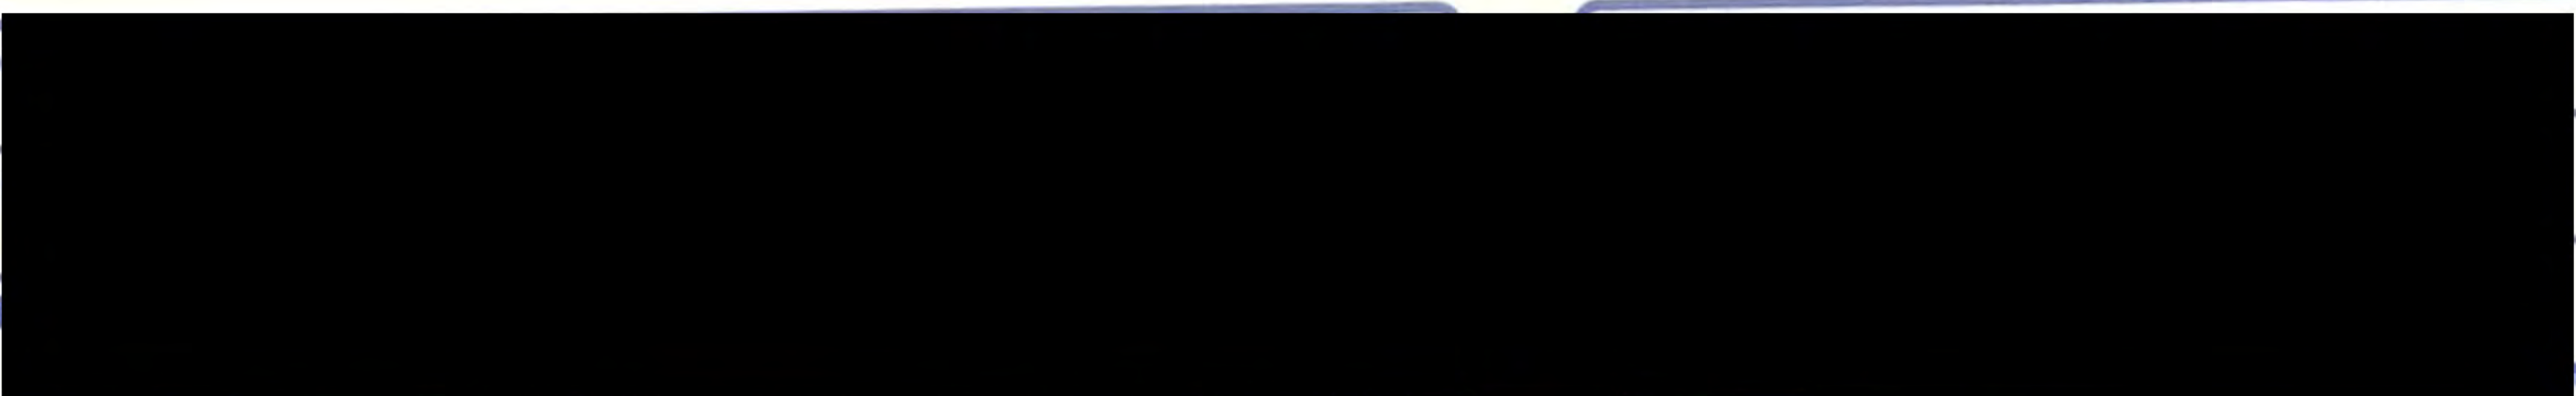
BAZ NO AK 120777

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

2251

SO	
AD	
CIT	

CUSTOMER'S ORDER 250 GTR / CAUF SPY	SOLD BY: 4487	TERMS: THANK YOU	F.O.B. 10246 KHS	DATE: 17 JULY 00
--	------------------	---------------------	---------------------	---------------------

22 JUNE	1	REMOVE, AND REMANUFACTURE NEW THROTTLE. INNER CABLE, REMOVE	
	2	AND REPLACE OUTER SHROUD - REINSTALL AND SOLDER END. REMOVE	
	3	SEEPING BYPASS OIL HOSE, DISASSEMBLE, INSPECT, REMAKE, INSTALL	
	4	RUN MOTOR & CHECK.	4.5
23 JUNE	5	DRILL AND HELICOIL 4 MOUNTING SCREWS FOR CRPT HEADLAMP PERISPRY	
	6	SURROUND - REFIT INSTALL SURROUND. REMOVE ROAD WHEELS - INVESTIGATE	
	7	CONTINUED SQUEAL ON LIGHT APPLICATION. REMOVE ALL BRAKE PADS,	
	8	REBOND 2 PAD BACKINGS TO PAD MATERIAL. SCUFF, DEGLAZE	
	9	ALL BRAKE ROTORS - INNER AND OUTER - REINSTALL PADS, READJUST	
	10	PAVIL BRAKE - INSTALL ROAD WHEELS - TORQUE NUTS, NOTE SEVERAL,	

PATRICK OILS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

2252

SOLD TO

ADDRESS

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 GTR/CAUF SPY

SOLD BY:

4487

TERMS:

F.O.B.

10246 KHS

DATE:

17 JULY 00

	1	RIVETS AT BOTTOM OF FUEL TANK LEAKING.			5.0
24 JUNE	2	CAR BACK IN AIR, DRAIN, STOP PROPERLY ALL FUEL FROM TANK			1.0
25 JUNE	3	UNBOLT REMOVED EXHAUST SYSTEM. REMOVED FUEL TANK, DISASSEMBLE			
	4	(SENDING UNIT, FILLER ETC.) TAKE TO CAR WASH FOR WASHING			
	5	AND PRELIMINARY DEFUMING FOR REPAIR.			2.0
27 JUNE/17 JULY	6	DRUMMER/REMOVED FUEL TANK TO HAYWARD FOR PAINT			1.0
27 JUNE/17 JULY	7	DRUMMER/REMOVED FUEL TANK TO BRUK RAD FOR REPAIR			1.0
15 JULY	8	ASSEMBLE FUEL TANK. (NEW GASKET FOR SENDING UNIT - NEW SPAL			
	9	RINGS ON PICK-UP PIPING / DRAIN PUG) CUT ORIGINAL STYLE CANVASS			
	10	MOUNTINGS - INSTALL NEWLY REPAIRED TANK BACK INTO CHASSIS			

Patrick Otis

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

2253

SOLD	
ADDR	
CITY, STATE, ZIP	

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER 250 GTR/CAUF SPY	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 17 JUL 90
--------------------------------------	------------------	--------	--------	--------------------

1	WITH NEW PROPER CLAMPS ON FULL HOSE BTE, UPON INSTALLATION OF		
2	EXHAUST SYSTEM, NOTE LEAKAGE AT TOP OF LEFT MUFFLER CAN. DRAWING		
3	TO NORMAN RACING FOR BRAZE REPAIR OF MUFFLER, PAINT TOUCH UP,		
4	INSTALL BOTH EXHAUST PIPES (DOWN PIPES TO REAR OF CAR) HANG SYSTEM		
5	WITH NEW 6MM HARDWARE TO INCLUDE MISSING ALUMINUM SPACERS BETWEEN		
6	STRAPS AS ORIGINAL, FULL WITH FUEL, RUN & CHECK ALL	4.5	
7	SHOP LABOR 19.0 HRS @ 80		1520"
8			
9	CABLE, HEAT SHRINK, ETC AL TO MAKE NEW THROTTLE CABLE		15"
10	14 INCHES BROWN WIRE. WRAPPED OIL HOSE @ 4 ⁵⁰ /IN		63"

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

2254

SOLD TO	
ADDRESS	
CITY, STATE, ZIP	

SHIP TO:	
ADDRESS:	
CITY, STATE, ZIP	

CUSTOMER'S ORDER 250 GTR/CAUF SPY	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 17 JULY 00
--------------------------------------	------------------	--------	--------	---------------------

1	2 PROPER FUEL FILL HOSE CLAMPS @ 3 ⁵⁰			7 ⁰⁰
2	NEW RUBBER FUEL SENDING UNIT TO TANK GASKET			5 ⁰⁰
3	CANVASS FUEL TANK MOUNTING MATERIAL			15 ⁰⁰
4	HARDWARE - FUEL TANK, EXHAUST SYSTEM, HELICOILS ETC	COPPER	SEAL RINGS	20 ⁰⁰
5	32 ALUMINUM EXHAUST SPACERS AS ORIG 104339 @ 2 ⁷⁵			88 ⁰⁰
6	FUEL TANK VENT HOSE			3 ⁰⁰
7	PARTS TOTAL			216 ⁰⁰
8	TAX ON PARTS			17 ⁸²
9				
10	92 OCTANE FUEL			7 ⁰⁰

Patrick Ottis

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

2255

SOLD TO:	[REDACTED]
ADDRESS:	[REDACTED]
CITY, STATE, ZIP	[REDACTED]

SHIP TO:	
ADDRESS:	
CITY, STATE, ZIP	

CUSTOMER'S ORDER 250 GTR/CAUR SP4	SOLD BY: 4487	TERMS:	F.O.B.	DATE: 17 JULY 00
--------------------------------------	------------------	--------	--------	---------------------

	1			
SUBJECT	2	DEFUME SOLDER, REPAIR ALL RIVET AREAS ON BOTTOM OF FUEL		
	3	TANK - HEAT TANK, REMOVE ALL PREVIOUS SEALANT IN TANK AND		
	4	REMOVE WITH NEW SEALANT - BERKLEY RADIATOR		450 ⁻
SUBJECT	5	SEAL GLASS BEAD, REMOVE ALL PAINT & SCALE FROM FUEL TANK		75 ⁻
SUBJECT	6	PRIME PAINT FUEL TANK, SATIN BLACK - PERFECT REFLECTIONS		225 ⁻
SUBJECT	7	BRAZE REPAIR LEFT MUFFLER CAN - TOP & REAR - NORMAN RAE		70 ⁻
	8	SUBJECT TOTAL		820 ⁻
	9	WASH DETAIL CAR		
	10			
			NO CHARGE	82 ⁻
				2580 ⁻

FOR
PAID

PATRICK OTIS
1720 TOWN STREET
BERKELEY, CALIFORNIA, 94710
BAZ NOAK 120777

INVOICE
©1998 REDIFORM® 7L721

INVOICE NO.

6714

(PD)

SALES	
ADDRESS	
CITY	

CUSTOMER'S ORDER 250 GTE/CAMF SPY	SOLD BY: 4487	TERMS: THANK YOU	F.O.B. 11394 KMS	DATE: 12 FEBRUARY 01
--------------------------------------	------------------	---------------------	---------------------	-------------------------

3 JANUARY	1	ROAD TEST CAR OUT TOWARDS SAN RAFAEL BRIDGE TO BRING MOTOR OIL TO
	2	TEMPERATURE. CAR IN AIR, DRAIN MOTOR OIL - REPLACE OIL FILTERS
	3	LUBRICATE CHASSIS AND INSPECT. CHECK COOLANT LEVEL - OK. PRESSURE
	4	CHECK COOLING SYSTEM AND RADIATOR CAP - OK. LOOSEN 4 WHEEL NUTS
	5	REMOVE REAR ROAD WHEELS. CHECK AGAIN CAUSE OF GREASE OIL LEAKAGE
	6	ONTO REAR ROAD WHEELS. CHECK DIFFERENTIAL OIL LEVEL - OK. CHECK FLOW
	7	THROUGH BOTH AXLE URNT PIPINGS - OK. INVESTIGATE PARK BRAKE OPERATIONS
	8	AND NOTE ACTUATING LEVER HITTING REAR AXLE BEFORE BRAKES ENGAGE.
	9	(THIS A RESULT OF REAR AXLE CONVERSION GTE TO CAL SPYDER). CHECK FUNCTION
	10	OF DRIVING LIGHTS - OK. REMOVE LEFT REAR BRAKE CALIPER, HUB

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6715

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER
250 CAMR SP4SOLD BY:
4487

TERMS:

F.O.B.
11394 KMSDATE:
12 FEBRUARY 01

	1	AND BRAKE ROTOR. REAR AXLE SEAL IS LEAKING. REMAIN LEFT REAR	
	2	SEAL HOUSING - INSPECT SEAL. NOTE SEAL RIDE ROUGH, CAUSING SEAL TO	
	3	LEAK? RIGHT SIDE SEAL RIDE PREVIOUSLY POLISHED. POLISH LEFT SEAL RIDE	
	4	IN WATER.	4.5
4 JAN	5	REPAIR AXLE SEAL WITH NEW STYLE SEAL. INSTALL HUB, BRAKE ROTOR. CLEAN	
	6	DEOIL BRAKE PADS. INSTALL BRAKE CALIPER, BUSH CALIPER. ATTACH	
	7	PARK BRAKE CABLE, ADJUST PARK BRAKE CALIPER. TORQUE COTTER PIN	
	8	HUB NUT. CLEAN POLISH INSIDE LEFT REAR ROAD WHEEL. DISASSEMBLE	
	9	RIGHT REAR WHEEL/CALIPER/HUB ASSEMBLY. INSPECT FOR CAUSE OF	
	10	OIL LEAK.	4.5

Patrick Otlis

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6716

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

750 CAUSE SP1

SOLD BY:

4489

TERMS:

F.O.B.

11394 VHS

DATE:

12 FEB 01

5 JAN.

1 REMOVE SEAL HOUSING FROM AXLE, INSPECT. REPLACE SEAL WITH NEW STYLE
2 SEAL TRIMMING OUTER LIP OFF OF SEAL IN HOPES OF ELIMINATING SEAL DISTORTION
3 FROM INNER LIP HITTING INSIDE OF HUB. INSTALL WITH SEAL HOUSING, HUB
4 RETOR. AND BRAKE CAMPER. ASSEMBLY. CURAN BRAKE PADS. PUSH BRAKE
5 SYSTEM. ADJUST PARK BRAKE. RIGHT SIDE. CURAN ROAD WHEEL IN SAME
6 FASHION AS LEFT SIDE. INSTALL FOUR ROAD WHEELS & TORQUE. 2.5

9 JAN

7 UNBOLT REMOVE FRONT BUMPER, REMOVE BOTH DRIVING LIGHTS, REMOVE GRILL
8 FOR RUBBER SURROUND REPLACEMENT. GRILL REMOVAL TIED TO BECAUSE "GUARD"
9 INTO PLACE. WORK WITH SOLVENT TO REMOVE GLUE FROM RUBBER
10 OFF OF PAINT. RECOMMEND PAINT REPAIR. 3.0

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6717

SOLD TO

ADDRESS:

CITY, STATE, ZIP

SHIP TO:

ADDRESS:

CITY, STATE, ZIP

CUSTOMER'S ORDER

250 CALIFORNIA SP7

SOLD BY:

4487

TERMS:

F.O.B.

11394 VHS

DATE:

12 FEB 01

9 FEB	1	WINDSHIELD WIPER. SWITCH FAILS ON DRIVE BACK FROM PAINT SHOP IN	
	2	HAYWARD. REMOVE WIPER SWITCH, DISASSEMBLE AND INSPECT. TRACE	
	3	CAUSE OF MALFUNCTION TO SEIZED DETENT BALLS IN SWITCH. EXTRACT OLD	
	4	BALLS (5.5MM) CURAN ORIGINAL DETENT SPRINGS - REPLACE BALLS - SHORTEN	
	5	CONTACT SPRINGS. ASSEMBLE CHECK SWITCH FUNCTION ON BENCH - OK.	
	6	INSTALL BACK INTO DASH & CHECK OPERATION. - OK. SOMETIMES WIPER MOTOR	
	7	RUNS AWAY IN OFF POSITION. POSSIBLE PARK CONTACT PROBLEM?	3.0
10 FEB	8	INSTALL NEW RUBBER EXTRUSION TO GRILL, GRILL INTO NOSE OF CAR. INSTALL	
	9	BETA MARCHEL DRIVING LAMPS - REPAIR 13 ⁺ FREEDER ENDS INSIDE LAMPS.	
	10	INSTALL POLISH FT. BUMPER. TRUCKER CHG. BATTERY	2.0

PATRICK OTTIS

INVOICE

©1998 REDIFORM® 7L721

INVOICE NO.

6718

SOLD TO	[REDACTED]
ADDRESS	[REDACTED]
CITY, STATE, ZIP	[REDACTED]

SHIP TO:
ADDRESS:
CITY, STATE, ZIP

CUSTOMER'S ORDER 750 CALIF. SPY	SOLD BY: 4487	TERMS:	F.O.B. 11394 VHS	DATE: 12 FEB 01
------------------------------------	------------------	--------	---------------------	--------------------

1	SHOP LABOR. 19.5 HRS @ 90 [¢]		1755 ⁰⁰
2	FRAM PH 2815 OIL FILTER		19 ⁹⁵
3	FRAM PB-50 OIL FILTER		10 ⁰⁰
4	8 QTS KENDALL GT-1 20/50 MOTOR OIL @ 3 ⁰⁰		24 ⁰⁰
5	OIL FULL CAP SEAL RING		2 ⁵⁰
6	2 REAR AXLE SEALS (TWO UP) 48 62.8 @ 12 ⁰⁰		24 ⁰⁰
7	CASTROL LMA BRAKE FLUID		12 ⁰⁰
8	PARTS TOTAL 92 ⁴⁵	TAX ON PARTS	7 ³⁹
9	92 OCTANE FUEL		25 ⁰⁰
10	JOB TOTAL		1879 ⁸⁴