

MODDERMAN

EPA #CAL000116486
B.A.R. #AH179981

Service, Inc.

INVOICE (HISTORY) 25421
Date

Page 1
21 JAN 2021

Specialist in **PORSCHE** service.

2599-B Wyandotte Street • Mountain View, CA 94043

Phone: (650) 967-3213 • Email: dave@modderman.com

Make PORSCHE License 7WTK162
Model 996 TT Eng. Type
Miles/Km 71,492.0 Eng. No. 6 CYL 3.6 L...
Vin WP0AB29953S686508 Prod.
Year 2003 Sales: 1DRM Unit
Cell. # (201) 388-1789 Other (CAP)

Open Date 21 JAN 2021

Ready By: 21 JAN 2021 10:36

Description of Labor / Service Provided

H. T/L Tech. Amount

MINOR MAINTENANCE SERVICE, CHANGE THE ENGINE OIL AND REPLACE THE OIL FILTER. DRAIN THE TURBO OIL COLLECTION TANKS. CLEAN THE RADIATOR INLETS. INSPECT THE AIR FILTER AND CABIN FILTER. REPLACE CABIN FILTER. INFLATE TIRES 38 FRT. 44 REAR CHECK ALL THE FLUID LEVELS AND ADJUST. SCAN THE DIAGNOSTIC LINK, CLEAR CODES AND ROAD TEST, OK FOUND A BAD OILPRESURE SENDER UNIT.

1SMM 360.50

INSTALL CUSTOMERS AIR BRAKE DUCTS FRONT.

1SMM 54.08

REPLACE THE OIL PRESURE SENDER UNIT.

1SMM 225.31

	Parts / Material	Description	Qty	Each \$	Extended \$
New	HM	OIL AND FILTER RECYCLING	1.00	0.00	0.00
New	900031 01130	DRAIN PLUG GASKET	1.00	1.59	1.59
New	MOTUL 5W40	ENGINE OIL SYNTHETIC	10.00	10.95	109.50
New	996 107 225 53	Oil Filter Kit - w/ O-Ring	1.00	21.95	21.95
New	997 571 219 01	Cabin Air Filter	1.00	45.99	45.99
New	996 606 203 03	Oil Pressure Sender	1.00	122.36	122.36
New	RCS 14 X 18	Seal Ring - Copper	1.00	1.30	1.30

Miscellaneous/Sublet Charges

GET CAR READY FOR THE SMOG TEST

Amount
85.00

Recommended Repairs / Notes

Original Estimate:	\$ 950.00	X:	X:
Revision #1	.00	I acknowledge notice and oral approval of an increase in the original estimated price	
Increase	0.00	Revision #2	.00
		Increase	0.00
		Revision #3	.00
		Increase	0.00

I hereby authorize the above named to operate and store the above vehicle for the purpose of testing, inspection, repair and delivery, at my own risk. I understand that the above named is not responsible for loss or damage equipment or articles left on or in vehicles in case of fire, theft, or any cause beyond their control. I understand that if I wish to retain worn and damaged parts that request will be made at the time of authorization or repairs. I understand that two (2) days after notice of completion of services rendered, that a storage charge of not more than \$ per day, will be charged unless otherwise agreed to in writing.

Signature _____ Date _____

Labor	\$ 639.89
Parts	\$ 302.69
Environmental:	\$ 4.50
Shop Supplies	\$ 0.00
Sub Total Charges	\$ 4.50
Sublet	\$ 85.00
Total Sales Tax	\$ 27.24

X: _____
Payment 1: AMX 1059.32

Account # 2937
Payment 2: Key# 0.00

Thank You From: MODDERMAN PORSCHE SERVICE, INC.

Tot. Before Sales Tax	\$ 1,032.08
Total Sale	\$ 1,059.32
Total Due	\$ 0.00

MODDERMAN

EPA #CAL000116486
B.A.R. #AH179981

Service, Inc.

INVOICE (HISTORY) 24758

Page: 1
Date: 22 JAN 2020

Specialist in **PORSCHE** service.

2599-B Wyandotte Street • Mountain View, CA 94043

Phone: (650) 967-3213 • Email: dave@modderman.com

Make PORSCHE
Model 996 TT
Miles/Km 70,870.0
Vin WP0AB29953S686508
Year 2003
Cell. # (201) 388-1789

License 7WTK162
Eng. Type
Eng. No. 6 CYL 3.6 L...
Prod. Unit
Other (CAP)

Open Date 17 JAN 2020

Ready By: 20 JAN 2020 08:01

Description of Labor / Service Provided

H. T/L Tech. Amount
RU 360.50

MINOR MAINTENANCE SERVICE, CHANGE THE ENGINE OIL AND REPLACE THE OIL FILTER. DRAIN THE TURBO OIL COLLECTION TANKS. CLEAN THE RADIATOR INLETS. INSPECT THE AIR FILTER AND CABIN FILTER, OK. INFLATE TIRES 38 FRT. 44 REAR CHECK ALL THE FLUID LEVELS AND ADJUST. SCAN THE DIAGNOSTIC LINK, CLEAR CODES AND ROAD TEST, OK!

Parts / Material	Description	Qty	Each \$	Extended \$
New HM	OIL AND FILTER RECYCLING	1.00	0.00	0.00
New 900031 01130	DRAIN PLUG GASKET	4.00	1.44	5.76
New MOTUL 5W40	ENGINE OIL SYNTHETIC	10.00	10.95	109.50
New 996 107 225 53	Oil Filter Kit - w/ O-Ring	1.00	21.95	21.95

Recommended MISSING LEFT FT. BRAKE DUCT Repairs / Notes

Original Estimate:	\$ 650.00	X: _____	X: _____
Revision #1	.00	Increase	0.00
Revision #2	.00	Increase	0.00
Revision #3	.00	Increase	0.00

I acknowledge notice and oral approval of an increase in the original estimated price

I hereby authorize the above named to operate and store the above vehicle for the purpose of testing, inspection, repair and delivery, at my own risk. I understand that the above named is not responsible for loss or damage equipment or articles left on or in vehicles in case of fire, theft or any cause beyond their control. I understand that if I wish to retain worn and damaged parts that request will be made at the time of authorization or repairs. I understand that two (2) days after notice of completion of services rendered, that a storage charge of not more than \$ per day, will be charged unless otherwise agreed to in writing.

Signature _____ Date _____

Labor	\$ 360.50
Parts	\$ 137.21
Environmental:	\$ 4.50
Shop Supplies	\$ 0.00
Sub Total Charges	\$ 4.50
Sublet	\$ 0.00
Total Sales Tax	\$ 12.35
Tot. Before Sales Tax	\$ 502.21
Total Sale	\$ 514.56
Total Due	\$ 0.00

Payment 1: VISA 514.56

Account # 2937
Payment 2:

Key#
0.00

Thank You From: MODDERMAN PORSCHE SERVICE, INC.

MODDERMAN

EPA #CAL000116486
B.A.R. #AH179981

Service, Inc. INVOICE (HISTORY) 24092
Date

Page: 1
19 MAR 2019

Specialist in **PORSCHE** service.

2599-B Wyandotte Street • Mountain View, CA 94043

Phone: (650) 967-3213 • Email: dave@modderman.com

Make **PORSCHE** License **7WTK162**
Model **996 TT** Eng. Type
Miles/Km **69,852.0** Eng. No. **6 CYL 3.6 L...**
Vin **WP0AB29953S686508** Prod.
Year **2003** Sales: **1DRM** Unit
Cell. # **(201) 388-1789** Other (CAP)

Open Date 18 MAR 2019

Ready By: 18 MAR 2019 11:41

Description of Labor / Service Provided

H. T/L Tech. Amount

SCAN THE CAR FOR CHECK ENGINE LIGHTS? FOUND CODE FOR THE CAM HALL SENSOR BANK ONE. REMOVE THE EXHAUST TO GET TO THE CAM SENSOR AND INSTALL NEW CAM SENSOR. RE INSTALL EXHAUST AND REPAIR ANY BROKEN BOLTS AND REPLACE OLD HARDWARE.

NDM 1,035.00

Parts / Material	Description	Qty	Each \$	Extended \$
New 996 606 106 03	Camshaft Position Sensor	1.00	432.72	432.72

Recommended Repairs / Notes

Original Estimate: \$ 1,500.00 X: _____ X: _____

I acknowledge notice and oral approval of an increase in the original estimated price

Revision #1	Increase	Revision #2	Increase	Revision #3	Increase
.00	0.00	.00	0.00	.00	0.00

I hereby authorize the above named to operate and store the above vehicle for the purpose of testing, inspection, repair and delivery, at my own risk. I understand that the above named is not responsible for loss or damage equipment or articles left on or in vehicles in case of fire, theft, or any cause beyond their control. I understand that if I wish to retain worn and damaged parts that request will be made at the time of authorization or repairs. I understand that two (2) days after notice of completion of services rendered, that a storage charge of not more than \$ per day, will be charged unless otherwise agreed to in writing.

Signature _____ Date _____

X: _____
Payment 1: AMX 1506.66

Account # 2937
Payment 2: Key# 0.00

Thank You From: MODDERMAN PORSCHE SERVICE, INC.

Labor	\$ 1,035.00
Parts	\$ 432.72
Environmental:	\$ 0.00
Shop Supplies	\$ 0.00
Sub Total Charges	\$ 0.00
Sublet	\$ 0.00
Total Sales Tax	\$ 38.94
Tot. Before Sales Tax	\$ 1,467.72
Total Sale	\$ 1,506.66
Total Due	\$ 0.00

MODDERMAN

EPA #CAL000116486
B.A.R. #AH179981

Service, Inc. INVOICE (HISTORY) 23904
Date

Page: 1
6 DEC 2018

Specialist in **PORSCHE** service.

2599-B Wyandotte Street • Mountain View, CA 94043

Phone: (650) 967-3213 • Email: dave@modderman.com

Make **PORSCHE** License **7WTK162**
Model **996 TT** Eng. Type
Miles/Km **69,381.0** Eng. No. **6 CYL. TURBO**
Vin **WP0AB29953S686508** Prod.
Year **2003** Sales: **1DRM** Unit
Cell. # **(201) 388-1789** Other (CAP)

Open Date 6 DEC 2018

Ready By: 6 DEC 2018 09:26

Description of Labor / Service Provided

MINOR MAINTENANCE SERVICE, CHANGE THE ENGINE OIL AND REPLACE THE OIL FILTER. CLEAN THE RADIATOR INLETS. INSPECT THE AIR FILTER AND CABIN FILTER, OK. INFLATE TIRES 38 FRT, 44 REAR CHECK ALL THE FLUID LEVELS AND ADJUST. SCAN THE DIAGNOSTIC LINK, CLEAR CODES AND ROAD TEST, OK!

H. T/L Tech. Amount

1SMM 258.75

CHANGE TRANSAXLE OIL. ADD NEW TRANSAXLE OIL.

1SMM 51.75

GET CAR READY FRO THE SMOG TEST.

SL 75.00

Parts / Material	Description	Qty	Each \$	Extended \$
New HM	OIL AND FILTER RECYCLING	1.00	0.00	0.00
New 900031 01130	DRAIN PLUG GASKET	4.00	1.44	5.76
New MOTUL 5W40	ENGINE OIL SYNTHETIC	9.00	10.95	98.55
New 996 107 225 53	Oil Filter Kit - w/ O-Ring	1.00	21.95	21.95
New LB 33289	LIGHT BULB 12V. 3 W	2.00	12.81	25.62
New RAL 22X27	DRAIN PLUG GASKET	2.00	1.44	2.88
New 000 043 305 49	Gear Oil 75W90 1 Liter	3.00	43.23	129.69

Recommended Repairs / Notes

Original Estimate: \$ 800.00 X: X:
 I acknowledge notice and oral approval of an increase in the original estimated price
 Revision #1 .00 Increase 0.00
 Revision #2 .00 Increase 0.00
 Revision #3 .00 Increase 0.00

I hereby authorize the above named to operate and store the above vehicle for the purpose of testing, inspection, repair and delivery, at my own risk. I understand that the above named is not responsible for loss or damage equipment or articles left on or in vehicles in case of fire, theft or any cause beyond their control. I understand that if I wish to retain worn and damaged parts that request will be made at the time of authorization or repairs. I understand that two (2) days after notice of completion of services rendered, that a storage charge of not more than \$ per day, will be charged unless otherwise agreed to in writing.

Signature _____ Date _____

Labor \$ 385.50
 Parts \$ 284.45
 Environmental: \$ 4.50
 Shop Supplies \$ 0.00
 Sub Total Charges \$ 4.50
 Sublet \$ 0.00
 Total Sales Tax \$ 25.60

Payment 1: AMX 700.05

Account # 2937

Key# 0.00

Payment 2:

Tot. Before Sales Tax \$ 674.45

Thank You From: MODDERMAN PORSCHE SERVICE, INC.

Total Sale \$ 700.05

Total Due \$ 0.00

MODDERMAN

EPA #CAL000116486
B.A.R. #AH179981

Service, Inc.

INVOICE (HISTORY) 23655

Page: 1

Date

12 NOV 2018

Specialist in **PORSCHE** service.

2599-B Wyandotte Street • Mountain View, CA 94043

Phone: (650) 967-3213 • Email: dave@modderman.com

Make **PORSCHE**
Model **996 TT**
Miles/Km **68,754.0**
Vin **WP0AB29953S686508**
Year **2003**
Cell. # **(201) 388-1789**

License **7WTK162**
Eng. Type
Eng. No. **6 CYL TURBO**
Prod. Unit
Other (CAP)

Open Date **30 JUL 2018**

Ready By: **30 JUL 2018 10:30**

Description of Labor / Service Provided

CHECK THE CAR HAS NO FIRST GEAR? TRANSAXLE SHIFTS INTO ALL GEARS AND ALL GEARS WORK GOOD, BUT THERE IS NO DRIVE IN FIRST GEAR. SUSPECT THAT THE DOG TEETH ARE BROKEN OR FIRST GEAR IS BAD? REMOVE THE TRANSAXLE TO GET THE TRANS AXLE TO REBUILD IT. CHECK THE ENGINE FLYWHEEL AND CLUTCH. REPLACE THE CLUTCH KIT WITH NEW FACTORY KIT. INSPECT THE FLYWHEEL AND CLEAN UP THE THROW OUT FORK. CLEAN THE THROW OUT BEARING GUIDE. REPLACE THE PILOT BEARING. INSTALL NEW FLYWHEEL AND BOLTS.

H. T/L Tech. Amount

NDM 1,239.23

REBUILD THE TRANS AXLE. DISASSEMBLE THTRANS AXLE AND INSPECT. FOUND A BAD FIRST GEAR. WE NEED TO REPLACE THE MAIN SHAFT WITH NEW FIRST AND SECOND GEAR SETS.

1DRM 1,487.07

INSPECT THE CLUTCH SYSTEM.

NDM 82.62

Parts / Material	Description	Qty	Each \$	Extended \$
New CLEANERS	BRAKE CLEAN	5.00	5.95	29.75
New 000 043 305 75	Coolant/Antifreeze	1.00	45.71	45.71
New 996 302 901 50	MAIN SHAFT 1 ST GEAR SET.	1.00	3883.33	3,883.33
New 000 043 305 49	Gear Oil 75W90 1 Liter	3.00	43.23	129.69
New 000 043 203 73	Gasket Sealer Reinzosil (70ml)	1.00	27.07	27.07
New RAL 22X27	DRAIN PLUG GASKET	2.00	1.44	2.88
New 999 034 035 01	LOCK NUT	1.00	25.36	25.36
New 999 034 034 00	NUT	1.00	25.36	25.36
New 950 304 617 20	RING	1.00	223.66	223.66
New 950 304 611 20	SYNCRO RING	1.00	223.66	223.66
New 996 304 613 20	CONE RING	1.00	99.69	99.69
New 996 303 142 50	DETENT	1.00	24.36	24.36
New 996 303 143 50	DETENT	1.00	24.36	24.36
New 996 302 955 51	GEAR WHEEL 5TH SET	1.00	852.36	852.36

Recommended Repairs / Notes

Original Estimate:	\$ 275.00	X:	X:
Revision #1	8000.00	I acknowledge notice and oral approval of an increase in the original estimated price	
19 SEP 2018 09:20	Increase 7725.00	Revision #2	8935.00
MR. NICK NAZARENO () - SPOKE TO		22 OCT 2018 15:03	Increase 935.00
		MR. NICK NAZARENO AT () - SPOKE TO	Revision #3
			Increase 0.00

MODDERMAN

EPA #CAL000116486
B.A.R. #AH179981

Service, Inc. INVOICE (HISTORY) 23655
Date

Page: 2
12 NOV 2018

Specialist in **PORSCHE** service.

2599-B Wyandotte Street • Mountain View, CA 94043

Phone: (650) 967-3213 • Email: dave@modderman.com

Make **PORSCHE** License **7WTK162**
Model **996 TT** Eng. Type
Miles/Km **68,754.0** Eng. No. **6 CYL. TURBO**
Vin **WP0AB29953S686508** Prod.
Year **2003** Sales: **1DRM** Unit
Cell. # **(201) 388-1789** Other (CAP)

Open Date 30 JUL 2018

Ready By: 30 JUL 2018 10:30

I hereby authorize the above named to operate and store the above vehicle for the purpose of testing, inspection, repair and delivery, at my own risk. I understand that the above named is not responsible for loss or damage equipment or articles left on or in vehicles in case of fire, theft or any cause beyond their control. I understand that if I wish to retain worn and damaged parts that request will be made at the time of authorization or repairs. I understand that two (2) days after notice of completion of services rendered, that a storage charge of not more than \$ per day will be charged unless otherwise agreed to in writing.

Signature _____ Date _____

Labor	\$ 2,808.92
Parts	\$ 5,617.24
Environmental:	\$ 0.00
Shop Supplies	\$ 0.00
Sub Total Charges	\$ 0.00
Sublet	\$ 0.00
Total Sales Tax	\$ 505.55

Payment 1: CHECK 8931.71

Account # 2937

Key#


Payment 2:

0.00

Thank You From: **MODDERMAN PORSCHE SERVICE, INC.**

Tot. Before Sales Tax	\$ 8,426.16
Total Sale	\$ 8,931.71
Total Due	\$ 0.00

TFB PERFORMANCE INC
 29691 Arnold Dr.
 Sonoma, CA 95476 US
 (415)205-2222
 tfbperformance@gmail.com
<http://www.tfbperformance.com/>

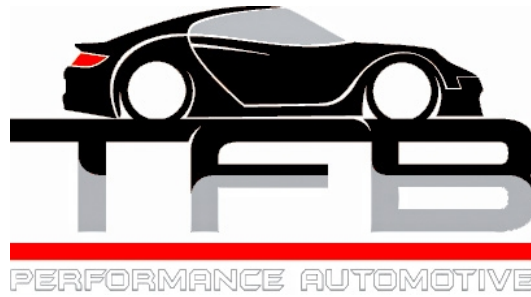

INVOICE

BILL TO


INVOICE # 4909
DATE 01/30/2018

DATE	ACTIVITY	QTY	RATE	AMOUNT
01/30/2018	Sales PILOT SPORT CUP 2 245/35ZR19	2	349.00	698.00T
01/30/2018	Sales PILOT SPORT CUP 2 295/30ZR19	2	390.00	780.00T
01/30/2018	Shipping Costs Shipping cost on parts	1	80.00	80.00
01/30/2018	Tire Mounting Tire mounting with balance	4	22.00	88.00
01/30/2018	California Tire Fee California Tire Fee	4	1.75	7.00

PAID

SUBTOTAL	1,653.00
TAX	120.09
TOTAL	1,773.09
PAYMENT	1,773.09
BALANCE DUE	\$0.00

TFB PERFORMANCE INC
 29691 Arnold Dr.
 Sonoma, CA 95476 US
 (415)205-2222
 tfbperformance@gmail.com
 http://www.tfbperformance.com/

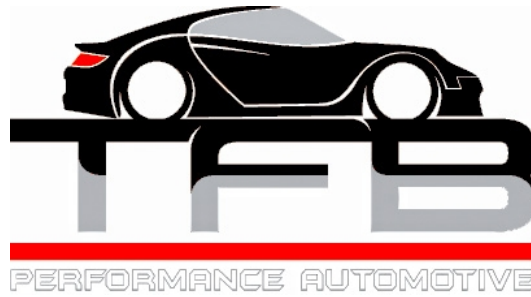

INVOICE

BILL TO

INVOICE # 4854
DATE 01/12/2018

DATE	ACTIVITY	QTY	RATE	AMOUNT
01/12/2018	Sales Differential mount	3	64.34	193.02T
01/12/2018	Sales Differential seal	2	31.06	62.12T
01/12/2018	Sales Gear oil	2	18.59	37.18T
01/12/2018	Sales Transmission mount	1	149.00	149.00T
01/12/2018	Shipping Costs Shipping cost on parts Trans mount	1	10.00	10.00
01/12/2018	Sales Axle nut	2	9.48	18.96T
01/12/2018	Sales CV boot kit	2	58.81	117.62T
01/12/2018	Labor TFB hourly rate Clutch chatter is super bad. Seems like it was not broken in correctly. Left front axle boot is leaking from outer boot All fluids are dirty including power steering and front transaxle Front brakes 45% Rear brakes 55% Front transaxle mounts are all bad and trans axle is slamming around. Front Transmission mounts is blown out on both sides. Check for service of spark plugs and fluids. Air filter looks clean and coil packs are very clean like they are new. Remove Front Transaxle and Reseal flanges along	14.50	110.00	1,595.00

PAID

DATE	ACTIVITY	QTY	RATE	AMOUNT
	with replacing all 3 mounts.			
	Remove front transmissnon mount and replace with new one.			
	While transaxle is being removed both axles will be out and all four boots are cracked and one is leaking.			
	Install Tarret engine mounts			
01/30/2018	Sales Driveshaft flex joint	1	90.00	90.00T
01/30/2018	Labor TFB hourly rate Change engine oil Change transaxle fluid	1.20	110.00	132.00
01/30/2018	Sales:Redline:Redline 75w90 Gear Oil Redline 75w90 Gear Oil Quart Front diff	1.50	17.25	25.88T
01/30/2018	Sales:Redline:Redline 75w90 Gear Oil Redline 75w90 Gear Oil Quart NS Transaxle	4	17.76	71.04T
01/30/2018	Sales Red Line Synthetic 0W40 Motor Oil Quart	10	14.50	145.00T
01/30/2018	Alignment:Standard 4 Wheel Alignment Standard Four Wheel Alignment	2.50	125.00	312.50
01/30/2018	Sales Oil filter kit	1	14.00	14.00T
02/07/2018	Sales Tarret engine mounts	2	198.75	397.50T
02/07/2018	Shipping Costs Shipping cost on parts Engine mounts	1	13.67	13.67

SUBTOTAL	3,384.49
TAX	107.36
TOTAL	3,491.85
PAYMENT	3,491.85
BALANCE DUE	\$0.00

MODDERMAN

EPA #CAL000116486
B.A.R. #AH179981

Service, Inc.

INVOICE (HISTORY) 22518

Date

Page: 1
30 JAN 2017

Specialist in **PORSCHE** service.

2599-B Wyandotte Street • Mountain View, CA 94043

Phone: (650) 967-3213 • Email: dave@modderman.com

Make **PORSCHE** License **7WTK162**
Model **996 TT** Eng. Type
Miles/Km **64,276.0** Eng. No. **6 CYL. TURBO**
Vin **WP0AB29953S686508** Prod.
Year **2003** Sales: **1DRM** Unit
Cell. # **(201) 388-1789** Other (CAP)

Open Date 26 JAN 2017

Ready By: 26 JAN 2017 11:23

Description of Labor / Service Provided

H. T/L Tech. Amount

MINOR MAINTENANCE SERVICE, CHANGE THE ENGINE OIL AND REPLACE THE OIL FILTER. CLEAN THE RADIATOR INLETS. INSPECT THE AIR FILTER AND CABIN FILTER. REPLACE CABIN AND AIR FILTER. INFLATE TIRES 38 FRT. 44 REAR. CHECK ALL THE FLUID LEVELS AND ADJUST. SCAN THE DIAGNOSTIC LINK, CLEAR CODES AND ROAD TEST, OK!

NDM 233.10

CHECK THE LOW VOLTAGE, FOUND THE ALT. IS NOT CHARGING. REMOVE THE AIR INTAKE AND AIR CLEANER HOUSING TO GET TO THE ALT. REPLACE THE ALT WITH NEW ALT. REPLACE THE ENGINE DRIVE BELT. TEST THE CHARGING SYSTEM, 14.2 VOLTS, OK NOW.

1SMM 427.35

INSTALL NEW FRONT HOOD STRUTS.

NDM N/C

Parts / Material	Description	Qty	Each \$	Extended \$
New HM	OIL AND FILTER RECYCLING	1.00	0.00	0.00
New 900031 01130	DRAIN PLUG GASKET	1.00	1.44	1.44
New MOTUL 5W40	ENGINE OIL SYNTHETIC	10.00	10.95	109.50
New 996 107 225 53	Oil Filter Kit - w/ O-Ring	1.00	21.95	21.95
New 997 571 219 01	Cabin Air Filter	1.00	42.95	42.95
New 996 603 012 09	Alternator 120 Amp	1.00	749.36	749.36
New 6PK-2288	Drive Belt	1.00	80.25	80.25
New 996 110 131 71	Air Filter	1.00	53.79	53.79
New 996 511 551 01	Hood Strut	2.00	49.36	98.72

Recommended Repairs / Notes

Original Estimate: \$ 550.00 X: _____ X: _____

Revision #1 1921.34
26 JAN 2017 13:05 Increase 1371.34
MR. NICK NAZARENO () - SPOKE TO

I acknowledge notice and oral approval of an increase in the original estimated price

Revision #2 .00 Increase 0.00
Revision #3 .00 Increase 0.00

I hereby authorize the above named to operate and store the above vehicle for the purpose of testing, inspection, repair and delivery, at my own risk. I understand that the above named is not responsible for loss or damage equipment or articles left on or in vehicles in case of fire, theft, or any cause beyond their control. I understand that if I wish to retain worn and damaged parts that request will be made at the time of authorization or repair. I understand that two (2) days after notice of completion of services rendered, that a storage charge of not more than \$ per day, will be charged unless otherwise agreed to in writing.

Signature: _____ Date: _____

Labor \$ 660.45
Parts \$ 1,157.96
Environmental: \$ 4.50
Shop Supplies \$ 0.00
Sub Total Charges \$ 4.50
Sublet \$ 0.00
Total Sales Tax \$ 98.43

Account # 2937 Key#
Payment 1: AMX 1921.34 Payment 2: 0.00

Thank You From: MODDERMAN PORSCHE SERVICE, INC.

Tot. Before Sales Tax \$ 1,822.91
Total Sale \$ 1,921.34
Total Due \$ 0.00

MODDERMAN

EPA #CAL000116486
B.A.R. #AH179981

Service, Inc. INVOICE (HISTORY) 22490
Date

Page: 1
12 JAN 2017

Specialist in **PORSCHE** service.

2599-B Wyandotte Street • Mountain View, CA 94043

Phone: (650) 967-3213 • Email: dave@modderman.com

Make **PORSCHE** License **AME931 WA**
Model **996 TT** Eng. Type
Miles/Km **640,540.0** Eng. No. **6 CYL. TURBO**
Vin **WP0AB29953S686508** Prod.
Year **2003** Sales: **1DRM** Unit
Cell. # **(201) 388-1789** Other (CAP)

Open Date 12 JAN 2017

Ready By: 12 JAN 2017 14:28

Description of Labor / Service Provided

H. T/L Tech. Amount

GET CAR READY FOR THE SMOG TEST. OUT OF STATES CAR.	1DRM	95.00
CHECK THE COOLANT LEVEL AND TOP OFF. ADD 1 QUART OF COOLANT AND INSTALL NEW RESERVOIR CAP.	1SMM	31.08
CLEAN THE DIRT OUT OF THE WHEELS FROM THE ROADS.	1CD	NIC

	Parts / Material	Description	Qty	Each \$	Extended \$
New	996 106 447 04	Expansion Tank Cap	1.00	33.99	33.99
New	000 043 305 15	Coolant/Antifreeze - 1 Liter (1.00	20.71	20.71

Recommended Repairs / Notes

Original Estimate: \$ 250.00 X: _____ X: _____
I acknowledge notice and oral approval of an increase in the original estimated price

Revision #1	.00	Revision #2	.00	Revision #3	.00
Increase	0.00	Increase	0.00	Increase	0.00

I hereby authorize the above named to operate and store the above vehicle for the purpose of testing, inspection, repair and delivery, at my own risk. I understand that the above named is not responsible for loss or damage equipment or articles left on or in vehicles in case of fire, theft, or any cause beyond their control. I understand that if I wish to retain worn and damaged parts that request will be made at the time of authorization or repairs. I understand that two (2) days after notice of completion of services rendered, that a storage charge of not more than \$ per day, will be charged unless otherwise agreed to in writing.

Signature _____ Date _____

X: _____
Payment 1: VISA 185.57

Account # 2937
Payment 2: Key# 0.00

Thank You From: MODDERMAN PORSCHE SERVICE, INC.

Labor	\$ 126.08
Parts	\$ 54.70
Environmental:	\$ 0.00
Shop Supplies	\$ 0.00
Sub Total Charges	\$ 0.00
Sublet	\$ 0.00
Total Sales Tax	\$ 4.79
Tot. Before Sales Tax	\$ 180.78
Total Sale	\$ 185.57
Total Due	\$ 0.00