

CUSTOMER #: 7903360

5120

# Maserati

of

## NEW ENGLAND

101 WASHINGTON STREET  
FOXBORO, MA 02035

Telephone: (617) 559-0123 • Fax (617) 559-0075

www.maseratinc.com

\*INVOICE\*

PAGE 1

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG	
RED	60	MERCEDES 300SL	19804210002538	SL1960	29188/29189	T538	
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
01JAN60 DL			17:00 15JUN09			CASH	16JUN09
R.O. OPENED	READY	OPTIONS:					
17:58 27MAY09	13:08 16JUN09						

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A PERFORM ANNUAL ENGINE OIL/FILTER SERVICE, INSPECT FLUID LEVELS, CHECK TIRE PRESSURES AND WHEEL BOLT TORQUE, INCLUDING FULL VISUAL INSPECTION

LOF PERFORM ANNUAL ENGINE OIL/FILTER SERVICE, INSPECT FLUID LEVELS, CHECK TIRE PRESSURES AND WHEEL BOLT TORQUE, INCLUDING FULL VISUAL INSPECTION

1021 NICOLA MAFFEO LIC#: 0

C

1 M1206 MOBIL 1 OIL FILTER

14 20W50 BRAD PENN 20W50

2 8909107 BRAKE CLN.

1 10259960 GUARNIZIONE D.18-24X1,5

PARTS:                      LABOR:                      OTHER:                      TOTAL LINE A:

\*\*\*\*\*

B RH SIDE CONV TOP INNER STRAP IS LOOSE-RESECURE  
SS APPLIED ADHEISIVE TAPE TO FABRIC LINER RH TOP.  
ADVISED CLIENT TO MONITOR.

1021 NICOLA MAFFEO LIC#: 0

C

PARTS:                      LABOR:                      OTHER:                      TOTAL LINE B:

\*\*\*\*\*

C CENTER VENT KNOB FELL OFF-POSSIBLY FELL DOWN NEAR PARKING BRAKE AREA...LOCATE KNOB AND RESECURE  
SS LOCATE VENT KNOB AND SECURE...REMOVED PARKING BRAKE COVER TO RETRIEVE KNOB. ADVISED CLIENT SOME OF THE VENT CABLES ARE STIFF

1021 NICOLA MAFFEO LIC#: 0

C

PARTS:                      LABOR:                      OTHER:                      TOTAL LINE C:

\*\*\*\*\*

**THANK YOU**  
**EXCLUSIONS OF WARRANTIES**

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, includes, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

**DISPOSAL OF HAZARDOUS WASTE**

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	



CUSTOMER #: 7903360

5120

# Maserati

of

## NEW ENGLAND

101 WASHINGTON STREET  
FOXBORO, MA 02035

Telephone: (617) 559-0123 · Fax (617) 559-0075

www.maseratine.com

\*INVOICE\*

PAGE 2

SERVICE ADVISOR: 1002 STEPHEN OLDFORD

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG
RED	60	MERCEDES 300SL	19804210002538	SL1960	29188/29189	T538
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
01JAN60 DD			17:00 15JUN09			CASH
R.O. OPENED	READY	OPTIONS:				
17:58 27MAY09	13:08 16JUN09					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
D							

D WASH EXTERIOR AND VACUUM  
CLEAN WASH EXTERIOR AND VACUUM

PARTS:                      LABOR:                      OTHER:                      TOTAL LINE D:

\*\*\*\*\*

E\*\* REPLACE WIPER BLADES  
SS REMOVED WIPER BLADES AND REPLACE RUBBER  
INSERT

1021 NICOLA MAFFEO LIC#: 0

C

2 8241227 WIPER REFILLS-1960 300SL

PARTS:                      LABOR:                      OTHER:                      TOTAL LINE E:

\*\*\*\*\*

for all your service needs contact the Maserati experts at 781-619-6977  
ice dept. at m6305srv@maseratiusa.com



### THANK YOU EXCLUSIONS OF WARRANTIES

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

### DISPOSAL OF HAZARDOUS WASTE

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	337.00
PARTS AMOUNT	258.94
GAS, OIL, LUBE	0.00
SUBLET AMOUNT	0.00
MISC. CHARGES	6.85
TOTAL CHARGES	602.79
LESS INSURANCE	0.00
SALES TAX	13.29
PLEASE PAY THIS AMOUNT	616.08



CUSTOMER #: 7903360

5451

\*INVOICE\*

PAGE 1

# Maserati

of

## NEW ENGLAND

101 WASHINGTON STREET  
FOXBORO, MA 02035

Telephone: (617) 559-0123 · Fax (617) 559-0075

www.maseratine.com

SERVICE ADVISOR: 1002 STEPHEN OLDFORD


COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN / OUT	TAG
RED	60	MERCEDES 300SL	19804210002538	SL1960	29206/29206	T538
DEL. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT
01JAN60 DD			17:00 31AUG09			CASH
R.O. OPENED	READY	OPTIONS:				
10:50 31AUG09	17:42 02SEP09					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A							
DRAIN AND INSPECT FUEL... FLUSH AND REFILL TANK							
SS DRAIN/FLUSH AND REFILL FUEL TANK. REPLACED							
SEALING RING ON DRAIN PLUG							
1021 NICOLA MAFFEO LIC#: 0							
C							
1 1RJP1 23.5X31MM ORING-MERCEDES							
SUBL FUEL							
C							
PARTS:	LABOR:			OTHER:	TOTAL LINE A:		

*****							
B							
WASH EXTERIOR AND VACUUM							
CLEAN VEHICLE WAS CLEAN... NOT WASHED AT THIS TIME							
99 C							
PARTS:	LABOR:			OTHER:	TOTAL LINE B:		

\*\*\*\*\*  
 for all your service needs contact the Maserati experts at 781-619-6977  
 ice dept. at m6305srv@maseratiusa.com

*(Signature)*  
*(Signature)*

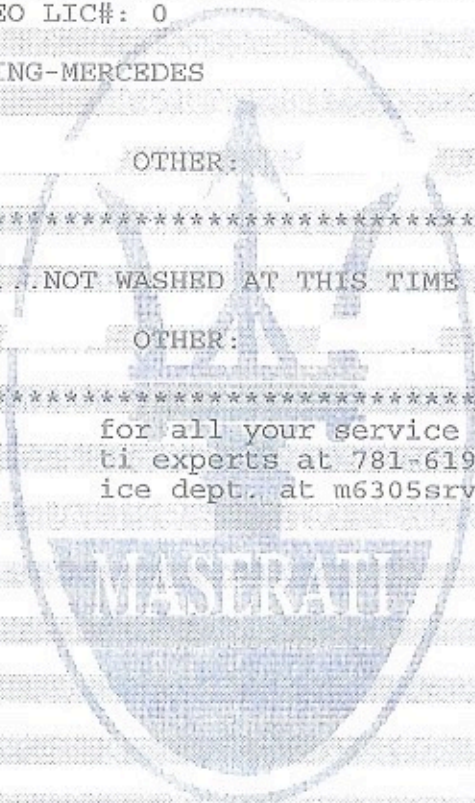

**THANK YOU  
EXCLUSIONS OF WARRANTIES**

Any warranties on the parts and accessories sold hereby are made by the manufacturer. The undersigned purchaser understands and agree that the dealer makes no warranties of any kind, express or implied, and disclaims all warranties, including warranties of merchantability or fitness for a particular purpose, with regard to the parts and/or accessories purchased; and that in no event shall the dealer be liable for incidental or consequential damages or commercial losses arising out of such purchase. The undersigned purchaser further agrees that the warranties excluded by the dealer, include, but are not limited to any warranties that such parts and/or accessories are of merchantable quality or that they will enable any vehicle or any of its systems to perform with reasonable safety, efficiency, or comfort.

**DISPOSAL OF HAZARDOUS WASTE**

The State of Massachusetts requires that all hazardous waste (Oil, Solvents, Anti-freeze, etc.) must be disposed of by a licensed contractor in an environmentally safe manner.

Any charges for disposal of hazardous waste reflects our conformity to state law in addition to our concern for the preservation of the environment.

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE.

DESCRIPTION	TOTALS
LABOR AMOUNT	
PARTS AMOUNT	
GAS, OIL, LUBE	
SUBLET AMOUNT	
MISC. CHARGES	
TOTAL CHARGES	
LESS INSURANCE	
SALES TAX	
PLEASE PAY THIS AMOUNT	





# SERVICE REPAIR ORDER

596 Boston Post Road  
 Weston, Mass. 02493  
 Phone: (781) 647-7300  
 Fax: (781) 647-7335

<b>DATE</b>	<b>R.O. NO.</b>
5/3/2010	6940

CUSTOMER NAME & ADDRESS						
				TEL-(Bus)	TEL-(Home)	
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Mercedes	300SL	1960	Red	19804210002538	29,362	Mercedes B...
ITEM	QTY.	DESCRIPTION			PRICE	TOTAL
Other Labor	3	SERVICE AND MAINTENANCE: Road tested vehicle. Placed on lift. Drained engine oil, replaced filter and refilled with 20W50 motor oil. Removed wheels from vehicle. Flushed and bled brake system. Reinstalled wheels and torqued to factory specification. Replaced gear oil. Replaced transmission oil. Set tire pressures. Road Tested vehicle.				
m1206	1	Mobil 1 Oil Filter				
sbfi27012A	1	Dot 5 Brake Fluid				
831A	3	Gear Oil 80W90				
exxon20w50A	10	Exxon Superflow 20w50				
ATF-dexron6A	2	Mobil Dexron 6 Transmission Fluid				
Other Labor	12	ENGINE RUNNING ROUGH: Set base ignition timing and checked. Persistent ignition problem, started by analyzing and testing each component of the ignition system. Replaced fouled spark plugs that were two different heat ranges. Tested and replaced ignition condensers, ignition wires. Removed distributor from vehicle. Replaced ignition cap and rotor. Replaced ignition points and set up distributor on distributor machine. Performed final engine set up.				

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

**Total**



# SERVICE REPAIR ORDER

596 Boston Post Road  
 Weston, Mass. 02493  
 Phone: (781) 647-7300  
 Fax: (781) 647-7335

DATE	R.O. NO.
5/3/2010	6940

CUSTOMER NAME & ADDRESS							
				TEL-(Bus)	TEL-(Home)		
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.	
Mercedes	300SL	1960	Red	19804210002538	29,362	Mercedes B...	
ITEM	QTY.	DESCRIPTION			PRICE	TOTAL	
w7dcA 0001568401A 1981500319A 0001581090A 0001581102A 0001581431A		6	Bosch W7DC Spark Plug				
		2	Condesor				
		1	Ignition Wires 300SL Roadster				
		1	Dual Points				
		1	Distributor Cap				
		1	Distributor Rotor				
			Sales Tax				

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

**Total**

X \_\_\_\_\_





# SERVICE REPAIR ORDER

596 Boston Post Road  
 Weston, Mass. 02493  
 Phone: (781) 647-7300  
 Fax: (781) 647-7335

DATE	R.O. NO.
5/13/2011	7524

CUSTOMER NAME & ADDRESS						
				TEL--(Bus)	TEL--(Home)	
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Mercedes	300SL	1960	Red	19804210002538	29,784	
ITEM	QTY.	DESCRIPTION			PRICE	TOTAL
Mercedes Labor	7.5	OVERHEATING: Customer states car overheats in traffic. Found lower pipe on radiator crushed in and reducing coolant flow. Drained engine coolant, removed radiator from vehicle. Sent to Carroll's radiator to be repaired. Reinstalled in car. Replaced 1 lower and four upper cooling hose sections. Road Tested vehicle, rechecked coolant level and temperatures.				
lilienthal300slradA	1	Radiator Repair				
fhoseA	2	Ferrari Coolant Hose 2 Feet Total				
Misc. Fast.	6	Zebra Hose Clamps 32-50 mm				
Misc. Fast.	12	6 6mm bolts and 6mm nuts				
AntifreezeA	2	Antifreeze				
		Sales Tax				
					<b>Total</b>	

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

X



# SERVICE REPAIR ORDER

596 Boston Post Road  
 Weston, Mass. 02493  
 Phone: (781) 647-7300  
 Fax: (781) 647-7335

DATE	R.O. NO.
5/13/2011	7524

CUSTOMER NAME & ADDRESS						
				TEL-(Bus)	TEL-(Home)	
MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Mercedes	300SL	1960	Red	19804210002538	29,784	
ITEM	QTY.	DESCRIPTION			PRICE	TOTAL
Mercedes Labor	2	OIL CHANGE & CHECK OVER:				
		1) Road Tested vehicle and placed on lift. Drained engine oil, replaced filter and refilled with Exxon Mobil 20 W50.				
		2) Checked all other fluid levels, set tire pressures.				
		3) Engine Running: Ran back through engine timing , rechecked distributor settings, phase, gap and dwell.				
m1206A	1	Mobil 1 Oil Filter				
exxon20w50A	8.5	Exxon Superflow 20w50				
Misc. Fast.	2	Sealing Rings				

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

<b>Total</b>
--------------





# SERVICE REPAIR ORDER

596 Boston Post Road  
 Weston, Mass. 02493  
 Phone: (781) 647-7300  
 Fax: (781) 647-7335

DATE	R.O. NO.
8/14/2012	8202

**PAID** Thanks

<b>CUSTOMER NAME &amp; ADDRESS</b>					
				TEL-(Bus)	TEL-(Home)

CUSTOMER COPY

MAKE	MODEL	YEAR	COLOR	VIN	MILEAGE	LIC. NO.
Mercedes	300SL	1960	Red	19804210002538	30,436	

ITEM	QTY.	DESCRIPTION	PRICE	TOTAL
Mercedes Labor	7	SERVICE AND REPAIRS: 1) Road Tested vehicle, removed underpanels and placed on lift. 2) Performed complete check over of vehicle. 3) Drained engine oil, replaced filter and refilled with 20W50. 4) Replaced brake fluid, flushed brake system and bled brakes at all four wheels. 5) Replaced gearbox oil and refilled. 6) Replaced spark plugs. 7) Road tested vehicle and rechecked all fluid levels, set tire pressures.		
51045A	1	Oil Filter		
mobil20w50A	10	Mobil Special 20w50		
7900A	6	Spark Plug		
bf1200A	0.5	ATE Type 4 / 200 Brake Fluid		
atf-type fA	2	Valveoline Type F Automatic Trans Fluid		
		Sales Tax		

CUSTOMER COPY

I authorize you to perform the above repairs and furnish necessary materials. Your employees may operate the vehicle for inspection, testing and delivery at my risk. BSC is not responsible for articles left in vehicle. The seller hereby disclaims all warranties, either express or implied, including any implied warranty of merchantability or fitness for a particular purpose. Seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of this item/items.

X \_\_\_\_\_

**Total**