

BUS: CELL: SERVICE ADVISOR: 198 NICK KALUSTIAN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
BLACK	07	ASTON MARTIN DB9	SCFAD02A97GB08976		31516/31523	T1452
IN SVC. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 02APR21		CASH	05APR21
R.O. OPENED	READY	OPTIONS: DLR:6009				
10:34 30MAR21	13:49 05APR21					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A CLIENT REQUEST FOR TLC TRANSPORTATION FLATBED SERVICE (PICK UP AND/OR DELIVERY)
TOW CLIENT REQUEST FOR TLC TRANSPORTATION FLATBED SERVICE (PICK UP AND/OR DELIVERY)
153 CPAM

SUBL TLC TRANSPORT INVOICE# 204511 PO# 212 PO#212	0.00	0.00
31516 Tow in	195.00	195.00

B CLIENT STATES SLOW LEAK IN TIRE. PLEASE CHECK FOR POSSIBLE NAIL AND REPAIR IF POSSIBLE. ADVISE
001 SEE LINE H
153 CPAM

31516 See line H for repairs.	0.00	0.00
-------------------------------	------	------

C CHECK TIRE PRESSURES AND ADVISE. ADJUST TIRE PRESSURES TO FACTORY SPECIFICATION PER CALIFORNIA REQUIREMENTS. NOTE: LF _____ / _____, RF _____ / _____, LR _____ / _____, RR _____ / _____
BEFORE AND AFTER PSI READINGS.
TP CHECK TIRE PRESSURES AND ADVISE. ADJUST TIRE PRESSURES TO FACTORY SPECIFICATION PER CALIFORNIA REQUIREMENTS. NOTE: LF _____ / _____, RF _____ / _____, LR _____ / _____, RR _____ / _____
BEFORE AND AFTER PSI READINGS.

31516 Checked tires: Front 5/32nds above wear bars Rear 8/32nds above wear bars. Starting pressure: Front 32psi Rear 0psi. Set tire pressures to: Front 36psi Rear 38psi. (N/C)

D PLEASE TORQUE ALL WHEELS TO MANUFACTURES SPECIFICATIONS
LBS
TQ PLEASE TORQUE ALL WHEELS TO MANUFACTURES SPECIFICATIONS
LBS

ORIGINAL ESTIMATE \$		FINAL REVISED ESTIMATE \$			DESCRIPTION	TOTALS
DATE	TIME	PHONE # OR IN PERSON	AUTHORIZED BY	ADDITIONAL AMOUNT \$	LABOR AMOUNT	
REASON					REVISD TOTAL \$	PARTS AMOUNT
DATE	TIME	PHONE # OR IN PERSON	AUTHORIZED BY	ADDITIONAL AMOUNT \$	GAS, OIL, LUBE	
REASON					REVISD TOTAL \$	SUBLET AMOUNT
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.						MISC. CHARGES
I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.						TOTAL CHARGES
						ADJUSTMENTS
						SALES TAX
						PLEASE PAY THIS AMOUNT

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK
BAR # ARD00293445 EPA # CAL CAL000443037

CUSTOMER #: 52012

38639

WALNUT CREEK LUXURY CARS, LLC

dba, Alfa Romeo Walnut Creek,

Maserati Walnut Creek, Bentley Walnut Creek
2255 N. Main Street · Walnut Creek CA 94596
Phone: (925) 444-2000 · Fax: (925) 951-1600

INVOICE

PAGE 2

SERVICE ADVISOR: 198 NICK KALUSTIAN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
BLACK	07	ASTON MARTIN DB9	SCFAD02A97GB08976		31516/31523	T1452
IN SVC. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 02APR21		CASH	05APR21
R.O. OPENED	READY	OPTIONS: DLR:6009				
10:34 30MAR21	13:49 05APR21					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
							(N/C)

153 ISP
 31516 Torqued all wheels to 132 ft lbs. Completed

 E PERFORM COMPLIMENTARY MULTI POINT INSPECTION
 MPI PERFORM COMPLIMENTARY MULTI POINT INSPECTION
 153 ISP
 31516 Performed multi-point inspection

 F PLEASE ADVISE WHEN NEXT MAINTENANCE SERVICE IS DUE BY TIME AND/OR MILEAGE
 SVC PLEASE ADVISE WHEN NEXT MAINTENANCE SERVICE IS DUE BY TIME AND/OR MILEAGE

153 ISP
 31516 Next service due in 1 year 10,000 miles

 G Repairs to your vehicle may be delayed due to shortages caused by COVID19 (Coronavirus) and its impact on the availability of parts and/or labor. Luxury Cars Walnut Creek want to apologize for any inconvenience which was out of our control.
 COVID19 Repairs to your vehicle may be delayed due to shortages caused by COVID19 (Coronavirus) and its impact on the availability of parts and/or labor. Luxury Cars Walnut Creek want to apologize for any inconvenience which was out of our control.

153 ISP
 31516 Note

 H** CLIENT REQUEST TO REPLACE 2 TIRES - MOUNT AND ROAD FORCE BALANCE
 2TIRE CLIENT REQUEST TO REPLACE 2 TIRES - MOUNT AND ROAD FORCE BALANCE

153 CPAM	765.00	151.07	151.07
2 001292 27535R19 BRIDGESTONE	452.96	452.96	905.92

ORIGINAL ESTIMATE \$	FINAL REVISED ESTIMATE \$	DESCRIPTION	TOTALS
		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		ADJUSTMENTS	
		SALES TAX	
<input checked="" type="checkbox"/> I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.		<input checked="" type="checkbox"/> I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.	
		PLEASE PAY THIS AMOUNT	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK BAR # ARD00293445 EPA # CAL CAL000443037

CUSTOMER #: 52012

38639

WALNUT CREEK LUXURY CARS, LLC

dba, Alfa Romeo Walnut Creek,

Maserati Walnut Creek, Bentley Walnut Creek
2255 N. Main Street · Walnut Creek CA 94596
Phone: (925) 444-2000 · Fax: (925) 951-1600

INVOICE

PAGE 3

SERVICE ADVISOR: 198 NICK KALUSTIAN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
BLACK	07	ASTON MARTIN DB9	SCFAD02A97GB08976		31516/31523	T1452
IN SVC. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 02APR21		CASH	05APR21
R.O. OPENED	READY	OPTIONS: DLR:6009				
10:34 30MAR21	13:49 05APR21					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
					8.49	8.49	16.98
					1.75	1.75	3.50

2 BOE TIRE TAX FEE
31516 0.00

Checked and found damaged right rear tire. Replaced both rear tires as a set. Performed road force match balance. Completed
Dot# EJ9HJMK 4520

I** CLIENT REQUEST TO PERFORM 13 YEAR / 30K MILE MAINTENANCE SERVICE
INTERVAL FOR 2004 - 2012 DB9 AND DBS VEHICLES

AMDB9-3 TECH NOTES

153 CPAM

OILFEE HAZARDOUS WASTE DISPOSAL FEE

1 AG43-6714-AA-PK OIL FILTER

1 697748-PK OIL PAN DRAIN PLUG

1 1R12-08-10317-PK O-RING

1 700781-PK BR FLUID REACT

12 G0529302B ENGINE OIL

2 CR2032 KEY BATTERY

153 CPAM	1682.23	1682.23
OILFEE HAZARDOUS WASTE DISPOSAL FEE	9.62	9.62
1 AG43-6714-AA-PK OIL FILTER	72.14	72.14
1 697748-PK OIL PAN DRAIN PLUG	26.87	16.75
1 1R12-08-10317-PK O-RING	5.79	5.79
1 700781-PK BR FLUID REACT	46.98	30.35
12 G0529302B ENGINE OIL	26.75	18.35
2 CR2032 KEY BATTERY	8.07	6.46

31523 6.50 Performed Thirteen year or 130,000 mile service. Renewed engine oil and filter. Added twelve quarts of Mobil One 0W40. Inspected suspension, chassis, and exhaust components. Checked operation of seat belts. Checked interior and exterior lights. Checked engine, transmission, differentials, brake components and fuel system for leaks. Check convertible top roof operation. Renewed brake fluid, and key fob battery. Attached scan tool and scanned vehicle. Reset service reminder. Checked brake pad thickness: Front 9mm and Rear 6mm. Checked tread depth: Front 5/32nds above wear bar indicator and Rear 8/32nds above wear bar indicator. Set tire pressure to: Front 36psi, Rear 38psi. Performed road test, operating the same as similar / like vehicles. Completed

ORIGINAL ESTIMATE \$		FINAL REVISED ESTIMATE \$		DESCRIPTION	TOTALS
DATE	TIME	PHONE # OR IN PERSON	AUTHORIZED BY	LABOR AMOUNT	
REASON				PARTS AMOUNT*	
REASON				GAS, OIL, LUBE	
REASON				SUBLET AMOUNT	
REASON				MISC. CHARGES	
REASON				TOTAL CHARGES	
REASON				ADJUSTMENTS	
REASON				SALES TAX	
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.		I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.		PLEASE PAY THIS AMOUNT	
X		X			

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

BAR # ARD00293445

EPA # CAL CAL000443037

CUSTOMER #: 52012

38639

WALNUT CREEK LUXURY CARS, LLC
dba. Alfa Romeo Walnut Creek,
Maserati Walnut Creek, Bentley Walnut Creek
2255 N. Main Street · Walnut Creek CA 94596
Phone: (925) 444-2000 · Fax: (925) 951-1600

INVOICE

PAGE 4

SERVICE ADVISOR: 198 NICK KALUSTIAN

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
BLACK	07	ASTON MARTIN DB9	SCFAD02A97GB08976		31516/31523	T1452
IN SVC. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 02APR21		CASH	05APR21
R.O. OPENED	READY	OPTIONS: DLR:6009				
10:34 30MAR21	13:49 05APR21					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
EST:	3,322.47			01APR21 08:02	SA: 198		
CONTACT: MARK STEFFAN				(415) 298-1211			
2 TIRES & SERVICE							



ORIGINAL ESTIMATE \$	FINAL REVISED ESTIMATE \$	DESCRIPTION	TOTALS
		LABOR AMOUNT	1833.30
		PARTS AMOUNT	1264.07
		GAS, OIL, LUBE	0.00
		SUBLET AMOUNT	195.00
		MISC. CHARGES	30.10
		TOTAL CHARGES	3322.47
		ADJUSTMENTS	0.00
		SALES TAX	104.29
<input checked="" type="checkbox"/> I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.		<input checked="" type="checkbox"/> I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.	
		PLEASE PAY THIS AMOUNT	3426.76

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK BAR # ARD00293445 EPA # CAL CAL000443037

CUSTOMER #: 606069

323536

LUXURY CARS-LOS GATOS, LLC

INVOICE

dba, Lamborghini Los Gatos, Bentley Los Gatos, Rolls Royce Los Gatos, Aston Martin Los Gatos, Bugatti Los Gatos 620 Blossom Hill Road · Los Gatos CA 95032 (408) 335-6389 · Fax (408) 709-2010

PAGE 1

BAR # ARD00293552 EPA # CAL000443043

SERVICE ADVISOR: 4068 ALEX ASTAR

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG. Values: 07, ASTON MARTIN DB9, SCFAD02A97GB08976, 31106/31114, T5146. Includes DEL DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., PAYMENT, INV. DATE.

Table with columns: R.O. OPENED, READY, OPTIONS, LIST, NET, TOTAL. Values: 12:12 17JUN20, 08:52 30JUN20, DLR:NONE, 2193.00, 2193.00.

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

A MPI VIDEO

CAUSE: MPI VIDEO AND SEND RESULTS TO CUSTOMER

MPIV MPI VIDEO

4072 IA (N/C)

PERFORMED MPI. FOUND - FRONT BRAKES AT 4 MM. RIGHT UPPER DASH PANEL LEATHER WARPED. MISSING RIGHT TONNEAU TRIM. P/A ITEMS ON 6/23/2020.

B Repairs to your vehicle may be delayed due to shortages caused by COVID-19 (Coronavirus) and its impact on the availability of parts and/or labor. Although this situation is beyond the control of This Dealership and Manufacture,

CAUSE: We apologize for any inconvenience, and will do our best to complete the work on your vehicle as soon as possible.?

COVID Repairs to your vehicle may be delayed due to shortages caused by COVID-19

(Coronavirus) and its impact on the availability of parts and/or labor. Although this situation is beyond the control of This Dealership and Manufacture,

4072 IA (N/C)

C LUXURY CARS LOS GATOS TRANSPORT FROM ORINDA

CAUSE: LUXURY CARS LOS GATOS TRANSPORT

LCLGT LUXURY CARS LOS GATOS TRANSPORT

4072 IA (N/C)

MISC TRANSPORT TO AND FROM ORINDA

PO#4007 IA (N/C)

D PERFORM 2 YEAR/20,000 MILE SERVICE PER FACTORY MENU

CAUSE: PERFORMED SERVICE PER ATTACHED MENU

DB92 PERFORM 2 YEAR/20,000 MILE SERVICE PER

FACTORY MENU

4072 CPA 2193.00 2193.00

ORIGINAL ESTIMATE \$

FINAL REVISED ESTIMATE \$

DESCRIPTION TOTALS

LABOR AMOUNT

PARTS AMOUNT

GAS, OIL, LUBE

SUBLET AMOUNT

MISC. CHARGES

TOTAL CHARGES

ADJUSTMENTS

SALES TAX

PLEASE PAY THIS AMOUNT

I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.

I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm.

Copyright 2014 CDK Global, LLC SERVICE INVOICE TYPE 2 - S12C - IMAGING

CUSTOMER COPY

CUSTOMER #: 606069

323536

LUXURY CARS-LOS GATOS, LLC

INVOICE

dba, Lamborghini Los Gatos, Bentley Los Gatos, Rolls Royce Los Gatos, Aston Martin Los Gatos, Bugatti Los Gatos
620 Blossom Hill Road · Los Gatos CA 95032
(408) 335-6389 · Fax (408) 709-2010

PAGE 2

BAR # ARD00293552 EPA # CAL000443043

SERVICE ADVISOR: 4068 ALEX ASTAR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
	07	ASTON MARTIN DB9	SCFAD02A97GB08976		31106/31114	T5146
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 30JUN20		0.00 CASH	30JUN20
R.O. OPENED	READY	OPTIONS:	DLR:NONE			
12:12 17JUN20	08:52 30JUN20					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	AG43-6714-AA	OIL FILTER(SINGLE)			47.66	47.66	47.66
13	PY112988PA	0W40 1 LITRE			12.95	12.95	168.35
1	4G43-04-10205	PLUG-OIL PAN DRAIN			22.16	22.16	22.16
1	4G43-9601-AB-PK	FILTER AIR CLNR-(2)			182.76	182.76	182.76
1	700781	RESPONSE SUPER DOT 4			28.44	28.44	28.44
1	2943	WW FLUID			4.99	4.99	4.99
1	4G43-13ZE1-AA-PK	FILTER-POLLEN(2)			87.76	87.76	87.76
1	89150201	PARTS CLEANER			25.50	25.50	25.50
1	CR2032	3V BATTERY			4.95	4.95	4.95
1	1R12-08-10317	O RING			2.28	2.28	2.28
1	9G43-17B437-AA	BLADE ASSY W/WPR LH			51.86	51.86	51.86
1	4G43-17528-CA	PASS SIDE BLADE ASSY			44.83	44.83	44.83

PERFORMED 12 YEAR SERVICE PER CHECKLIST.

E** REPLACE FRONT BRAKES

00.00.612 REPLACE FRONT BRAKES

4072	CPA					774.00	774.00
1	7G43-2D007-AA	BRAKE PAD KIT-FRONT			595.33	595.33	595.33
2	4G43-28-10265	FRONT BRAKE DISC (1)			284.98	284.98	569.96
4	4G43-2C564-AB	BOLT-M12 X 1.5 X 80			5.43	5.43	21.72
2	4G43-2L507-AB	PAD WEAR LEAD FRONT			49.67	49.67	99.34
6	4G43-65-10059	CLIP-FIRTREE 5X6.5X2			0.60	0.60	3.60
1	89150201	PARTS CLEANER			25.50	25.50	25.50

VERIFIED FRONT BRAKES AT 4 MM. P/A PARTS ON 6/23/2020. REPLACED FRONT BRAKE PADS, ROTORS, CALIPER BOLTS, AND WEAR SENSORS. ROAD TESTED, NO ISSUES NOTICED WITH BRAKES.







F** CUSTOMER REQUEST TO SEND OUT THE ONE DASH PANEL FOR LEATHER

RECOVERY. PLEASE CHECK AND ADVISE

9996 STANDARD

4072	CPA					516.00	516.00
1	4G43-C043C54-CHW	CVR ASY I/PNL UPR PA			416.16	350.00	350.00

VERIFIED UPPER RIGHT LEATHER DASH PANEL WARPED. P/A DASH PANEL ON 6/23/2020. REPLACED UPPER RIGHT LEATHER DASH PANEL.

 BENTLEY	 ASTON MARTIN	ORIGINAL ESTIMATE \$	FINAL REVISED ESTIMATE \$			DESCRIPTION	TOTALS
		DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL
 ROLLS ROYCE	 LOTUS						PARTS AMOUNT
 Lamborghini	 BUGATTI						SUBLET AMOUNT
		I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.			I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.		TOTAL CHARGES
		X			X		ADJUSTMENTS
ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.							SALES TAX
							PLEASE PAY THIS AMOUNT

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.cdph.ca.gov/propp65.html>

CUSTOMER #: 606069

323536

LUXURY CARS-LOS GATOS, LLC

INVOICE

dba, Lamborghini Los Gatos, Bentley Los Gatos, Rolls Royce Los Gatos, Aston Martin Los Gatos, Bugatti Los Gatos 620 Blossom Hill Road · Los Gatos CA 95032 (408) 335-6389 · Fax (408) 709-2010

PAGE 3

BAR # ARD00293552 EPA # CAL000443043

SERVICE ADVISOR: 4068 ALEX ASTAR

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG, DEL DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., PAYMENT, INV. DATE. Includes details for ASTON MARTIN DB9 and service dates.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL

G** CUSTOMER REQUEST TO PERFORM THE REAR DIFFERENTIAL FLUID SERVICE 9996 STANDARD 4072 CPA 2 704349 OIL-75W 90 (1LTR) 60.08 60.08 120.16

VERIFIED DIFFERENTIAL NOISY DURING TIGHT TURNS. P/A DIFF SERVICE AND RESTEST AFTER 100 MILES ON 6/24/2020. PERFORMED DIFF SERVICE.

H** CUSTOMER REQUEST TO DIAGNOSE THE CONVERTIBLE TOP TRIM MISSING. PLEASE CHECK AND ADVISE

9996 STANDARD 4072 CPA 1 4G43-L53296-AA LINK F/TOP LAT ROD 61.90 61.90 61.90 1 4G43-17431-AA SPRING 3.54 3.54 3.54

VERIFIED RIGHT SIDE SOFT-TOP TRIM PANEL DOESN'T MOVE OPEN / CLOSED. INSPECTED PANEL, FOUND ROD BROKEN. P/A ROD / SPRING KIT ON 6/24/2020. REPLACED RIGHT ROD / SPRING ASSEMBLY. TESTED, SOFT-TOP TRIM PANEL FIXED.

EST: 6,876.00 24JUN20 09:13 SA: 4068 CONTACT: MARK STEFAN (415)298-1211 FRONT BRAKES, REAR DIFF, DASH PANEL AND TOP DIAGNO

EST: 2,975.00 17JUN20 12:12 SA: 4068 CONTACT:

Table with columns: ORIGINAL ESTIMATE, FINAL REVISED ESTIMATE, DESCRIPTION, TOTALS. Includes logos for Bentley, Aston Martin, Rolls Royce, Lotus, and Bugatti.

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. This invoice is a customer copy.

CUSTOMER #: 606069

320941

LUXURY CARS-LOS GATOS, LLC

dba, Lamborghini Los Gatos, Bentley Los Gatos, Rolls Royce Los Gatos, Aston Martin Los Gatos, Bugatti Los Gatos
620 Blossom Hill Road · Los Gatos CA 95032
(408) 335-6389 · Fax (408) 709-2010

INVOICE

PAGE 1

BAR # ARD00293552 EPA # CAL000443043

SERVICE ADVISOR: 4068 ALEX ASTAR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
	07	ASTON MARTIN DB9	SCFAD02A97GB08976		30753/30756	T4517
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 21JUN19		0.00 CASH	20JUN19
R.O. OPENED	READY	OPTIONS:	DLR:NONE			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A MPI VIDEO
 CAUSE: MPI VIDEO AND SEND RESULTS TO CUSTOMER
 MPIV MPI VIDEO
 4013 IA (N/C)

B LOS GATOS LUXURY CAR TRANSPORT FROM ORINDA
 CAUSE: LOS GATOS LUXURY CAR TRANSPORT
 LGLCT LOS GATOS LUXURY CAR TRANSPORT
 4013 CPA 0.00 0.00

MISC TRASNPORT FROM ORINDA
 PO#4007 CPA 305.00 305.00
 MISC TRASNPORT BACK TO ORINDA
 PO#4007 CPA 305.00 305.00

C PERFORM 1 YEAR/10,000 MILE SERVICE PER FACTORY MENU
 CAUSE: PERFORMED SERVICE PER ATTACHED MENU
 DB91 PERFORM 1 YEAR/10,000 MILE SERVICE PER FACTORY MENU
 4013 CPA 1548.00 1548.00
 1 AG43-6714-AA OIL FILTER (SINGLE) 61.96 61.96 61.96
 13 PY112988PA 0W40 1 LITRE 12.95 12.95 168.35
 1 4G43-04-10205 PLUG-OIL PAN DRAIN 36.00 36.00 36.00
 1 700781 RESPONSE SUPER DOT 4 49.78 49.78 49.78
 1 CR2032 3V BATTERY 4.95 4.95 4.95
 1 89150201 PARTS CLEANER 25.50 25.50 25.50
 1 2943 WW FLUID 4.99 4.99 4.99
 1 1R12-08-10317 O RING 4.44 4.44 4.44

CARRY OUT ONE YEAR SERVICE. R/H SOFT TOP HINGE COVER BROKE . DASH PANEL WARPED, BRAKE SQUEAL .

ORIGINAL ESTIMATE \$		FINAL REVISED ESTIMATE \$				DESCRIPTION	TOTALS
						LABOR AMOUNT	1548.00
						PARTS AMOUNT	355.97
DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	GAS, OIL, LUBE	0.00
						SUBLET AMOUNT	0.00
						MISC. CHARGES	610.00
						TOTAL CHARGES	2513.97
						ADJUSTMENTS	0.00
I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.		I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.				SALES TAX	32.48
X		X				PLEASE PAY THIS AMOUNT	2546.45

CUSTOMER #: 606069

318274

ASTON MARTIN LOS GATOS

INVOICE

620 Blossom Hill Rd., Los Gatos, CA 95032

(408) 358-7777

www.losgatosluxcars.com

PAGE 1

BAR # ARD-260275 EPA # CAL 000348002

SERVICE ADVISOR: 4068 ALEX ASTAR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
	07	ASTON MARTIN DB9	SCFAD02A97GB08976		27199/27208	T3236
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD	20OCT2010	17:00	08JUN18		0.00 CASH	13JUN18
R.O. OPENED	READY	OPTIONS: DLR:NONE				
10:34 30MAY18	13:18 13JUN18					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A MPI VIDEO
 CAUSE: MPI VIDEO AND SEND RESULTS TO CUSTOMER
 MPIV MPI VIDEO
 4072 IA (N/C)
 Performed MPI.

B PERFORM 10 YEAR/100,000 MILE SERVICE PER FACTORY MENU
 CAUSE: PERFORMED SERVICE PER ATTACHED MENU
 DB910 PERFORM 10 YEAR/100,000 MILE SERVICE PER
 FACTORY MENU

DESCRIPTION	LIST	NET	TOTAL
4072 CPA		2772.00	2772.00
1 AG43-6714-AA OIL FILTER (SINGLE)	61.96	61.96	61.96
13 PY112988PA 0W40 1 LITRE	12.95	12.95	168.35
1 4G43-04-10205 PLUG-OIL PAN DRAIN	33.78	33.78	33.78
1 1R12-08-10317 O RING	4.44	4.44	4.44
1 700781 RESPONSE SUPER DOT 4	49.78	49.78	49.78
1 2943 WW FLUID	4.99	4.99	4.99
1 89150201 PARTS CLEANER	25.50	25.50	25.50
1 CR2032 3V BATTERY	4.95	4.95	4.95
1 9G43-17B437-AA BLADE ASSY W/WPR LH	72.60	72.60	72.60
1 4G43-17528-CA PASS SIDE BLADE ASSY	62.76	62.76	62.76
1 4G43-9601-AB-PK FILTER AIR CLNR-(2)	202.83	202.83	202.83
1 4G43-13ZE1-AA-PK FILTER-POLLEN(2)	104.88	104.88	104.88
1 DEXCOOL COOLANT/ANTIFREEZE	34.69	34.69	34.69
1 CCKV2 TIRE INFL KIT	220.00	220.00	220.00

Performed 10 year service per checklist. Noticed = Center brake light inop. Front brakes 5 mm. Rear brakes 2 mm. Front / rear tires 6 years old and cracking. Front tires 5 mm. Rear tires 3 mm. Recommend alignment with new tires. Hood struts weak. Both door struts weak. Tire sealant expired. Right tonneau trim cover rod broken. Right upper dash panel leather shrinking. P/A needed parts on 5/30/18.

D CUSTOMER STATES THAT THE BRAKE WARNING LIGHT IS ON. PLEASE CHECK AND ADVISE

ORIGINAL ESTIMATE \$				FINAL REVISED ESTIMATE \$			DESCRIPTION	TOTALS
				DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT
							PARTS AMOUNT	
							GAS, OIL, LUBE	
							SUBLET AMOUNT	
							MISC. CHARGES	
							TOTAL CHARGES	
							ADJUSTMENTS	
							SALES TAX	
							PLEASE PAY THIS AMOUNT	

I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE. I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.

CUSTOMER COPY

CUSTOMER #: 606069

318274

ASTON MARTIN LOS GATOS

INVOICE

620 Blossom Hill Rd., Los Gatos, CA 95032

(408) 358-7777

www.losgatosluxcars.com

PAGE 2

BAR # ARD-260275 EPA # CAL 000348002

SERVICE ADVISOR: 4068 ALEX ASTAR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
	07	ASTON MARTIN DB9	SCFAD02A97GB08976		27199/27208	T3236
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 08JUN18		0.00 CASH	13JUN18
R.O. OPENED	READY	OPTIONS: DLR:NONE				

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

9996 STANDARD
4072 IA (N/C)

Verified brake warning on instrument cluster, related to rear brake pad sensors. Also noticed center brake light inop. P/A rear brake job and center brake light.

E** CUSTOMER REQUEST TO CHECK THE FRONT BUMPER CLEAR BRA AND ADVISE.

9996 STANDARD
4072 CPA 0.00 0.00

F** CUSTOMER REQUEST TO REPLACE THE NON OPERATIONAL 3RD BRAKE LAMP

ASSEMBLY
9996 STANDARD
4072 CPA 504.00 504.00
1 4G43-13N408-BE LAMP ASSY - CHMSL 303.77 303.77 303.77

Verified center brake light inop. P/A center brake light assembly. For access removed trunk lid trim panel. Replaced center brake light. Tested, verified all light working.

G** REPLACE REAR BRAKES


3421930 REPLACE REAR BRAKES
4072 CPA 756.00 756.00
1 4G43-28-10942 RR BR PADS& SHIM SET 674.66 674.66 674.66
2 4G43-28-10266 REAR BRAKE DISC (1) 329.18 329.18 658.36
4 4G43-2C564-AB BOLT M12 X 1.5 X 80 5.31 5.31 21.24
2 4G43-2D009-AB PAD WEAR LEAD REAR 66.96 66.96 133.92

Verified rear brakes at 2 mm. Replaced rear rotors, brake pads, wear sensors, and caliper bolts. Road tested and performed brake bedding in procedure. No issues noticed with brakes.

H** INSTALL 4 TIRES BALANCE AND RESET TIRE PRESSURES

CAUSE: REPLACE 4 TIRES BALANCE AND RESET TIRE PRESSURES

T4 INSTALL 4 TIRES BALANCE AND RESET TIRE PRESSURES

	ORIGINAL ESTIMATE \$			FINAL REVISED ESTIMATE \$			DESCRIPTION	TOTALS
	DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	
							PARTS AMOUNT	
							GAS, OIL, LUBE	
							SUBLET AMOUNT	
							MISC. CHARGES	
							TOTAL CHARGES	
							ADJUSTMENTS	
							SALES TAX	
							PLEASE PAY THIS AMOUNT	

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE. X

I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE. X

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from cleaning your vehicle. 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>.

CUSTOMER #: 606069

318274

ASTON MARTIN LOS GATOS

INVOICE

620 Blossom Hill Rd., Los Gatos, CA 95032

(408) 358-7777

www.losgatosluxcars.com

PAGE 3

BAR # ARD-260275 EPA # CAL 000348002

SERVICE ADVISOR: 4068 ALEX ASTAR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
	07	ASTON MARTIN DB9	SCFAD02A97GB08976		27199/27208	T3236
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 08JUN18		0.00 CASH	13JUN18
R.O. OPENED	READY	OPTIONS: DLR:NONE				
10:34 30MAY18	13:18 13JUN18					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
	4072	CPA				200.00	200.00
2	038089	235/40-19	9G43-1508-AA	AM BRIDGESTONE			
	POTENZA	RE50A			306.00	306.00	612.00
2	TIRE	California Tire Fee			1.75	1.75	3.50
2	038106	275/35R19	BRIDGE		422.80	422.80	845.60
2	TIRE	California Tire Fee			1.75	1.75	3.50

Verified all tires 6 year old. Front at 5 mm / Rear at 3 mm. Mount and balanced all tires. Road tested, no issues noticed with tires.

I** 4 WHEEL ALIGNMENT

4WA 4 WHEEL ALIGNMENT

4072 CPA

1008.00 1008.00

Performed four wheel alignment. Adjusted front camber, toe / Rear camber, toe to spec. Road tested, no issues noticed with alignment or steering wheel level.

J** CUSTOMER REQUEST TO REPLACE THE HOOD STRUTS

9996 STANDARD

4072 CPA

252.00 252.00

2 4G43-16C826-AB GAS SPRING ASY

71.42 71.42 142.84

Verified hood struts weak. Replaced both hood struts.

K** CUSTOMER REQUEST TO REPLACE THE DOOR STRUTS

9996 STANDARD

4072 CPA

756.00 756.00

2 4G43-23504-AB ARM ASY FR DR CHECK

65.40 65.40 130.80

Verified both door struts weak. For access removed front tires and wheel liner. Replaced both door struts. Installed removed items. Tested, verified fault fixed.

L** CUSTOMER REQUEST TO REPLACE THE BROKEN TANNEAU COVER FLAP

9996 STANDARD

4072 CPA

252.00 252.00

1 4G43-L53296-AA LINK F/TOP LAT ROD

60.40 60.40 60.40

ORIGINAL ESTIMATE			FINAL REVISED ESTIMATE			DESCRIPTION	TOTALS
\$			\$			LABOR AMOUNT	
						PARTS AMOUNT	
DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	GAS, OIL, LUBE	
						SUBLET AMOUNT	
						MISC. CHARGES	
						TOTAL CHARGES	
						ADJUSTMENTS	
I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.			I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.			SALES TAX	
X			X			PLEASE PAY THIS AMOUNT	



ASTON MARTIN

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code 13243.5 et seq.) For further information about Proposition 65: http://www.oehha.org/propp65.html

CUSTOMER #: 606069

318274

ASTON MARTIN LOS GATOS

INVOICE

620 Blossom Hill Rd., Los Gatos, CA 95032

(408) 358-7777

www.losgatosluxcars.com

PAGE 4

BAR # ARD-260275 EPA # CAL 000348002

SERVICE ADVISOR: 4068 ALEX ASTAR

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
	07	ASTON MARTIN DB9	SCFAD02A97GB08976		27199/27208	T3236
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 08JUN18		0.00 CASH	13JUN18
R.O. OPENED	READY	OPTIONS: DLR:NONE				

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
1	4G43-1861-AA	CLIP			1.38	1.38	1.38
1	4G43-17431-AA	SPRING			3.42	3.42	3.42
1	4G43-338013-AA	PLUG BLANKING			0.78	0.78	0.78
1	4G43-103021-AB	FIX PUSH ON			2.92	2.92	2.92

Verified right tanneau cover flap doesn't move. Inspected flap assembly and found rod that moves the flap is missing. P/A needed parts on 5/30/18. Installed new rod, spring, and clamp. Tested, verified cover flap fixed.


M** CUSTOMER REQUEST TO REPLACE ALL FOUR TPMS SENSORS
9996 STANDARD

4072 CPA

4 CG33-360671-AA TPMS VALVE SERVICE	379.37	379.37	1517.48
-------------------------------------	--------	--------	---------

Replaced all TPM sensor. Coded sensor to vehicle. Road tested, verified system fixed.

ASTON MARTIN

 ASTON MARTIN ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.	ORIGINAL ESTIMATE \$ _____			FINAL REVISED ESTIMATE \$ _____			DESCRIPTION	TOTALS
	DATE			PHONE #			LABOR AMOUNT	6752.00
	TIME			AUTHORIZED			PARTS AMOUNT	6161.08
	ADDITIONAL AMOUNT			REVISED TOTAL			GAS, OIL, LUBE	0.00
							SUBLET AMOUNT	0.00
							MISC. CHARGES	7.00
							TOTAL CHARGES	12920.08
I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.			I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.			ADJUSTMENTS	0.00	
X _____			X _____			SALES TAX	554.50	
						PLEASE PAY THIS AMOUNT	13474.58	

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, greases, grime, touch-up paint, certain replacement parts, and particulates from cleaning your vehicle. 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.cdph.ca.org/prop65.html>.

CUSTOMER COPY

Aston Martin Vehicle Maintenance Check Sheet

Always use body interior and exterior protection and the correct grades of lubricants and fluids. Tick the box in column "C" when the check is complete and tick in column "A" if corrective work is necessary.

FULLY CLEAN THE VEHICLE AND THE WORK AREA.

Owner: Mark Stefan

Date 5-30-18

Vehicle Reg. No.:

Key No.:

Model/Derivative: 2007 DB9 V.i.

Odometer (km(mils)): 27199

VIN: B08976

Dealer Job/Invoice No.: 318274

12 Months
10,000 mls
16,000 km

24 months
20,000 mls
32,000 km

Pre-Maintenance

			C	A
x	x	Install the vehicle protection kit and wing covers	<input checked="" type="checkbox"/>	
x	x	Do a check of the Campaign Status	<input checked="" type="checkbox"/>	

Fluid, Filters and Inspect for Leaks

			C	A
x	x	Examine the engine for oil leaks	<input checked="" type="checkbox"/>	
x	x	Renew the engine oil (use the correct specification)	<input checked="" type="checkbox"/>	
x	x	Renew the engine oil filter	<input checked="" type="checkbox"/>	
-	x	Renew the air cleaner element(s) (V12 Engines)	<input checked="" type="checkbox"/>	
Every 3 years or 30,000 mls (48,000 km)		Renew the air cleaner element(s) (V8 Engines)		
x	-	Examine the transmission and final drive for condition and leaks. Fill if necessary		
Every 6 years 60,000 mls 96,000 km	Every 10 years 100,000 mls 160,000 km	Do a check of the manual transaxle oil level. Fill if necessary	<input checked="" type="checkbox"/>	
Every 4 years or 40,000 mls (64,000 km)		Renew the manual transaxle oil and clean the filter		
Every 4 years or 40,000 mls (64,000 km)		Renew the automatic differential oil and clean the filter		
x	x	Examine the engine cooling and occupant heating system for condition and leaks. Fill if necessary	<input checked="" type="checkbox"/>	
Every 5 years or 50,000 mls (80,000 km)		Renew the engine coolant - 50/50 concentration	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of the fuel system, hoses, pipes and unions for leaks	<input checked="" type="checkbox"/>	
Every 12 months		Renew the brake/clutch fluid (use the correct specification) (V12 engines)	<input checked="" type="checkbox"/>	
Every 24 months		Renew the brake/clutch fluid (use the correct specification) (V8 engines)		
x	x	Examine the brake/clutch fluid level. Fill if necessary	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of the power steering system, hose, pipes and unions	<input checked="" type="checkbox"/>	
x	x	Examine the power steering fluid level and fill if necessary	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of the brake system, hoses, pipes and unions	<input checked="" type="checkbox"/>	
x	x	Examine the condition of the suspension dampers for leaks	<input checked="" type="checkbox"/>	
x	x	Examine the condition of the exhaust system for leaks	<input checked="" type="checkbox"/>	
x	x	Examine the level of the the windscreen and headlamp washer reservoir. Fill if necessary	<input checked="" type="checkbox"/>	
x	x	Do a check of the exhaust bypass valve operation at 800/3000 rpm	<input checked="" type="checkbox"/>	

Model Applicability:

V8 and V12 Vantage, Vantage S, DB9, DBS, Rapide, Virage. For all other models please use the applicable Maintenance Check Sheet.

Note: For maximum customer satisfaction, we recommend that you do a road test before the maintenance is done, and again when the work is complete.

x	x	Examine the condition and attachment of the air conditioning system, hoses, pipes and unions. Use UV to do a check for leaks	<input checked="" type="checkbox"/>	
-	x	Renew the pollen filter	<input checked="" type="checkbox"/>	

12 Months
10,000 mls
16,000 km

24 months
20,000 mls
32,000 km

Mechanical Function Check

			C	A
x	x	Examine the condition, attachment, correct operation and lubricate all door locks, latches, hinges and joints.	<input checked="" type="checkbox"/>	
x	x	Examine the condition, attachment, correct operation and lubricate the bonnet catch.	<input checked="" type="checkbox"/>	
x	x	Examine the condition, attachment, correct operation and lubricate the secondary bonnet catch(es).	<input checked="" type="checkbox"/>	
x	x	Examine the condition and tension of the accessory drive belt. Adjust or replace if necessary	<input checked="" type="checkbox"/>	
x	x	Examine the cooling pack radiator, condenser and transmission cooler for blockage and unwanted material. Clean if necessary	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of the cooling system hoses	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of the air conditioning hoses	<input checked="" type="checkbox"/>	
Every 4 Years or 40,000 miles (64,000 km)		Clean the throttle butterflies (V12 only)		
x	x	Examine the condition and attachment of the wiper blades. Replace if necessary	<input checked="" type="checkbox"/>	
x	x	Examine the condition and operation of all seat belts and buckles	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of the rear view mirror	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of the handbrake and the handbrake pads	<input checked="" type="checkbox"/>	
x	x	Examine the condition, attachment and adjustment of the handbrake cables. Adjust if necessary	<input checked="" type="checkbox"/>	
x	x	Examine the condition of the brake pads, brake discs and calipers. At 60% wear, replace the brake pads and pad wear sensors. For CCM Brakes, at every 3rd pad change, clean, dry, weigh and examine the condition of the brake discs	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of front brake disc shields for fatigue, cracks and the clearance from the discs	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of all suspension, ball joints, gaiters, bushes and fixings	<input checked="" type="checkbox"/>	
-	x	Examine the condition and attachment of the driveshafts	<input checked="" type="checkbox"/>	
x	x	Examine the condition and attachment of the exhaust system, mountings and heatshields	<input checked="" type="checkbox"/>	
-	x	Examine the condition and attachment of the wheel arch liners and the underbody protection	<input checked="" type="checkbox"/>	

Maintenance time intervals should always be obeyed, even with low service mileages, to keep the vehicle at the best performance and condition.

Aston Martin Vehicle Maintenance Check Sheet

12 Months
10,000 mls
16,000 km

24 months
20,000 mls
32,000 km

Electrical Function Test

Every 70,000 mls (112,000 km)			C	A
x	x	Renew the spark plugs		
x	x	Measure and record the battery voltage	x	
x	x	Examine the condition and attachment of the battery connections. Adjust if necessary	x	
x	x	Do a functional test of the battery disconnect switch	x	
x	x	Examine the condition and attachment of all lamp units	x	
-	x	Do a check of the headlamp alignment. Adjust if necessary	x	
x	x	Do a functional test of all of the lights and the auto-sense function	x	
x	x	Do a functional test of all warning indicators	x	
x	x	Do a functional test of the audible warnings and security system	x	
x	x	Do a functional test of the horns	x	
x	x	Do a functional test of the windscreen wipers and auto-sense function	x	
x	x	Do a functional test of the windscreen and headlamp washers	x	
x	x	Examine the condition and attachment of the door mirrors	x	
x	x	Do a functional test of the fold-back door mirrors	x	
x	x	Do a functional test of the electrically operated windows	x	
x	x	Do a functional check of the service indicator. Reset the indicator	x	
x	x	Renew the batteries in the remote key fobs	x	
x	x	Renew the tracker tags (where applicable)	x	

Anti Corrosion Check

			C	A
x	x	Examine the body panels and under body for corrosion. Work from the inside out (do not include stone chips)	x	

Comments

- Center brake light shop.
- Rear brakes at 2mm.
- Tires 6 years old.
- Recommend alignment
- Hood strut weak
- Door strut weak
- Tire sealant expired.
- Tonneau trim pad broken.
- Right upper dash panel shrinking.

Technician	Dealer Stamp
Name <i>Parham Zagar</i>	LOS GATOS LUXURY CARS 66 E. MAIN ST. LOS GATOS, CA 95030
Sign and Date <i>[Signature]</i>	

12 Months
10,000 mls
16,000 km

24 months
20,000 mls
32,000 km

Wheels and Tyres Check


			C	A
x	x	Make sure that the tyres are the correct size, type and orientation	x	
x	x	Measure and record the tyre tread depth	x	
-	x	Examine the tyres for uneven or excessive wear or damage	x	
x	x	Measure and if necessary, adjust the tyre pressures	x	
x	x	Do a torque check of the road wheel nuts	x	
x	x	Examine the road wheel rims for inside or outside damage. Record all damage	x	
x	x	Make sure that the colour coded tyre pressure monitor system valve caps are on the correct wheels (if applicable)	x	
x	x	Do a functional test of the tyre pressure sensors	x	
x	x	Do a check of the date of the tyre inflation kit	x	

Final Checks

			C	A
x	x	Degrease the windscreen	x	
x	x	Do a road test	x	
x	x	Do a functional test of the ABS and the traction control operation	x	
x	x	Make sure that the drain for the fuel filler bowl is clear	x	
x	x	Do a functional test of the adaptive damping system	x	

Tyre Wear Report

	Outer	Centre	Inner	Outer	Centre	Inner
	Across Tyre			Across Tyre		
CW Rotation	Left Front (mm)			Right Front (mm)		
Valve						
90°		5			5	
120°						
270°						
Tyre Pressure	36			36		
CW Rotation	Left Rear (mm)			Right Rear (mm)		
Valve						
90°		3			3	
120°						
270°						
Tyre Pressure	38			38		

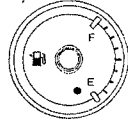Fuel Level Record the fuel level when the vehicle arrives at your Dealership. Always fill the fuel tank before you return the vehicle (chargeable)		Open Circuit Battery Voltage _____ Volts	To remove the surface charge: Set the ignition to ON Set the headlamps to ON for 4 mins. Set the headlamps to OFF for 2 mins. Set the ignition to OFF Test the battery voltage
--	---	--	--

Maintenance time intervals should always be obeyed, even with low service mileages, to keep the vehicle at the best performance and condition.



LOS GATOS LUXURY CARS
620 BLOSSOM HILL RD.
LOS GATOS CA 95032
(408) 358-7777

Work Order: 318274
Last Name: Stefan
First Name: Mark
VIN: SCFAD02A97GB08976
Technician: 4072
Odometer: 27199
Date: 6/8/18 3:11 PM



SCFAD02A97GB08976

Aston Martin : DB9 : 2005-12 : except Sports Pack (Modified Specification)
ExpressAlign Total Alignment

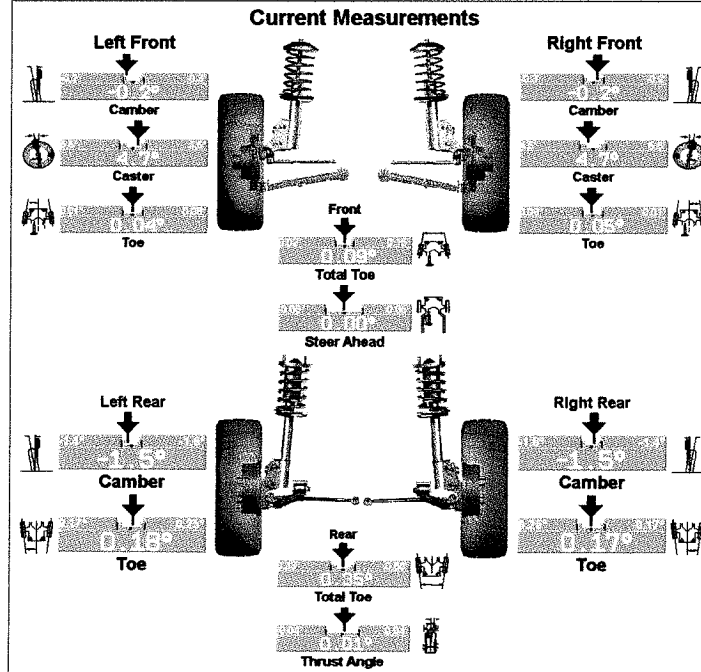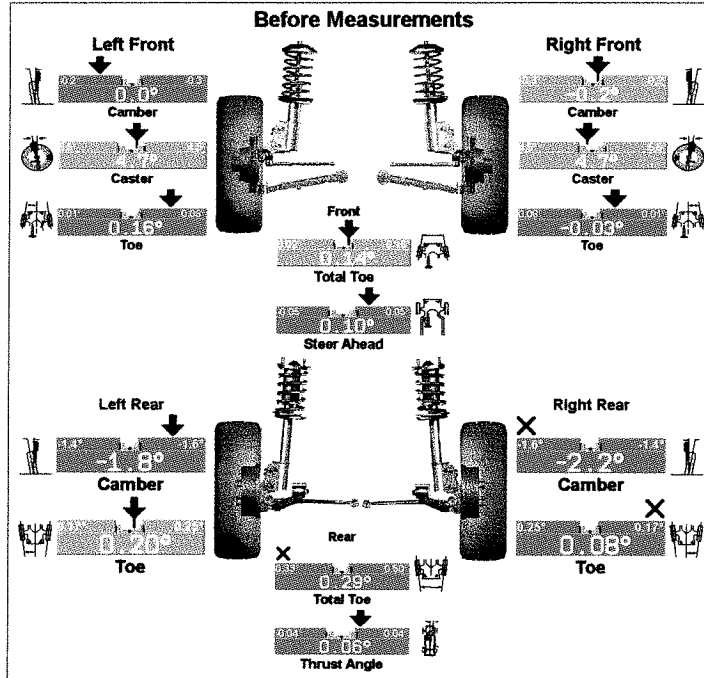

LOS GATOS LUXURY CARS.
620 BLOSSOM HILL RD
LOS GATOS, CA 95032
408-554-4000

318274

ASTON MARTIN LOS GATOS

620 Blossom Hill Rd., Los Gatos, CA 95032
(408) 358-7777

www.losgatosluxcars.com

INVOICE

PAGE 1

BAR # ARD-260275 EPA # CAL 000348002

SERVICE ADVISOR: 4068 ALEX ASTAR

CHASE VISA
VISA
XXXXXXXXXXXX9893
AID: A0000000031010
Entry Method: Chip Read
Apprvd: Online Batch#: 000008
06/14/18 10:25:49
Inv#: 00318274 Appr Code: 000280
Total: USD\$ 13,474.58

MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG
ASTON DB9	SCFAD02A97GB08976		27199/27208	T3236
EXP	PROMISED	PO NO	PAYMENT	INV. DATE
2010	17:00 08JUN18		0.00 CASH	13JUN18
BY	OPTIONS:			
JUN18	DLR:NONE			
HOURS	LIST	NET	TOTAL	

TEST RESULTS TO CUSTOMER

(N/C)

100 MILE SERVICE PER FACTORY MENU
SEE PER ATTACHED MENU
1000 MILE/100,000 MILE SERVICE PER

		2772.00	2772.00
OIL FILTER (SINGLE)	61.96	61.96	61.96
W40 1 LITRE	12.95	12.95	168.35
PLUG-OIL PAN DRAIN	33.78	33.78	33.78
O RING	4.44	4.44	4.44
SE SUPER DOT 4	49.78	49.78	49.78
	4.99	4.99	4.99
S CLEANER	25.50	25.50	25.50
TERY	4.95	4.95	4.95
1 2G43-17B437-AA BLADE ASSY W/WPR LH	72.60	72.60	72.60
1 4G43-17528-CA PASS SIDE BLADE ASSY	62.76	62.76	62.76
1 4G43-9601-AB-PK FILTER AIR CLNR-(2)	202.83	202.83	202.83
1 4G43-13ZE1-AA-PK FILTER-POLLEN(2)	104.88	104.88	104.88
1 DEXCOOL COOLANT/ANTIFREEZE	34.69	34.69	34.69
1 CCKV2 TIRE INFL KIT	220.00	220.00	220.00

STEFAN-MARK
Customer Copy
THANK YOU

Performed 10 year service per checklist. Noticed = Center brake light inop. Front brakes 5 mm. Rear brakes 2 mm. Front / rear tires 6 years old and cracking. Front tires 5 mm. Rear tires 3 mm. Recommend alignment with new tires. Hood struts weak. Both door struts weak. Tire sealant expired. Right tonneau trim cover rod broken. Right upper dash panel leather shrinking. P/A needed parts on 5/30/18.

THE CUSTOMER STATES THAT THE BRAKE WARNING LIGHT IS ON. PLEASE CHECK AND ADVISE

ORIGINAL ESTIMATE \$	FINAL REVISED ESTIMATE \$	DESCRIPTION	TOTALS
		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		ADJUSTMENTS	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	



ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.
I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code 25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/prop65.html>

CUSTOMER #: 52012

26302

THE LUXURY COLLECTION

INVOICE



2255 N. Main St
Walnut Creek, CA 94596
www.tlcwc.com
Phone: (925) 444-2000
Fax: (925) 482-2452

PAGE 1

SERVICE ADVISOR: 143 HENRY ESCANO

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/ OUT, TAG. Includes service dates and payment info.

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL
A CLIENT REQUESTS TO PERFORM NINTH YEAR SERVICE INTERVAL. INSPECT AND ADVISE

Table listing service items: 001 PERFORM 9 YEAR SERVICE INTERVAL, 153 CPAM 6.50, 1 AG43-6714-AA OIL FILTER, etc.

23769 Performed 9 year service interval. Renewed oil and filter. Added 12 quarts of 0w-40 mobile 1 synthetic oil. Renewed brake fluid and battery remote.

B CLIENT REQUESTS INSTALL SOP FOR CONVERTIBLE TOP. INSPECT AND ADVISE
001 PARTS ON ORDER
153 ISP 0.00 (N/C)

C CHECK TIRE PRESSURES AND TREAD DEPTH. ADJUST TIRE PRESSURES TO FACTORY SPECIFICATION AND NOTE TREAD DEPTH TO WEAR BARS PER CALIFORNIA REQUIREMENTS.
TP CHECK TIRE PRESSURES AND TREAD DEPTH. ADJUST TIRE PRESSURES TO FACTORY SPECIFICATION AND NOTE TREAD DEPTH TO WEAR BARS PER CALIFORNIA REQUIREMENTS.
153 ISP 0.00 (N/C)

23769 Checked tires: Front 5/32nds above wear bars Rear 4/32nds

Table with columns: ORIGINAL ESTIMATE \$, FINAL REVISED ESTIMATE \$, DESCRIPTION, TOTALS. Includes acknowledgment checkboxes.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

BAR # ARD 273282 EPA # CAL 000423371

CUSTOMER #: 52012

26302

THE LUXURY COLLECTION

INVOICE



2255 N. Main St
Walnut Creek, CA 94596
www.tlcwc.com
Phone: (925) 444-2000
Fax: (925) 482-2452

PAGE 2

SERVICE ADVISOR: 143 HENRY ESCANO

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG, IN SVC. DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., PAYMENT, INV. DATE. Includes service dates and payment info.

08:55 20JUN17 17:20 20JUN17
D TECHNICIAN COMMENTS: FRONT LH BRAKES FRONT RH BRAKES REAR LH BRAKES REAR RH BRAKES FRONT RH TIRE TREAD FRONT LH TIRE TREAD REAR RH TIRE REAR LH TIRE SERVICE DUE
COM TECHNICIAN COMMENTS: FRONT LH BRAKES FRONT RH BRAKES REAR LH BRAKES REAR RH BRAKES FRONT RH TIRE TREAD FRONT LH TIRE TREAD REAR RH TIRE REAR LH TIRE SERVICE DUE
153 ISP 0.00 (N/C)

23769
Front brake pads at 6.0mm
Rear brake pads at 4.0mm

AST10 ASTON MARTIN PARTS & LABOR 10% DISCOUNT CPAM -160.00 -160.00

EST: 1,600.00 20JUN17 08:55 SA: 143

Summary table with columns: ORIGINAL ESTIMATE \$, FINAL REVISED ESTIMATE \$, DESCRIPTION, TOTALS. Includes sub-totals for Labor, Parts, Gas, Oil, Lube, Sublet, Misc. Charges, Adjustments, Sales Tax, and Total Payable Amount.

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK BAR # ARD 273282 EPA # CAL 000423371

CUSTOMER #: 52012

23921



Bentley Walnut Creek
Maserati of Walnut Creek

INVOICE

1425 Parkside Drive
Walnut Creek, CA 94596
www.lmcwc.com
Phone: (925) 444-2000
Fax: (925) 951-1600

PAGE 1

SERVICE ADVISOR: 143 HENRY ESCANO

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
BLACK	07	ASTON MARTIN DB9	SCFAD02A97GB08976		21484/21487	T019
IN SVC. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 03JUN16		175.00 CASH	03JUN16
R.O. OPENED	READY	OPTIONS: DLR:6009				
09:14 03JUN16	17:03 03JUN16					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A CLIENT REQUEST TO PERFORM 8TH YEAR SERVICE INTERVAL							
001 PERFORM 8 YR SERVICE							
	142	CPAM		8.50		1572.50	1572.50
1	AG43-6714-AA	OIL FILTER			53.08	53.08	53.08
1	697748-PK	OIL PAN DRAIN PLUG			16.75	16.75	16.75
1	1R12-08-10317-PK	O-RING			5.79	5.79	5.79
1	9G33-M99C104-AA12-PK	FLUORESCENT DYE			10.54	10.54	10.54
1	700781-PK	BR FLUID REACT			30.35	30.35	30.35
12	3Z0052107A	ENGINE OIL			17.18	17.18	206.16
1	CR2032	KEY BATTERY			3.00	3.00	3.00
1	4G43-9601-AB-PK	AIR FILTER CLEANER			101.33	101.33	101.33
1	4G43-13ZE1-AA-PK	POLLEN FILTER			48.66	48.66	48.66
3	704349-PK	OIL 75W-90			26.78	26.78	80.34
2	4G43-27-10245-PK	COPPER WASHER PLUG			5.35	5.35	10.70
1	4G43-17B437-CA-PK	WIPER BLADE PASSENGER			49.14	49.14	49.14
1	9G43-17B437-AA-PK	WIPER BLADE DRIVER			53.05	53.05	53.05

21486 8.50 Performed DB9 eight year service. Renewed engine oil and filter. Added 11.5 quarts of Mobil One 0W40 oil. Renewed one key fob battery. Renewed rear differential fluid. Renewed brake fluid. Renewed engine air filters. Renewed pollen filters. Tested Battery: 674A SAE Rated 680A SAE. Checked brake pad thickness: Front 7mm Rear 7mm. Checked tread depth: Front 5/32nds above wear bar indicator, Rear 4/32nds above wear bar indicator. Set tire pressure to: Front 36PSI and Rear 38PSI. Filled out service record book and reset service reminder. Performed road test, operating the same as similar / like vehicles. Complete

B CHECK TIRE PRESSURES AND TREAD DEPTH. ADJUST TIRE PRESSURES TO FACTORY SPECIFICATION AND NOTE TREAD DEPTH TO WEAR BARS PER CALIFORNIA REQUIREMENTS.

TP CHECK TIRE PRESSURES AND TREAD DEPTH. ADJUST TIRE PRESSURES TO FACTORY SPECIFICATION AND NOTE TREAD DEPTH TO WEAR BARS PER CALIFORNIA REQUIREMENTS.

ORIGINAL ESTIMATE \$		FINAL REVISED ESTIMATE \$			DESCRIPTION	TOTALS
DATE	TIME	PHONE # OR IN PERSON	AUTHORIZED BY	ADDITIONAL AMOUNT \$	LABOR AMOUNT	
REASON					PARTS AMOUNT	
					GAS, OIL, LUBE	
					SUBLET AMOUNT	
					MISC. CHARGES	
					TOTAL CHARGES	
					ADJUSTMENTS	
					SALES TAX	
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.					PLEASE PAY THIS AMOUNT	
X						
I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.						
X						

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

BAR # ARD 273282 EPA # CAL 000395109

CUSTOMER #: 52012

23921



Bentley Walnut Creek
Maserati of Walnut Creek

INVOICE

1425 Parkside Drive
Walnut Creek, CA 94596
www.lmcwc.com
Phone: (925) 444-2000
Fax: (925) 951-1600

PAGE 2

SERVICE ADVISOR: 143 HENRY ESCANO

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
BLACK	07	ASTON MARTIN DB9	SCFAD02A97GB08976		21484/21487	T019
IN SVC. DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 03JUN16		175.00 CASH	03JUN16
R.O. OPENED	READY	OPTIONS: DLR:6009				
09:14 03JUN16	17:03 03JUN16					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
	142	ISP		0.00			(N/C)

21486 Checked tires: Front 5/32nds above wear bars Rear 4/32nds above wear bars. Set tire pressures to: Front 36psi Rear 38psi.

C TECHNICIAN COMMENTS

COM TECHNICIAN COMMENTS

142 ISP 0.00

(N/C)

EST: 2,308.84 03JUN16 09:14 SA: 143

ORIGINAL ESTIMATE \$		FINAL REVISED ESTIMATE \$		DESCRIPTION	TOTALS
DATE	TIME	PHONE # OR IN PERSON	AUTHORIZED BY	LABOR AMOUNT	1572.50
REASON				PARTS AMOUNT	668.89
REASON				GAS, OIL, LUBE	0.00
REASON				SUBLET AMOUNT	0.00
REASON				MISC. CHARGES	6.95
REASON				TOTAL CHARGES	2248.34
REASON				ADJUSTMENTS	0.00
REASON				SALES TAX	56.86
I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.				PLEASE PAY THIS AMOUNT	
I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.				2305.20	

NOTICE TO CONSUMER: PLEASE READ IMPORTANT INFORMATION ON BACK

BAR # ARD 273282 EPA # CAL 000395109

CUSTOMER #: 606069

310707

ASTON MARTIN LOS GATOS

INVOICE

620 Blossom Hill Rd., Los Gatos, CA 95032

(408) 358-7777

www.losgatosluxcars.com

PAGE 1

BAR # ARD-260275 EPA # CAL 000348002

SERVICE ADVISOR: 4018 MARC LEBAS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG
	07	ASTON MARTIN DB9	SCFAD02A97GB08976		19587/19595	T3528
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00	28JAN15	CASH	29JAN15
R.O. OPENED	READY	OPTIONS: DLR:NONE				
11:17	26JAN15	08:49	29JAN15			

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A Install Fault Monitor Module and Harness
 CAUSE: install seat heater update kit as required
 RA-01-0019 Install Fault Monitor Module and Harness
 4039 WA (N/C)
 1 FG43-632B22-AA SEAT HEATER SUPERVISOR KIT (N/C)
 install seat heater update kit as required install seat heater update kit as required

B CHECK SERVICE DUE- LAST SERVICE STAMP 2/2012 5 YEAR
 TOW VEHICLE WAS TOWED TO SHOP *****
 ***** Upon request you are entitled to a copy of the towing fees and access notice.
 4039 CPA 0.00 0.00

MISC TRANSPORT PO#4007 CTOW 130.00 130.00

MISC TRANSPORT PO#4007 ITOW (N/C)

C MULTI POINT INSPECTION CHECK TIRE PRESSURES AND CHECK TIRE CONDITION.
 CAUSE: MULTI POINT INSPECTION
 MPI MULTI POINT INSPECTION CHECK TIRE PRESSURES AND CHECK TIRE CONDITION.
 4039 CPA 0.00 0.00

D CHECK TIRE PRESSURES LF RF LR RR CHECK TIRE CONDITION PASS FAIL
 TP CHECK TIRE PRESSURES LF RF LR RR CHECK TIRE CONDITION PASS FAIL
 4039 CPA 0.00 0.00

ORIGINAL ESTIMATE \$	FINAL REVISED ESTIMATE \$	DESCRIPTION	TOTALS
		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		ADJUSTMENTS	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	



ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE.
 X

I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.
 X

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, lumes, greases, grime, touch-up paint, certain replacement parts, and particulates from cleaning your vehicle. 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.p65.org/prop65.html>.

CUSTOMER #: 606069

310707

ASTON MARTIN LOS GATOS

INVOICE

620 Blossom Hill Rd., Los Gatos, CA 95032

(408) 358-7777

www.losgatosluxcars.com

PAGE 2

BAR # ARD-260275 EPA # CAL 000348002

SERVICE ADVISOR: 4018 MARC LEBAS

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/OUT	TAG
	07	ASTON MARTIN DB9	SCFAD02A97GB08976		19587/19595	T3528
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 DD		20OCT2010	17:00 28JAN15		CASH	29JAN15
R.O. OPENED		READY	OPTIONS: DLR:NONE			
11:17 26JAN15		08:49 29JAN15				

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

E** PERFORM 7 YEAR/70,000 MILE SERVICE PER FACTORY MENU

CAUSE: carry out 7 year service and recommend new battery due to low CCA

DB97 PERFORM 7 YEAR/70,000 MILE SERVICE PER FACTORY MENU

DESCRIPTION	LIST	NET	TOTAL
4039 CPA		1080.00	1080.00
1 AG43-6714-AA OIL FILTER(SINGLE)	52.83	52.83	52.83
13 PY112988PA 0W40 1 LITRE	9.95	9.95	129.35
1 4G43-04-10205 PLUG-OIL PAN DRAIN	23.34	23.34	23.34
1 1R12-08-10317 O RING	2.53	2.53	2.53
1 700781 RESPONSE SUPER DOT 4	31.52	31.52	31.52
1 2943 WW FLUID	4.99	4.99	4.99
1 CR2032 3V BATTERY	4.95	4.95	4.95
1 89150201 PARTS CLEANER	8.95	8.95	8.95

carry out 7 year service and recommend new battery due to low CCA
carry out 7 year service and recommend new battery due to low CCA

F** REPLACE BATTERY.

CAUSE: install new battery and test for draw, no draw found. reset all systems all ok.

9996 REPLACE BATTERY
4039 CPA

1 MTP93T8 BATTERY	249.95	249.95	249.95
-------------------	--------	--------	--------

install new battery and test for draw, no draw found. reset all systems all ok. install new battery and test for draw, no draw found. reset all systems all ok.



ASTON MARTIN

ALL PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.

ORIGINAL ESTIMATE \$			FINAL REVISED ESTIMATE \$			DESCRIPTION	TOTALS
DATE	TIME	PHONE #	AUTHORIZED	ADDITIONAL AMOUNT	REVISED TOTAL	LABOR AMOUNT	1440.00
						PARTS AMOUNT	508.41
						GAS, OIL, LUBE	0.00
						SUBLET AMOUNT	0.00
						MISC. CHARGES	130.00
						TOTAL CHARGES	2078.41
						ADJUSTMENTS	0.00
						SALES TAX	44.49
						PLEASE PAY THIS AMOUNT	2122.90

I ACKNOWLEDGED NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATE PRICE. X

I ACKNOWLEDGED RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE. X

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including but not limited to, fuel, oil batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from cleaning your vehicle. 1) work in a well ventilated area; 2) do not smoke, drink or eat while working; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65: <http://www.oehha.org/pro65.html>.

CUSTOMER COPY

Aston Martin Vehicle Maintenance Check Sheet

Always use body interior and exterior protection and the correct grades of lubricants and fluids. Tick the box in column "C" when the check is complete and tick in column "A" if corrective work is necessary.

FULLY CLEAN THE VEHICLE AND THE WORK AREA.

Owner: Mark Stefan Date: 1/28/15
 Vehicle Reg. No.: — Key No.: —
 Model/Derivative: DB9 Valente Odometer (km/mls): 19587
 VIN: SCFAD02A976B08976 Dealer Job/Invoice No.: 310707

12 Months 10,000 mls 16,000 km	24 months 20,000 mls 32,000 km	Pre-Maintenance	C	A
x	x	Install the vehicle protection kit and wing covers	/	/
x	x	Do a check of the Campaign Status	/	/

Fluid, Filters and Inspect for Leaks		C	A
x	x	Examine the engine for oil leaks	/
x	x	Renew the engine oil (use the correct specification)	/
x	x	Renew the engine oil filter	/
-	x	Renew the air cleaner element(s) (V12 Engines)	/
Every 3 years or 30,000 mls (48,000 km)		Renew the air cleaner element(s) (V8 Engines)	/
x	-	Examine the transmission and final drive for condition and leaks. Fill if necessary	/
Every 6 years 60,000 mls 96,000 km	Every 10 years 100,000 mls 160,000 km	Do a check of the manual transaxle oil level. Fill if necessary	/
Every 4 years or 40,000 mls (64,000 km)		Renew the manual transaxle oil and clean the filter	/
Every 4 years or 40,000 mls (64,000 km)		Renew the automatic differential oil and clean the filter	/
x	x	Examine the engine cooling and occupant heating system for condition and leaks. Fill if necessary	/
Every 5 years or 50,000 mls (80,000 km)		Renew the engine coolant - 50/50 concentration	/
x	x	Examine the condition and attachment of the fuel system, hoses, pipes and unions for leaks	/
Every 12 months		Renew the brake/clutch fluid (use the correct specification) (V12 engines)	/
Every 24 months		Renew the brake/clutch fluid (use the correct specification) (V8 engines)	/
x	x	Examine the brake/clutch fluid level. Fill if necessary	/
x	x	Examine the condition and attachment of the power steering system, hose, pipes and unions	/
x	x	Examine the power steering fluid level and fill if necessary	/
x	x	Examine the condition and attachment of the brake system, hoses, pipes and unions	/
x	x	Examine the condition of the suspension dampers for leaks	/
x	x	Examine the condition of the exhaust system for leaks	/
x	x	Examine the level of the the windscreen and headlamp washer reservoir. Fill if necessary	/
x	x	Do a check of the exhaust bypass valve operation at 800/3000 rpm	/

x	x	Examine the condition and attachment of the air conditioning system, hoses, pipes and unions. Use UV to do a check for leaks	/
-	x	Renew the pollen filter	/

12 Months 10,000 mls 16,000 km	24 months 20,000 mls 32,000 km	Mechanical Function Check	C	A
x	x	Examine the condition, attachment, correct operation and lubricate all door locks, latches, hinges and joints.	/	
x	x	Examine the condition, attachment, correct operation and lubricate the bonnet catch.	/	
x	x	Examine the condition, attachment, correct operation and lubricate the secondary bonnet catch(es).	/	
x	x	Examine the condition and tension of the accessory drive belt. Adjust or replace if necessary	/	
x	x	Examine the cooling pack radiator, condenser and transmission cooler for blockage and unwanted material. Clean if necessary	/	
x	x	Examine the condition and attachment of the cooling system hoses	/	
x	x	Examine the condition and attachment of the air conditioning hoses	/	
Every 4 Years or 40,000 miles (64,000 km)		Clean the throttle butterflies (V12 only)	/	
x	x	Examine the condition and attachment of the wiper blades. Replace if necessary	/	
x	x	Examine the condition and operation of all seat belts and buckles	/	
x	x	Examine the condition and attachment of the rear view mirror	/	
x	x	Examine the condition and attachment of the handbrake and the handbrake pads	/	
x	x	Examine the condition, attachment and adjustment of the handbrake cables. Adjust if necessary	/	
x	x	Examine the condition of the brake pads, brake discs and calipers. At 60% wear, replace the brake pads and pad wear sensors. For CCM Brakes, at every 3rd pad change, clean, dry, weigh and examine the condition of the brake discs	/	
x	x	Examine the condition and attachment of front brake disc shields for fatigue, cracks and the clearance from the discs	/	
x	x	Examine the condition and attachment of all suspension, ball joints, gaiters, bushes and fixings	/	
-	x	Examine the condition and attachment of the driveshafts	/	
x	x	Examine the condition and attachment of the exhaust system, mountings and heatshields	/	
-	x	Examine the condition and attachment of the wheel arch liners and the underbody protection	/	

Model Applicability:
 V8 and V12 Vantage, Vantage S, DB9, DBS, Rapide, Virage. For all other models please use the applicable Maintenance Check Sheet.

Note: For maximum customer satisfaction, we recommend that you do a road test before the maintenance is done, and again when the work is complete.

Aston Martin Vehicle Maintenance Check Sheet

12 Months
10,000 mls
16,000 km

24 months
20,000 mls
32,000 km

Electrical Function Test

Every 70,000 mls (112,000 km)			C	A
		Renew the spark plugs	/	/
x	x	Measure and record the battery voltage	/	/
x	x	Examine the condition and attachment of the battery connections. Adjust if necessary	/	/
x	x	Do a functional test of the battery disconnect switch	/	/
x	x	Examine the condition and attachment of all lamp units	/	/
-	x	Do a check of the headlamp alignment. Adjust if necessary	/	/
x	x	Do a functional test of all of the lights and the auto-sense function	/	/
x	x	Do a functional test of all warning indicators	/	/
x	x	Do a functional test of the audible warnings and security system	/	/
x	x	Do a functional test of the horns	/	/
x	x	Do a functional test of the windscreen wipers and auto-sense function	/	/
x	x	Do a functional test of the windscreen and headlamp washers	/	/
x	x	Examine the condition and attachment of the door mirrors	/	/
x	x	Do a functional test of the fold-back door mirrors	/	/
x	x	Do a functional test of the electrically operated windows	/	/
x	x	Do a functional check of the service indicator. Reset the indicator	/	/
x	x	Renew the batteries in the remote key fobs	/	/
x	x	Renew the tracker tags (where applicable)	/	/

Anti Corrosion Check

			C	A
x	x	Examine the body panels and under body for corrosion. Work from the inside out (do not include stone chips)	/	/

Comments

Technician Name

Robbie Allen

Dealer Stamp

Sign and Date
RA 1/28/15

12 Months
10,000 mls
16,000 km

24 months
20,000 mls
32,000 km

Wheels and Tyres Check

			C	A
x	x	Make sure that the tyres are the correct size, type and orientation	/	/
x	x	Measure and record the tyre tread depth	/	/
-	x	Examine the tyres for uneven or excessive wear or damage	/	/
x	x	Measure and if necessary, adjust the tyre pressures	/	/
x	x	Do a torque check of the road wheel nuts	/	/
x	x	Examine the road wheel rims for inside or outside damage. Record all damage	/	/
x	x	Make sure that the colour coded tyre pressure monitor system valve caps are on the correct wheels (if applicable)	/	/
x	x	Do a functional test of the tyre pressure sensors	/	/
x	x	Do a check of the date of the tyre inflation kit	/	/


Final Checks

			C	A
x	x	Degrease the windscreen	/	/
x	x	Do a road test	/	/
x	x	Do a functional test of the ABS and the traction control operation	/	/
x	x	Make sure that the drain for the fuel filler bowl is clear	/	/
x	x	Do a functional test of the adaptive damping system	/	/

Tyre Wear Report

	Outer	Centre	Inner	Outer	Centre	Inner
	Across Tyre			Across Tyre		
CW Rotation	Left Front (mm)			Right Front (mm)		
Valve	4	7	4	4	7	4
90°	"	"	"	"	"	"
120°	"	"	"	"	"	"
270°	"	"	"	"	"	"
Tyre Pressure	36			36		
CW Rotation	Left Rear (mm)			Right Rear (mm)		
Valve	4	6	4	4	6	4
90°	"	"	"	"	"	"
120°	"	"	"	"	"	"
270°	"	"	"	"	"	"
Tyre Pressure	38			38		

Fuel Level	Open Circuit Battery Voltage	To remove the surface charge:
Record the fuel level when the vehicle arrives at your Dealership. Always fill the fuel tank before you return the vehicle (chargeable)	12.39 Volts	Set the ignition to ON Set the headlamps to ON for 4 mins. Set the headlamps to OFF for 2 mins. Set the ignition to OFF Test the battery voltage

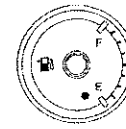

Maintenance time intervals should always be obeyed, even with low service mileages, to keep the vehicle at the best performance and condition.

Issue 3, After Sales Operations, July 2012

Customer Number: B08976

Invoice No: 188174

MARIN LUXURY CARS

195 Casa Buena Drive
Corte Madera, CA 94925
(415) 460-4600
Fax: (415) 460-4662
www.marinluxurycars.com

INVOICE

2908



Email: SERVICE ADVISOR: 485 LUCIAN FREIRE

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/ OUT, TAG. Includes details for a silver 07 Aston Martin DB9 Vol with VIN SCFAD02A97GB08976 and license 6AZN063.

LINE OPCODE TECH TYPE HOURS LIST NET TOTAL

Table listing service items: A 10,000 SERVICE INTERVAL DB9, 10K 10,000 SERVICE INTERVAL DB9, 133 CA, 1 AG43-6714-AA OIL FILTER (WHITE) SINGLE WKS, etc.

PARTS: 364.27 LABOR: 1600.00 OTHER: 0.00 TOTAL LINE A: 1964.27
17505 10,000 MILE SERVICE COMPLETE 10,000 MILE SERVICE. FRONT PADS 8MM REAR PADS 7MM TIRES L/F 4MM 8MM 5MM R/F 3MM 8MM 4MM L/R 5MM 7MM 5MM R/R 5MM 7MM 5MM USE BY DATE FOR TIRE SEALANT 7/2011. CHECK STORED FAULT CODES LOGGED IN EMS P0483- FAN PERFORMANCE. FORCE FANS ON USING A/C BOTH FAN RUNNING AT PRESENT... P/A FAN ECU... SLOW SPEED MANEUVERING FINDING DIFFERENTIAL CHATTERING. DRAIN REFILL DIFFERENTIAL, SERVICE OIL FILTER. BRIEF ROAD TEST NOISE REDUCED. REPLACE ENGINE OIL AND FILTER. TOP OFF FLUID SERVICE BRAKE FLUID . LOAD TEST BATTERY RATED 680CCA. CHARGE TIME 0:20:28, GOOD BATTERY. LEADING LEFT SIDE TONNEAU LID DRAIN SLOW O DRAIN.

B ASTON MARTIN RECOMMENDS THAT THE DRIVER OF THE VEHICLE CHECK THE OIL LEVEL ONCE A WEEK. (MORE OFTEN IN HIGH MILEAGE OR HARSH CONDITIONS). THAT ALONG WITH OTHER REQUIRED MAINTENANCE CAN BE FOUND IN THE OWNERS GUIDE.
D ASTON MARTIN RECOMMENDS THAT THE DRIVER OF THE VEHICLE CHECK THE OIL LEVEL ONCE A WEEK. (MORE OFTEN IN HIGH MILEAGE OR HARSH CONDITIONS). THAT ALONG WITH OTHER REQUIRED MAINTENANCE CAN BE FOUND IN THE OWNERS

Customer Copy

Table with columns: PAYMENT IN FULL REQUIRED PRIOR TO RELEASE OF VEHICLE, METHOD OF PAYMENT WE ACCEPT, NOTICE TO CUSTOMER, DESCRIPTION, TOTALS. Includes payment details and a list of charges.

Notice to Consumer: Please read important information on back.

EPA# CAD981683998

BAR# AM214052

Customer Number: B08976

Invoice No: 188174

MARIN LUXURY CARS

195 Casa Buena Drive
Corte Madera, CA 94925
(415) 460-4600
Fax: (415) 460-4662
www.marinluxurycars.com

INVOICE

2908



SERVICE ADVISOR: 485 LUCIAN FREIRE

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/ OUT, TAG. Includes details for SILVER 07 ASTON MARTIN DB9 VOL, VIN SCFAD02A97GB08976, LICENSE 6AZN063, MILEAGE 17500 17505, TAG 2433.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Includes sections for GUIDE, PARTS, C CHECK TIRE PRESSURES, and D PK UP AND REUNITE.

Customer Copy

Table with columns: PAYMENT IN FULL REQUIRED PRIOR TO RELEASE OF VEHICLE, METHOD OF PAYMENT WE ACCEPT, NOTICE TO CUSTOMER, DESCRIPTION, TOTALS. Includes a summary of charges totaling 1995.23.

Notice to Consumer: Please read important information on back.

EPA# CAD981683998

BAR# AM214052

Customer Number: B08976

Invoice No: 180831

MARIN LUXURY CARS

195 Casa Buena Drive
Corte Madera, CA 94925
(415) 460-4600
Fax: (415) 460-4662
www.marinluxurycars.com

INVOICE

CATE 1

i-2908



SERVICE ADVISOR: 475 BRYAN ANTON

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG, DEL DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for ASTON MARTIN DB9 VOL and service dates.

Table with columns: LINE OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL

A PERFORM ANNUAL SERVICE
CAUSE: MAINT
10K 10,000 SERVICE INTERVAL DB9
133 CA
1 AG43-6714-AA OIL FILTER (WHITE) SINGLE WKS
SERVICE USE ONLY
10 0W40 MOBIL 1 0W40 OIL
1 1R12-08-10317 O RING
1 208 FUEL SYSTEM CLEANER
1 SUNDRY TOP OFF FLUIDS & GREASE
1 9822 WIND/CLEANER
1 4G43-9601-AB-PK FILTER AIR CLEANER BOX OF 2
PARTS: 444.37 LABOR: 1260.00 OTHER: 0.00 TOTAL LINE A: 1704.37

14968 PERFORM ANNUAL SERVICE COMPLETE ANNUAL SERVICE ASTON MARTIN .
TIRES WORN AS PER LINE (B) FRONT PADS DOWN TOO SENSORS OVER ALL 6MM
REAR PADS TO SENSOR OVER ALL 4MM. SERVICE BRAKE FLUID. CHANGE ENGINE
OIL AND FILTER, SERVICE BRAKE FLUID, REPLACE AIR FILTERS. CHECK AND
PRINT OUT FAULT CODES. CHECK TONNEAU LID DRAINS FINDING RIGHT SIDE
PLUGGED, CLEAR DRAIN. TOP OFF FLUIDS.

B CUSTOMER REQUEST REPLACE ALL 4 TIRES
TIRES CUSTOMER REQUEST REPLACE TIRES AND BALANCE
AS PER RECOMMENDATION
133 CA
2 038089 235/40ZR19 BRIDGESTONE POTENZA
4 CTF CALIFORNIA TIRE FEE
8 9001 (ea) Wheel Weight
2 038106 275/35ZR19 BRIDGESTN POTENZA RE050A
PARTS: 1541.58 LABOR: 180.00 OTHER: 0.00 TOTAL LINE B: 1721.58

C PERFORM ALL WHEEL ALIGNMENT
ALIGN PERFORM ALL WHEEL ALIGNMENT

Customer Copy table with columns: PAYMENT IN FULL REQUIRED PRIOR TO RELEASE OF VEHICLE, METHOD OF PAYMENT WE ACCEPT THE FOLLOWING, NOTICE TO CUSTOMER, ORIGINAL ESTIMATE \$, AUTHORIZED REVISED ESTIMATE \$, CUSTOMER SIGNATURE, DESCRIPTION, TOTALS. Includes sub-totals for LABOR AMOUNT, PARTS AMOUNT, GAS, OIL, LUBE, etc.

Notice to Consumer: Please read important information on back.

Customer Number: B08976

Invoice No: 180831

MARIN LUXURY CARS

195 Casa Buena Drive
Corte Madera, CA 94925
(415) 460-4600
Fax: (415) 460-4662
www.marinluxurycars.com

INVOICE

CATE 1

-2908



SERVICE ADVISOR: 475 BRYAN ANTON

Table with columns: COLOR, YEAR, MAKE/MODEL, VIN, LICENSE, MILEAGE IN/OUT, TAG, DEL DATE, PROD. DATE, WARR. EXP., PROMISED, PO NO., RATE, PAYMENT, INV. DATE. Includes details for ASTON MARTIN DB9 VOL and service dates.

Table with columns: LINE, OPCODE, TECH, TYPE, HOURS, LIST, NET, TOTAL. Header row for service items.

133 CA PARTS: 0.00 LABOR: 350.00 OTHER: 0.00 TOTAL LINE C: 350.00

14970 PERFORM FOUR WHEEL ALIGNMENT COMPLETE FOUR WHEEL ALIGNMENT. ADJUST REAR TOE, CAMBER, ADJUST FRONT CASTER AND CAMBER.

D AS A COURTESY, WE MAY PROVIDE A LOANER UP TO 4 DAYS, OR WHEN THE VEHICLE IS COMPLETED. WE RESERVE THE RIGHT TO CHARGE UP TO \$80.00/DAY OR MARKET RATE FOR COMPARABLE VEHICLES FOR ADDITIONAL UN-RETURNED USAGE.

CAUSE: X

LOANER AS A COURTESY, WE MAY PROVIDE A LOANER UP TO 4 DAYS, OR WHEN THE VEHICLE IS COMPLETED. WE RESERVE THE RIGHT TO CHARGE UP TO \$80.00/DAY OR MARKET RATE FOR COMPARABLE VEHICLES FOR ADDITIONAL UN-RETURNED USAGE.

133 INTA PARTS: 0.00 LABOR: 0.00 OTHER: 0.00 TOTAL LINE D: (N/C) 0.00

E** REPLACE FRONT AND REAR BRAKE PADS AND ROTORS BRAKES BRAKE REPAIR

Table with columns: PARTS, LABOR, OTHER, TOTAL LINE E. Lists items like BRAKE PAD KIT-FRONT, FRONT BRAKE DISC BOX OF 2, etc.

2754.19 PARTS: 2754.19 LABOR: 720.00 OTHER: 0.00 TOTAL LINE E: 3474.19

14970 BRAKES WORN TOO SENSORS REPLACE FRONT PADS AND ROTORS, REPLACE REAR PADS AND ROTORS. LUBE PARKING BRAKE SLIDE PINS. RUN A BRIEF ROAD TEST TO BED IN NEW BRAKES.

~ | -4470

Customer Copy

Table with columns: PAYMENT IN FULL REQUIRED PRIOR TO RELEASE OF VEHICLE, METHOD OF PAYMENT WE ACCEPT THE FOLLOWING, NOTICE TO CUSTOMER, ORIGINAL ESTIMATE \$, AUTHORIZED REVISED ESTIMATE \$, CUSTOMER SIGNATURE, DESCRIPTION, TOTALS. Includes a list of payment methods and a detailed breakdown of charges.

Notice to Consumer: Please read important information on back.

EPA# CAD981683998

BAR# AM214052

Customer Number: B08976

Invoice No: **180831**

MARIN LUXURY CARS

195 Casa Buena Drive
Corte Madera, CA 94925
(415) 460-4600
Fax: (415) 460-4662
www.marinluxurycars.com

INVOICE

CATE 1

-2908



SERVICE ADVISOR: 475 BRYAN ANTON

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN/ OUT	TAG	
SILVER	07	ASTON MARTIN DB9 VOL	SCFAD02A97GB08976	6AZN063	14968 14970	1657	
DEL DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	RATE	PAYMENT	INV. DATE
23JUL07		20OCT2010	15:18 06FEB13		0.00	CASH	07FEB13
R.O. OPENED		READY	OPTIONS: SOLD-STK:P2022				
08:52 05FEB13		11:13 07FEB13					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
EST:				05FEB13 16:41	SA: 475		

Customer Copy

PAYMENT IN FULL REQUIRED PRIOR TO RELEASE OF VEHICLE METHOD OF PAYMENT WE ACCEPT THE FOLLOWING: CASH MASTERCARD VISA AMX COMPANY OR PERSONALIZED CHECK \$2,000.00 WITH THE FOLLOWING 1) CHECK GUARANTEE CARD 2) VALID DRIVERS LICENSE 3) NAME AND ADDRESS (NO. P.O. IMPRINTED ON CHECK)	NOTICE TO CUSTOMER I acknowledge notice an oral approval of any additional customer or warranty work performed and/or increase in the original estimate price. I also acknowledge and approve all repairs as itemized and/or receipt of vehicle. I also acknowledge receipt of additional consumer warranty and service information contained in the Parts & Service Warranty Disclaimer.		DESCRIPTION LABOR AMOUNT PARTS AMOUNT GAS, OIL, LUBE SUBLET AMOUNT MISC. CHARGES/ADJ. TOTAL CHARGES LESS AMOUNT SALES TAX PLEASE PAY THIS AMOUNT	TOTALS 2510.00 4740.14 0.00 0.00 0.00 7250.14 0.00 391.06 7641.20
	ORIGINAL ESTIMATE \$ _____ CUSTOMER SIGNATURE _____ X	AUTHORIZED REVISED ESTIMATE \$ _____		

Notice to Consumer: Please read important information on back.

EPA# CAD981683998

BAR# AM214052

Cole European

106168

317797

Member of the Cole Car Company Inc.
Serving the Bay Area Since 1963
Sales: 2103 North Main Street
Service & Parts: 1421 Lesnick Lane
Walnut Creek, CA 94596
Telephone: 925.935.2653

INVOICE

PAGE 1

BAR# ARD 00130543

EPA# CAR 000151936

SERVICE ADVISOR: 200 STEVEN HALLETT

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN	TAG
STSI	07	ASTON MARTIN DB9VOLA	SCFAD02A97GB08976	6AZN063	4526/4560	T707
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 IS		20OCT2010	17:00 10FEB09		CASH	17FEB09
R.O. OPENED	CUSTOMER NOTIFIED DATE	OPTIONS: STK:7A1143 DLR:005 AXL:2				
10FEB09	17FEB09					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL	
A	DB9	12	MONTH/10,000	MILE SERVICE				
	DB9	12	MONTH/10,000	MILE SERVICE				
			248	CA		1365.00	1365.00	
		1	4G43-44-10818	OIL FILTER	50.93	50.93	50.93	
		1	4G43-04-10205	DRAIN PLUG	30.37	30.37	30.37	
		1	1R12-08-10317	O-RING	3.80	3.80	3.80	
		12	OW40M-QT	OIL	11.29	11.29	135.48	
		2	1182202899	QRT DISTILLED WATER	0.80	0.80	1.60	
		1	C2C31221	FLUID-BRAKE	22.85	22.85	22.85	
		1	ZC32A	CLEANER	4.95	4.95	4.95	
		1	JAG101	TECH FLUID PK6	13.60	13.60	13.60	
		1	M715	BRAKE CLEANER	3.99	3.99	3.99	

B	CUSTOMER REQUESTS CHECK ALIGNMENT							
	4WA	4-WHEEL ALIGNMENT						
			393	CA		480.00	480.00	

C	CUSTOMER REQUESTS CHECK WHEEL BALANCE							
	G74	PERFORM WHEEL BALANCE						
			413	CA		160.00	160.00	

FRONT BRAKE PADS 8.3MM
REMAINING. REAR BRAKE PADS
6.9MM REMAINING. THANK YOU,
STEVE

THANK YOU FOR CHOOSING US TO SERVICE YOUR CAR
YOU MAY BE RECEIVING A SURVEY TO ENSURE YOUR
SATISFACTION. IF THERE IS ANY REASON WHY WE
CAN NOT SCORE A "10", PLEASE LET US KNOW
YOUR COMPLETE SATISFACTION IS OUR #1 PRIORITY

HARRY HENDRY, SERVICE MANAGER (925)935-2653

3 17 PAID
cmc

ORIGINAL ESTIMATE: \$	FINAL REVISED ESTIMATE: \$	"By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary." "HAZARDOUS WASTE DISPOSAL" which includes such items as engine oil, automatic transmission fluid, antifreeze, differential fluid, batteries, etc. will be charged as a separate charge if removed in the servicing of your vehicle. TEAR DOWN ESTATE: I understand that my vehicle will be reassembled within _____ days of the date shown above if I choose not to authorize the service recommended.	DESCRIPTION	TOTALS
HAZARDOUS WASTE DISPOSAL: \$			LABOR AMOUNT	2005.00
I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.	I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.		PARTS AMOUNT	267.57
PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.			GAS, OIL, LUBE	0.00
<p>Notice To Consumer: Please read important information on back.</p> <p><small>WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well ventilated area; 2) do not smoke; 3) use proper disposal techniques; 3) wear your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components.</small></p> <p><small>(Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65, visit www.P65Warnings.ca.gov.</small></p>			SUBLET AMOUNT	0.00
			MISC. CHARGES	0.00
			TOTAL CHARGES	2272.57
			LESS INSURANCE	0.00
			SALES TAX	22.07
			PLEASE PAY THIS AMOUNT	2294.64

CUSTOMER COPY

106168

317796

Cole European

Member of the Cole Car Company Inc.
Serving the Bay Area Since 1963
Sales: 2103 North Main Street
Service & Parts: 1421 Lesnick Lane
Walnut Creek, CA 94596
Telephone: 925.935.2653

INVOICE

PAGE 2

BAR# ARD 00130543


EPA# CAR 000151936

SERVICE ADVISOR: 200 STEVEN HALLETT

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN	TAG	
STSI	07	ASTON MARTIN DB9VOLA	SCFAD02A97GB08976	6AZN063	4526/4560	T707	
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE	
20OCT07 IS		20OCT2010	17:00 01MAR09		CASH	17FEB09	
R.O. OPENED	CUSTOMER NOTIFIED DATE	OPTIONS: STK:7A1143 DLR:005 AXL:2					
10FEB09	17FEB09						
LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
		393	WA				(N/C)

THANK YOU FOR CHOOSING US TO SERVICE YOUR CAR
YOU MAY BE RECEIVING A SURVEY TO ENSURE YOUR
SATISFACTION. IF THERE IS ANY REASON WHY WE
CAN NOT SCORE A "10", PLEASE LET US KNOW
YOUR COMPLETE SATISFACTION IS OUR #1 PRIORITY

HARRY HENDRY, SERVICE MANAGER (925)935-2653

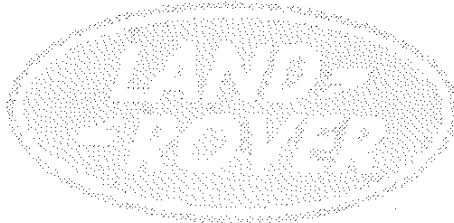

ORIGINAL ESTIMATE: \$ _____	FINAL REVISED ESTIMATE: \$ _____	"By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary." "HAZARDOUS WASTE DISPOSAL" which includes such items as engine oil, automatic transmission fluid, antifreeze, differential fluid, batteries, etc. will be charged as a separate charge if removed in the servicing of your vehicle. TEAR DOWN ESTATE: I understand that my vehicle will be reassembled within _____ days of the date shown above if I choose not to authorize the service recommended.	DESCRIPTION	TOTALS
HAZARDOUS WASTE DISPOSAL: \$ _____			LABOR AMOUNT	0.00
I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.	I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.		PARTS AMOUNT	0.00
PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.			GAS, OIL, LUBE	0.00
Notice To Consumer: Please read important information on back.			SUBLET AMOUNT	0.00
			MISC. CHARGES	0.00
			TOTAL CHARGES	0.00
			LESS INSURANCE	0.00
			SALES TAX	0.00
			PLEASE PAY THIS AMOUNT	0.00

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, grease, grime, touch-up paint, certain replacement parts, and to minimize your exposure when servicing, maintaining or cleaning your vehicle. 1) work in a well ventilated area; 2) do not smoke; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components.
(Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq.) For further information about Proposition 65, visit <http://www.cdph.ca.gov/665.htm>

CUSTOMER COPY

Cole European

3 1 7 7 9 6

INVOICE

Member of the Cole Car Company Inc.
 Serving the Bay Area Since 1963
 Sales: 2103 North Main Street
 Service & Parts: 1421 Lesnick Lane
 Walnut Creek, CA 94596
 Telephone: 925.935.2653

PAGE 1

BAR# ARD 00130543

EPA# CAR 000151936

SERVICE ADVISOR: 200 STEVEN HALLETT

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN	TAG
STSI	07	ASTON MARTIN DB9VOLA	SCFAD02A97GB08976	6AZN063	4526/4560	T707
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PO NO.	PAYMENT	INV. DATE
20OCT07 IS		20OCT2010	17:00 01MAR09		CASH	17FEB09
R.O. OPENED	CUSTOMER NOTIFIED DATE	OPTIONS: STK:7A1143 DLR:005 AXL:2				
10FEB09	17FEB09					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
------	--------	------	------	-------	------	-----	-------

A FSA163-FUEL FILLER CAP VALVE MALFUNCTION-V8 VANTAGE 06-08 MY-DB9
 07-08 MY

FSA163 FSA163-FUEL FILLER CAP VALVE
 MALFUNCTION-V8 VANTAGE 06-08 MY-DB9 07-08 MY
 248 WA
 1 4G43-68-10936 FUEL CAP SERVICE KIT
 4 JHC200401 CLIP-HOSE

(N/C)
 (N/C)
 (N/C)

B SHORTER DIPSTICK FOR DB9 V12 VEHICLES
 FSA165 SHORTER DIPSTICK FOR DB9 V12 VEHICLES

248 WA
 1 4G4E-6750-AC OIL DIP STICK
 1 4G43-19A509-AA/S TRANS FLUID

(N/C)
 (N/C)
 (N/C)

C** TECH. FOUND TRANSMISSION COOLER LINES LEAKING @ COOLER
 G44 TRANS. LINES NOT AVAILABLE - RE-CLAMP LINES
 AND TOP UP FLUID

248 WA

(N/C)

D** RIGHT FRONT UPPER CONTROL ARM BUSHING FOUND DEFECTIVE WHEN ALIGNING
 G60 REPLACE UPPER CONTROL ARM

248 WA
 1 4G43-3084-BD RH CTRL ARM UPPER

(N/C)
 (N/C)

E** ALIGN AFTER CONTROL ARM REPLACEMENT
 G57 4-WHEEL ALIGNMENT

ORIGINAL ESTIMATE: \$	FINAL REVISED ESTIMATE: \$	DESCRIPTION	TOTALS
		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		LESS INSURANCE	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	

WARNING Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and parts and materials used to maintain vehicles, including, but not limited to, fuel, oil, batteries, brakes, and wheel balancing weights. When you service, clean or maintain your car, you will be exposed to listed chemicals contained in used oil, waste and replacement fluids, fumes, greases, grime, touch-up paint, certain replacement parts, and particulates from component wear. When we service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well-ventilated area; 2) do not smoke; 3) wash your hands when finished or when taking a break; and 4) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components.
 Posted in accordance with Proposition 65 in Cal. Health & Safety Code §25249.5 et seq. For further information about Proposition 65, visit www.calhelp.org/prop65.htm.

CUSTOMER COPY



ASTON MARTIN

DB9 VEHICLE MAINTENANCE SHEET

Always use wing (fender) covers and AM interior vehicle protection materials and the correct grades of lubricants and fluids. Tick the C box when the Check is complete and tick the A box if corrective Action was necessary.

THOROUGHLY CLEAN VEHICLE AND WORKING ZONE.

1,000 miles	10,000 miles	20,000 miles
1,500 km	16,000 km	32,000 km
3 months	12 months	24 months

Pre-Maintenance

	C	A
x x x Fit vehicle protection kit and wing covers	/	/
x x x Check bulletin / Field Service Action / recall status	/	/

Fluid, Filters and Leaks Check

	C	A
x x x Renew engine oil	/	/
x x x Renew engine oil filter	/	/
x x x Check for engine oil leaks	/	/
- - x Renew the air cleaner element	/	/
x x - Check manual transaxle for leaks, top-up if necessary	/	/
Every 2 years 20,000mils Every 6 years 60,000 mls Every 10 years 100,000 mls 32,000 km 96,000 km 160,00 km	/	/
Check manual transaxle oil level. Top up if necessary	/	/
Every 4 years or 40,000 miles 64,000 km	/	/
Renew manual transaxle oil and clean filter	/	/
- - x Renew rear axle oil (automatic) and clean filter	/	/
x - - Check / top-up rear axle (automatic)	/	/
x x x Check auto gearbox for leaks	/	/
Every 5 years or 100,000 miles 160,000 km	/	/
Renew engine coolant – ensure concentration 50/50	/	/
x x x Check / top-up engine coolant	/	/
x x x Check cooling and heating system for leaks	/	/
x x x Check fuel hoses, pipes and union for leaks, security and condition	/	/
Every 12 months	/	/
Renew brake / clutch fluid (ensure correct specifications)	/	/
x x x Check / top-up brake / clutch fluid reservoir	/	/
x x x Check / top up power steering reservoir	/	/
x x x Check power steering system for leaks, security and condition	/	/
x x x Check brake hoses, pipes and unions for leaks, security and condition	/	/
x x x Check suspension dampers for leaks	/	/
x x x Top-up windscreen / headlamp washer reservoir	/	/
x x x Check exhaust system for leaks	/	/
x x x Check exhaust bypass valve operation 800 / 3000 rpm	/	/
x x x Check air conditioning system for leaks (UV visual)	/	/
- - x Renew pollen filter	/	/

Owner M. Stephan Date 2-11-09

Vehicle Reg. No. _____ Key No. _____ Speedo Km/Mls 4526

Derivative Volante Dealers Job/Invoice No. 317797

V.I.N. B08976

1,000 miles	10,000 miles	20,000 miles
1,500 km	16,000 km	32,000 km
3 months	12 months	24 months

Mechanical Function Check

	C	A
- x x Lubricate all door locks / hinges / joints	/	/
- x x Lubricate bonnet secondary catch	/	/
- x x Check security of bonnet catch and check that the bonnet secondary catch moves freely over its whole travel and returns smartly under spring pressure	/	/
x x x Check / adjust polyvee drive belt tension, renew if necessary	/	/
x x x Adjust handbrake cables if necessary	/	/
x x x Check handbrake security	/	/
x x x Check condition of handbrake pads	/	/
x x x Inspect brake pad wear and condition of discs and calipers. At 60% worn replace brake pads and pad wear warning leads.	/	/
- x - Check and renew wiper blade inserts, if necessary	/	/
- - x Renew wiper blades	/	/
- x x Inspect cooling pack radiator / condenser for debris and clean out if necessary	/	/
x x x Check condition and operation of all seat belts and buckles	/	/
x x x Check security of exhaust system mountings and heatshields	/	/
x x x Check security and condition of cooling system hoses	/	/
x x x Check security and condition of air conditioning hoses	/	/
x x x Check security and condition of suspension ball joints, gaiters, bushes and fixings	/	/
- - x Check tightness of drive shaft bolts	/	/
x x x Check rear view mirror for security and function	/	/
- - x Check the condition of underbody protection / wheelarch liners	/	/
Every 4 years or 40,000 miles 64,000 km	/	/
Clean throttle butterflies	/	/

*Note To ensure maximum customer satisfaction, it is recommended that a road test is carried out prior to commencement of maintenance services, as well as afterwards.

Regardless of low service mileage, time intervals should always be actioned to ensure optimum vehicle condition and customer satisfaction

DB9 VEHICLE MAINTENANCE SHEET

1,000 miles 10,000 miles 20,000 miles
 1,500 km 16,000 km 32,000 km
 3 months 12 months 24 months

Electrical Function Check

Every 70,000 mls	112,000 km			C	A
			Renew spark plugs	/	
x	x	x	Check and record battery voltage	/	
x	x	x	Check and service the battery connections if necessary	/	
x	-	x	Check and if necessary adjust headlamp alignment	/	
x	x	x	Check operation of all lights	/	
x	x	x	Check operation of all warning indicators	/	
x	x	x	Check audible warnings including security system	/	
x	x	x	Check operation of the horns	/	
x	x	x	Check operation of the windscreen wipers	/	
x	x	x	Check operation of the windscreen / headlight washers / jets	/	
x	x	x	Check rear view mirrors for security and function / heaters	/	
x	x	x	Check foldback mirrors if fitted	/	
x	x	x	Check electric window operation	/	
x	x	x	Check the battery disconnect / connect switch	/	
x	x	x	Check the service indicator and reset	/	
			Anti Corrosion Check	C	A
-	x	x	Check body panels and underbody for corrosion starting from the inside out (excluding stone chips)	/	

1,000 miles 10,000 miles 20,000 miles
 1,500 km 16,000 km 32,000 km
 3 months 12 months 24 months

Wheels and Tyres Check

				C	A
x	x	x	Check for correct tyre size, type and orientation	/	
x	x	x	Check and report tyre tread depth	/	
x	x	x	Check tyres for uneven / excessive wear or damage	/	
x	x	x	Check / adjust tyre pressures	/	
x	x	x	Check torque of road wheel nuts	/	
x	x	x	Check road wheel rims for inner and outer damage and report	/	
x	x	x	Check colour coded Tyre Pressure Monitoring System valve caps are on correct wheels if applicable	/	
x	x	x	Check operation of tyre pressure sensors	/	
x	x	x	Check date of tyre inflation kit	/	

Final Checks

				C	A
x	x	x	Degrease windscreen	/	
x	x	x	Carry out road test	/	
x	x	x	Check ABS and Traction Control operation	/	
x	x	x	Check operation of all seat belts and buckles	/	
x	x	x	Check that fuel filler bowl rain drain is clear	/	

Gear Change Modes

				C	A
x	x	x	Auto	/	
x	x	x	Sport	/	
x	x	x	Touchtronic	/	
x	x	x	Reverse	/	

Dealer Stamp


Cole European
 2103 N. Main St.
 Walnut Creek, Ca. 94596

JACOBS
 DL#00669

DLH#112

ADSON MARTIN
 DLR#0005

Record fuel levels on arrival at Dealership

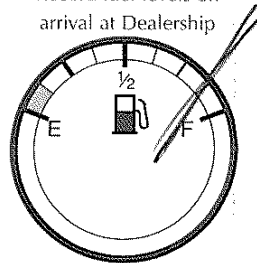

NB Always fill fuel tank prior to return

Open Circuit Battery Voltage

12.34v

To Remove Surface Charge:

- Key in Ignition- ON
- Head lamps ON 4 mins
- Head lamps OFF 2 mins
- Key out of Ignition- OFF
- Test Battery Voltage

*Tyre Wear Report

Outer	Centre	Inner	Outer	Centre	Inner
Across Tyre			Across Tyre		

* CW Rotation

Valve
90°
180°
270°

LHF mm

6	6	6
---	---	---

RHF mm

6	6	6
---	---	---

* CW Rotation

Valve
90°
180°
270°

LHR mm

5	6	6
---	---	---

RHR mm

5	6	6
---	---	---

▲ Tyre pressures set to:

Front	36
Rear	38

Regardless of low service mileage, time intervals should always be actioned to ensure optimum vehicle condition and customer satisfaction

Cole European

317797

INVOICE

PAGE 1

Member of the Cole Car Company Inc.
 Serving the Bay Area Since 1963
 Sales: 2103 North Main Street
 Service & Parts: 1421 Lesnick Lane
 Walnut Creek, CA 94596
 Telephone: 925.935.2653

BAR# ARD 00130543

EPA# CAR 000161936


SERVICE ADVISOR: 200 STEVEN HALLETT

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN	TAG
STSI	07	ASTON MARTIN DB9VOLA	SCFAD02A97GB08976	6AZN063	4526/4560	T707
IN SERVICE DATE	PROD DATE	WARR EXP	PROMISED	PO NO.	PAYMENT	INV DATE
20OCT07 IS		20OCT2010	17:00 10FEB09		CASH	17FEB09
R.O. OPENED	CUSTOMER NOTIFIED DATE	OPTIONS: STK:7A1143 DLR:005 AXL:2				
10FEB09	17FEB09					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A	DB9 12 MONTH/10,000 MILE SERVICE						
	DB912MO DB9 12 MONTH/10,000 MILE SERVICE						
	248 CA					1365.00	1365.00
	1 4G43-44-10818 OIL FILTER				50.93	50.93	50.93
	1 4G43-04-10205 DRAIN PLUG				30.37	30.37	30.37
	1 1R12-08-10317 O-RING				3.80	3.80	3.80
	12 0W40M-QT OIL				11.29	11.29	135.48
	2 1182202899 QRT DISTILLED WATER				0.80	0.80	1.60
	1 C2C31221 FLUID-BRAKE				22.85	22.85	22.85
	1 ZC32A CLEANER				4.95	4.95	4.95
	1 JAG101 TECH FLUID PK6				13.60	13.60	13.60
	1 M715 BRAKE CLEANER				3.99	3.99	3.99

B	CUSTOMER REQUESTS CHECK ALIGNMENT						
	4WA 4-WHEEL ALIGNMENT						
	393 CA					480.00	480.00

C	CUSTOMER REQUESTS CHECK WHEEL BALANCE						
	G74 PERFORM WHEEL BALANCE						
	413 CA					160.00	160.00

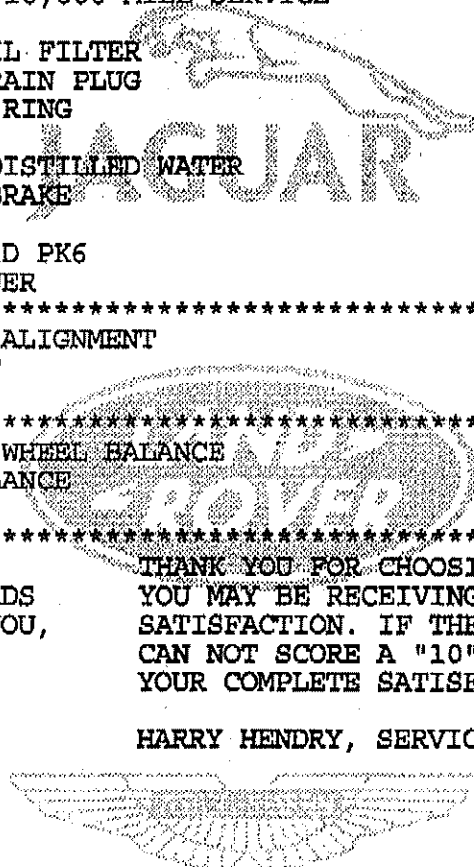

FRONT BRAKE PADS 8.3MM
 REMAINING. REAR BRAKE PADS
 6.9MM REMAINING. THANK YOU,
 STEVE

THANK YOU FOR CHOOSING US TO SERVICE YOUR CAR
 YOU MAY BE RECEIVING A SURVEY TO ENSURE YOUR
 SATISFACTION. IF THERE IS ANY REASON WHY WE
 CAN NOT SCORE A "10", PLEASE LET US KNOW
 YOUR COMPLETE SATISFACTION IS OUR #1 PRIORITY

HARRY HENDRY, SERVICE MANAGER (925)935-2653

ORIGINAL ESTIMATE: \$ _____	FINAL REVISED ESTIMATE: \$ _____	"By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary." "HAZARDOUS WASTE DISPOSAL" which includes such items as engine oil, automatic transmission fluid, antifreeze, differential fluid, batteries, etc. will be charged as a separate charge if removed in the servicing of your vehicle. TEAR DOWN ESTATE: I understand that my vehicle will be reassembled within _____ days of the date shown above if I choose not to authorize the service recommended.	DESCRIPTION	TOTALS
HAZARDOUS WASTE DISPOSAL: \$ _____	I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.		I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.	LABOR AMOUNT
PARTS ARE NEW UNLESS SPECIFIED OTHERWISE. Notice To Consumer: Please read important information on back.			PARTS AMOUNT	267.57
			GAS, OIL, LUBE	0.00
			SUBLET AMOUNT	0.00
			MISC. CHARGES	0.00
			TOTAL CHARGES	2272.57
			LESS INSURANCE	0.00
			SALES TAX	22.07
			PLEASE PAY THIS AMOUNT.	2294.64
<small>WARNING: Motor vehicles contain substances known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and parts and materials used to maintain vehicles, including, but not limited to, tires, oil, batteries, brakes, and vehicle lubrication systems. When you service, clean or maintain your car, you will be exposed to these chemicals contained in used oil, waste and replacement fluids, fumes, grease, gums, touch-up paint, certain replacement parts, and particulates from component wear. When you service your car, we will return used components to you upon request. Used parts and components contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when working on or cleaning your vehicle: 1) work in a well-ventilated area; 2) do not breathe in the fumes; 3) do not get on your skin; 4) do not get on your clothes when taking a break; and 5) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Printed in accordance with Proposition 65 in Cal. Health & Safety Code § 25249.5 et seq.) For further information about Proposition 65, please contact the State of California at 1-800-953-5868.</small>				

CUSTOMER COPY

Cole European

317796

INVOICE

Member of the Cole Car Company Inc.
 Serving the Bay Area Since 1963
 Sales: 2103 North Main Street
 Service & Parts: 1421 Lesnick Lane
 Walnut Creek, CA 94596
 Telephone: 925.935.2653

PAGE 1

BAR# ARD 00130543

EPA# CAR 000151938

SERVICE ADVISOR: 200 STEVEN HALLETT

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN	TAG
STSI	07	ASTON MARTIN DB9VOLA	SCFAD02A97GB08976	6AZN063	4526/4560	T707
IN SERVICE DATE	PROD. DATE	WARR. EXP.	PROMISED	PD. NO.	PAYMENT	INV. DATE
20OCT07 IS		20OCT2010	17:00 01MAR09		CASH	17FEB09
R.O. OPENED	CUSTOMER NOTIFIED DATE	OPTIONS: STK:7A1143 DLR:005 AXL:2				
10FEB09	17FEB09					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
A	FSA163	FUEL FILLER CAP VALVE MALFUNCTION-V8 VANTAGE 06-08 MY-DB9					

07-08 MY
 FSA163 FSA163-FUEL FILLER CAP VALVE MALFUNCTION-V8 VANTAGE 06-08 MY-DB9-07-08 MY
 248 WA (N/C)
 1 4G43-68-10936 FUEL CAP SERVICE KIT (N/C)
 4 JHC200401 CLIP-HOSE (N/C)



B SHORTER DIPSTICK FOR DB9 V12 VEHICLES
 FSA165 SHORTER DIPSTICK FOR DB9 V12 VEHICLES
 248 WA (N/C)
 1 4G4E-6750-AC OIL DIP STICK (N/C)
 1 4G43-19A509-AA/S TRANS FLUID (N/C)

C** TECH. FOUND TRANSMISSION COOLER LINES LEAKING @ COOLER
 G44 TRANS. LINES NOT AVAILABLE - RE-CLAMP LINES
 AND TOP UP FLUID
 248 WA (N/C)

D** RIGHT FRONT UPPER CONTROL ARM BUSHING FOUND DEFECTIVE WHEN ALIGNING
 G60 REPLACE UPPER CONTROL ARM
 248 WA (N/C)
 1 4G43-3084-BD RH CTRL. ARM UPPER (N/C)

E** ALIGN AFTER CONTROL ARM REPLACEMENT
 G57 4-WHEEL ALIGNMENT

ORIGINAL ESTIMATE: \$	FINAL REVISED ESTIMATE: \$	DESCRIPTION	TOTALS
		LABOR AMOUNT	
		PARTS AMOUNT	
		GAS, OIL, LUBE	
		SUBLET AMOUNT	
		MISC. CHARGES	
		TOTAL CHARGES	
		LESS INSURANCE	
		SALES TAX	
		PLEASE PAY THIS AMOUNT	

HAZARDOUS WASTE DISPOSAL: \$
 I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.

I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.

"By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary."
 "HAZARDOUS WASTE DISPOSAL" which includes such items as engine oil, automatic transmission fluid, antifreeze, differential fluid, batteries, etc. will be charged as a separate charge if removed in the servicing of your vehicle.
 TEAR DOWN ESTATE: I understand that my vehicle will be reassembled within _____ days of the date shown above if I choose not to authorize the service recommended.

PARTS ARE NEW UNLESS SPECIFIED OTHERWISE.
Notice To Consumer: Please read important information on back.

WARNING: Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, vehicle fluids, and paints and materials used to maintain vehicles, including, but not limited to, fuel, oil, battery, brake, and wheel (spinning weights). When you service, clean or maintain your car, you will be exposed to these chemicals contained in fuel, oil, brake and suspension fluids, hoses, greases, paint, touch-up paint, custom replacement parts, and maintenance of motor vehicles and vehicle components. When you service, clean or maintain your car, you will be exposed to these chemicals in the State of California to cause cancer and birth defects or other reproductive harm. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) work in a well-ventilated area; 2) do not eat, drink, or use tobacco products when working on or near a vehicle; and 3) follow all manufacturer instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posted in accordance with Proposition 65 in Cal. Health & Safety Code § 25249.5 et seq.) For further information about Proposition 65, visit www.P65.gov.

Cole European

317796

INVOICE

Member of the Cole Car Company Inc.
 Serving the Bay Area Since 1963
 Sales: 2103 North Main Street
 Service & Parts: 1421 Lesnick Lane
 Walnut Creek, CA 94596
 Telephone: 925.935.2653

PAGE 2

BAR# ARD 00130543

EPA# CAR 000151838


SERVICE ADVISOR: 200 STEVEN HALLETT

COLOR	YEAR	MAKE/MODEL	VIN	LICENSE	MILEAGE IN	TAG
STSI	07	ASTON MARTIN DB9VOLA	SCFAD02A97GB08976	6AZN063	4526/4560	T707
IN SERVICE DATE	PROD DATE	WARR EXP	PROMISED	PD NO	PAYMENT	INV DATE
20OCT07 IS		20OCT2010	17:00 01MAR09		CASH	17FEB09
R.O. OPENED	CUSTOMER NOTIFIED DATE	OPTIONS: STK:7A1143 DLR:005 AXL:2				
10FEB09	17FEB09					

LINE	OPCODE	TECH	TYPE	HOURS	LIST	NET	TOTAL
	393	WA					(N/C)

THANK YOU FOR CHOOSING US TO SERVICE YOUR CAR
 YOU MAY BE RECEIVING A SURVEY TO ENSURE YOUR
 SATISFACTION. IF THERE IS ANY REASON WHY WE
 CAN NOT SCORE A "10", PLEASE LET US KNOW
 YOUR COMPLETE SATISFACTION IS OUR #1 PRIORITY

HARRY HENDRY, SERVICE MANAGER (925)935-2653

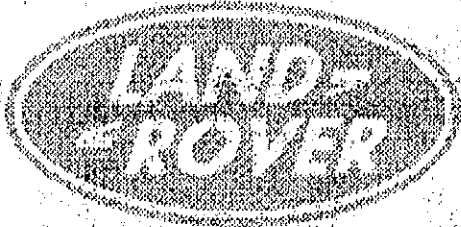

ORIGINAL ESTIMATE: \$	FINAL REVISED ESTIMATE: \$	"By law, you may choose another licensed Smog Check facility to perform any needed repairs or adjustments that the Smog Check test indicates are necessary." "HAZARDOUS WASTE DISPOSAL" which includes such items as engine oil, automatic transmission fluid, antifreeze, differential fluid, batteries, etc., will be charged as a separate charge if removed in the servicing of your vehicle. TEAR DOWN ESTATE: I understand that my vehicle will be reassembled within days of the date shown above if I choose not to authorize the service recommended.	DESCRIPTION	TOTALS
HAZARDOUS WASTE DISPOSAL: \$	I ACKNOWLEDGE RECEIPT OF VEHICLE AND I HAVE RECEIVED A COPY OF THIS INVOICE.		I ACKNOWLEDGE NOTICE AND ORAL APPROVAL OF AN INCREASE IN THE ORIGINAL ESTIMATED PRICE.	LABOR AMOUNT
PARTS ARE NEW UNLESS SPECIFIED OTHERWISE. Notice To Consumer: Please read important information on back.			PARTS AMOUNT	0.00
			GAS, OIL, LUBE	0.00
			SUBLET AMOUNT	0.00
			MISC. CHARGES	0.00
			TOTAL CHARGES	0.00
			LESS INSURANCE	0.00
			SALES TAX	0.00
			PLEASE PAY THIS AMOUNT	0.00

WARNING: Motor vehicles contain chemicals known to the State of California to cause cancer and birth defects or other reproductive harm. These chemicals are contained in many vehicle components and replacement parts, including fluids, and some and materials used to maintain vehicles. To minimize your exposure when servicing, maintaining or cleaning your vehicle: 1) Work in a well-ventilated area; 2) Do not swallow, inhale or get chemicals on your skin; 3) Wash hands and face after handling; 4) Use parts and replacement parts that are labeled as being safe for use in California to cause cancer, are labeled as being safe for use in California to cause reproductive harm; 5) Do not use compressed air to clean your clothing or skin; and 6) Follow all manufacturer's instructions pertaining to proper use and maintenance of motor vehicles and vehicle components. (Posting in accordance with Proposition 65 in Cal. Health & Safety Code 125248.5 et seq.) For further information about Proposition 65, visit the website www.P65.gov.

CUSTOMER COPY

BAR:AG1955350
 EPA:CAD982003303
 Date: 11/20/2008
 Time: 4:09:33PM

Brooks Motor Cars

9829 Bigge St.
 Oakland, CA 94603
 (510)-632-8901

RO #003933

Final Bill Page 1 of 3

Scheduled: 11/4/2008 Arrival: 11/4/2008	Make: 2007 Aston Martin Model: DB9 Style: 2D Conv License: 6AZN063 Color: SILVER VIN: Mileage: 3,838 Hat No.: Unit No.:	CUSTOMER PAYING SEE HOME ADDRESS NOTE CITY, CA 94603 Adjuster: Ins. Co. Phone (510) 632-8901 x Claim #: Date of Loss: Source: Mitchell UltraMate® EMS
--	---	--

*** **Thank you for coming to our shop for your repairs.** ***

Line	Line Items	Price	Labor	Paint	Other
1	Repr RT. FENDER		474.00 B		
2	RT. FENDER			308.10 R	
3	R&I RT. FENDER		434.50 B		
4	Repr FRONT BUMPER			158.00 R	
5	FRONT BUMPER			276.50 R	
6	Overhaul FRONT BUMPER		395.00 B		
7	R&I RT. ROCKER MLDG		158.00 B		
8	Repl RT. ROCKER SEAL	78.50 F	39.50 B		
9	Repl RT. HEADLAMP ASSEMBLY	1,818.50 F	79.00 B		
10	Repl CLEAR ARMOR Sublet				300.00 O
11	FLEX ADDITIVE	8.00 O			
12	CLEAR COAT			237.00 R	
13	TINT COLOR			39.50 R	
14	FINISH SAND AND BUFF			316.00 R	
15	MASK FOR OVERSPRAY			23.70 R	
16	PAINT/MATERIALS				438.60 P
17	HAZARDOUS WASTE DISPOSAL				5.00 Z

BAR:AG1955350
EPA:CAD982003303
Date: 11/20/2008
Time: 4:09:34PM

Brooks Motor Cars

9829 Bigge St.
Oakland, CA 94603
(510)-632-8901

RO #003933

Final Bill Page 2 of 3

Totals	Total \$
Parts, Foreign (F)	1,897.00
Parts, Other (O)	8.00
Parts Total	1,905.00
Labor, Body (B)	1,580.00
Labor, Refinish (R)	1,358.80
Labor Total	2,938.80
Hazardous Waste (Z)	5.00
Paint (P)	438.60
Sublet Other (O)	300.00
Other Total	743.60
Subtotal	5,587.40
SALES TAX (Rate =8.750%)	205.07
Total	5,792.47
Insurance Total	5,792.47

Brooks Motor Cars

BAR:AG1955350
EPA:CAD982003303
Date: 11/20/2008
Time: 4:09:34PM

9829 Bigge St.
Oakland, CA 94603
(510)-632-8901

RO #003933

Final Bill Page 3 of 3

All part prices in the Price column that are marked as (D) Domestic or (F) Foreign are new and made by the original equipment manufacturer (OEM). Part prices marked as (A) are aftermarket, new, non-OEM. Part prices marked as (U) are Used. Part prices marked as (O) are Other parts as described. See Totals area for additional price details. Other terms: Repl or R&R = Remove and Replace, O/H = Overhaul, R&I = Remove and Install.

ALL REPLACEMENT PARTS ARE O.E.M. UNLESS OTHERWISE SPECIFIED AS "AFTERMARKET/NEW." YOU ARE HEREBY AUTHORIZED TO MAKE THE ABOVE SPECIFIED REPAIRS: I UNDERSTAND THAT PAYMENT IN FULL WILL BE DUE UPON RELEASE OF VEHICLE, INCLUDING ADDITIONAL SUPPLEMENTAL DAMAGE CHARGES AND HEREBY GRANT YOU AND/OR YOUR EMPLOYEES, PERMISSION TO OPERATE THE VEHICLE HERIN DESCRIBED ON STREETS, HIGHWAYS, OR ELSEWHERE FOR THE PURPOSE OF TESTING OR INSPECTION. AN EXPRESS MECHANIC'S LIEN IS HEREBY ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO. WE WILL NOT BE HELD RESPONSIBLE FOR LOSS OR DAMAGE TO VEHICLE OR ARTICLES LEFT IN VEHICLE IN CASE OF FIRE, THEFT, ACCIDENT, OR ANY OTHER CAUSE BEYOND OUR CONTROL. THIS REPAIR ORDER INCLUDES FULL POWER AND AUTHORITY TO SIGN MY NAME TO ALL CHECKS, DRAFTS, OR NEGOTIABLE INSTRUMENTS RELATED TO OR ARISING OUT OF WORK PERFORMED. PARTS PRICES ARE SUBJECT TO INVOICE.

SIGNED X _____ DATE _____