

sean nguyen  
 637 luscombe st  
 independence OR, 97351  
 Sean Nguyen  
 503-510-0126

# Invoice

Invoice Number: 10003  
 Issue Date: 08/04/2016

Bill Moore

sunroof coupe

Qty	Item	Description	Unit Price	Total
1	parts	Parts 1 ATE master cylinder 240.69 2 front caliper kits 52.02 2 rear caliper kits 39.18 2 front rubber lines 55.58 2 rear rubber lines 45.96 shipping from stoddard 27.89 misc consumables	\$486.32	\$486.32
1	labor	4 hrs labor caliper rebuild 3 hrs labor remove and install calipers replace rubber lines and master cylinder, bleed brake	\$525.00	\$525.00
			Subtotal	\$1,011.32
			Total Amt	\$1,011.32
			Paid Today	\$1,011.32
			Balance Due	\$0.00

Please contact us for more information about payment options.

Thank you for your business.

sean nguyen  
637 luscombe st  
independence OR, 97351  
Sean Nguyen  
503-510-0126

# Invoice

Invoice Number: 10004  
Issue Date: 09/29/2016

68,200

Bill Moore

Qty	Item	Description	Unit Price	Total
1	tune up	new plugs clean adjust points adjust valves change oil/ filter top off gear oil  Parts gear oil 9.00 4 quarts VR1 10.36 ea 4 NGK plugs 4.62 ea 2 hours labor 150.00	\$218.92	\$218.92
1	shifter	remove floor mats, driver seat, pedal boards shifter rod, lever and coupler, replace all 3 bushings reinstall adjust and safty wire  parts 3 bushings and shipping from sierra madre 62.14 2.5 hours	\$249.64	\$249.64

plugged in clock made buzzing noise removed clock, quote from seattle speedometer 225 to rebuild plus shipping

Please contact us for more information about payment options.

Thank you for your business.



Qty	Item	Description	Unit Price	Total
1	wheel bearings	pull front wheel bearings clean out what was left of old grease re pack wheel bearings replace seals re install brakes parts 2 wheel seal grease 20.00 2 hours labor  check nuts and bolts over the suspension suspension labor .5	\$207.50	\$207.50
			Subtotal	\$676.06
			Total Amt	\$676.06
			Paid Today	\$676.06
			Balance Due	\$0.00

68,200



**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 441431-800-342-1414 440-869-9890  
FAX (440) 946-9410 WEBSITE HTTP://WWW.STODDARD.COMNO RETURN WITHOUT PRIOR AUTHORIZATION.  
NO RETURN WITHOUT THIS INVOICE.  
NO RETURN ON ELECTRICAL PARTS OR SPECIAL ORDER PARTS.  
20% HANDLING ON ALL RETURNED PARTS.  
NO RETURN ON ANY PART AFTER 10 DAYS. MOO602**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 44143UPS SHIPPER NO.  
OH 477-398

PKG ID#

SOLD TO

BILL & JANE MOORE  
20102 SW HIGH HAWK RD  
MCMINNVILLE, OR 97128-8388

SHIP TO

WILLIAM MOORE  
20102 SW HIGH HAWK ROAD  
MCMINNVILLE, OR 97128

Terms: CASH RETAIL SALE

PO#:

PAGE 1 OF 1

Sold By: 5521

Invoice Date: 04 OCT 16

Invoice# 576882

Ship By: UPS GND

Tax#

Qty	Qty	Qty		Part-No.	And Description		Price	Sale	Amount
Ord	Ship	B/O							
1	1	0	644-611-121-00	COVER/6 VOLT	02		45.60	45.60	45.60
1	1	0	SIC-611-025-20	BATTERY STRAP	29		27.45	27.45	27.45
2	2	0	644-628-091-00	STRAP	16		11.13	11.13	22.26

VISA: XXXX-XXXX-XXXX-7097

APPROVAL CODE: 08919C

THANK YOU, BRAD BROWNELL

FREIGHT 17.73

The seller STODDARD NLA, LLC, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of the item/items. On open item account transactions: net 30 days (1.5% after 30 days)

Subtotal:	95.31
Freight:	17.73
Tax:	0.00

Phone: (503) 472-4652

113.04

stpl1100\_1

CUSTOMER COPY



# THINGS TO DO **TODAY**



1964 Coupe

DATE 12/28/16

COMPLETED ☒

1. Lube 67,835 Dve 70,835 ☐
2. Adjust valves 68,200 71,200 ☐  
oil filter " "
3. Gear oil " " ☐  
O.I Change " "
4. Plugs " " ☐
5. Lube 5/30/17 68,393 ☐
6. Oil Change/F.Her/screen 7/21/17 68,520 ☐
7. ☐
8. ☐
9. ☐
10. ☐



**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 441431-800-342-1414 440-869-9890  
FAX (440) 946-9410 WEBSITE HTTP://WWW.STODDARD.COMNO RETURN WITHOUT PRIOR AUTHORIZATION.  
NO RETURN WITHOUT THIS INVOICE.  
NO RETURN ON ELECTRICAL PARTS OR SPECIAL ORDER PARTS.  
20% HANDLING ON ALL RETURNED PARTS.  
NO RETURN ON ANY PART AFTER 10 DAYS. MO0602**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 44143UPS SHIPPER NO.  
OH 477-398

PKG ID#

**SOLD TO**BILL & JANE MOORE  
20102 SW HIGH HAWK RD  
MCMINNVILLE, OR 97128-8388**SHIP TO**WILLIAM MOORE  
20102 SW HIGH HAWK ROAD  
MCMINNVILLE, OR 97128

Terms: CASH RETAIL SALE

PO#: 30997

PAGE 1 OF 1

Sold By: 5523

Invoice Date: 17 APR 17

Invoice# 591077

Ship By: REGULAR MAIL

Tax#

Qty	Qty	Qty		Part-No. And Description	Price	Sale	Amount
Ord	Ship	B/O					
1	1	0	NLA-701-012-00	FRAM DECAL 37	6.95	6.95	6.95

100030997 CC#0319

AUTHO #60092047496

THANK YOU FOR YOUR ORDER -- DEVON

JNBMOORE356@YAHOO.COM

FREIGHT

1.30



The seller STODDARD NLA, LLC, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of the item/terms. On open item account transactions: net 30 days (1.5% after 30 days)

Subtotal:	6.95
Freight:	1.30
Tax:	0.00

Phone: (503) 472-4652

8.25



**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 441431-800-342-1414 440-869-9890  
FAX (440) 946-9410 WEBSITE HTTP://WWW.STODDARD.COMNO RETURN WITHOUT PRIOR AUTHORIZATION.  
NO RETURN WITHOUT THIS INVOICE.  
NO RETURN ON ELECTRICAL PARTS OR SPECIAL ORDER PARTS.  
20% HANDLING ON ALL RETURNED PARTS.  
NO RETURN ON ANY PART AFTER 10 DAYS. MO0602

SOLD TO

BILL & JANE MOORE  
20102 SW HIGH HAWK RD  
MCMINNVILLE, OR 97128-8388**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 44143UPS SHIPPER NO.  
OH 477-398

PKG ID#

SHIP TO

WILLIAM MOORE  
20102 SW HIGH HAWK ROAD  
MCMINNVILLE, OR 97128

Terms: CASH RETAIL SALE

PO#: VERBAL

PAGE 1 OF 1

Sold By: 5514

Invoice Date: 12 MAY 17

Invoice# 593082

Ship By: MAIL

Tax#

Qty	Qty	Qty		Part-No. And Description	Price	Sale	Amount
Ord	Ship	B/O					
1	1	0	NLA-741-111-00	CABLE	59	25.16	25.16

VISA: XXXX-XXXX-XXXX-0319

APPROVAL CODE: 01398C

THANK YOU..KEITH--1-800-438-8119

FREIGHT 4.71



The seller STODDARD NLA, LLC, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of the item/terms. On open item account transactions: net 30 days (1.5% after 30 days)

Subtotal:	25.16
Freight:	4.71
Tax:	0.00

Phone: (503) 472-4652

29.87



**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 441431-800-342-1414 440-869-9890  
FAX (440) 946-9410 WEBSITE HTTP://WWW.STODDARD.COMNO RETURN WITHOUT PRIOR AUTHORIZATION.  
NO RETURN WITHOUT THIS INVOICE.  
NO RETURN ON ELECTRICAL PARTS OR SPECIAL ORDER PARTS.  
20% HANDLING ON ALL RETURNED PARTS.  
NO RETURN ON ANY PART AFTER 10 DAYS. MO0602**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 44143IPS SHIPPER NO.  
OH 477-398

PKG ID#

**SOLD TO**BILL & JANE MOORE  
20102 SW HIGH HAWK RD  
MCMINNVILLE, OR 97128-8388**SHIP TO**WILLIAM MOORE  
20102 SW HIGH HAWK ROAD  
MCMINNVILLE, OR 97128

Terms: CASH RETAIL SALE

PO#: VERBAL

PAGE 1 OF 1

Sold By: 5523

Invoice Date: 16 JUN 17

Invoice# 595996

Ship By: PRI MAIL

Tax#

Qty	Qty	Qty		Part-No. And Description	Price	Sale	Amount
Ord	Ship	B/O					
8	8	0	644-521-191-01	SEAT BUFFER 69	5.53	5.53	44.24

VISA: XXXX-XXXX-XXXX-0319

APPROVAL CODE: 05441C

THANK YOU FOR YOUR ORDER -- DEVON

jnbmoore356@yahoo.com

FREIGHT 7.31



The seller STODDARD NLA, LLC, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of the item/terms. On open item account transactions: net 30 days (1.5% after 30 days)

Subtotal:	44.24
Freight:	7.31
Tax:	0.00

Phone: (503) 472-4652

51.55



sean nguyen  
637 luscombe st  
independence OR, 97351  
Sean Nguyen  
503-510-0126

# Invoice

Invoice Number: 10013  
Issue Date: 11/24/2017

Bill Moore  
coupe

clean up motor, replace plugs, ohm wires, file and ga  
points, adjust valves, clean up engine compartment,  
touch up black paint, address drainplug leak, replace  
clutch/pressure plate  
4hrs labor 300.00  
plugs 4.19 x4  
oil 48.00 (amzoil)  
clutch 189.42  
pressure plate 260.39

Qty	Item	Description	Unit Price	Total
1	remove motor and trans	2. hrs labor	\$150.00	\$150.00
1	dissassemble clean and seal trans	completly dissassemble trans and clean and inspect, replace all seals and replace T.O. bearing, axle bearings,and hoop mounts 8 hrs labor 600.00 parts gasket set 129.68 axle seal kits 25.24x2 gear oil 68.99 hoop mounts 217.12x2 throw out bearing 219.48	\$1,502.87	\$1,502.87

Please contact us for more information about payment options.

Thank you for your business.

Qty	Item	Description	Unit Price	Total
1	clean up/tune up motor	clean up motor, new plugs, ohm wires, file and gap points, adjust valves, clean engine compartment/touch up paint, address drainplug leak, replace clutch/pressure plate 4hrs labor 300.00 plugs 4.19 x4 oil 48.00 (amzoil) clutch 189.42 pressure plate 260.39	\$814.57	\$814.57
1	install motor	install motor, adjust clutch adjust ebrakes,bleed brakes,lube suspension button up and drive 2 hrs labor 150.00 consumables engine degreaser, brake clean, brake fluid etc 100.00	\$250.00	\$250.00
			Subtotal	\$2,717.44
			Total Amt	\$2,717.44
			Paid Today	\$2,717.44
			Balance Due	\$0.00



sean nguyen  
637 luscombe st  
independence OR, 97351  
Sean Nguyen  
503-510-0126

# Invoice

Invoice Number: 10018  
Issue Date: 02/19/2018

Bill Moore

super 90 coupe

Qty	Item	Description	Unit Price	Total
1	carb rebuild	carb rebuild 5 hrs install 1 hr to be tuned pendingh weather	\$450.00	\$450.00
			Subtotal	\$450.00
			Total Amt	\$450.00
			Paid Today	\$450.00
			Balance Due	\$0.00

Please contact us for more information about payment options.

Thank you for your business.



**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 441431-800-342-1414 440-869-9890  
FAX (440) 946-9410 WEBSITE HTTP://WWW.STODDARD.COMNO RETURN WITHOUT PRIOR AUTHORIZATION.  
NO RETURN WITHOUT THIS INVOICE.  
NO RETURN ON ELECTRICAL PARTS OR SPECIAL ORDER PARTS.  
20% HANDLING ON ALL RETURNED PARTS.  
NO RETURN ON ANY PART AFTER 10 DAYS. MO0602**STODDARD**  
PARTS190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 44143UPS SHIPPER NO.  
OH 477-398

PKG ID#

**SOLD TO**BILL & JANE MOORE  
20102 SW HIGH HAWK RD  
MCMINNVILLE, OR 97128-8388**SHIP TO**WILLIAM MOORE  
20102 SW HIGH HAWK ROAD  
MCMINNVILLE, OR 97128

Terms: CASH RETAIL SALE

PO#: 5730NLA

PAGE 1 OF 1

Sold By: 5514

Invoice Date: 21 FEB 18

Invoice# 613768

Ship By: PRIMAIL

Tax#

Qty	Qty	Qty		Part-No. And Description	Price	Sale	Amount
Ord	Ship	B/O					
1	1	0	644-612-301-01	GROUND STRAP 16	17.29	17.29	17.29


VISA: XXXX-XXXX-XXXX-5573

APPROVAL CODE: 08445C

THANK YOU..KEITH--1-800-438-8119

jnbmoore356@yahoo.com

FREIGHT 7.92

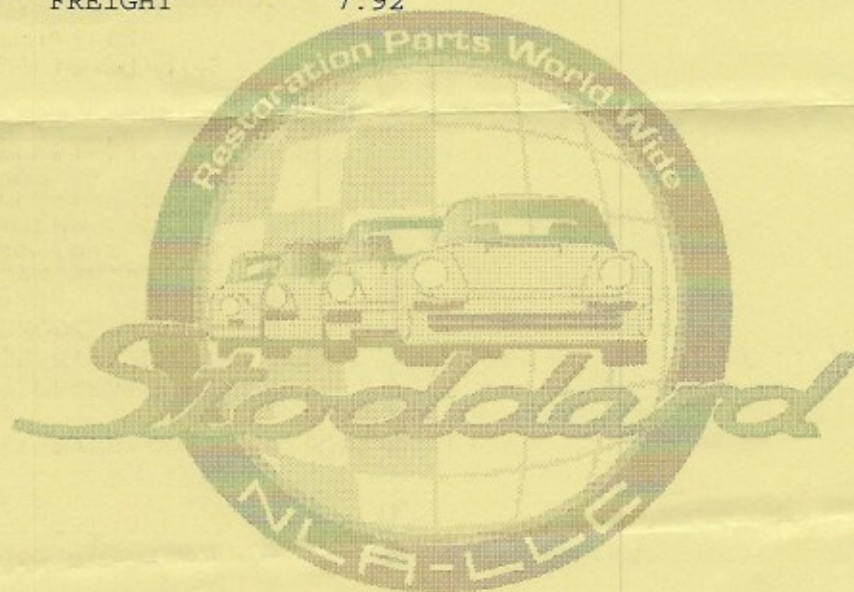

The seller STODDARD NLA, LLC, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of the item/terms. On open item account transactions: net 30 days (1.5% after 30 days)

Subtotal:	17.29
Freight:	7.92
Tax:	0.00

Phone: (503) 472-4652

25.21



# Heckmann & Thiemann Motors

2327 SE Powell Blvd  
Portland, OR, 97202



**Heckmann &  
Thiemann Motors**  
Volkswagen Porsche Audi Subaru

**503-233-4809**

**www.heckmannthiemann.com**

## Courtesy Inspection w/Education - HT

<b>Customer:</b>	Bill Moore	<b>License:</b>	
<b>Vehicle:</b>	1964 PORSCHE 356 SERIES	<b>VIN:</b>	
<b>Inspection date:</b>	05/31/2018	<b>Odometer:</b>	69,235 miles
<b>Repair Order:</b>	3521	<b>Technician:</b>	Andy Fey

**We have  
inspected your  
vehicle with the  
following results:**



**Andy Fey, Technician**



**Jordan Martirosian,  
Service Advisor**

## Diagnose and Test

**PERFORM 54 POINT COURTESY INSPECTION**



**DIAGNOSE ENGINE STALLS AT ABOUT 60 MPH -**

Road tested vehicle. Engine hiccups under steady cruise. Check dwell. Dwell was off. Check distributor cap and rotor. Check points and condenser.

Replace points. Adjust dwell and timing. Adjust carburetor co and synchronize

idle.

A

Cyl #2 does not respond. Remove and

clean idle jet.

Remove and inspect all spark plugs.

Replace plugs. 4) BP6HS

Check compression. 175 175 170 170

Check plug wires.

Check for air leak on intake.

Cyl 2 still doesn't respond and Engine

hesitates/ sputters slightly on light

acceleration or cruise. Need to remove

carburetor / disassemble and inspect.

*Notes:*

Road tested vehicle. Engine hiccups under steady cruise. Check dwell. Dwell was off. Check distributor cap and rotor. Check points and condenser.

Replace points. Adjust dwell and timing.

Adjust carburetor co and synchronize idle.

A

Cyl #2 does not respond. Remove and clean idle jet.

Remove and inspect all spark plugs. Replace plugs. 4) BP6HS



Check compression. 175 175 170 170

Check plug wires.

Check for air leak on intake.

Cyl 2 still doesn't respond and Engine hesitates/ sputters slightly on light acceleration or cruise. Need to remove carburetor / disassemble and inspect.

### DIAGNOSTIC - CHECK CLUTCH CABLE

*Notes:*

Clutch cable looks ok. Clutch pedal feels good.



# Inspection Details

## Good

Road Test	Observation	Action
Walk Around		
VIN Plate / Sticker		
Instrument Cluster		
Under Hood	Observation	Action
Engine Code	Notes: Engine Code ____	
Fluid Diagnostic Sheet	Notes: Picture is required.	
Under Car	Observation	Action
Front Tires	7/32 Tread Left Notes: Set Tire Pressure 26PSI	
Front Brakes	7 mm	
Rear Tires	5/32 Tread Left Notes: Set Tire Pressure 30PSI	
Rear Brakes	7 mm	



# Good

## Road Test

✓ Engine cranking	✓ Warning Lights	✓ Clutch Engagement
✓ Shifting	✓ Chassis	✓ Alignment
✓ Braking	✓ Parking Brake	✓ Nose Dive
✓ Acceleration Squat	✓ Steering	

## In Car

✓ Horn	✓ Turn Signals/Hazards	✓ Windshield Wipers
✓ Air Conditioning/Heater	✓ Headlights	✓ Power Windows
✓ Brake/Running Lights		

## Under Hood

✓ Engine Oil	✓ Cooling System Hoses	✓ Cooling Fans
✓ Air Filter	✓ Battery	✓ Fuel System

## Under Car

✓ Front Strut/Shock	✓ Rear Strut/Shock	✓ Brake Hydraulics
✓ Drive Axle Boots	✓ Exhaust System	✓ More Detail if Needed



## Needs future Attention

In Car	Observation	Action
Old Oil Change Sticker Mileage	Notes: Oil Change Due at No sticker	
Under Hood	Observation	Action
Brake Fluid	2% Moisture	
Under Car	Observation	Action
Suspension/Steering	Minor Play Notes: Some play in king and link pins.	
Fluid Leaks	Engine Oil Notes: oil leaks around strainer plate, pulley seal and fuel pump area.	

## Needs Immediate Attention


Road Test	Observation	Action
Engine Performance	Hesitates	




## Needs Immediate Attention

Under Hood	Observation	Action
Transmission Fluid	<p>Low</p> <p><i>Notes:</i></p> <p>Topped up trans oil. 1 pint 75w90 gear oil</p>	<p>The transmission is what directs the power of your cars engine to the wheels at the steady speed to provide the best balance of performance and fuel efficiency even under the most extreme load or temperature conditions. It's made up of over 2,000 moving parts that need to be lubricated and cooled constantly. Having your transmission fluid serviced regularly can extend the life of your transmission and prevent a transmission rebuild or complete replacement. For more information click and watch:</p>
Drive Belts	Cracking	




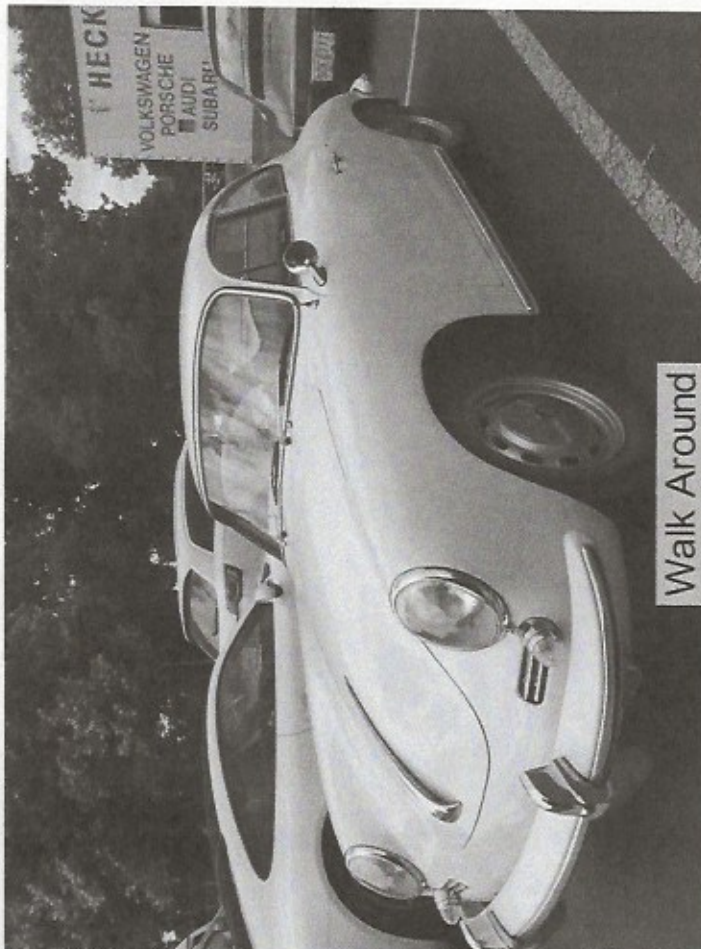


Walk Around

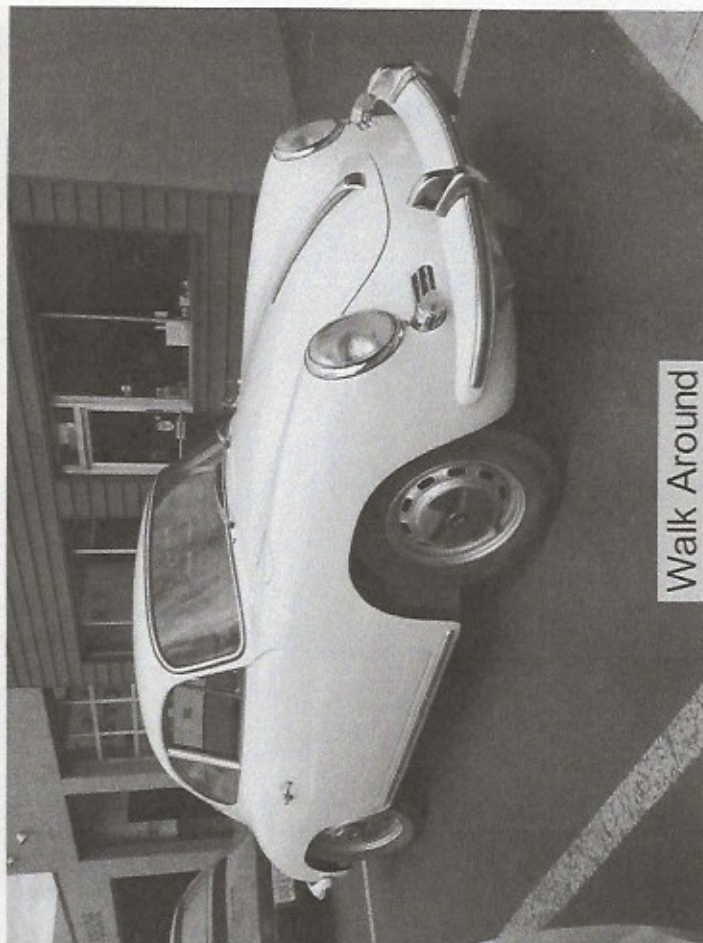

Walk Around

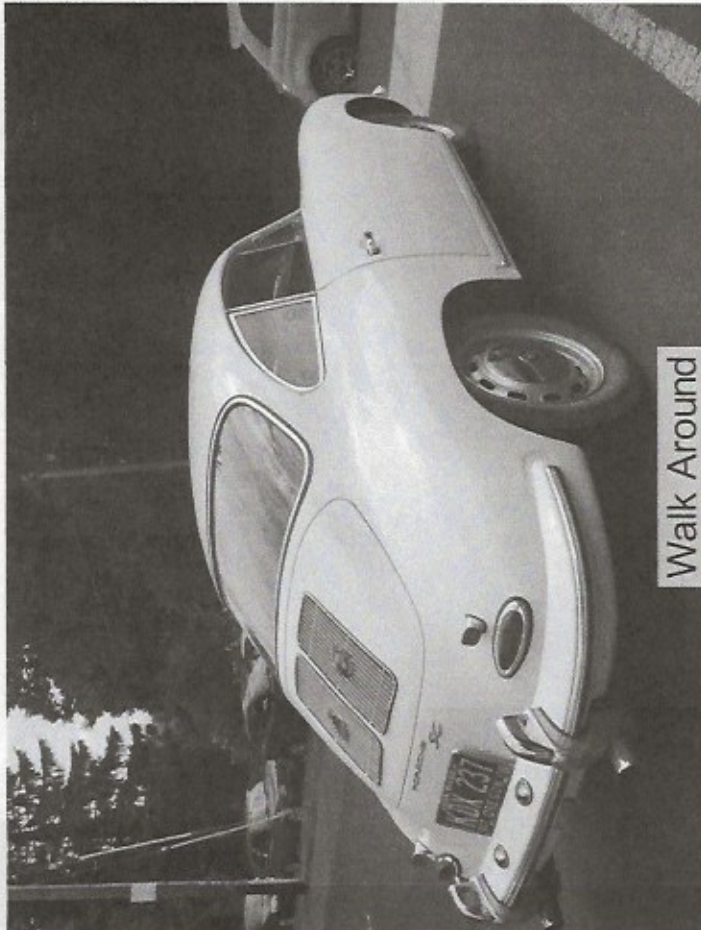


Walk Around

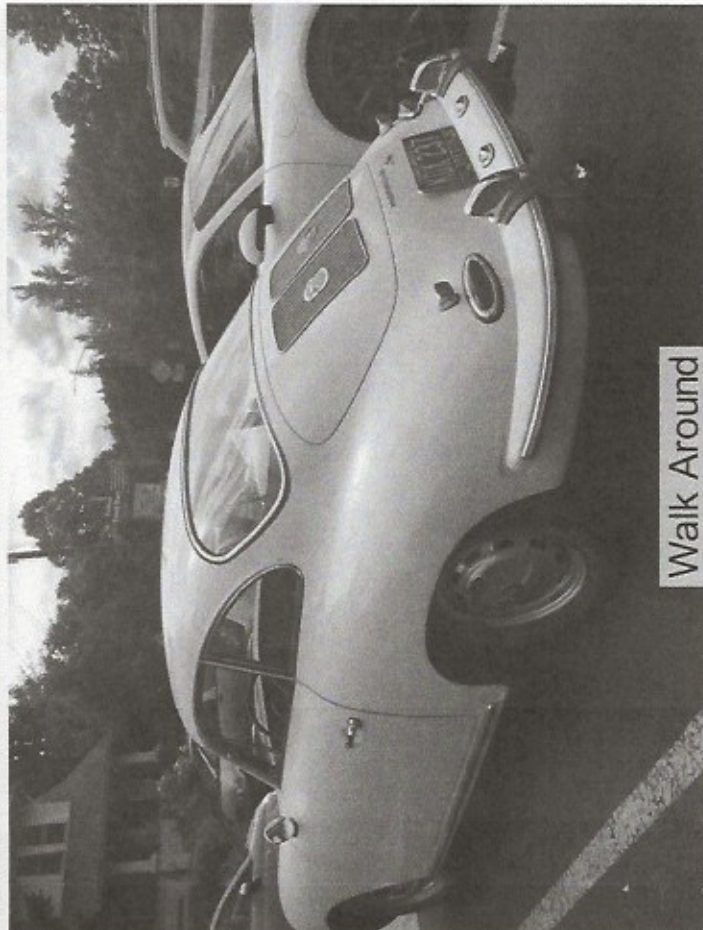

Walk Around




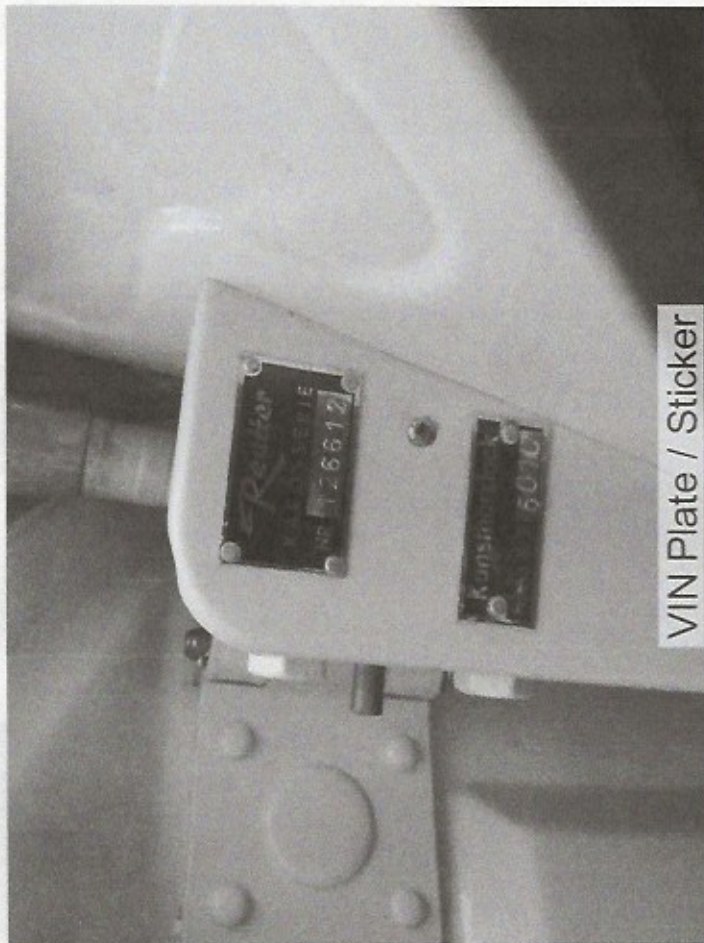


VIN Plate / Sticker



Instrument Cluster

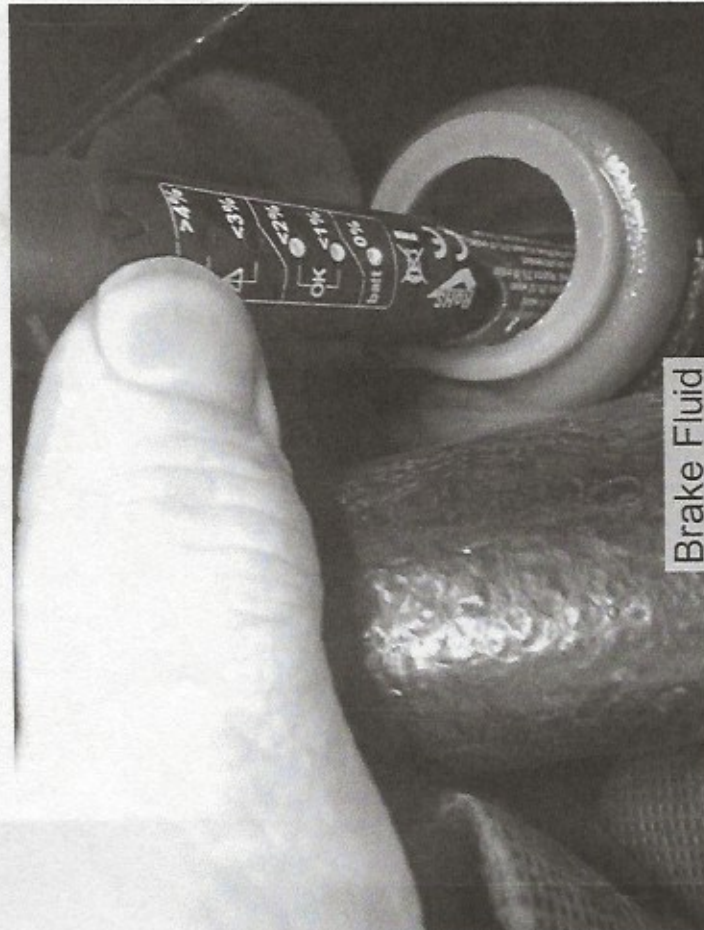


Brake Fluid

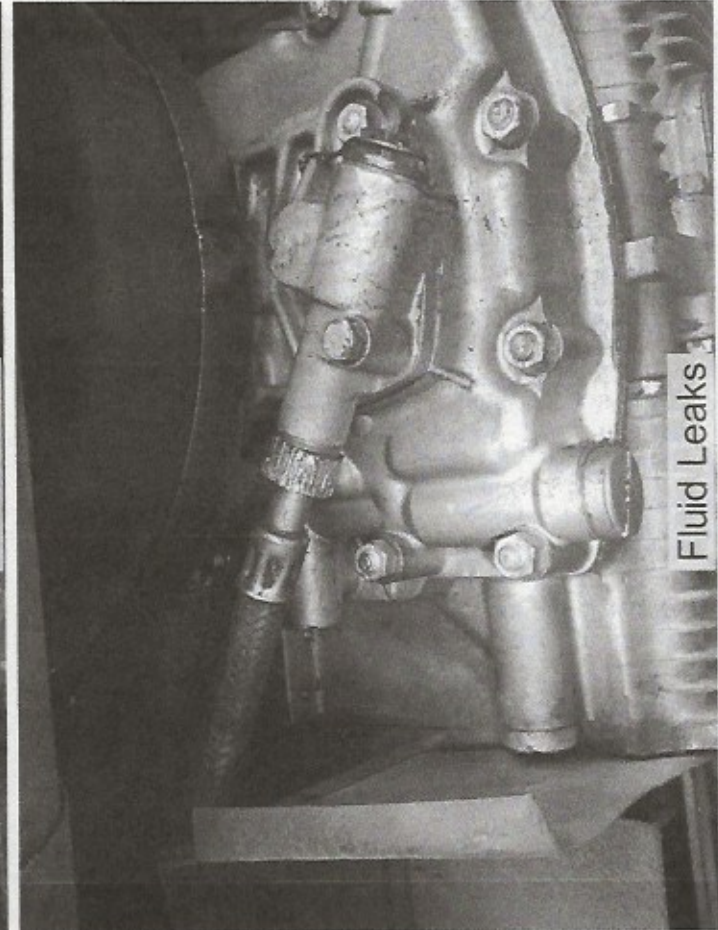

Fluid Leaks



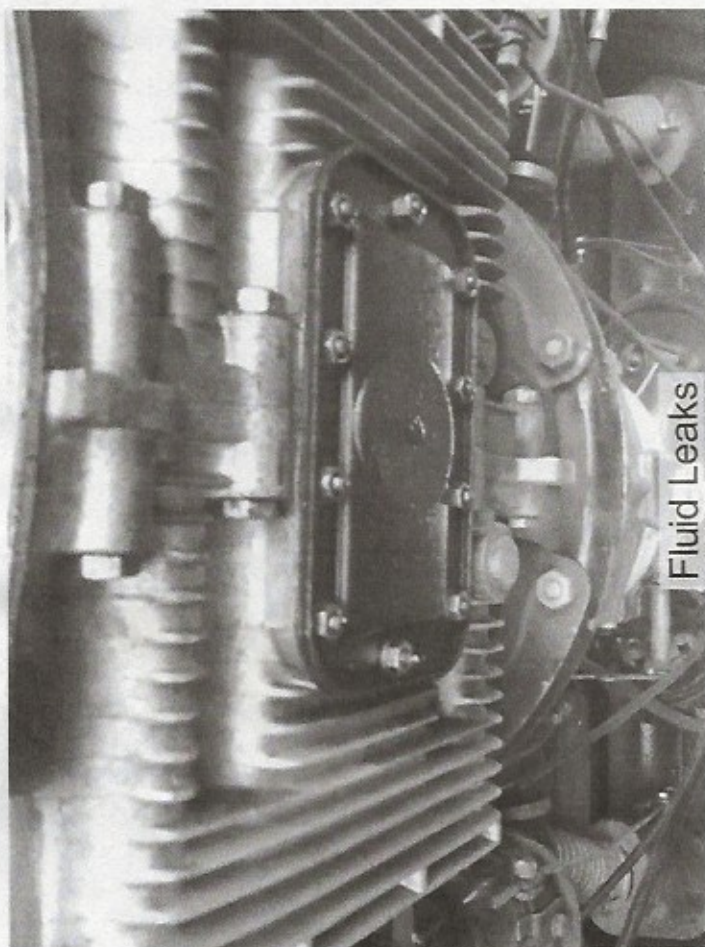



**Heckmann & Thiemann Motors, Inc**

2327 SE Powell Blvd  
Portland, OR 97202  
(503) 233-4809

PROUD TO SERVE YOU SINCE 1968

**Invoice Order # 0003521**

Original Estimate #

**MOORE, BILL**  
20102 SW HIGH HAWK  
MCMINNVILLE, OR 97128  
Phone 1: (503) 472-4652  
Phone 2: ()

**1964 Porsche 356 series**

Key# :

8

VIN :

Clr :

YELLOW

Mileage: In 69250 Out 69250

Fleet #: 8

6/15/2018

License : KDX237

10:55 am

Technician	Service Description	Parts	Labor	Job Total										
45	PERFORM 54 POINT COURTESY INSPECTION		0.00											
45	DIAGNOSE ENGINE STALLS AT ABOUT 60 MPH - Road tested vehicle. Engine hiccups under steady cruise. Check dwell. Dwell was off. Check distributor cap and rotor. Check points and condenser. Replace points. Adjust dwell and timing. Adjust carburetor co and synchronize idle. A Cyl #2 does not respond. Remove and clean idle jet. Remove and inspect all spark plugs. Replace plugs. 4) BP6HS Check compression. 175 175 170 170 Check plug wires. Check for air leak on intake. Cyl 2 still doesn't respond and Engine hesitates/ sputters slightly on light acceleration or cruise. Need to remove carburetor / disassemble and inspect.	34.20	488.51	522.71										
<table> <tr> <th><u>Part Number</u></th><th><u>Part Description</u></th><th><u>Part Price Each</u></th><th><u>Quantity</u></th><th><u>Extended</u></th></tr> <tr> <td>BP6HS</td><td>SPARK PLUG</td><td>8.55</td><td>4</td><td>34.20</td></tr> </table>					<u>Part Number</u>	<u>Part Description</u>	<u>Part Price Each</u>	<u>Quantity</u>	<u>Extended</u>	BP6HS	SPARK PLUG	8.55	4	34.20
<u>Part Number</u>	<u>Part Description</u>	<u>Part Price Each</u>	<u>Quantity</u>	<u>Extended</u>										
BP6HS	SPARK PLUG	8.55	4	34.20										
45	DIAGNOSTIC - CHECK CLUTCH CABLE		149.76	149.76										
45	PORSCHE 356 CARB OVERHAUL-BOTH SIDES	244.42	1013.89	1258.31										
<table> <tr> <th><u>Part Number</u></th><th><u>Part Description</u></th><th><u>Part Price Each</u></th><th><u>Quantity</u></th><th><u>Extended</u></th></tr> <tr> <td>SO25K</td><td>CARBURETOR KIT</td><td>122.21</td><td>2</td><td>244.42</td></tr> </table>					<u>Part Number</u>	<u>Part Description</u>	<u>Part Price Each</u>	<u>Quantity</u>	<u>Extended</u>	SO25K	CARBURETOR KIT	122.21	2	244.42
<u>Part Number</u>	<u>Part Description</u>	<u>Part Price Each</u>	<u>Quantity</u>	<u>Extended</u>										
SO25K	CARBURETOR KIT	122.21	2	244.42										

**Payments:**

MSTR CHARG VISA, \$1970.65, on 06/15/18

CardNo: [\*\*\*\*\*5573], AuthorizationNo: []

**Authorizations**

Approved By	Approval Given to:	Date	Time	Difference	Total Authorized	Method
BILL MOORE	JM	5/30/18	5:05 pm	\$366.74	\$366.74	By Phone
Reason:						
BILL MOORE	JM	6/4/18	5:20 pm	\$1,486.29	\$1,900.00	By Phone
Reason:						

**Repair Order Notes**

Inspection Type: Courtesy Inspection w/Education - HT  
For details go to: <http://tinyurl.com/ycfps3p7>  
Technician: Andy Fey





**Heckmann & Thiemann Motors, Inc**

2327 SE Powell Blvd  
Portland, OR 97202  
(503) 233-4809

PROUD TO SERVE YOU SINCE 1968

**Invoice Order # 0003521**

Original Estimate #

**MOORE, BILL**  
20102 SW HIGH HAWK  
MCMINNVILLE, OR 97128  
Phone 1: (503) 472-4652  
Phone 2: ()

**1964 Porsche 356 series**

Key# :

8

VIN :

Clr :

YELLOW

Mileage: In 69250 Out 69250

Fleet #: 8

6/15/2018

License : KDX237

10:55 am

**Technician    Service Description****Parts    Labor    Job Total**

I hereby authorize the repair work to be done along with the necessary parts & materials and hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere, at your discretion, for the purpose of testing and/or inspection. An express mechanics lien is hereby acknowledged on the above vehicle to secure the amount of repairs thereto. I understand that dealer/owner is not responsible for delay or other consequence due to the unavailability of parts shipments beyond their control. Not responsible for damage or articles left in car in case of fire, theft or any other cause beyond our control. WARRANTY IS 12 MONTHS OR 12,000 MILES WHICH EVER OCCURS FIRST, UNLESS SPECIFIED OTHERWISE!

TOTAL PARTS	\$278.62
TOTAL LABOR	\$1,652.16
SUBLET	\$0.00
Supply Chrg	\$39.87
SUBTOTAL	\$1,970.65
OTHER FEES	\$0.00
SALES TAX	\$0.00

**TOTAL REPAIR ORDER    \$1,970.65**

PAID	\$1,970.65
DUE	\$0.00

Customer Signature: \_\_\_\_\_ Date: \_\_\_\_\_





Tom Finley's Upholstery  
409 Oak St  
Dayton, OH 97114  
503-560-1997

No.

DATE

10-14-19

ORDER NO.

NAME

Bill Moore

ADDRESS

CITY, STATE, ZIP

SOLD BY

☐

CASH

☐

C.O.D.

☐

PAID OUT

☐

CHARGE

☐

MERCHANDISE RETURNED

QUANTITY

DESCRIPTION

PRICE

AMOUNT

Down Payment for  
Int. Seats

1400.00

PAID  
CHECK # 865

SIGNATURE



**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 441431-800-342-1414 440-869-9890  
FAX (440) 946-9410 WEBSITE HTTP://WWW.STODDARD.COMNO RETURN WITHOUT PRIOR AUTHORIZATION.  
NO RETURN WITHOUT THIS INVOICE.  
NO RETURN ON ELECTRICAL PARTS OR SPECIAL ORDER PARTS.  
20% HANDLING ON ALL RETURNED PARTS.  
NO RETURN ON ANY PART AFTER 10 DAYS. MO0602**STODDARD**  
PARTS190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 44143UPS SHIPPER NO.  
OH 477-398

PKG ID#

**SOLD TO**BILL & JANE MOORE  
20102 SW HIGH HAWK RD  
MCMINNVILLE, OR 97128-8388**SHIP TO**WILLIAM MOORE  
20102 SW HIGH HAWK ROAD  
MCMINNVILLE, OR 97128

Terms: CASH RETAIL SALE

Sold By: 5523

Ship By: PRI MAIL

PO#: VERBAL

Invoice Date: 16 OCT 19

Tax#

PAGE 1 OF 1

Invoice# 656846

Qty	Qty	Qty		Part-No. And Description		Price	Sale	Amount
Ord	Ship	B/O						
2	2	0	NLA-803-901-05	SEAT BELT	18	52.50	52.50	105.00

VISA: XXXX-XXXX-XXXX-5573

APPROVAL CODE: 09676D

THANK YOU FOR YOUR ORDER -- DEVON

jnbmoore356@yahoo.com

PRI MAIL

FREIGHT 15.78



The seller STODDARD NLA, LLC, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of the item/terms. On open item account transactions: net 30 days (1.5% after 30 days)

Subtotal:	105.00
Freight:	15.78
Tax:	0.00

Phone: (503) 472-4652

120.78

x1911.100.1

Copyright 2014 CDK Global, LLC PARTS INVOICE 1UP - P13C1 - IMAGING

**CUSTOMER COPY**



Tom Finley's Upholstery  
409 Oak St.  
Dayton, OR 97114  
503-560-1997

No.

DATE

11-12-19

ORDER NO.

NAME

Bill Moore

ADDRESS

CITY, STATE, ZIP

SOLD BY

☐

CASH

☐

C.O.D.

☐

PAID OUT

☐

CHARGE

☐

MERCHANDISE RETURNED

QUANTITY

DESCRIPTION

PRICE

AMOUNT

Leather Seat Gravel Burs

1400.00

13 hrs. Labor

650.00

2050.00

2050.00  
PAID 1400.00  
650.00

K & H PAID Check #875  
European Auto Upholstery  
Garden Grove 1-800-824-3356

SIGNATURE



sean nguyen  
637 luscombe st  
independence OR, 97351  
Sean Nguyen  
503-510-0126

# Invoice

Invoice Number: 10031  
Issue Date: 08/30/2019

70,094 miles

Bill Moore  
coupe

super 90 coupe

Qty	Item	Description	Unit Price	Total
1	hood hinge repair	remove hood remove pass hinge weld/repair/reshape star and latch reinstall adjust hood 4 hrs labor \$300.00	\$300.00	\$300.00
1	shocks	remove old shocks modify hardware install new shocks 1.5hrs 112.50	\$112.50	\$112.50
1	parking brake	adjust parking brakes .5 hrs labor	\$37.50	\$37.50
1	steering	fix steering start inspection at steering box end at steering wheel, (shafts needed adjustment at rag joint steering wheel was dragging on column) 3 hrs 225.00	\$225.00	\$225.00
1	clutch cable	replace clutch cable and bowden tube bowden tube 26.75 clutch cable 17.50 1.5 hrs labor	\$156.75	\$156.75
1	lube window mech	pull door handles window cranks and door panels lube window regulators 2 hrs	\$150.00	\$150.00

Please contact us for more information about payment options.

Thank you for your business.



Qty	Item	Description	Unit Price	Total
1	tires	verdistein tires tires shipped 595 mount and balance 100 tire disposal 20 1 hr labor 75	\$790.00	\$790.00
1	oil change/ vlave adj 70,000	change oil 4 qts valvoline VR1 4.99 ea pull starter and inspect lube 1 hr shop time Sump with DRAIN plug 189. <sup>00</sup> 2 HOURS LABOR CLEAN & INSTALL 170	\$94.96	\$94.96
			Subtotal	\$1,866.71
			Total Amt	\$1,866.71
			Paid Today	\$1,866.71
			Balance Due	\$0.00
				2205.71



Sean Nguyen  
Hoptown Fabrication  
637 Luscombe st  
Independence OR 97351

# Invoice

503-510-0126

Invoice Number: 10039  
Issue Date: 01/10/2020

Bill Moore

super 90 coupe

Qty	Item	Description	Unit Price	Total
1	headlight upgrade	pull head lights install h4 bulbs and h4 55/60 watt bulbs also install upgraded head light relays 1.5 hrs labor 142.50 3 h4 bulbs (1 spare in glove box) 52.17 7" head lights 139.00 head light relay kit 112.50 shipped	\$446.10	\$446.10
1	dash light upgrade	LED dash light up grade replace dash light bulbs with LED bulbs repair bulb holders 1 hr labor 95.00 6V LED bulbs 97.00 shipped	\$192.00	\$192.00
1	led tail light upgrade	replace/fit tail lights with led panels .5 hr labor 47.50 LED tail light boards 240 shipped	\$287.50	\$287.50
1	adjust heater	left side heater box spring was worn not opening fresh air box spring replaced and adjusted .5 hr labor	\$47.50	\$47.50
1	speedo/tach cable	pull pedal boards steering cloumn carpet shifter replace tach cable, pull front wheel replace speedo cable re assemble 2 hrs labor 190 speedo cable 25 tach cable 40 shipping 11.50	\$266.50	\$266.50

Please contact us for more information about payment options.

Thank you for your business.



Qty	Item	Description	Unit Price	Total
1	fuel tap	drain fuel pull tap rebuild test and index re install 2 hrs labor 190 rebuild kit 39.29 shipping 11.60	\$240.89	\$240.89
1	oil change/ service	change oil adj valves check poins set timing lube suspension/adjust hood 1.5 hr shop time 142.50 4 qts valvolene vr1 5.99 ea 23.96 filter 6.99	\$173.45	\$173.45
1	battery	take old battery in to be tested buy new batter install new battery .5 hr labor 47.50 battery 97.99	\$145.49	\$145.49
			Subtotal	\$1,799.43
			Total Amt	\$1,799.43
			Paid Today	\$1,799.43
			Balance Due	\$0.00





Palo Alto Speedometer, Inc.  
Instrument & Clock Service

718 Emerson Street  
Palo Alto, CA 94301-2410

T (650) 323-0243  
F (650) 323-4632  
www.paspeedo.com  
info@paspeedo.com  
Reg. # AD 86482

Bill Moore

Date 1/24/2020 Phone (503) 472-4652

Invoice No.

114215

Shipping Address

Bill Moore  
20102 SW High Hawk Rd  
McMinnville, OR 97128

Billing Address

Bill Moore  
20102 SW High Hawk Rd  
McMinnville, OR 97128

Shipping Method UPS Ground  
Account No.  
Tracking No. 1Z83350E0352744276  
Ship Date 3/9/2020  
Insurance 500.00

PO No.  
Year 1964  
Make Porsche  
License Plate  
RO No.  
Mileage  
Model  
VIN

Customer Info

Please convert to quartz. 6V system  
2/12/20: Called customer, no answer. Unable to leave message.  
2/25/20 8:50am: Estimate OK by phone, \$450.00 + UPS.  
No cosmetics.  
2-3 weeks to complete.  
3/9/2020 (8:28am) Called ready, left message.

Description of Work

VDO electric clock ?.6? hour, minute hands green numerals white pointers with gasket (but splitting) with bracket/hardware

Install new VDO quartz clock movement. Clean and polish lens and chrome bezel. No cosmetics \$450.00

Subtotal \$450.00

**Paid 3/9/2020**

Labor \$0.00

Parts \$450.00

Shipping \$24.43

Misc \$0.00

Tax \$0.00

Total \$474.43

ESTIMATES ARE FOR PARTS AND LABOR.

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. AN EXPRESS MECHANIC'S LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERETO. IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE BY THEFT OR FIRE TO VEHICLES PLACED WITH THEM FOR STORAGE, SALE, REPAIR OR WHILE ROAD TESTING.

Signature




**STODDARD****PARTS**190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 441431-800-342-1414 440-869-9890  
FAX (440) 346-9410 WEBSITE HTTP://WWW.STODDARD.COMNO RETURN WITHOUT PRIOR AUTHORIZATION.  
NO RETURN WITHOUT THIS INVOICE.  
NO RETURN ON ELECTRICAL PARTS OR SPECIAL ORDER PARTS.  
20% HANDLING ON ALL RETURNED PARTS. MOO602  
NO RETURN ON ANY PART AFTER 10 DAYS.**STODDARD**  
PARTS190 ALPHA PARK  
HIGHLAND HEIGHTS, OH 44143UPS SHIPPER NO.  
OH 477-398

PKG ID#

**SOLD TO**BILL & JANE MOORE  
20102 SW HIGH HAWK RD  
MCMINNVILLE, OR 97128-8388**SHIP TO**WILLIAM MOORE  
20102 SW HIGH HAWK ROAD  
MCMINNVILLE, OR 97128Terms: CASH RETAIL SALE  
Sold By: 5514  
Ship By: PRIORITY MAILPO# VERBAL  
Invoice Date: 12 JUN 20  
Tax#PAGE 1 OF 1  
Invoice# 673409

Qty	Qty	Qty	Part-No.	And Description	Price	Sale	Amount
Ord	Ship	B/O					
1	1	0	NLA-604-611-01	RELAY KIT 6V 3	85.20	85.20	85.20

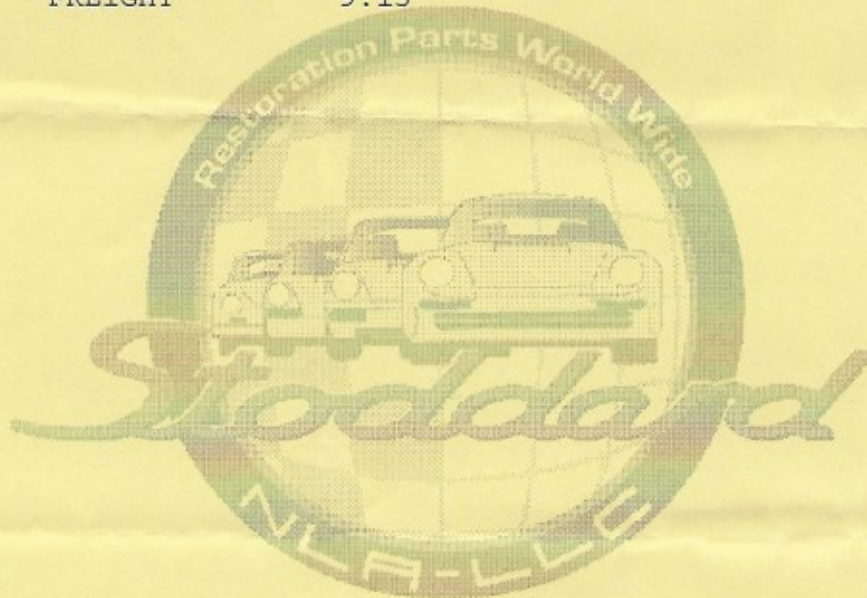VISA: XXXX-XXXX-XXXX-8599  
APPROVAL CODE: 03762D  
THANK YOU..KEITH--1-800-438-8119  
jnbmoore356@yahoo.com  
FREIGHT 9.13

The seller STODDARD NLA, LLC, hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and the seller neither assumes nor authorizes any other person to assume for it any liability in connection with the sale of the item/terms. On open item account transactions: net 30 days (1.5% after 30 days)

Subtotal: 85.20  
Freight: 9.13  
Tax: 0.00

Phone: (503) 472-4652

US DOLLARS

94.33





Palo Alto Speedometer, Inc.  
Instrument & Clock Service

718 Emerson Street  
Palo Alto, CA 94301-2410

T (650) 323-0243  
F (650) 323-4632  
www.paspeedo.com  
info@paspeedo.com  
Reg. # AD 86482

Bill Moore

Invoice No.

115831

Date

Phone

6/24/2020

(503) 472-4652

Shipping Address

Billing Address

Bill Moore

20102 SW High Hawk Rd

McMinnville, OR 97128

Bill Moore

20102 SW High Hawk Rd

McMinnville, OR 97128

PO No.

RO No

Year

Mileage

Make

Model

Porsche

356

License Plate

VIN

Shipping Method

Ship Date

US PRIORITY MAIL

6/25/2020

Account No.

Insurance

Tracking No.

10.00

9405503699300431323906

Customer Info

6/24/2020 (10:55am) Advised the customer, the USPS shipping will cost more than the part. We can not put the part simply in the mail.

Description of Work

Amount

1 x VDO steel light bulb socket, 6 Volt bulb

\$10.00

Subtotal

\$10.00

**Paid 6/25/2020**

Labor

\$0.00

Parts

\$10.00

Shipping

\$9.00

Misc

\$0.00

Tax

\$0.00

Total

**\$19.00**

ESTIMATES ARE FOR PARTS AND LABOR

I HEREBY AUTHORIZE THE ABOVE REPAIR WORK TO BE DONE ALONG WITH NECESSARY MATERIALS. YOU AND YOUR EMPLOYEES MAY OPERATE ABOVE VEHICLE FOR PURPOSES OF TESTING, INSPECTION OR DELIVERY AT MY RISK. AN EXPRESS MECHANIC'S LIEN IS ACKNOWLEDGED ON ABOVE VEHICLE TO SECURE THE AMOUNT OF REPAIRS THERE TO. IT IS UNDERSTOOD THAT THIS COMPANY ASSUMES NO RESPONSIBILITY FOR LOSS OR DAMAGE BY THEFT OR FIRE TO VEHICLES PLACED WITH THEM FOR STORAGE, SALE, REPAIR OR WHILE ROAD TESTING.

Signature





# McMinnville Volkswagen

1920 N.E. Highway 99 West P.O. Box 330 McMinnville, OR 97128-0330  
 McMinnville: (503) 472-4658 Salem: (503) 363-6183 Portland: (503) 295-2774  
 Fax: (503) 472-4998

## SERVICE INVOICE

R/O 70678	VIN 0 0 1 2 6 6 1 2	BILL MOORE		DATE IN 06/05/2020
YEAR 1964	MAKE PORSCHE	MODEL 356	COLOR O	TIME IN 15:30
MILES IN 71228	MILES OUT 71230	ODOMETER 00000/00	OR KDX237	CLOSED 14:36
SEE ALSO			RES H: (503) 472-4652 W: ( ) -	WRITER NICK\18

- |   |  |
|---|--|
| (1) CUSTOMER STATES THEY HAVE HAD ISSUE WITH 2<br>TIMES CAR NOT STARTING WHEN PARKED ON INCLINE<br>CHECK AND ADVISE<br>COULD NOT DUPLICATE CONCERN BUT DID FIND<br>STARTER STICKING & MAKING NOISE<br>REPLACED STARTER AND OPERATES TO SPECS<br>(Tech:29) A | Labor T29 287.50<br>IMC-SR21X (STARTER) 1 270.00<br>Total Labor ..... 287.50<br>Total Parts ..... 270.00<br>Total Repair (Customer )..... 557.50 |
| (2) INSTALLED CUSTOMER SUPPLIED RELAY KIT (LABOR<br>ONLY)<br>DONE<br>(Tech:29) A  | Labor T29 34.50<br>Total Labor ..... 34.50<br>Total Repair (Customer )..... 34.50  |
| (3) INSTALLED CLOCK AND BULB WITH PARTS SUPPLIED<br>BY CUSTOMER (LABOR ONLY)<br>DONE<br>(Tech:29) A   | Labor T29 115.00<br>Total Labor ..... 115.00<br>Total Repair (Customer )..... 115.00   |
| (4) INTERNAL TIME TO COVER TECHS TIME FOR<br>REPLACING FAULTY STARTER<br>(Tech:29) A  | Labor T29 15<br>..... (Internal ) .....  |



www.macvw.com

Next Service DEC '20 Lube-Oil-Filter

### DISCLAIMER OF WARRANTIES

Any warranties on the product sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

### TERMS

10% restocking charge applied on all merchandise returned for credit or refund. No returns after 30 days or without this invoice. Special order parts must be paid for in advance and are not returnable.

W/C

INT.

CUSTOMER

Labor	437.00
Parts	270.00
Sublet/Fees	.00
Shop Supplie	.00
Oil/Grease	.00
Sub Total	707.00
Tax	2.83
Total (Due)	709.83

Page 1 of 1

Job 70678

70678



Customer Copy





# McMinnville Volkswagen

1920 N.E. Highway 99 West P.O. Box 330 McMinnville, OR 97128-0330  
 McMinnville: (503) 472-4658 Salem: (503) 363-6183 Portland: (503) 295-2774  
 Fax: (503) 472-4998

## SERVICE INVOICE

R/O 72257	VIN 0 0 1 2 6 6 1 2	BILL MOORE		DATE IN 03/02/2021
YEAR 1964	MAKE PORSCHE	MODEL 356	COLOR O	TIME IN 13:05
MILES IN 71365	MILES OUT 71367	FIRST USE 00/00/00	LISC OR KDX237	CLOSED 10:38
SEE ALSO			RES. H: (503) 472-4652	BUS. W: (503) -
			WRITER NICK\18	

- (1) PERFORM ENGINE OIL AND FILTER CHANGE.  
 TOP OFF ALL FLUIDS AND PERFORM VEHICLE  
 INSPECTION. SEE SHEET FOR DETAILS  
 DONE

Labor	T29	25.00
CQ-85010	(OIL FILTER) 1	15.95
CQ-VV211	(20W50 HI PERFO) 5	59.90
Total Labor		25.00
Total Parts		75.85
Total Repair (Customer)		100.85

(Tech:29) A

- (2) PERFORM TUNE UP PER CUSTOMER REQUEST  
 REPLACED SPARK PLUGS & GAPPED, VALVE ADJUST,  
 CARB ADJUST, POINTS CLEANED & ADJUSTED, TIMED  
 ENGINE, CLEANED CAP & ROTOR, ADJUSTED BELTS,  
 REPLACED FUEL FILTER AND VALVE COVER GASKETS

Labor	T29	593.40
CQ-CFI86031	(FUEL FILTER) 1	7.18
CQ-NGK7534	(SPARK PLUG) 4	23.80
IMC-61610795100	(V/C GASKET) 2	24.72
Total Labor		593.40
Total Parts		55.70
Total Repair (Customer)		649.10

(Tech:29) A



www.macvw.com

Next Service SEP '21 LUBE-OIL-FILTER

### DISCLAIMER OF WARRANTIES

Any warranties on the product sold hereby are those made by the manufacturer. The seller hereby expressly disclaims all warranties, either expressed or implied, including any implied warranty of merchantability or fitness for a particular purpose, and neither assumes nor authorizes any person to assume for it any liability in connection with the sale of said products. Any limitation contained herein does not apply where prohibited by law.

**TERMS**  
 10% restocking charge applied on all merchandise returned for credit or refund. No returns after 30 days or without this invoice. Special order parts must be paid for in advance and are not returnable.

W/C	INT.	CUSTOMER
		Labor
		Parts
		Sublet/Fees
		Shop Supplie
		Oil/Grease
		Sub Total
		Tax
		Total (Due)

Page 1 of 1

Job 72257

72257

\*72257\*

Customer Copy