

1989 PORSCHE 911 TURBO CABRIOLET

10/6/18

w/ SLANTNOSE - OPTION CODE M505

- GUARDS RED w/ CASHMERE, 282HP, 3.3L,
- FACTORY CERTIFICATE OF AUTHENTICITY
- 1989 FACTORY BROCHURE w/ FINISH OPTIONS
- G50 FIVE SPEED - ONE YEAR ONLY - 1989
- MULTIPLE SETS OF FACTORY KEYS
- TWO OWNERS, NORTHERN CALIFORNIA
- 45,000 MILES
- OPTIONAL EQUIPMENT: STEER WHEEL w/ RAISED HUB
TUNNEAU COVER
AMPLIFIER SYSTEM
HEATED SEAT - LEFT
SLANT NOSE
LIMITED SLIP DIFFERENTIAL
"CD-2" CD PLAYER w/ RADIO
SHORTER GEAR SHIFT LEVER
LUGGAGE COMPARTMENT
BLACK VELOUR
- TOOL ROLL, JACK, SPARE TIRE, TIRE COMPRESSOR
- BOOKS,
- AIR CONDITIONING - DOES NOT WORK CURRENTLY
- SLIGHTEST WEAR ON DRIVER SEAT LEFT BOLSTER
- SLIGHT CHIP/CRACK IN WIND SHIELD, AT LEAST 14 YRS
- ONE OF 20 BUILT IN 1989
- PRICE NEW: 85,060 FOR TURBO CABRIOLET
IN 1989 29,555 FOR SLANT NOSE
\$114,615
- WITH BATTERY TENDER
- ALARM SYSTEM
- SEKURIFLEX WINDSHIELD w/ BUILT IN ANTENNA
- ORIGINAL PAINT, TOP, LEATHER,
- CORRECT BLAUPUNKT RADIO

1989 PORSCHE 911 TURBO
 CABRIOLET SLANTNOSE WPOEB0932K507052

DATE	MILEAGE	COST	DESCRIPTION	VENDOR
3-19-05	42,402	-	PURCHASE IN WALNUT CREEK	PRESTIGE AUTOHAUS
3-15-06*	41,112	410.13	CHANGE OIL, MISC. REPAIRS	"
5-9-07	43,739	50.25	SMOG TEST	SAVE ON SMOGS
5-1-08	44,090	1062.81	NEW BATTERY, OIL/BRAKE SERVICE	PRESTIGE AUTOHAUS
5-7-09	44,173	75.00	SMOG TEST	AAAAA SMOG CNTR
4-21-11	44,470	75.00	" "	"
5-13-13	44,780	85.00	" "	"
9-4-14		223.05	NEW BATTERY	AUTOS INTL.
4-18-15	44,971	61.75	FAILED SMOG TEST	AAAAA
4-20-15	44,996	655.28	OIL CHANGE, ADJUSTED IDLE	EUROPEAN AUTOTECH
4-21-15	44,996	INCL.	PASSED SMOG TEST	" " "
4-19-17	45,245	80.00	SMOG TEST	PACHECO SMOG
3-23-18	45,415	292.94	MINOR SERVICE, FLUID CHANGE	EUROPEAN AUTOTECH

* MILEAGE INCORRECT ON SERVICE DOCUMENT

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE

*CODE N-NEW U-USED R-REBUILT

QTY.	*	PART NO. OR DESCRIPTION	SALE AMOUNT
11		QTS HELIX SYNTHETIC 5W-40	211 20
1		OIL FILTER	28 87
TOTAL PARTS			240 07
OUTSIDE-SUBLET REPAIRS			

*PAID C/C
OMER*

PRESTIGE AUTOHAUS
 2259 North Main Street
 Walnut Creek, California 94596
 Phone (925) 937-5400
 BAR# AA 075111 -- EPA# CAL 000163257

020503
REPAIR ORDER

NAME		DATE	LABOR CHARGE PER HR.	
ADDR		3-15-06	MAINTENANCE INSPECTION	<input type="checkbox"/>
CITY			LUBRICATION	<input type="checkbox"/>
PHON		YEAR	MAKE	TYPE OR MODEL
RES.		89	PORSCHE	930
BUS.				
VEH. I.D.#	W P O E B O 9 3 2 K \$ 0 7 0 5 2 4	MILEAGE	LIC. #	MOTOR #
		041,112	5MEM588	
TIME REC'D	TIME PROM.	GROSS VEH. WT.	ORD. WRITTEN BY	CUST. ORDER NO.
A.M. P.M.	A.M. P.M.			
OPER. NO.	REPAIR ORDER - DESCRIPTION OF WORK			
OMER	REPAIR FRONT SEAT			N/C
	CHARGE BATTERY, CHECK CHARGING SYSTEM, INSTALL TANAU COVER CLIP			1.25HR 150 00
NOTE: BRAKE FLUID SYSTEM NEEDS TO BE FLUSHED TRANSAXLE OIL NEEDS TO BE CHANGED				

PLEASE INITIAL HERE _____ TOTAL SUBLET REPAIRS
 FOLLOWING REPAIRS RECOMMENDED

ORIGINAL ESTIMATE \$	390.00	DATE	3-15-06	IN PERSON BY	J. CABER
REVISED ESTIMATE \$		DATE		PH #	
REVISED ESTIMATE \$		DATE		PH #	

I acknowledge notice and oral approval of an increase in the original estimated price.

TOTAL LABOR	150 00
TOTAL PARTS	240 07
GAS, OIL, GREASE	
HAZARDOUS WASTE DISPOSAL	8 25
SUBLET REPAIRS	
SMOG CERTIFICATE	
SUB TOTAL	398 32
TAX	19 81
PAY THIS AMOUNT	418 13

GAS, OIL & GREASE	PRICE	LBS. GREASE	TOTAL GAS, OIL & GREASE
GALS. GAS @			
QTS. OIL @			

WARRANTY: From date of delivery for a period of 4,000 miles or 90 days, whichever comes first. This firm will repair free of charge any defects in material and workmanship to the repairs stated on this invoice. All work to be done in our shop only. This does not include towing charges or customer supplied parts.
 \$_____ per day storage fee will be charged 24 hours after notification of work completed.

CASH CHECK CHARGE CREDIT CARD

TERMS ARE CASH UNLESS OTHER PRIOR ARRANGEMENTS ARE MADE
SEE IMPORTANT INFORMATION ON BACK

Vehicle Information

Model Year... 1989 Make... PORSCHE Model... 911 CARRERA
License... 5MEM588 State... California VIN... WPOEB0932KS070524
Engine Size... 3.2 Liters Type... Passenger Transmission... Manual
GVWR... N/A Test Weight... 3000 lbs. Cylinders... 6
Odometer... 43739 Certification... California VLT Record #... 10758
Fuel Type... Gasoline Exhaust... Single Inspection Reason... 1.9% RND
Engine Year... N/A Engine Make... N/A Bar Number... N/A
Fleet BAR File #... N/A

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(2132Q159M154)
Smog Check Certificate Number..(MQ990367)

Your Smog Check certificate has been electronically transmitted to the DMV. This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

Table with 6 columns: ECS, Result, ECS, Result, ECS, Result. Rows include PCV, Catalytic Converter, Pump Air Injection, Vacuum lines sensors/switches, Fuel Cap Integrity Test, Thermostatic Air Cleaner, Spark Controls, Oxygen Sensor, Other related emis. components, Fuel Cap Visual, Fuel Evaporative Controls, Fuel Injection, Wiring to Sensors, Liquid Fuel Leak, Ignition Timing (26 BTDC).

SMOG CHECK VEHICLE INSPECTION REPORT

(05/09/2007 @ 9:16:00 am)

Page # 2 VIN..... WPOEB0932KS070524 License.. 5MEM588

ASM Emission Test Results

Table with 14 columns: Test, RPM, %CO2, %O2, HC (PPM), CO (%), NO (PPM), Result. Rows include M1: 15 MPH, M2: 25 MPH.

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Smog Check Station Information

SAVE ON SMOGS INC Technician Name/Number..... TEIFEL THOMAS ALLEN/EA137545
1250 CONTRA COSTA BLVD #107 Repair Tech Name/Number..... N/A
PLEASANT HILL, CA 94523 Software Version/EIS Number... 0311/SX980135
925 691 1045 Station Number..... TC232873

022084

PRESTIGE AUTOHAUS

2259 North Main Street
Walnut Creek, California 94596
Phone (925) 937-5400
BAR# AA 075111 -- EPA# CAL 000163257

REPAIR INVOICE

LABOR CHARGE PER HR. _____

ALL PARTS INSTALLED ARE NEW UNLESS SPECIFIED OTHERWISE
* CODE = N-NEW U-USED R-REBUILT O-OEM A-AFTERMARKET C-CUSTOMER SUPPLIED

* QTY	PART NO. & DESCRIPTION	AMOUNT
1	MEGA INTERSTATE BATTERY	193.73
1	OIL FILTER 930-107-764-01	34.10
11	QTS HELIX ULTRA SYNTHETIC OIL 5W/40	242.00
2	COPPER DRAIN PLUG SEALS	5.00
4	QTS SYNTHETIC GEAR OIL	88.00
2	COPPER DRAIN PLUG SEALS FOR TRANSAXLE	5.00
4	PTS BRAKE FLUID DOT-4	44.00
TOTAL PARTS		611.83

OUTSIDE-SUBLET REPAIRS

*PAID VISA
5-10-08*

INITIAL TO AUTHORIZE SUBLET REPAIRS _____ TOTAL SUBLET REPAIRS _____

FOLLOWING REPAIRS RECOMMENDED

WARRANTY: FROM DATE OF DELIVERY FOR A PERIOD OF 4,000 MILES OR 90 DAYS, WHICHEVER COMES FIRST, THIS FIRM WILL REPAIR FREE OF CHARGE ANY DEFECTS IN MATERIAL AND WORKMANSHIP TO THE REPAIRS STATED ON THIS INVOICE. ALL WORK TO BE DONE IN THIS SHOP ONLY. THIS DOES NOT INCLUDE TOWING OR CUSTOMER SUPPLIED PARTS.

DATE	5-1-08	<input type="checkbox"/> MAINTENANCE INSPECTION
STATE	ZIP	<input type="checkbox"/> LUBRICATION
HC		<input type="checkbox"/> CHANGE OIL GRADE:
PHONE WHEN READY	ORDER WRITTEN BY	LICENSE PLATE #
<input type="checkbox"/> YES <input type="checkbox"/> NO	MIKI/OMER	5MEM588
MAKE	MODEL	YEAR
PORSCHE	930 TURBO	1989
V.I.N. W P O E B 0 9 3 2 K S 0 7 0 5 2 4		ODOMETER
		44,090
G.W.V.R.		MOTOR #
CUST. PO #		<input type="checkbox"/> TRANS.
		<input type="checkbox"/> DIFF.
		<input type="checkbox"/> ROTATE TIRES
		<input type="checkbox"/> ALIGN FRONT END
OPR. # REPAIR ORDER • DESCRIPTION OF LABOR		
CAR TOWED IN. BATTERY COMPLETELY DEAD. CAR IS STORED MOSTLY.		
CHARGE OLD BATTERY, CHECK CHARGING SYSTEM. BATTERY IS DEAD.		
INSTALL NEW MEGA BATTERY.		.5 * 65.00
INSTALL CUSTOMERS SUPPLIED CONECTOR FOR AUTO BATT. CHARGER.N/C		
SERVICE TRANSAXLE AND REPLACE NEW GEAR OIL.		.5 65.00
FLUSH BRAKE SYSTEM, BLEED IT AND RENEW BRAKE FLUID		1.0 130.00
OIL, FILTER, LUBRICATION SERVICE & SAFETY INSPECTION		1.130.00
HAND WASH AND VACUM		N/C
ORIGINAL ESTIMATE \$	DATE	TIME
PHONE/CONTACT		<input type="checkbox"/> BY PHONE <input type="checkbox"/> EMAIL
		<input type="checkbox"/> IN PERSON <input type="checkbox"/> FAX
TOTAL LABOR		390.00
TOTAL PARTS		611.83
GAS, OIL, GREASE		
HAZARDOUS WASTE DISPOSAL		10.50
SUBLET REPAIRS		
SMOG CERTIFICATE		
SUBTOTAL		
TAX		50.48
TOTAL		1,062.81
REPLACED PARTS REQUESTED BY CUSTOMER? <input type="checkbox"/> YES <input type="checkbox"/> NO		
TERMS: <input type="checkbox"/> CASH <input type="checkbox"/> CHECK <input type="checkbox"/> CHARGE <input type="checkbox"/> DEBIT CARD <input type="checkbox"/> CREDIT CARD		

TERMS ARE CASH UNLESS PRIOR ARRANGEMENTS ARE MADE
SEE IMPORTANT INFORMATION ON BACK

PLEASE PAY THIS AMOUNT **1,062.81**

SMOG CHECK VEHICLE INSPECTION REPORT

(05/07/2009 @ 9:14:57 am)

Vehicle Information

Model Year..... 1989	Make..... PORSCHE	Model..... 911 CARRERA
License..... 5MEM588	State..... California	VIN..... WP0EB0932KS070524
Engine Size..... 3.2 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... 3000 lbs.	Cylinders..... 6
Odometer..... 44173	Certification..... California	VLT Record #..... 10758
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason.... 1.9% RND
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(2872K050N194)
Smog Check Certificate Number..(NK164888)

Your Smog Check certificate has been electronically transmitted to the DMV.
This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
PCV.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
EGR (Visual).....	Pass	Spark Controls.....	Pass	Fuel Injection.....	Pass
Pump Air Injection.....	Pass	Oxygen Sensor.....	Pass	Wiring to Sensors.....	Pass
Vacuum lines sensors/switches..	Pass	Other related emis. components.	Pass	Liquid Fuel Leak.....	Pass
Fuel Cap Integrity Test.....	Pass	Fuel Cap Visual.....	Pass	Malfunction Indicator Light....	Pass

SMOG CHECK VEHICLE INSPECTION REPORT

(05/07/2009 @ 9:14:57 am)

Page # 2

VIN..... WP0EB0932KS070524

License.. 5MEM588

ASM Emission Test Results

Test	RPM			%CO2			HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
M1: 15 MPH	1327	11.7	4.4	121	31	42	0.76	0.10	0.17	807	237	778	Pass			
M2: 25 MPH	2180	11.0	5.1	96	20	16	0.65	0.09	0.11	746	199	365	Pass			

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Smog Check Station Information

AAAAA SMOG CENTER INC
2134 MARKET ST
CONCORD, CA 94520
707.925.6973

Technician Name/Number..... ALVAREZ, RODOLFO/EA153089
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 0311/SX091079
Station Number..... TC257273

SMOG CHECK VEHICLE INSPECTION REPORT

(04/21/2011 @ 9:00:43 am)

Vehicle Information

Model Year..... 1989	Make..... PORSCHE	Model..... 911 CARRERA TURBO
License..... 5MEM588	State..... California	VIN..... WFOEB0932KS070524
Engine Size..... 3.3 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... 3375 lbs.	Cylinders..... 6
Odometer..... 44470	Certification..... California	VLT Record #..... 21476
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason..... 1.9% RND
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(2674C0500294)
Smog Check Certificate Number..(OC510340)

Your Smog Check certificate will be electronically transmitted to DMV
This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
PCV.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
Spark Controls.....	Pass	Fuel Injection.....	Pass	Pump Air Injection.....	Pass
Oxygen Sensor.....	Pass	Wiring to Sensors.....	Pass	Vacuum lines sensors/switches..	Pass
Other related emis. components.	Pass	Liquid Fuel Leak.....	Pass	Fuel Cap Visual.....	Pass
Ignition Timing (27 BTDC).....	Pass				

ASM Emission Test Results

Test	RPM		%CO ₂			HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS			
M1: 15 MPH	1350	11.8	4.2	114	31	50	0.73	0.10	0.19	785	237	784	Pass		
M2: 25 MPH	2163	11.1	4.8	88	20	21	0.61	0.09	0.13	724	199	388	Pass		


MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Smog Check Station Information

AAAAA SMOG CENTER INC
2134 MARKET ST
CONCORD, CA 94520
1 925 687 7664

Technician Name/Number..... ALVAREZ, RODOLFO/EA153089
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 1003/SX091079
Station Number..... TC257273

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

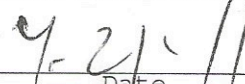

 Date



 Technician's Signature

SMOG CHECK VEHICLE INSPECTION REPORT

(05/13/2013 @ 2:22:55 pm)

Vehicle Information

Model Year..... 1989	Make..... PORSCHE	Model..... 911 CARRERA TURBO
License..... 5MEM588	State..... California	VIN..... WPOEB0932KS070524
Engine Size..... 3.3 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... 3375 lbs.	Cylinders..... 6
Odometer..... 44780	Certification..... California	VLT Record #..... 21476
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason..... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Visual Inspection..(Pass) Functional Check..(Pass) Emissions Test..(Pass)

DMV ID Number..(2012W1560534)
Smog Check Certificate Number..(OW237480)

Your Smog Check certificate has been electronically transmitted to the DMV.
This certificate is valid for ninety (90) days from the date of issuance.

Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
PCV.....	Pass	Fuel Evaporative Controls.....	Pass	Catalytic Converter.....	Pass
Spark Controls.....	Pass	Fuel Injection.....	Pass	Pump Air Injection.....	Pass
Oxygen Sensor.....	Pass	Wiring to Sensors.....	Pass	Vacuum lines sensors/switches..	Pass
Other related emis. components.	Pass	Liquid Fuel Leak.....	Pass	Fuel Cap Integrity Test.....	Pass
Fuel Cap Visual.....	Pass	Ignition Timing (27 BTDC).....	Pass		

ASM Emission Test Results

Test	RPM			HC (PPM)			CO (%)			NO (PPM)			Result
	MEAS	MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
M1: 15 MPH	1363	11.7	4.0	114	27	47	0.73	0.09	0.17	785	255	784	Pass
M2: 25 MPH	1588	11.5	4.3	88	18	31	0.61	0.07	0.11	724	223	602	Pass

MAX = Maximum Allowed Emissions AVE = Average Emissions For Passing Vehicles MEAS = Amount Measured

Smog Check Station Information

GREEN STAR SMOG CHECK TEST ONLY
2134 MARKET ST
CONCORD, CA 94520
1 925 687 7664

Technician Name/Number..... ALVAREZ, RODOLFO/EA153089
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 1201/SX061113
Station Number..... TC271756

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

Date

Technician's Signature

5-11-13

Autos International

2201 Commerce Ave
 Concord, CA. 94520
 Phone - 925-676-0440 Fax - 925-676-4286
 TRUSTED FOR OUTSTANDING SERVICE

INVOICE

2427

Org. Est. # 003029
 ARD 276078
 EO637210

INVOICE

Print Date : 09/04/2014

0 -
 Lic # : - Odometer In : 1
 Unit # : Odometer Out : 1
 Vin # :
 Hat # : Ref # :

Part Description / Number	Qty	Sale	Extended	Labor Description	Extended
WARRANTY 85 MO WARRANTY MTP49/H8	1.00	189.95	189.95		
WARRANTY CORE CHARGE BCC	1.00	16.00	16.00	<i>credited 9/12/14</i>	

Estimate \$ 223.05 Revisions \$ 0.00 Current Estimate \$ 223.05

Labor:	0.00
Parts:	205.95
Sublet:	\$0.00
Sub:	205.95
Tax:	17.10
Total:	223.05
Bal Due:	\$223.05

By: _____ Date: _____ Time: _____
 I hereby authorize the above repair work to be done along with the necessary material and hereby grant you and/or your employees permission to operate the car or truck herein described on street, highways or elsewhere for the purpose to testing and/or inspection. An express mechanic's lien is hereby acknowledged on above car or truck to secure the amount of repairs thereto. Warranty on parts and labor is one year or 12,000 miles whichever comes first. Warranty work has to be performed in our shop & cannot exceed the original cost of repair.

SMOG CHECK VEHICLE INSPECTION REPORT

(04/18/2015 @ 4:21:08 pm)

Vehicle Information

Model Year..... 1989	Make..... PORSCHE	Model..... 911 CARRERA TURBO
License..... 5MEM588	State..... California	VIN..... WPOEB0932KS070524
Engine Size..... 3.2 Liters	Type..... Passenger	Transmission..... Manual
GVWR..... N/A	Test Weight..... N/A	Cylinders..... 6
Odometer..... 44971	Certification..... California	VLT Record #..... 21475
Fuel Type..... Gasoline	Exhaust..... Single	Inspection Reason..... HEP
Engine Year..... N/A	Engine Make..... N/A	Bar Number..... N/A
Fleet BAR File #..... N/A		

Overall Test Results

ABORTED TEST
Engine RPM too high

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist the identification of oxides of nitrogen, crankcase, and cold start emissions which are not measured during the idle tests)

<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>
------------	---------------	------------	---------------	------------	---------------

Smog Check Station Information

GREEN STAR SMOG CHECK TEST ONLY
2134 MARKET ST
CONCORD, CA 94520
1 925 687 7664

Technician Name/Number..... SAEPHANH, KYLE/EO631958
Repair Tech Name/Number..... N/A
Software Version/EIS Number... 1401/SX061113
Station Number..... TC271756

I certify under penalty of perjury under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and correct.

4/18/15
Date



Technician's Signature

**ONE FREE RETEST
WITHIN 30 DAYS**

authorize the repair work listed herein, including sublet work, to be done along with any materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and/or attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

European Autotech Inc.

31-J Beta Court
 San Ramon, CA 94583
 (925) 820-6460

BAR # ARD272122, EPA # CAL000021453
 EUROPEANAUTOTECHSR.COM

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

Invoice # 37085

1989 Porsche 911 Turbo Carrera
 VIN: WP0EB0932KS070524
 Engine: H6 3.3L, 3294cc, SOHC, GAS, FI, B
 Trans: M/T

License # 5MEM588
 ODO In:44996 Out: 44999
 Color: Red
 Mfg. Date: 3/89
 Unit #

Inv Date: 4/20/2015
 Service Writer:
 Status: Complete
 Driver:
 PO #

Vehicle Problems	Requests for Service	Services Performed	Hrs	Qty	Price	Ext
Customer states that: diagnose failed smog						
Labor Service - diagnose failed [aborted] smog, factory under hood sticker says timing should be at 26 degrees before at 4000 rpm, book says 3 atdc to 1 befor at 900 rpm plus or minus 50 with vacuum lines disconnected and plugged, timing is within specs we lowered the idle to 875. 3			2.00		135.00	270.00
Labor Service - Smog inspection 3 New SC State smog cert.			1.00	1.00	80.00 8.25	80.00 8.25

Notes: install customers trickle charger

Labor Service - Install customers trickle charger, cut wire ends and hook to battery 3	0.50		135.00		67.50
----------------------------------------------------------------------------------------	------	--	--------	--	-------

Notes: radio code, 45532

Notes: service

Labor Service - Minor service porsche 911 & carreras to 89-change oil and filter, check and top off all fluids, inspect all tire pressures, and a complete safety inspection (belts-brakes-lights). 3	0.50		135.00		67.50
New 930-107-764-01 Oil Filter		1.00	20.34		20.34
New 20W50 B.P. Brad Penn, contains high levels of zinc and phosphorous, for cars with solid lifters		12.00	10.75		129.00

Front brake linings aprox 6 mm remain [squeak],
 rear brake linings aprox 8 mm remain

Revisions of Original Estimate - Original Estimate of Services and Parts \$512.27							
Rev#	Date and Time	Who Contacted	Method	Contact #	Cont. By	Revise By	Total
1	4/22/2015 10:36AM				ADMIN	143.01	655.28
oil,battery							

X

Customer accepts revision to the invoice and agrees to pay revised amount.

Recommended Repairs and Services:

- check a/c if easy fix, needs retrofit to r134a 724.64
- Car leaks engine oil [minor] from lower timing chain covers and housings, Car needs vacuum hoses replaced to distributor [brittle], air filter, belts, recommend new ignition wires or boots on dist end, # 1 was falling off when car came in, needs rear deck shock

Vehicle Tire Information

Check Performed.

	Left Front	Right Front	Left Rear	Right Rear	Checked By
Tire Pressure PSI	36	36	38	38	3

European Autotech Inc.

31-J Beta Court

San Ramon, CA 94583

(925) 820-6460

BAR # ARD272122, EPA # CAL000021453

EUROPEANAUTOTECHSR.COM

... amount of repair...
 ... damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay a collection costs and all attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. Have read and understand the above and acknowledge receipt of an estimate.

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

Invoice # 37085

1989 Porsche 911 Turbo Carrera License # 5MEM588

Inv Date: 4/20/2015

Continued from previous page

<p>Warranty 2 YEAR OR 24 -K MILE WARRANTY WHICHEVER COMES FIRST, PARTS AND LABOR GOOD AT THIS REPAIR FACILITY ONLY.</p>		<p>Invoice Summary</p> <table border="0"> <tr> <td>Parts</td> <td>157.59</td> </tr> <tr> <td>Labor</td> <td>485.00</td> </tr> <tr> <td>Sub Total</td> <td>642.59</td> </tr> <tr> <td>Sales Tax (CA)</td> <td>12.69</td> </tr> <tr> <td>Total</td> <td>655.28</td> </tr> </table>	Parts	157.59	Labor	485.00	Sub Total	642.59	Sales Tax (CA)	12.69	Total	655.28
Parts	157.59											
Labor	485.00											
Sub Total	642.59											
Sales Tax (CA)	12.69											
Total	655.28											
<p>X</p>	<p>Customer acknowledges receipt of merchandise and services.</p>											
<p>Page 2 of 2</p>	<p>Discard old parts</p>	<p>Original Estimate: 512.27</p>										

Smog Check Vehicle Inspection Report (VIR)

Vehicle Information

Test Date/Time: 04/21/2015 @ 13:01

Model Year: 1989	Make: PORSCHE	Model: 911 CARRERA TURBO
License: 5MEM588	State: CA	VIN: WPOEB0932KS070524
Engine Size: 3.3 L	Type: Passenger	Transmission: Manual
GVWR: N/A	Test Weight: 3375	Cylinders: 6
Odometer: 44996	Certification: California	VLT Record #: 21476
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: High Emitter Profile

Overall Test Results

Thank you for performing the needed emissions-related repairs to your vehicle. These repairs help California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air.

Smog Check Certificate Number: PQ275302
DMV ID Number: **2892Q255P954**

Your Smog Check certificate has been electronically transmitted to DMV.
Your certificate is valid for 90 days from date of issuance.
Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test)

Result	ECS	Result	ECS	Result	ECS
Pass	PCV	N/A	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	N/A	OBD System Checks
N/A	EGR Visual	Pass	Vacuum Lines to Sensors/ Switches	Pass	Carb./Fuel Injection
N/A	EGR Functional		Ignition Timing: 26 BTDC	Pass	Other Emission Related Components
Pass	Fuel Cap Functional	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Pass	Fuel Cap Visual	Pass	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Spark Controls	N/A			
N/A	Fuel Evaporative Controls Functional				

ASM Emission Test Results

Test	RPM	%CO ₂		HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1540	11.3	4.5	114	27	108	0.73	0.09	0.57	785	255	664	PASS
25 mph	1566	11.2	4.6	89	18	50	0.61	0.07	0.24	724	223	384	PASS

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured

Repair Actions

Initial Timing (Secondary) Ok
Other-Ignition System (Secondary) Ok

Repair Costs

Total Repair Time: 2.0 hours
Emission-Related Repairs (Parts): \$0
Emission-Related Repairs (Labor): \$270
Tamper Repairs (Parts and Labor): \$0
Estimated Costs of Additional Repairs: \$0
Hourly Labor Rate: \$135
Emission-Related Repairs (Parts - LIRAP): \$0
Emission-Related Repairs (Labor - LIRAP): \$0

Smog Check Inspection Station Information

European Autotech
31-J Beta Ct San Ramon, CA 94583
(925) 820-6460
Station Number: RC272122

Technician Name/Number: MURAD, CHRISTOPHER/EO305306
Repair Tech Name/Number: MURAD, CHRISTOPHER/EO305306
Software Version/EIS Number: 1301/ES315295

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate. Pretest repairs performed on this vehicle were not tamper related.

Date

Technician's Signature

Smog Check Vehicle Inspection Report (VIR)

Vehicle Information

Test Date/Time: 04/19/2017 @ 11:05

Model Year: 1989	Make: PORSCHE	Model: 911 CARRERA TURBO
License: 5MEM588	State: CA	VIN: WPOEB0932KS070524
Engine Size: 3.3 L	Type: Passenger	Transmission: Manual
GVWR: N/A	Test Weight: 3375	Cylinders: 6
Odometer: 45245	Certification: California	VL Record #: 21476
Fuel Type: Gasoline	Exhaust: Single	Inspection Reason: High Emitter Profile

Overall Test Results

Congratulations! Your vehicle passed the enhanced Smog Check inspection, which helps California reach its daily goal of removing an extra 100 tons of smog-forming emissions from the air. Thank you for keeping your vehicle well maintained.

Smog Check Certificate Number: ZT437081
DMV ID Number: **2828T052Z494**

Your Smog Check certificate has been electronically transmitted to DMV.
Your certificate is valid for 90 days from date of issuance.
Please keep this copy for your records.

Emission Control Systems Visual Inspection/Functional Check Results

(Visual/Functional tests are used to assist in the identification of crankcase and cold start emissions which are not measured during the ASM test)

<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>	<u>Result</u>	<u>ECS</u>
Pass	PCV	N/A	Thermostatic Air Cleaner	Pass	Fuel Evaporative Controls
Pass	Catalytic Converter	Pass	Air Injection	N/A	OBD System Checks
N/A	EGR Visual	Pass	Vacuum Lines to Sensors/	Pass	Carb./Fuel Injection
N/A	EGR Functional		Switches	Pass	Other Emission Related
Pass	Fuel Cap Functional	N/A	Ignition Timing:		Components
Pass	Fuel Cap Visual	Pass	Wiring to Sensors	Pass	Oxygen Sensor
Pass	Spark Controls	N/A	Fillpipe Restrictor	Pass	Liquid Fuel Leaks
Pass	Fuel Evaporative Controls Functional				

ASM Emission Test Results

Test	RPM	%CO ₂		%O ₂			HC (PPM)			CO (%)			NO (PPM)			Results
		MEAS	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	MAX	AVE	MEAS	
15 mph	1343	11.3	4.6	114	27	66	0.73	0.09	0.49	785	255	771	PASS			
25 mph	2155	10.8	5.1	89	18	34	0.61	0.07	0.32	724	223	542	PASS			

MAX = Maximum Allowable Emissions

AVE = Average Emissions For Passing Vehicles

MEAS = Amount Measured


Smog Check Inspection Station Information

PACHECO SMOG
5301 PACHECO BLVD. PACHECO, CA 94553
925-682-7664
Station Number: TC262992

Technician Name/Number: MARTELLE, ANTONIO/EO639531
Repair Tech Name/Number:
Software Version/EIS Number: 1301/ES315029

I certify, under penalty of perjury, under the laws of the State of California, that I performed the inspection in accordance with all bureau requirements, and that the information listed on this vehicle inspection report is true and accurate.

4-19-17
Date

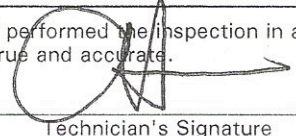
Technician's Signature

I hereby authorize the repair work listed herein, including sublet work, to be done along with necessary materials. You and your employees may operate the described vehicle for the purposes of testing, inspection or delivery at my risk. An express lien is acknowledged on said vehicle to secure the amount of repairs thereto. You will not be held responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft, accident or any other cause beyond your control. Customer agrees to pay all collection costs and for attorneys fees in the event that default is made in any payment due. If vehicle is returned to customer without repair service being performed, a diagnostic and handling fee (including reassembly) may be charged. I have read and understand the above and acknowledge receipt of an estimate.

European Autotech Inc.

31-J Beta Court
 San Ramon, CA 94583
 (925) 820-6460

BAR # ARD272122, EPA # CAL000021453
 EUROPEANAUTOTECHSR.COM

X

Terms: CASH unless arrangements made prior to authorization. Vehicles left after repair is completed may be subject to a storage fee.

Invoice # 42113

1989 Porsche 911 Turbo Carrera

VIN: WP0EB0932KS070524

Engine: H6 3.3L, 3294cc, SOHC, GAS, FI, B
 Trans: M/T

License # 5MEM588

ODO In:45415 Out: 45417

Color: Red

Mfg. Date: 3/89

Unit #

Inv Date: 3/23/2018

Service Writer: Chris Murad

Status: Complete

Driver:

PO #

Vehicle Problems	Requests for Service	Services Performed	Qty	Price	Ext
------------------	----------------------	--------------------	-----	-------	-----

Customer states that: 10.30 oil service

Labor Service - Minor service porsche 911 & carreras to 89-change oil and filter, check and top off all fluids, inspect all tire pressures, and a complete safety inspection (belts-brakes-lights). 3					72.50
New	20W50 B.P.	Brad Penn, contains high levels of zinc and phosphorous, for cars with solid lifters	12.00	11.95	143.40
New	930 107 764 03	Oil Filter Spin-On	1.00	15.44	15.44

Notes: test battery

Labor Service - Check charging system and battery. Hook up battery tender wires, installed battery mount, battery tested good. Charging system is working properly at this time. 3					72.50
------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------	--	--	--	--	-------

Front brake linings aprox 6 mm remain, Rear brake linings aprox 8 mm remain

Recommended Repairs and Services:

- check a/c if easy fix, needs retrofit to r134a 724.64
- Car leaks engine oil [minor] from lower timing chain covers and housings, Car needs vacuum hoses replaced to distributor [brittle], air filter, belts, recommend new ignition wires or boots on dist end, # 1 was falling off when car came in, needs rear deck shock
- car needs front and rear hood shocks, rear engine pad is starting to fall down on corners, Recommend fuel filter replacement

Add On Charges Breakdown

Oil/Filter Disp 6.00

Vehicle Tire Information

Check Performed.

Tire Pressure PSI	Left Front	Right Front	Left Rear	Right Rear	Checked By
	32	32	38	38	

Warranty

2 YEAR OR 24 MONTHS WHATEVER COMES FIRST, PARTS & LABOR ONLY.

Invoice Summary

Parts	158.84
Labor	145.00
Labor Discount	-30.00
Add On Charges	6.00

Customer Copy

THANK YOU!

services.

Sub Total	279.84
Sales Tax (CA)	13.10

Discard old parts

Original Estimate: 360.74

Total 292.94



INVOICE

Eason Auto Works

Eason Auto Works BAR AG200637

3423 Harlan Street
 OAKLAND, CA 94608
 Phone (510)-420.1262
 FAX (510)-985.2899

DOCUMENT # 0002255 **DATE** 11/15/2018

CUSTOMER INFORMATION	
NAME	Licence

VEHICLE INFORMATION			
MAKE	MODEL	COLOR	YEAR
PORSCHE	911 TURBO		1989
TYPE	VIN NUMBER	ODOMETER	LICENSE PLATE
SEDAN	WP0EB0932KS070524	45,560MI.	5MEM588

Summary: some repairs per findings. Replace spark plugs and deck lid shocks during inspection.

Details: PPI found poor fuel injector at cylinder #1. Remove and clean. Also rebuild wastegate with new gaskets. Pressure piston intake leaking vacuum and clicking upon throttle application. REMOVE, clean and reinstall with new seal. REPLACE cap and rotor at same time. Driver's seat doesn't want to move. Outside rail stuck. remove, clean, reinstall

LABOR

DESCRIPTION	LABOR RATE	HOURS:MIN	DISC.%	TOTAL DISC.	TOTAL
PRE-PURCHASE INSPECTIN	800.00	1:0	0.00	0.00	800.00
REMOVE/REPLACE PRESSURE RELIEFE TUBE REMOVAL AND CLEANING	140.00	9:0	0.00	0.00	1,260.00
REMOVE/REPLACE WASTEGATE ACTUATOR	140.00	3:0	0.00	0.00	420.00
REMOVE/REPLACE FUEL INJECTOR	140.00	1:0	0.00	0.00	140.00
REPAIR DRIVER'S SEAT	140.00	5:0	0.00	0.00	700.00
TOTAL					\$3,320.00

PARTS

CONDITION	QTY.	DESCRIPTION	PRICE	DISC.%	TOTAL DISC.	TOTAL
OEM New	1.00	DISTRIBUTOR ROTOR	22.00	0.00	0.00	22.00
OEM New	6.00	SPARK PLUGS	14.00	0.00	0.00	84.00
OEM New	1.00	DISTRIBUTOR CAP	44.00	0.00	0.00	44.00
	2.00	DECK LID SHOCK	22.00	0.00	0.00	44.00
	2.00	WASTEGATE SEAL	18.00	0.00	0.00	36.00
	2.00	PRSEEURE RELIEF TUBE SEAL	6.00	0.00	0.00	12.00
TOTAL						\$242.00

QUOTED BY	
DONE BY	REPAIR ORDER DATE
Bill	

TOTAL SUM	\$3,562.00
DISCOUNT	\$0.00
SUB-TOTAL	\$3,562.00
TAX .66241%	\$23.60
TOTAL	\$3,585.60
BALANCE DUE	\$3,585.60

I authorize Eason Auto Works to perform the above repairs with the necessary materials. I authorize any Eason Auto Works employee to operate the vehicle for testing purposes and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto. I agree to pay a storage fee of \$50 per day on vehicle left more than 3 working days after notification that the job is completed.

PORSCHE

Porsche Austin

200 E. Huntland Dr. • Austin, TX 78752 • (512)371-1155 • 800-687-1747

PARTS HAS UNIQUE ACCESSORIES
FOR UNIQUE CARS
SEE OUR PARTS DEPARTMENT FOR DETAILS

CUSTOMER NO. 168853	ADVISOR CHASE ATKINS	TAG NO. 800039	INVOICE DATE 05/16/19
LABOR RATE 195.00	LICENSE NO.	MILEAGE 1335	COLOR RED
YEAR / MAKE / MODEL 89/PORSCHE/911 CARRERA/2DR CABRIOLE	VEHICLE I.D. NO. W P O F B 0 9 3 2 K S 0 7 0 5 2 4	DELIVERY DATE	DELIVERY MILES
F.T.E. NO.	P.O. NO.	SELLING DEALER NO.	PRODUCTION DATE
RESIDENCE PHONE	BUSINESS PHONE	COMMENTS	04/26/19

JOB # 5 TOTAL PARTS		31.98	ENVIRONMENTAL COMPLIANCE CHARGE	
JOB # 5 TOTAL LABOR & PARTS		267.62	Maintaining and repairing your car inevitably involves the use of chemicals and generation of wastes (solvents, oils, caustics, lead, asbestos, etc.) that must be stored, managed and disposed of in strict compliance with federal, state and local environmental regulations. We support these regulations and also believe our customers do too because they help ensure a safer, healthier environment for everyone. Complying with these regulations increases the cost of service. Ordinarily, increased costs simply result in an increased hourly labor charge. This dealership has decided in lieu of raising its labor rate, to list a compliance charge on appropriate service bills because we believe our customers would be interested to know that they are helping to pay for a cleaner environment.	
J# 6+08POZ2	BODY & INTERIOR	TECH(S):800375	195.00	<p>MO: 45696</p> <p>DISCLAIMER OF WARRANTIES BY SIGNING, BUYER ACKNOWLEDGES AND AGREES THAT THE SELLER, EXPRESSLY DISCLAIMS ALL WARRANTIES WHETHER STATUTORY, EXPRESS OR IMPLIED, INCLUDING WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, AND WARRANTIES ARISING FROM COURSE OF DEALING OR USAGE OF TRADE, BUYER FURTHER AGREES THAT ALL EXPRESS WARRANTIES OR EXPRESS REPRESENTATIONS OF MATERIAL FACTS ARE CLEARLY SET FORTH UPON THIS AGREEMENT AND THAT NO WARRANTIES OR REPRESENTATIONS, EXPRESS OR IMPLIED, EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.</p> <p>TERMS CASH: UNLESS ARRANGEMENTS MADE I hereby authorize the repair work hereinafter set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.</p> <p>X NOTICE PURSUANT TO §70.001, Texas Property Code I AM THE PERSON OR AGENT ACTING ON BEHALF OF THE PERSON, WHO IS OBLIGATED TO PAY FOR THE REPAIR OF THE MOTOR VEHICLE SUBJECT TO THE REPAIR AGREEMENT. I UNDERSTAND THAT THE VEHICLE IS SUBJECT TO REPOSSESSION IN ACCORDANCE WITH §9.608, Texas Business and Commerce Code, IF PAYMENT FOR THE REPAIR OF THE MOTOR VEHICLE BY A CHECK, MONEY ORDER, OR A CREDIT CARD TRANSACTION IS STOPPED, DISHONORED BECAUSE OF INSUFFICIENT FUNDS, NO FUNDS, OR BECAUSE THE MAKER OR DRAWER HAS NO ACCOUNT OR THE ACCOUNT UPON WHICH IT IS DRAWN OR THE CREDIT CARD ACCOUNT HAS BEEN CLOSED.</p>
TECH NOTED THAT THE HOOD STRUTS HAVE FAILED. CLIENT HAS APPROVED. REPLACED FRONT HOOD STRUTS				
PARTS-----QTY-----FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----				
JOB # 6	2	911-511-331-00	HOOD GAS STRUT 58.36 116.72	
JOB # 6 TOTAL PARTS			116.72	
JOB # 6 TOTAL LABOR & PARTS			311.72	
J# 7+25POZ1	QUALITY CONTROL	TECH(S):80777	0.00	
QUALITY CONTROL VEHICLE QUALITY CONTROL PERFORMED QUALITY CONTROL				
PARTS-----QTY-----FP-NUMBER-----DESCRIPTION-----UNIT PRICE-----				
JOB # 7 TOTAL PARTS			0.00	
JOB # 7 TOTAL LABOR & PARTS			0.00	
MISC-----CODE-----DESCRIPTION-----CONTROL NO-----				
JOB # A	1PSS	PO SHOP SUPPLIES	4.75	
TOTAL - MISC			4.75	
COMMENTS-----	DROP			
TOTALS-----				
SHOP SUPPLY CHARGES ARE FOR PARTS AND CHEMICALS USED WHILE SERVICING YOUR VEHICLE THAT DO NOT HAVE A SPECIFIC PART NUMBER. THESE MAY INCLUDE, BUT ARE NOT LIMITED TO: BRAKE, ELECTRICAL, AND CARBURATOR CLEANING SOLVENTS, SILICONE, TEFLON, AND MULTI-PURPOSE LUBRICANTS, WHEEL WEIGHTS, FASTENERS, AND ADHESIVES.		TOTAL LABOR....	1487.54	
		TOTAL PARTS....	1038.26	
		TOTAL SUBLET....	0.00	
		TOTAL G.O.G....	0.00	
		TOTAL MISC CHG.	4.75	
		TOTAL MISC DISC	0.00	
		TOTAL TAX.....	86.05	
		TOTAL INVOICE \$	2616.60	

CUSTOMER SIGNATURE _____

CLAIMS FOR WORK PERFORMED MUST BE MADE WITHIN 180 DAYS
OR 6,000 MILES WHICHEVER COMES FIRST FROM DATE OF WORK.

The Reynolds and Reynolds Company ERMINISIAE CC/13621 Q (07/16)

Signature of Person Responsible or Agent for Person Responsible

PORSCHE

Porsche Austin

200 E. Huntland Dr. • Austin, TX 78752 • (512)371-1155 • 800-687-1747

PARTS HAS UNIQUE ACCESSORIES
FOR UNIQUE CARS
SEE OUR PARTS DEPARTMENT FOR DETAILS

CUSTOMER NO. 168853		ADVISOR CHASE ATKINS	TAG NO. 800039 1335	INVOICE DATE 05/16/19	INVOICE NO. POCS75175
LABOR RATE 195.00		LICENSE NO.	MILEAGE 45,694	COLOR RED/	STOCK NO.
YEAR / MAKE / MODEL 89/PORSCHE/911 CARRERA/2DR CABRIOLE		DELIVERY DATE		DELIVERY MILES	
VEHICLE I.D. NO. W P O E B 0 9 3 2 K S 0 7 0 5 2 4		SELLING DEALER NO.		PRODUCTION DATE	
RESIDENCE PHONE		BUSINESS PHONE		R. O. DATE 04/26/19	
COMMENTS					

LABOR & PARTS						ENVIRONMENTAL COMPLIANCE CHARGE
J# 1 02POZ1	ENGINE & EQUIPMENT	TECH(S):800375			861.90	<p>Maintaining and repairing your car inevitably involves the use of chemicals and generation of wastes (solvents, oils, caustics, lead, asbestos, etc.) that must be stored, managed and disposed of in strict compliance with federal, state and local environmental regulations. We support these regulations and also believe our customers do too because they help ensure a safer, healthier environment for everyone. Complying with these regulations increases the cost of service. Ordinarily, increased costs simply result in an increased hourly labor charge. This dealership has decided in lieu of raising its labor rate, to list a compliance charge on appropriate service bills because we believe our customers would be interested to know that they are helping to pay for a cleaner environment.</p>
<p>CLIENT STATES THAT THE ENGINE STRUGGLES TO START AFTER DRIVING. SUSPECT THE FUEL ACCUMULATOR. ONLY KYLE S TO WORK ON THE CAR. FUEL ACCUMULATOR FAILED REPLACED FUEL ACCUMULATOR AND TESTED, VEHICLE STARTS PROPERLY</p>						
PARTS-----QTY--FP-NUMBER-----DESCRIPTION-----UNIT PRICE-						
JOB # 1 1 911-110-197-02 FUEL ACCUMULATOR						
JOB # 1 TOTAL PARTS	671.32					
JOB # 1 TOTAL LABOR & PARTS					1533.22	
J# 2 00POZMPI	MULTIPOINT INSPECTIO	TECH(S):800375			0.00	
<p>PERFORM MULTIPOINT INSPECTION PERFORMED MULTIPOINT INSPECTION</p>						
PARTS-----QTY--FP-NUMBER-----DESCRIPTION-----UNIT PRICE-						
JOB # 2 TOTAL PARTS	0.00					
JOB # 2 TOTAL LABOR & PARTS					0.00	
J# 3 03POZ	BASE CODE ELECTRIC	TECH(S):800375			0.00	
<p>CHECK VEHICLE OVER.</p>						
PARTS-----QTY--FP-NUMBER-----DESCRIPTION-----UNIT PRICE-						
JOB # 3 1 900-631-128-90 BULB 12V 21.5W						
JOB # 3 TOTAL PARTS	13.58					
JOB # 3 TOTAL LABOR & PARTS					13.58	
J# 4 01POZ1	WIPER CONCERN	TECH(S):80195			195.00	
<p>TECH NOTED THAT THE WASHERS ARE NOT SPRAYING. CLIENT HAS APPROVED. WASHER PUMP SIEZED REPLACED WASHER PUMP AND TOPPED UP WASHER FLUID</p>						
PARTS-----QTY--FP-NUMBER-----DESCRIPTION-----UNIT PRICE-						
JOB # 4 1 928-628-074-01 WASHER FLUID PUM						
JOB # 4 8 999-512-527-00 HOSE SPRING CLAM						
JOB # 4 1 914-628-433-00 WASHER SYS.VALVE						
JOB # 4 1 914-628-215-00 WASHER SYSTEM VA						
JOB # 4 TOTAL PARTS	204.66					
JOB # 4 TOTAL LABOR & PARTS					399.66	
J# 5 05POZBG	BG BRAKE FLUSH	TECH(S):800375			235.64	
<p>BRAKE FLUSH FOR THE VEHICLE. MAINTENANCE PERFORMED COMPLETE BRAKE FLUSH</p>						
PARTS-----QTY--FP-NUMBER-----DESCRIPTION-----UNIT PRICE-						
JOB # 5 1 000-064-005-01 BRAKE FLUSH						
<p>TO BE MADE WITHIN 180 DAYS OR 6,000 MILES WHICHEVER COMES FIRST FROM DATE OF WORK.</p>						

DISCLAIMER OF WARRANTIES
BY SIGNING, BUYER ACKNOWLEDGES AND AGREES THAT THE SELLER, EXPRESSLY DISCLAIMS ALL WARRANTIES WHETHER STATUTORY, EXPRESS OR IMPLIED, INCLUDING WARRANTIES OF MERCHANTABILITY, FITNESS FOR A PARTICULAR PURPOSE, AND WARRANTIES ARISING FROM COURSE OF DEALING OR USAGE OF TRADE, BUYER FURTHER AGREES THAT ALL EXPRESS WARRANTIES OR EXPRESS REPRESENTATIONS OF MATERIAL FACTS ARE CLEARLY SET FORTH UPON THIS AGREEMENT AND THAT NO WARRANTIES OR REPRESENTATIONS, EXPRESS OR IMPLIED, EXTEND BEYOND THE DESCRIPTION ON THE FACE HEREOF.

TERMS CASH: UNLESS ARRANGEMENTS MADE
I hereby authorize the repair work hereinafter set forth to be done along with the necessary material and agree that you are not responsible for loss or damage to vehicle or articles left in vehicle in case of fire, theft or any other cause beyond your control or for any delays caused by unavailability of parts or delays in parts shipments by the supplier or transporter. I hereby grant you and/or your employees permission to operate the vehicle herein described on streets, highways or elsewhere for the purpose of testing and/or inspection. An express mechanic's lien is hereby acknowledged on above vehicle to secure the amount of repairs thereto.

NOTICE PURSUANT TO §70.001, Texas Property Code
I AM THE PERSON OR AGENT ACTING ON BEHALF OF THE PERSON, WHO IS OBLIGATED TO PAY FOR THE REPAIR OF THE MOTOR VEHICLE SUBJECT TO THE REPAIR AGREEMENT. I UNDERSTAND THAT THE VEHICLE IS SUBJECT TO REPOSSESSION IN ACCORDANCE WITH §9.609, Texas Business and Commerce Code, IF PAYMENT FOR THE REPAIR OF THE MOTOR VEHICLE BY A CHECK, MONEY ORDER, OR A CREDIT CARD TRANSACTION IS STOPPED, DISHONORED BECAUSE OF INSUFFICIENT FUNDS, NO FUNDS, OR BECAUSE THE MAKER OR DRAWER HAS NO ACCOUNT OR THE ACCOUNT UPON WHICH IT IS DRAWN OR THE CREDIT CARD ACCOUNT HAS BEEN CLOSED.

Signature of Person Responsible or Agent for Person Responsible

The Reynolds and Reynolds Company ERMINTSI4E CC713621 Q (07/16)



Eason Auto
 BAR AG2000637
 3423 Harlan Street
 Oakland, CA 94608
 (510) 420-1262
 bill@easonauto.com
 www.easonauto.com

Invoice #1290

Created: 10/1/2024
 Invoiced: 10/1/2024
 Payment Term: On Receipt
 Service Writer: Bill Eason

Fantasy Junction *
 Sales@fantasyjunction.com

1989 PORSCHE 911 slantnose (Red)
 VIN: WP0EB0932KS070524
 License Plate: 89 930S
 Mileage In: 45,766
 Mileage Out: 45,767

R+R speedo for ODO repair					
Description	Price	QTY	HRS	Subtotal	
1 speedo removal			0.5	\$112.50	
2 shipping for speedo	\$18.00			\$18.00	
3 Palo alto speedometer invoice	\$400.00			\$400.00	
4 shipping back to my shop	\$33.00			\$33.00	
			Shop Supplies (4%): \$4.50	Tax (10.25%): \$0.46	Total: \$568.46

replace steering column bushing					
Description	Price	QTY	HRS	Subtotal	
1 steering column bushing	\$40.00	1		\$40.00	
2 install bushing			0.5	\$112.50	
			EPA (1%): \$0.40	Shop Supplies (4%): \$6.10	Tax (10.25%): \$4.77
					Total: \$163.77

replace shifter bushings at shift tower					
Description	Price	QTY	HRS	Subtotal	
1 shift bushing 91142413901	\$26.00	1		\$26.00	
2 shift bushing 95042422403	\$6.00	1		\$6.00	
3 remove shift tower install bushings and reinstall			2	\$450.00	
			EPA (1%): \$0.32	Shop Supplies (4%): \$19.28	Tax (10.25%): \$5.29
					Total: \$506.89

Thank you for your business. The work is complete and your payment is due upon pickup of the vehicle. Mechanics liens may be placed on vehicles until repairs are paid for in full. Please contact us promptly if you have any questions about anything we did.

Signature _____

Bill Eason
 10-1-24

Parts	\$72.00
Labor	\$675.00
Subcontract	\$451.00
Subtotal	\$1,198.00
Shop Supplies	\$29.88
EPA	\$0.72
Tax	\$10.52
Grand Total	\$1,239.12
Paid To Date	(\$0.00)

REMAINING BALANCE \$1,239.12